



Expertise

Protocol number: 46692426
Order No. / Reference: 26661238
Inspection date: 20 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLA 220 d 4Matic 8G-DCT AMG Line

VIN: W1N4N1FB7PJ524292



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLA 220 d 4Matic 8G-DCT AMG Line	
Vehicle Identification number	W1N4N1FB7PJ524292
Mileage (Read)	110,090 km
First registration	5 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2026
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	140 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Manufaktur Mountaingrau Magno
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	193 Tag(e)
Last service on / at	01/2026 at 105,094 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV680213
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / APU 00069		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,190 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 103V	Winter tyres on Light alloy	Bridgestone	6mm / 6mm
2)	235/50 R19 103V	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99W	Summer tyres (Without wheel rim)	Pirelli	7mm / 7mm
2)	235/50 R19 99W	Summer tyres (Without wheel rim)	Pirelli	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with HOLD function, hill start assist, pre-filling and drying brakes in wet conditions
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- AMG front apron with chrome front splitter
- AMG floor mats
- Anti-lock braking system (ABS)
- Center console armrest for driver and front passenger with integrated storage compartment
- Outdoor temperature display
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Windscreen laminated glass
- Speed Limit Assistant
- Illuminated glove box
- Rear window wiper with intermittent function
- ISOFIX child seat anchorages with Top Tether in the rear
- Mechanical child safety lock
- Rear headrests (3)
- Fuel tank with a capacity of 51 liters
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Package: Light and Visibility Package
- Package: Off-road Technology Package
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio accessories: Digital radio
- Rain and light sensor
- Remote Services Plus
- GLA-Class seat belts
- Seats: Sports seats
- 12V power outlet in center console
- Cruise control
- Electronic immobilizer
- Central locking
- Adaptive brake light flashing
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive with off-road functions and presentation in the CENTRAL MEDIA DISPLAY
- AMG rear apron with diffuser look and chrome trim element
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Door sills with "Mercedes-Benz" lettering
- Chassis: Comfort chassis with lowered suspension
- electric parking brake
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Heated rear window with timer
- KEYLESS-GO start function
- Communication module (LTE) for the use of Mercedes me connect services
- Cargo area cover
- Steering column mechanically adjustable in height and length
- Navigation accessories: Extended MBUX functions
- Package: Non-smoking
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Tire pressure monitoring system
- Service interval indicator ASSYST
- Seats: Rear seat backrests foldable
- Sport pedal assembly made of brushed stainless steel with rubber studs
- High-visibility vest for drivers
- Heat-insulating glass, green all around
- Decorative elements carbon structure

Extra equipment

- Blind Spot Assist
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Parking assistant with PARKTRONIC - Preparation for live traffic information)
- Package: ENERGIZING Package Plus in conjunction with Business Package (AMG Line) (Advanced sound system with 10 speakers and 225 watts system output - Heated seats for driver and front passenger - Ambient lighting - THERMOTRONIC automatic climate control - Freshness, vitality, training: video instructions - Tips: 3-minute audio information for the sustainable promotion of health and well-being in everyday life - for the body regions head, shoulders, upper body, lower back and pelvis)
- Package: Night (AMG Line) (Door trim in black with inlay in running board design in high-gloss black - Exterior mirror housings in black - Belt edge trim and window line trim strip in high-gloss black - Roof rails in black - Heat-insulating dark tinted glass - 48.3 cm (19") AMG light alloy wheels in 5-twin-spoke design, aerodynamically optimized, high-gloss black and glossy, with 235/50 R 19 tires on 7.5 J x 19 ET 53 - Diamond grille with chrome pins, individual flames in black and chrome inlays, as well as AMG-specific front airbags with inlays in high-gloss black - AMG rear airbags with trim elements in high-gloss black)
- Phone accessories: Wireless charging system for mobile devices (in the off-the-shelf section)
- Pre-installation for digital key handover (Share your vehicle with friends and family members more easily than ever before – no matter where you are. You retain full control and decide conveniently via app whether you consent to its use. You can also unlock your vehicle remotely via the mobile application. Only then will a stored key be activated. Service is free of charge for 3 years from activation.)
- Radio accessories: Burmester surround sound system (with 12 speakers and 590 watts system power)
- Seats: Rear seats are longitudinally adjustable (If required, you can move the entire rear bench seat by 140 millimeters, thus increasing either the cargo space or the legroom in the rear.)
- Steering wheel: Multifunction sports steering wheel in Nappa leather/MICROCUT microfiber (The multifunction sports steering wheel in Nappa leather with chrome controls and a microfiber grip area in MICROCUT fits perfectly in the hand. It is the ideal partner for dynamic driving during rapid changes of direction. The shape and material combination create pure racing flair. The fine Nappa leather also signals the highest quality.)
- Storage compartment in center console with roller blind (The roller blind for the storage compartment in the center console offers you an elegant privacy screen made of high-quality material. This looks good, the interior appears even tidier, and everything important is within easy reach. Typical everyday items such as a smartphone, wallet, or various keys fit into the practical storage compartment.)
- Ambient lighting in 64 colors (Stage the interior according to your personal preference or current mood. The 64 colors of the ambient lighting create fascinating color worlds, for example in the illuminated air vents, doors or the instrument panel.)
- Ambient lighting with projection of the brand logo
- Black fabric headliner
- EASY-PACK tailgate (electrically opening and closing tailgate - switch for electrically opening the tailgate in the driver's door - switch for electrically closing the tailgate at the bottom edge of the tailgate - manual cargo cover for covering the cargo area)
- Heated seats for driver and front passenger
- Heated windshield washer system
- MULTIBEAM LED (18 individually controllable high-performance LEDs per MULTIBEAM LED module for creating a column-shaped high beam with 16 controllable individual segments - Low beam and high beam in LED projection technology - Adaptive Highbeam Assist Plus (glare-free permanent high beam) - Cornering lights or cornering lights with roundabout and intersection function (only in conjunction with hard drive navigation) - Active curve illumination when high beam is activated - City light, country road light and motorway light - Adaptive full-LED rear lights)
- Package: MBUX High-End Package (Hard drive navigation - Smartphone integration - Wireless charging system for mobile devices - Preparation for digital key handover - Connectivity package navigation - Central Media Display 10.25" - Fully digital instrument display with high-resolution 10.25" display - MBUX Augmented Reality for navigation - Traffic sign assistant - Preparation for live traffic information)
- Package: Mirror package (Exterior mirrors electrically fold in and out via a button in the driver's door control panel - the menu allows you to set the exterior mirrors to fold in automatically when locking the vehicle and unfold again when unlocking - the exterior mirror on the driver's side and the interior mirror dim automatically and continuously depending on the incident glare and ambient light)
- Package: Parking package with reversing camera (Active Parking Assist with PARKTRONIC)
- Paintwork: MANUFAKTUR magno
- Panoramic sliding sunroof (electrically operated in glass design with comfort and automatic rain closing, electric sunshade, anti-pinch protection and PRE-SAFE closing function)
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Driver's seat electrically adjustable with memory function (including exterior mirrors with parking position)
- Seats: Front seat electrically adjustable, right side with memory
- Sport brake system (drilled brake discs, brake calipers at the front and badges at the rear with Mercedes-Benz lettering)
- Steering: Direct steering
- Towbar with ESP trailer stabilization
- Type designation removed from luggage compartment lid



- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4-piece set in 5-twin-spoke design (aerodynamically optimized, painted in high-gloss black and polished, 235/50 R19 with 7.5 J x 19 ET 53)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Rear spoiler (Zusätzliche Spoilerlippe, nicht Bestandteil der Ausstattung) - Differs from the original configuration - Un- / install
2	Misc.	Main inspection - Due - Perform
3	Door - front left side	Door - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Interior	Interior - Soiled - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction
6	Wheel / tyres	Tyres - complete set - Differs from the original configuration - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 18 Jan 2024	7.911,66 €
2	Rear, Underbody, Provided by user / customer, from 6 Nov 2025	13.991,74 €



Repainting

No. Repainting

- 1 Bonnet, Professionally carried out, Invoice of repair done Non-existent
- 2 Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
- 3 Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Bonnet	291 µm	Side panel - rear right side	218 µm
Door - front right side	218 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Winterreifensatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres

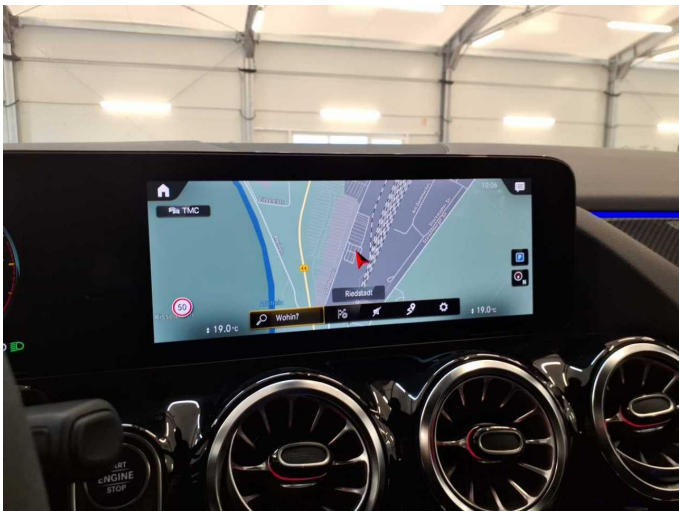


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

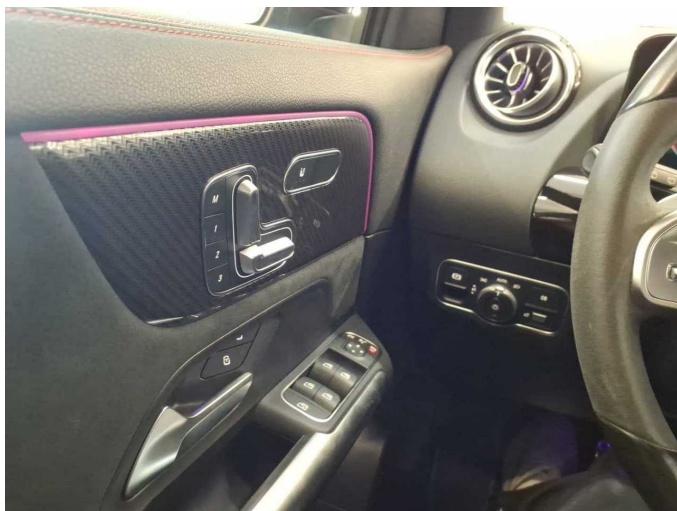


Figure 21: Misc.



Figure 22: Misc.

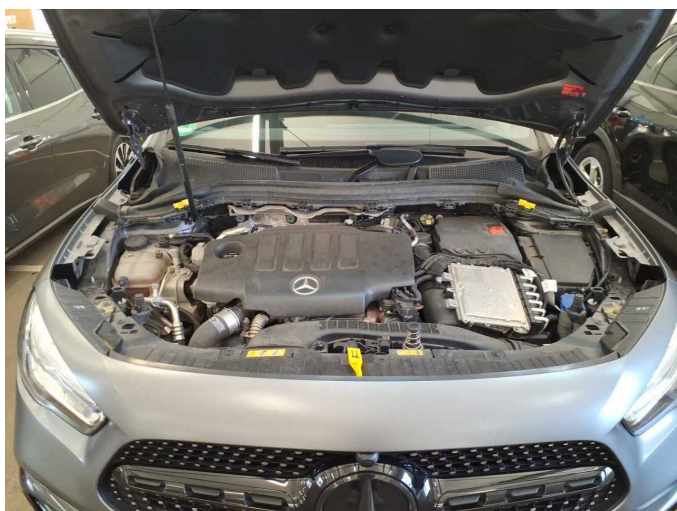


Figure 23: Misc.

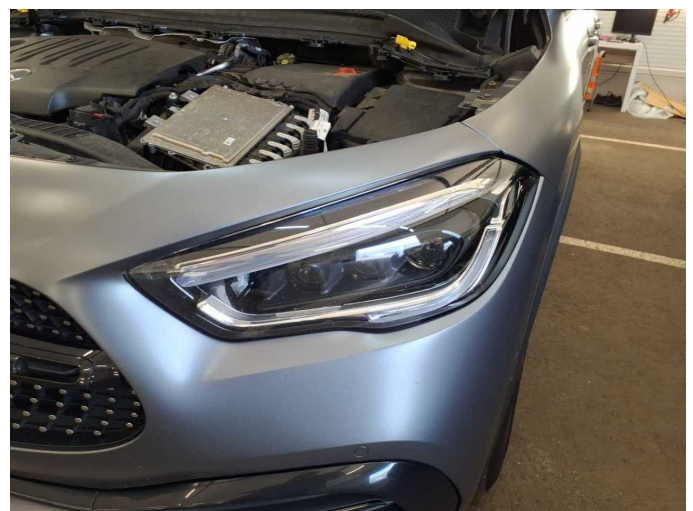


Figure 24: Misc.

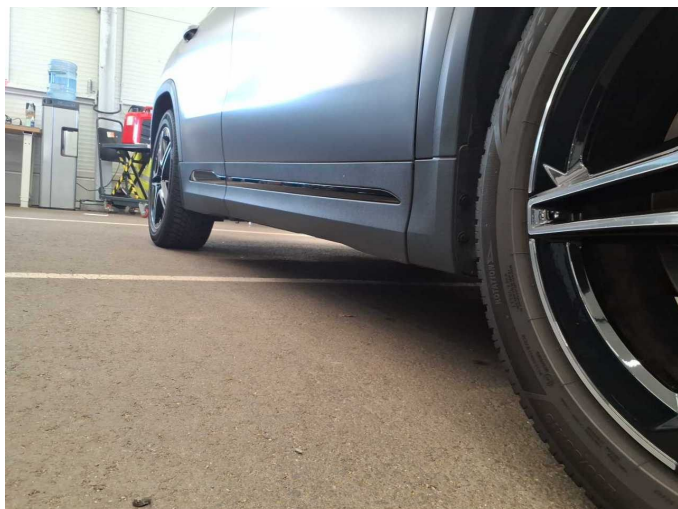


Figure 25: Misc.

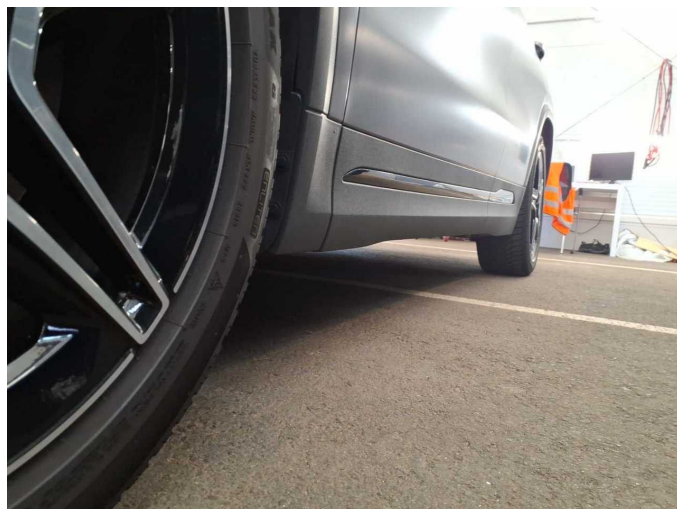


Figure 26: Misc.



Figure 27: Misc.

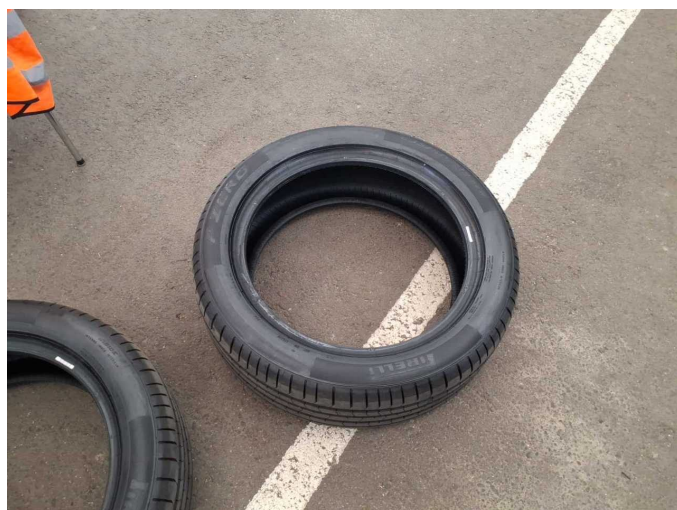


Figure 28: Misc.

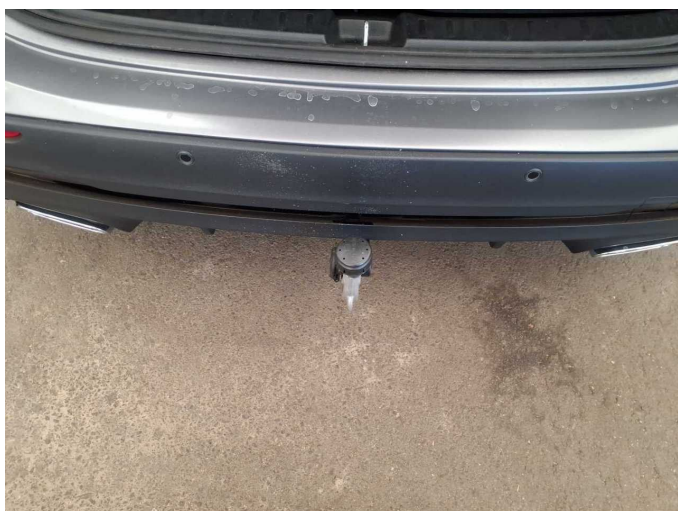


Figure 29: Misc.



Damage 1: Boot lid / rear door: Rear spoiler (Zusätzliche Spoilerlippe, nicht Bestandteil der Ausstattung) - Differs from the original configuration - Un- / install



Damage 3: Door - front left side: Door - Scratch(es) - Paint




Damage 3: Door - front left side: Door - Scratch(es) - Paint




Missing part 1: Equipment: Vehicle key - Missing - Replace



Repainting 1: Bonnet

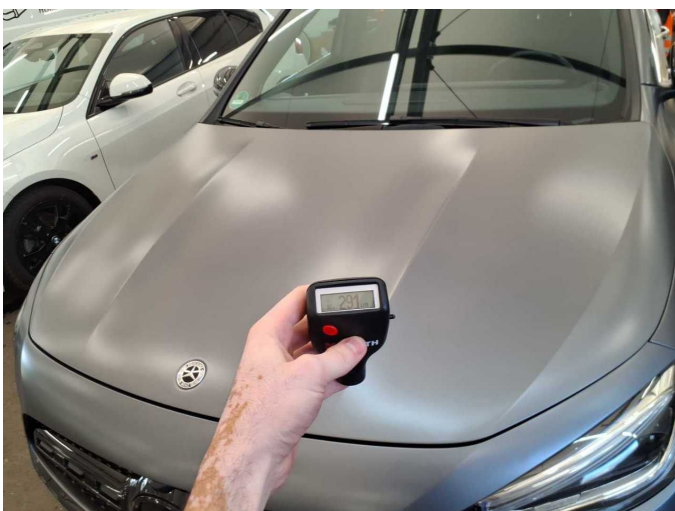

Repainting 1: Bonnet

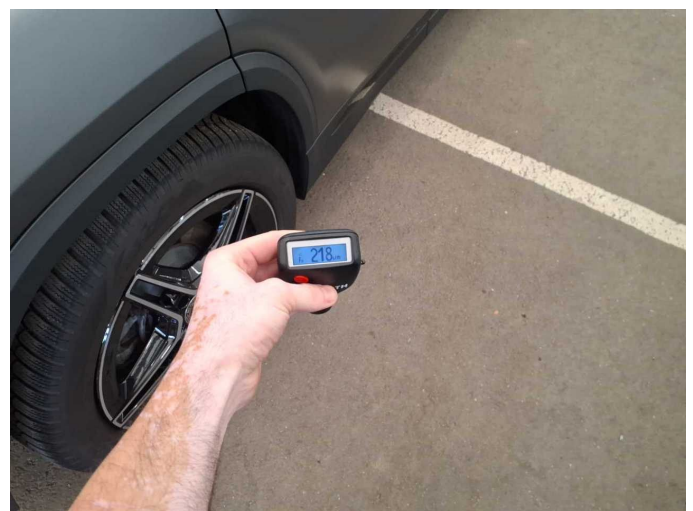


Repainting 2: Side panel - rear right side



Repainting 2: Side panel - rear right side



Repainting 3: Door - front right side

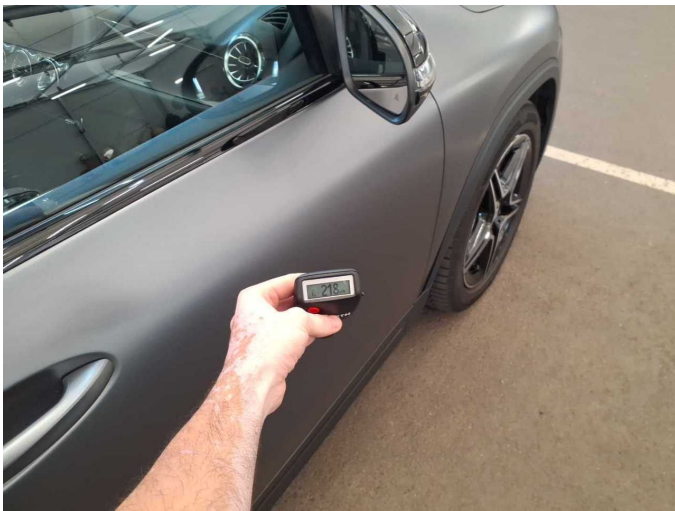

Repainting 3: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N4N1FB7PJ524292

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLA 220 d 4Matic 8G-DCT
AMG Line

Datum	KM-Stand	Beschreibung
04.02.2026	105.101	Systemtest/Eigendiagnose; Systemtest/Eigendiagnose
30.01.2026	105.101	Systemtest/Eigendiagnose
26.01.2026	105.094	Bremsscheiben+Beläge v+h; Regelwartungsdienst
19.11.2024	77.934	Regelwartungsdienst
25.04.2024	51.496	Bremsscheiben+Beläge v+h; Regelwartungsdienst
18.10.2023	25.048	Regelwartungsdienst