



Expertise

Protocol number: 46179537
Order No. / Reference: 26511819
Inspection date: 26 Jun 2026

Manufacturer: Volvo	Model: XC40 Recharge 69 kWh Single Motor Ultimate
VIN: YV1XZEFV2P2106043	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC40 Recharge 69 kWh Single Motor Ultimate	
Vehicle Identification number	YV1XZEFV2P2106043
Mileage (Read)	28,623 km
First registration	22 May 2023
Number of holders	1
Power / Engine displacement	80 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Crystal Weiß-Perleffekt
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	340 Tag(e)
Last service on / at	06/2025 at 20,498 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS768554
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BUN 00002		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,480 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 104H	All-season tyres on Light alloy	Michelin	5mm / 5mm
2)	255/45 R19 104H	All-season tyres on Light alloy	Michelin	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Waste bin integrated into center console (removable)
- Passenger side airbag can be deactivated
- Active safety belts with belt tensioners
- Ambient lighting
- Anti-lock braking system (ABS) with electronic brake force distribution
- Electrically adjustable exterior mirrors
- Hill descent control
- LED turn signals integrated into the exterior mirrors
- Convenient Entry and Start
- Roof edge spoiler
- Digital services including Google Maps navigation system
- Driver Assistance
- Pass-through hatch behind the center armrest in the rear
- Electronic Stability Control (ESC)
- Advanced air purification system
- Electric windows front and rear
- Automatic emergency braking
- Front luggage compartment (31 liters)
- Transmission: 1-speed direct drive
- Hooks for carrier bags in the luggage compartment
- rear window wiper
- Interior lighting
- Keyless Drive
- Automatic climate control with 2-zone temperature control
- Headrests of the 2nd row of seats can be folded down (electrically)
- Front headrests
- Charging cable Schuko/Type 2 (Mode 2)
- LED fog lights
- Steering wheel adjustable for height and reach
- Steering wheel: Sports steering wheel
- Front center armrest with integrated storage compartment
- One Pedal Drive
- Package: Winter Package
- Panoramic glass sunroof with lifting function (electric)
- Parking camera with 360° surround view
- Radio accessories: Two USB-C ports in the center tunnel (front and rear)
- Recharge Pure Electric front grille and grille surround in body color
- Roadside Assistance
- Wheels: 19" 5-twin-spoke alloy wheels, sport design
- Rear view camera
- Safety Assistance
- Gearshift lever made of Swedish crystal glass
- Whiplash Protection System (WHIPS)
- Service, maintenance and wear
- Seats: Passenger seat adjustable in height and length
- Seats: Electrically adjustable driver and passenger seats
- Seats: Driver's seat height and length adjustable including tilt adjustment
- Acoustic Vehicle Alerting System (AVAS)
- Airbags
- Alarm system with motion/tilt sensor and security lock
- Android infotainment system
- Fold-out (bag) hook on the glove compartment
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window
- Hill start assist
- third brake light
- Anthracite headliner
- Roof rails in high-gloss black (integrated)
- Digital Instrumentation 2nd Gen.
- Driver Awareness
- Aluminum door sill plates with Recharge lettering, front
- Electronic differential lock
- Foldable cargo floor with fastening system for carrier bags in the luggage compartment
- Guarantee
- Luggage compartment partition net
- Front seat belt height adjustment
- Automatic tailgate
- Interior and exterior mirrors automatically dimming
- ISOFIX mounts
- Child safety lock for the rear doors (electric)
- Comfort opening/closing of the side windows via radio remote control
- Rear headrests fixed
- Paint finish: Contrasting roof in Black Stone
- Charging indicator
- LED headlights "Thor's Hammer"
- Steering wheel: Multifunction buttons on the steering wheel
- Illuminated makeup mirror for driver and front passenger
- Emergency brake lights
- Optical override protection front and rear in high-gloss black
- Electric parking brake
- Radio: Premium Sound audio system by Harman Kardon
- Recharge emblem on the rear of the vehicle
- Recharge emblem on the C-pillar
- Rain sensor
- Tire pressure monitoring system
- Run-off Road Protection
- Wheels: Tire sealant
- Rear seats can be folded down in a 60/40 split or completely.
- Headlight cleaning system
- Side window surround in high-gloss black (bottom)
- Speed-sensitive power steering
- Seats: Adjustable (manual) leg rest for driver and front passenger seats
- Seats: Lumbar support (4-way adjustable) for driver and front passenger seats
- Sport front and rear apron



- Sport exterior mirrors in high-gloss black
- Sport pedals
- 12-volt socket at the front
- Textile floor mats front and rear
- First aid kit and warning triangle
- Lashing eyes (four) in the luggage compartment
- Electric pre-conditioning of the vehicle interior
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys

- Electric auxiliary heater with timer
- Phone: Inductive smartphone charging system
- Textile floor mats: Sport textile floor mats front and rear
- Glazing: Colored glazing
- Preparation for Trailer Stability Assist (TSA)
- Warning tone/indicator when seat belts are not fastened (for all seats)

Extra equipment

- Paint finish: Crystal White Pearl Effect
- Glazing: Side and rear windows tinted (from the B-pillar back)
- Upholstery: Connect Textile/Microtech (imitation leather) (incl. rear center armrest - Backlit inlay: Topography - Headliner: Anthracite)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Fog lamp	Fog lamp - front right side (Rahmen) - Scratch(es) - Replace
2	Wheel / tyres	Tyre - rear right side (Flanke) - Damaged - Replace
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
4	Wheel / tyres	Alloy rim - front left side (Materialabtrag) - Scratched - Replace
5	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent
2	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
3	Bonnet, Professionally carried out, Invoice of repair done Non-existent
4	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	185 µm	Mudguard - right side	147 µm
Bonnet	238 µm	Door - front right side	196 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

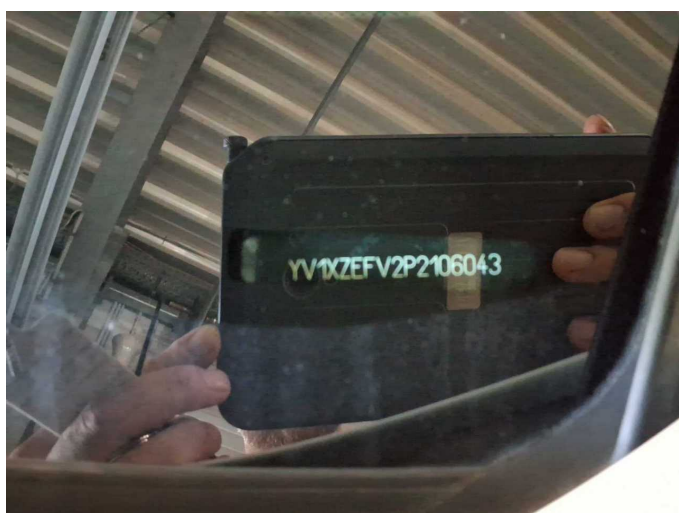


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

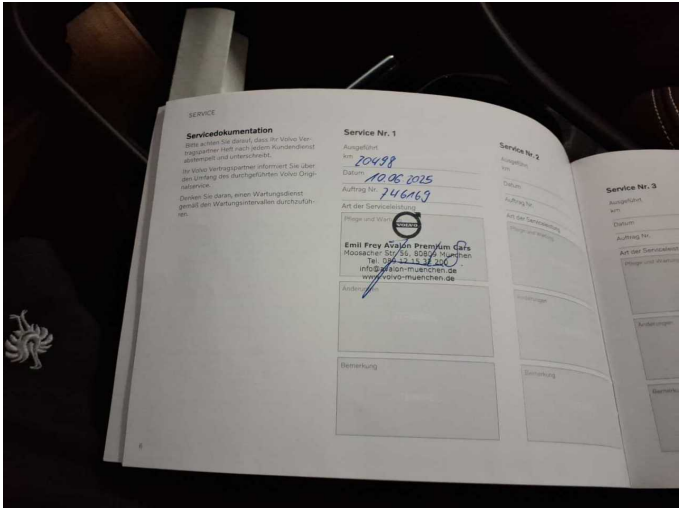


Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.

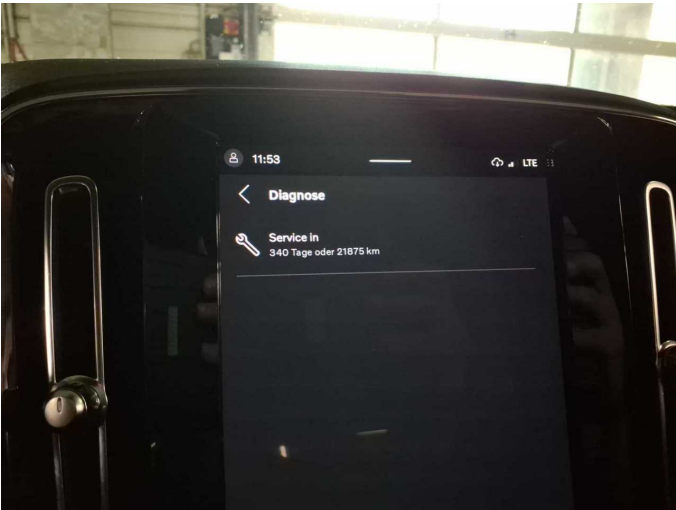


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Damage 1: Fog lamp: Fog lamp - front right side (Rahmen) - Scratch(es)
- Replace



Damage 1: Fog lamp: Fog lamp - front right side (Rahmen) - Scratch(es)
- Replace

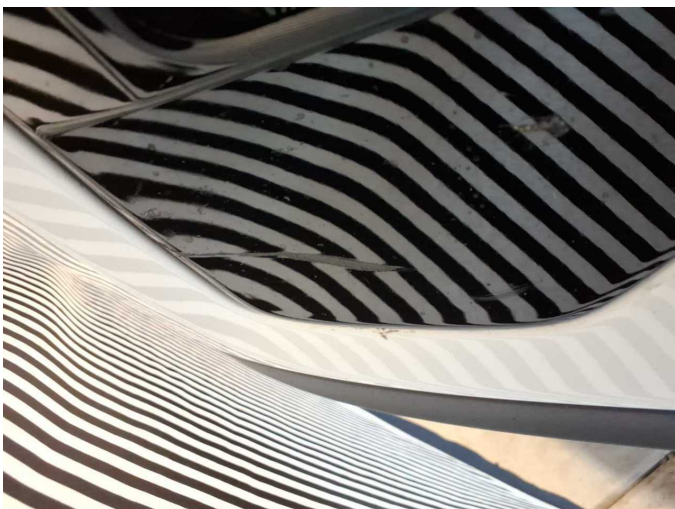

Damage 1: Fog lamp: Fog lamp - front right side (Rahmen) - Scratch(es)
- Replace



Damage 2: Wheel / tyres: Tyre - rear right side (Flanke) - Damaged -
Replace



Damage 2: Wheel / tyres: Tyre - rear right side (Flanke) - Damaged - Replace



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 4: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace




Damage 4: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace




Damage 4: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace

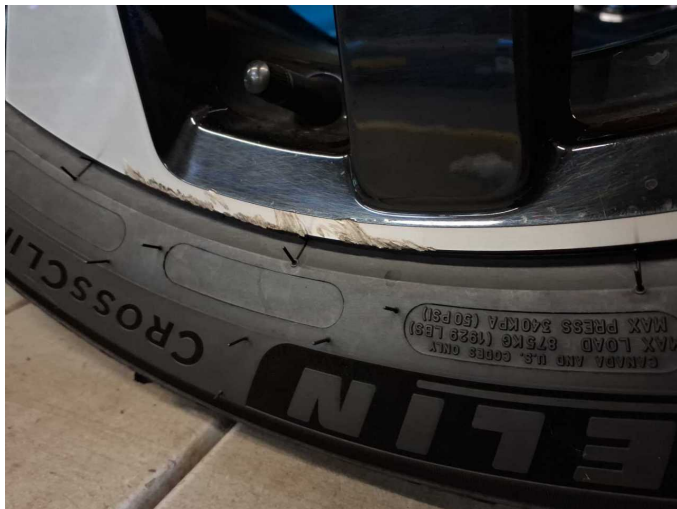

Damage 5: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace

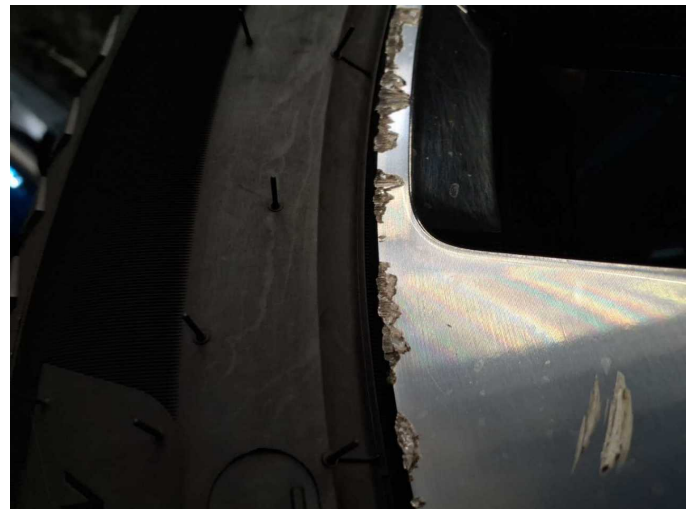

Damage 5: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Repainting 1: Mudguard - left side



Repainting 2: Mudguard - right side



Repainting 3: Bonnet



Repainting 4: Door - front right side