



Expertise

Protocol number: 46837895
Order No. / Reference: 26824467
Inspection date: 31 Jul 2026

Manufacturer: Opel

Model: Grandland X 1.5 D Start/Stop Automatik Ultimate

VIN: W0VZCYHZ6MS230643



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Grandland X 1.5 D Start/Stop Automatik Ultimate	
Vehicle Identification number	W0VZCYHZ6MS230643
Mileage (Read)	65,087 km
First registration	17 Jan 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	96 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Mondstein Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	9 Monat(e)
Last service on / at	11/2025 at 55,649 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF970096
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	1844 / AHG 00192		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R19 97V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	205/55 R19 97V	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 12V equipment (12V socket on the center console, in the rear and in the luggage compartment)
- Adaptive Forward Lighting (AFL) with LED technology (Variable light distribution for city, country roads and highways - Dynamic cornering light function - Static turning light function - Bad weather light function - LED position lights - Parking lights - High beam assist: traffic-dependent dimming taking into account preceding and oncoming traffic - Automatic headlight range control)
- Driver and passenger side airbags
- Airbag: Head airbags, front and rear outer
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Heated ThermoTec windshield
- Hill Start Assist
- Braking system: Regenerative
- Roof design line in chrome
- Roof rails, silver
- Diesel particulate filter with SCR and oxidation catalyst
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Forward Collision Warning with Automatic Emergency Braking and Pedestrian Detection (monitors the distance (close, medium, far) to the vehicle ahead; if the vehicle approaches a vehicle or pedestrian too quickly, a warning tone sounds and a message appears in the driver information display. If a collision is imminent, the braking system is prepared and, if necessary, emergency braking is initiated to minimize the consequences of a potential collision. - Lane Keeping Assist: warns if the vehicle unintentionally leaves its lane - Driver Fatigue Detection)
- Interior lighting, front and rear, with reading lights front and rear
- Child safety lock in the rear doors, manual
- Rear headrests (3), height adjustable
- Front headrests, height adjustable
- LED headlights (LED taillights, LED front turn signals, manual headlight range adjustment)
- Steering wheel, height and reach adjustable
- Center armrest, sliding, front, including storage compartment and cup holder
- Parkpilot, front and rear parking aid (with acoustic warning signal)
- Upholstery: Leather
- Quickheat heating system
- Radio: Navi 5.0 IntelliLink with 8" color touchscreen display (and voice control for audio, telephone and navigation. - Up to 10 mobile phones can be paired - Navigation with integrated memory - Road map of Europe, 3D map display - Dynamic route guidance via map and/or arrow display - Map display of TMC messages, display of points of interest - Trip planning, GPS module, 2 USB ports - Display and reading of emails - OpelConnect with telematics services including live navigation services - Emergency call/breakdown call, vehicle status and information - Routes - Map updates)
- Low beam automatically
- Storage compartments (storage compartment in the instrument panel, driver's side - storage compartment in the center console, front - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 1.0-liter beverage bottles - illuminated glove compartment with cooling and heating function - bag hooks, on the side in the luggage compartment)
- Airbag: Chest-pelvis-side airbags, driver and front passenger
- Electrically folding exterior mirrors (electrically adjustable and heated exterior mirrors, upper exterior mirror housing in body color, with ambient lighting)
- On-board computer
- Roof and exterior mirrors in diamond black (including aluminum sport pedals)
- Decorative trim strips, Toba Grey
- Tachometer
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection, comfort closing function via remote control of the central locking system)
- Luggage compartment cover
- Cruise control with intelligent speed limiter (The intelligent speed limiter, in conjunction with traffic sign recognition, allows for rapid speed adjustment)
- Transmission: 8-speed automatic
- Rear window wiper
- Interior features (rear seats split and foldable in a 40:60 ratio - rear center armrest with pass-through from the luggage compartment - luggage compartment floor, adjustable to two heights - luggage compartment lighting)
- Dual-zone automatic climate control (with separate temperature control for driver and front passenger - recirculation mode, manual - automatic air distribution - sun position sensor - particle and odor filter)
- Leather steering wheel including remote control
- Illuminated makeup mirrors in both sun visors
- Fog light
- Park & Go Premium (360-degree camera - Automatic parking assistant, including front and rear parking sensors - Electrically folding exterior mirrors with ambient lighting - Blind spot warning in both exterior mirrors (active between 12 km/h and 140 km/h) - Navi 5.0 IntelliLink: 8" color touchscreen display and voice control for audio, telephone and navigation, Bluetooth audio streaming, hands-free system, smartphone integration via Apple CarPlay™ and Android Auto, 2 USB ports, dual tuner, 6 speakers)
- Radio accessories: Digital radio reception DAB+ (Offers a wider selection of radio programs. Digitally broadcast radio stations and traffic information can be received.)
- Tire pressure warning



- | | |
|---|---|
| <ul style="list-style-type: none"> • Keyless locking and starting system "Keyless Open & Start" (sensor-controlled tailgate, electric, self-opening and -closing via foot gesture) • Seat belts (three-point seat belts in all seats - height-adjustable seat belts, front - belt force limiters, front and rear outer seats - double belt tensioners, front - belt tensioners, rear outer seats - warning tone and light for unfastened seat belts, front and rear) • Seats: Premium ergonomic seats with AGR seal of approval, driver and front passenger (driver's seat 8-way electrically adjustable - front passenger seat 6-way manually adjustable - seat tilt electrically adjustable - electro-pneumatic lumbar support, adjustable in height and length - extendable thigh support, manually adjustable - seat ventilation - heated leather steering wheel and front seat heating - interior features - dual-zone automatic climate control - ambient lighting in center console and front doors - leather upholstery, black - headrests, door trim, outer seat bolsters in leatherette) • 12-volt power outlet in the rear center console and in the luggage compartment • Traffic sign recognition (recognition of speed limits and their cancellation, as well as display of the recognized sign in the driver information display (depending on visibility and weather conditions)) • Immobiliser • Tinted heat-insulating glazing | <ul style="list-style-type: none"> • Wheels: Light alloy 7 J x 19 with multi-spoke design in bicolor (with tires 205/55 R 19) • Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack)) • Service interval indicator • Speed-sensitive power steering • Visibility equipment (front rain sensor - high beam assist - automatic dimming headlights - interior rearview mirror, automatically dimming) • Seats: 5 seats (comfort driver's seat, 6-way manually adjustable (length, height, backrest angle) - comfort passenger seat, 4-way manually adjustable (length, backrest angle) - rear seat backrest split 40:60 and foldable) • Seats: Seat heating (multi-stage, driver and front passenger; heated leather steering wheel) • Solar Protect heat-insulating glazing (heavily tinted, in the rear) • Start/Stop System (Reinforced starter motor - High-performance battery - Switch to deactivate the start/stop function) • 12-volt power outlet (in the center console, front) • Blind spot warning system • Underride protection look, front and rear, in silver • Lashing eyes in the luggage compartment (4) • Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer (and for ISOFIX child seat mounting system on the front passenger seat) • Central locking with remote control and interior switches |
|---|---|

Extra equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • 230V equipment (230V socket on the center console, rear - 12V socket in the luggage compartment) • Paint finish: Metallic • Radio accessories: Denon Premium Sound System (8 speakers - 1 subwoofer) | <ul style="list-style-type: none"> • Detachable trailer hitch (trailer stability program) • Automatic speed assistant with stop function (Automatic speed assistant maintains the set speed and the selected distance (close, medium, far) to the vehicle in front by means of automatic braking intervention or automatic acceleration (activation from 30 km/h to 180 km/h)) |
|--|--|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Body	Body - Glued / labelled - De-glue / neutralise
3	Door - rear right side	Door - dent(s) - Smart repair
4	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
5	Wheel / tyres	Tyre - front right side - Porous / cracked - Replace
6	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
7	Roof	Roof - dent(s) - Smooth repair work
8	Interior	Boot cover / roller cover - Broken / torn - Replace
9	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
2	Front bumper	Front bumper - Scratch(es) - No deduction
3	Roof	Roof rail - right side - dent(s) - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction
5	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

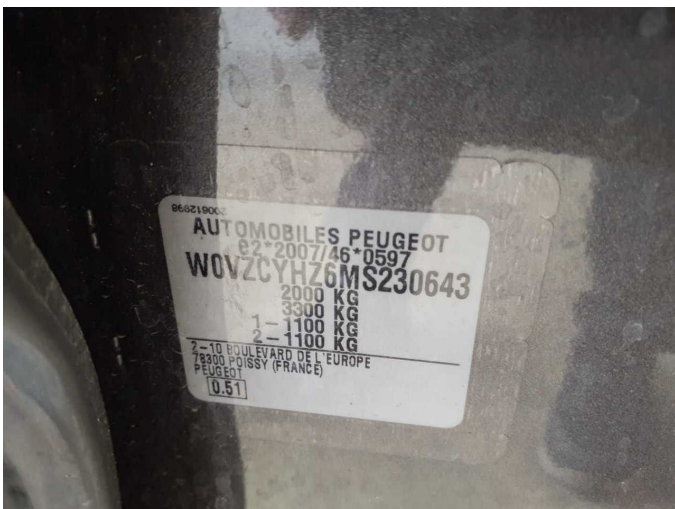


Figure 11: VIN



Figure 12: Mounted tyres

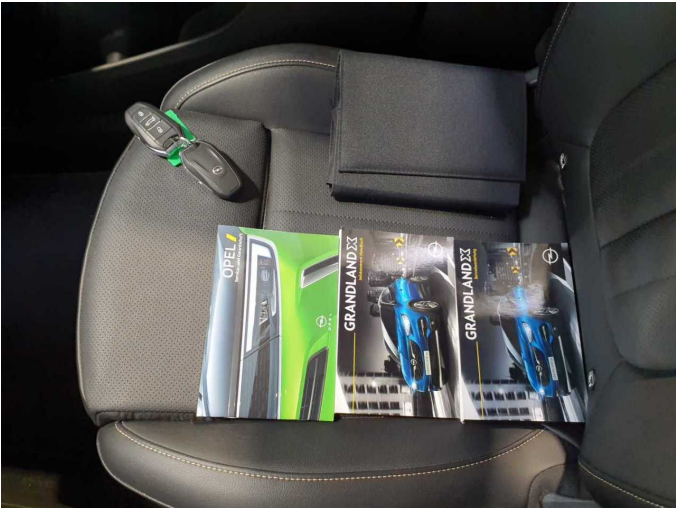


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres

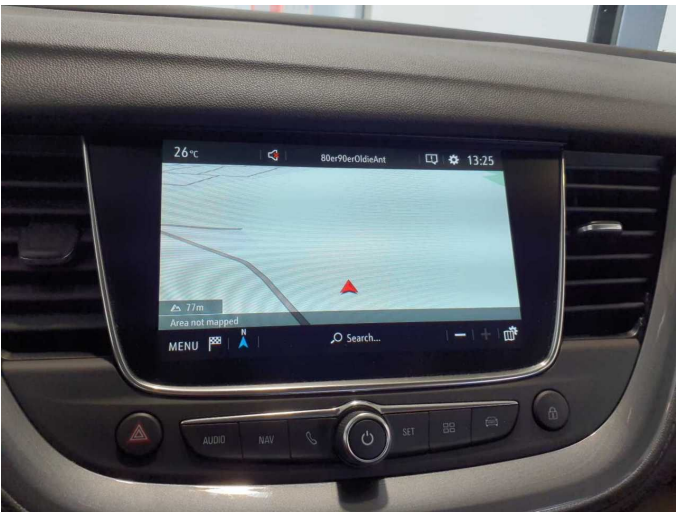


Figure 17: Navigation

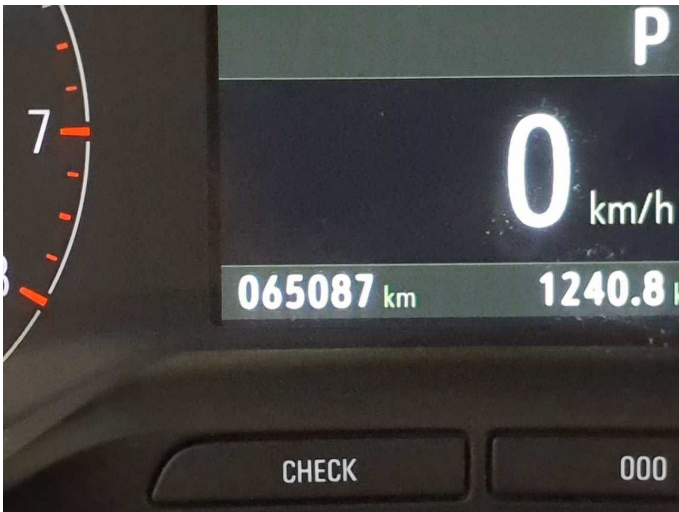


Figure 18: Misc.



Figure 19: Misc.

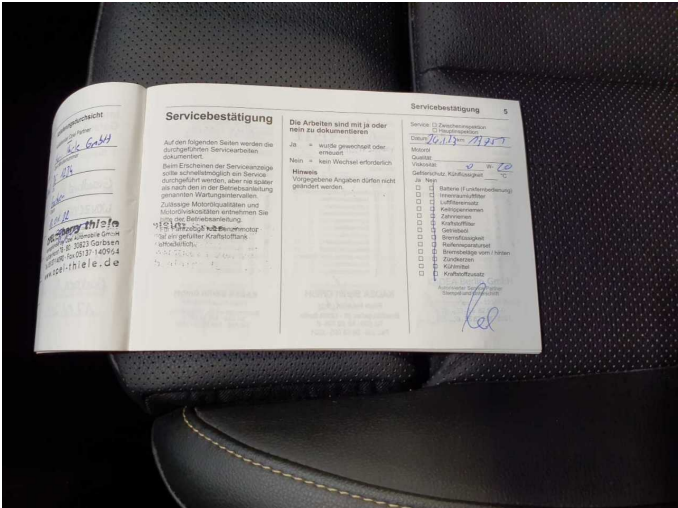


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

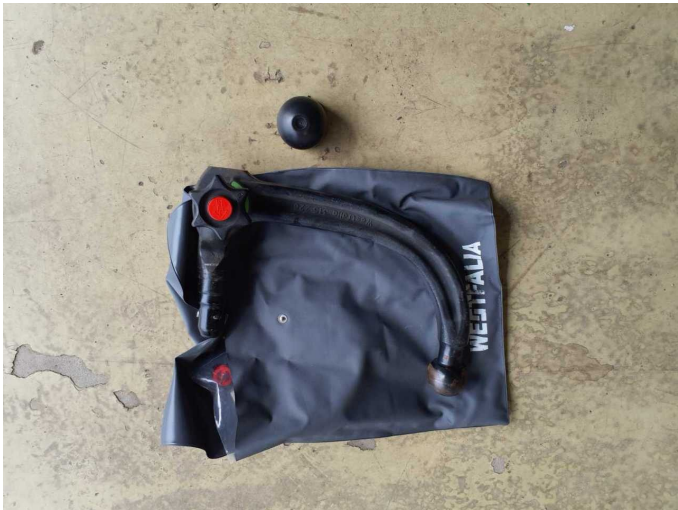


Figure 30: Misc.

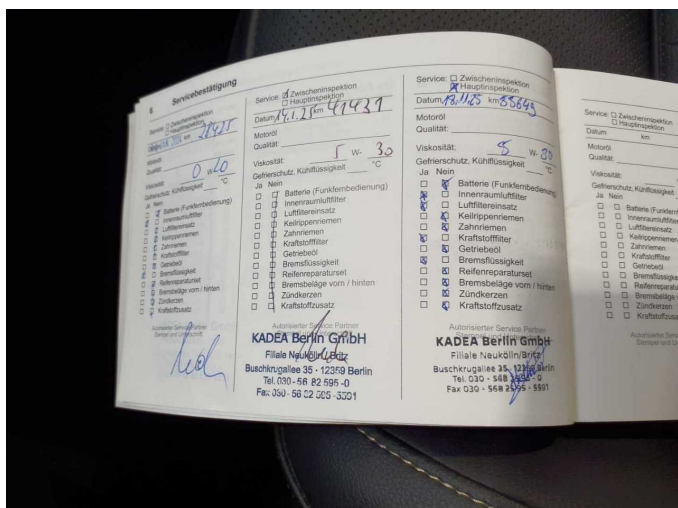


Figure 31: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Door - rear right side: Door - dent(s) - Smart repair

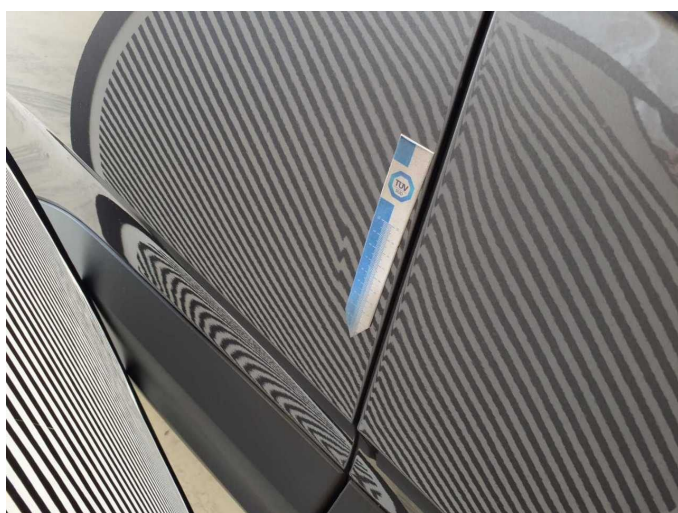

Damage 3: Door - rear right side: Door - dent(s) - Smart repair

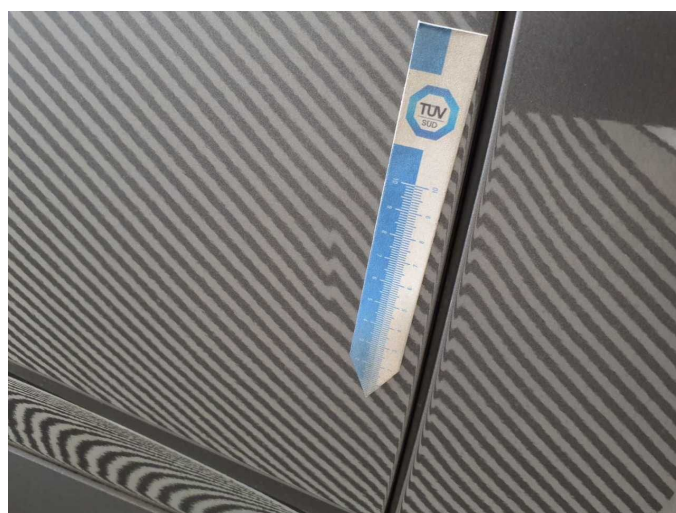

Damage 3: Door - rear right side: Door - dent(s) - Smart repair



Damage 4: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 4: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 4: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Wheel / tyres: Tyre - front right side - Porous / cracked - Replace



Damage 5: Wheel / tyres: Tyre - front right side - Porous / cracked - Replace



Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 7: Roof: Roof - dent(s) - Smooth repair work




Damage 7: Roof: Roof - dent(s) - Smooth repair work




Damage 7: Roof: Roof - dent(s) - Smooth repair work



Damage 7: Roof: Roof - dent(s) - Smooth repair work

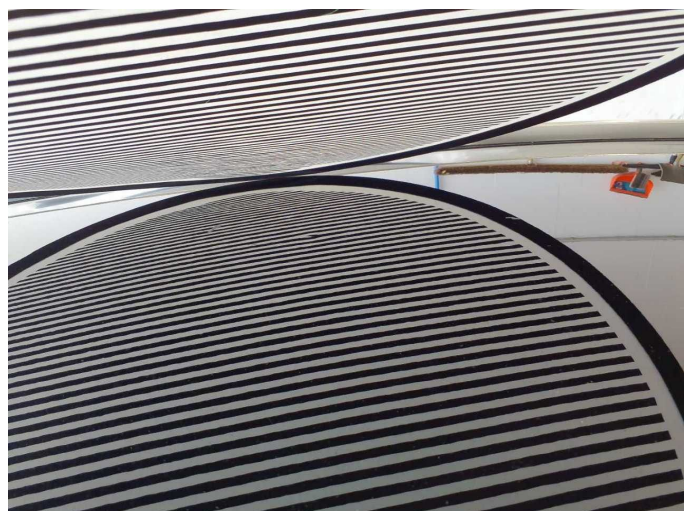

Damage 7: Roof: Roof - dent(s) - Smooth repair work

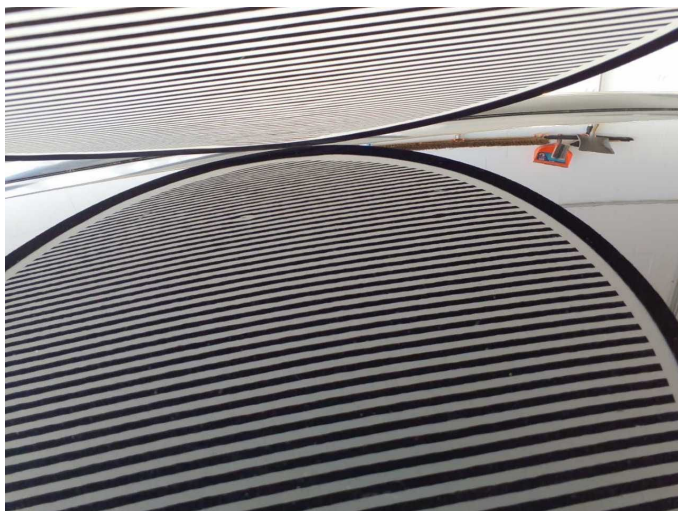

Damage 7: Roof: Roof - dent(s) - Smooth repair work



Damage 8: Interior: Boot cover / roller cover - Broken / torn - Replace



Damage 8: Interior: Boot cover / roller cover - Broken / torn - Replace



Damage 8: Interior: Boot cover / roller cover - Broken / torn - Replace



Damage 9: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 9: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 9: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace