

Expertise

Protocol number: 46628906
Order No. / Reference: 26687057
Inspection date: 20 Jul 2026

Manufacturer: Audi	Model: A4 Avant 35 TDI S tronic S line
VIN: WAUZZZF49RA111419	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 35 TDI S tronic S line	
Vehicle Identification number	WAUZZZF49RA111419
Mileage (Read)	128,874 km
First registration	10 Jun 2024
Number of holders	1
Next periodical technical inspection	06/2027
(Report not on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,968 ccm / 4
Power	120 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Daytonagrau Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,200 km
Last service on / at	05/2026 at 120,477 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HB080532
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BPK 01439		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,165 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/40 R18 93Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	245/40 R18 93Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	125/70 R19 100M	All-season tyres on Steel	Sonstige	4 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Exterior mirror housings in body color
- third brake light, raised
- Black roof rails
- Tachometer
- Door sill trims with aluminum inlay at the front, illuminated, with S lettering
- Electronic Stability Control (ESC)
- Chassis: Sport chassis
- Window channel strips in black (rubber)
- front and rear floor mats
- Transmission: S tronic 7-speed
- rear window wiper
- Interior lighting
- Camera-based traffic sign recognition
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Loading floor
- LED taillights
- Light/rain sensor
- front center armrest
- Wheel: Alloy wheels, 5-Y-spoke (S-design)
- Radio: MMI Radio plus
- Headlights using LED technology
- Fabric seat covers Index
- Seats: Rear seat backrest foldable
- Lane Departure Warning
- First aid kit with warning triangle
- Electronic immobilizer
- Central locking "Keyless-Go" without deadbolt
- Airbag: Front airbags, passenger airbag can be deactivated
- Traction control (ASR)
- Audi pre sense city
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- S line roof spoiler
- Diesel particulate filter (DPF)
- Parking assistance plus
- Electromechanical parking brake
- Electronic Differential Lock (EDS)
- Driver information system with color display
- electric window regulator
- Remote key, without SafeLock
- Cruise control system with speed limiter
- Heated rear window
- Top speed limited to 210 km/h
- Interior mirror dimming
- Child lock
- boot floor mat
- Headrests (5)
- Manual cargo cover
- Steering column, manually adjustable in height and axis
- Mild hybrid
- Non-smoking version
- Wheel: Tires optimized for rolling resistance, speed-limited
- Tire pressure monitoring system
- Electromechanical power steering
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing

Extra equipment

- AdBlue tank (24 liters) (larger tank for AdBlue solution to reduce nitrogen oxides in the exhaust gas using an SCR system)
- Assistance Package Tour (The Assistance Package Tour includes the following assistance systems: - adaptive speed assistant - traffic jam assistant - Audi active lane assist - predictive efficiency assistant - left turn assistant - evasive steering assistant - high beam assistant)
- Audi virtual cockpit plus (Innovative, fully digital instrument cluster with 12.3-inch display, full HD resolution with additional graphic display options: Classic, Sport and Dynamic design - For flexible and needs-based display of the respective information according to the driver's needs: speed/RPM, map display, Audi connect services, radio/media information, etc. - VIEW button in the multifunction steering wheel)
- Comfort automatic climate control 3-zone (in addition to the automatic climate control: - climate control unit with large TFT display and capacitive rocker switches - electronically regulates the air temperature and distribution individually for driver and front passenger - additional climate control unit for setting the rear compartment temperature in the rear center console - automatic recirculation control with dust and odor separating allergen filter - residual heat utilization)
- Decorative inlays in matt brushed aluminum (for dashboard, door panels and center console)
- Deletion of model designation and performance/technology lettering
- Lane change warning including Audi pre sense rear (lane change assistant, supports the driver within system limits when changing lanes (functional range from approx. 15 to a maximum of 250 km/h) by displaying the information in the respective exterior mirror. Audi pre sense rear uses additional radar sensors to detect potential rear-end collisions within system limits. In combination with the optional parking aid plus or parking assistant, exit warning and rear cross-traffic assist are also included).
- LED matrix headlights, LED taillights and headlight cleaning system (Matrix LED technology combines a camera system with LED light sources and precise optics for highly adaptive light distribution. In addition to the matrix LED function, the headlights offer the following features: - visually enhanced daytime running lights - low beam - high beam - position lights - dynamic turn signals - cornering lights - all-weather lights - static cornering lights - motorway lights - automatic dynamic headlight range control - coming home/leaving home function)
- Package: Ambient Lighting Package Plus (3 predefined color profiles; additional interactive and individual color profiles. The interactive color profile is controlled by the Audi drive select modes. 30 colors are available for the individual color profile. The color adjustments apply to the following contour and ambient lighting elements: - Entry lights on the underside of the rear doors (white) - Rear footwell lighting - Front cupholders (multicolor) - Ambient door lighting front/rear (multicolor) - Contour lighting (multicolor))
- Paint finish: Daytona Gray Pearl Effect
- Audi connect Navigation & Infotainment (Navigation with Google Satellite Map - Online search for navigation destinations - Online voice input - Online traffic information plus - Online points of interest - On-street parking - Hazard information - myAudi Navi. - Highly detailed 3D city display - Online media streaming - Online radio - Hybrid radio - Weather information - Online news - Wi-Fi hotspot - HoloD interface - User profiles)
- Black Optics Package Plus (Black optics package with Audi rings front and rear and model designation on the rear in black. On the S model, the model designation in the radiator grille is also finished in black/red.)
- Business package (MMI Navigation plus with MMI touch - Audi phone box - 3-spoke leather steering wheel with multifunction plus - Heated front seats - Frameless, automatically dimming interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides - High-beam assistant - Manual sunshade for rear door windows)
- Comfort center armrest at the front (adjustable in tilt and longitudinally sliding or completely foldable)
- Comfort key with sensor-controlled luggage compartment unlocking including electrically opening/closing luggage compartment lid (including visual differentiation on the top and bottom of the key; access authorization system: The vehicle key only needs to be carried with the vehicle; locking and unlocking of the vehicle from the outside via sensors on all door handles. The luggage compartment lid can also be opened when the vehicle is locked. In addition, a foot gesture (kick movement) below the rear bumper unlocks the luggage compartment lid and causes it to swing open automatically.)
- Electrically adjustable, heated, and folding exterior mirrors with automatic dimming and memory function (integrated LED turn signals and curb view function for the passenger-side mirror, including heated windshield washer nozzles; mirror glass available in convex, flat, or aspherical shapes. The curb view function tilts the passenger-side mirror downwards when reverse gear is engaged, providing the driver with a better view of the curb. The memory function saves personal settings to the vehicle key).
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and S sport seats also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt, headrest and belt height; with pronounced seat side bolsters for better lateral support in curves, extendable thigh support)
- Fuel tank with increased filling volume (54 l)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- On-board tools and jack (in the luggage compartment)



- S line interior package (sports seats in front - black fabric/leather combination with S embossing in the backrests of the front seats - 3-spoke leather steering wheel with multifunction plus including steering wheel grips in perforated leather and S emblem - brushed matt aluminum inlays - glossy black accent surfaces - illuminated front door sill trims with aluminum inlays and S lettering - stainless steel pedals and footrest - black fabric headliner - velour floor mats in the front)
- Seat covers in fabric Sequenz/leather combination (for front sports seats: - Seat center section of the front seats and the two outer rear seats in fabric Sequenz black - Seat side bolsters, headrest center section front in leather black with contrast stitching - S embossing in the backrests of the front seats - Headrests in the rear as well as center armrest front and rear in synthetic leather)
- Seats: Electrically adjustable front seats including memory function for the driver's seat (electric adjustment of seat height, seat longitudinal position, seat and backrest tilt with memory function for driver's side, 2 memory locations per personal user profile for the electrically adjustable front seats and the exterior mirrors, electric 4-way lumbar support)
- Reversing camera (facilitates maneuvering by displaying the area behind the vehicle on the MMI display with dynamic and static aids. Two modes can be selected: perpendicular parking and, for vehicles with factory-installed trailer hitches, trailer mode. Depending on the selected mode, the calculated lane and guide lines are displayed. The reversing camera is discreetly integrated into the tailgate handle. Activation occurs when reverse gear is engaged.)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (The steering wheel impresses with its high-quality look and aluminum trim and feels good in the hand. Height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons. It also includes paddle shifters for manually changing gears with an automatic transmission.)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)
- Wheel: Deselect low rolling resistance tires, remove speed limiter (18 inch) (Tires 245/40 R 18 93Y)
- Wheel: Spare wheel, space-saving
- Wheel: Winter light alloy wheels 5-parallel spokes (size 7.0 J x 17 with winter tires 225/50 R 17 - suitable for snow chains, maximum permissible speed 210 km/h)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
2	Mudguard - right side	Mudguard - right side - dent(s) - Smooth repair work
3	Door - front right side	Brightware - upper - Scratched - Smart repair
4	Side panel - rear left side	Sill - Scratched - Smart repair
5	Side panel - rear right side	Sill - Scratched - Smart repair
6	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
7	2nd wheel set	1 alloy rim - Scratched - Loss in value
8	Front bumper	Front bumper - Scratched - Paint
9	Door - front left side	Door - Scratched - Paint
10	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
11	Vehicle glazing	Windscreen - Broken / torn - Replace
12	Rear bumper	Rear bumper (Fhgz. mit Sideassist) - Scratched - Replace



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

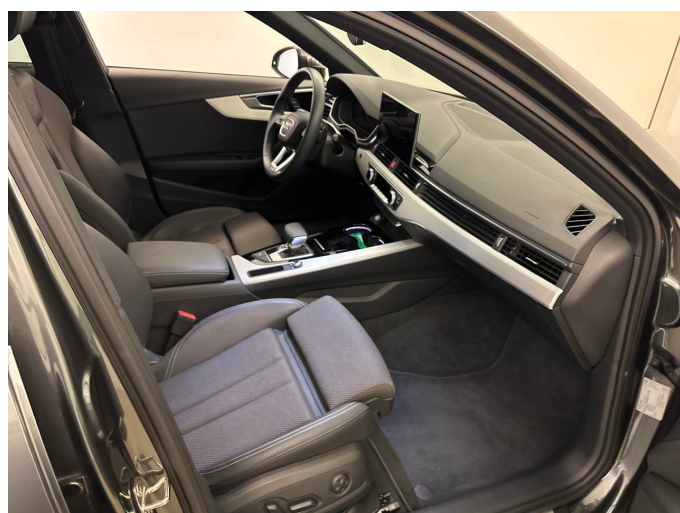


Figure 5: Interior - front

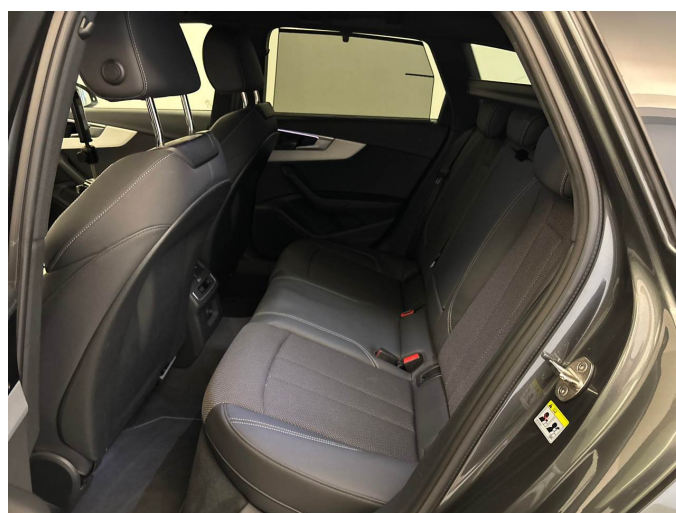


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

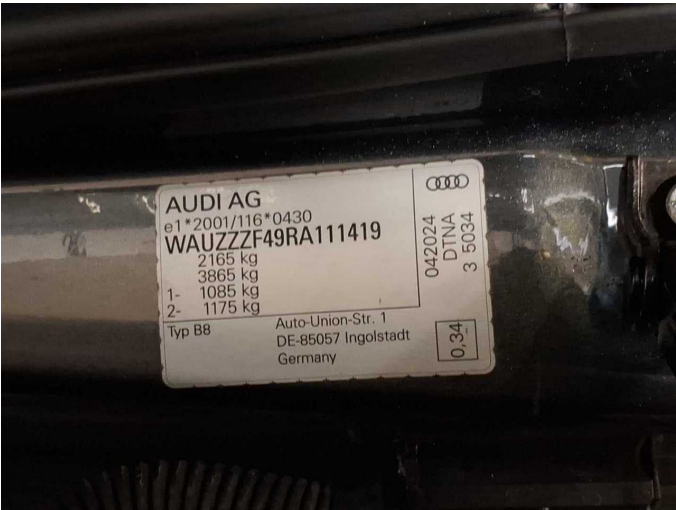


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

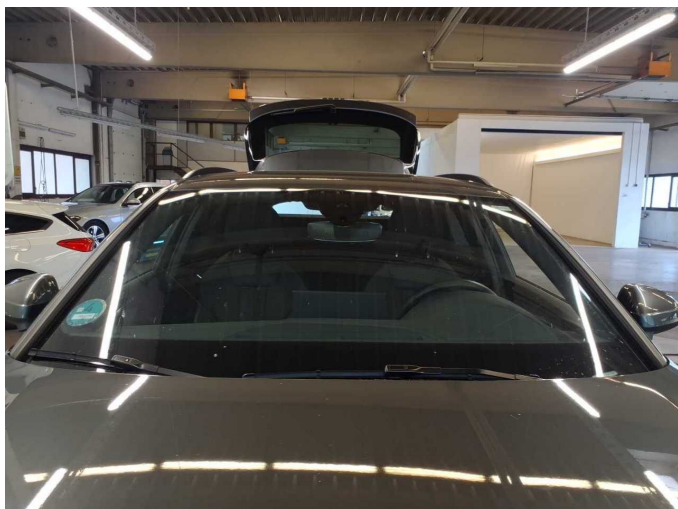


Figure 25: Misc.



Figure 26: Misc.

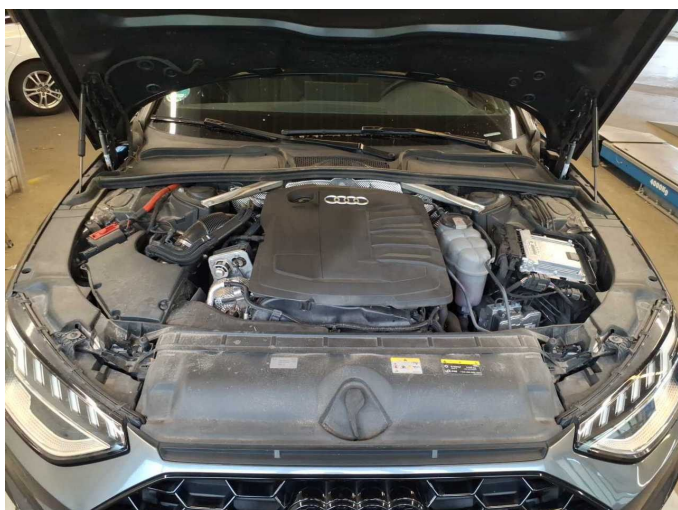


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.


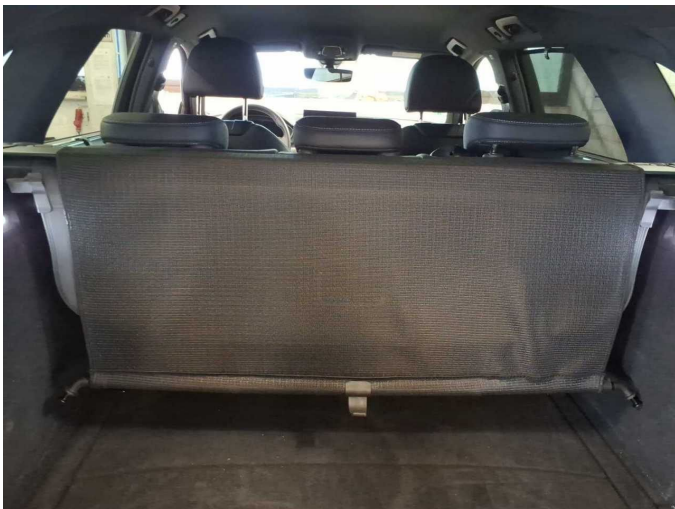


Figure 33: Misc.



Figure 34: Misc.

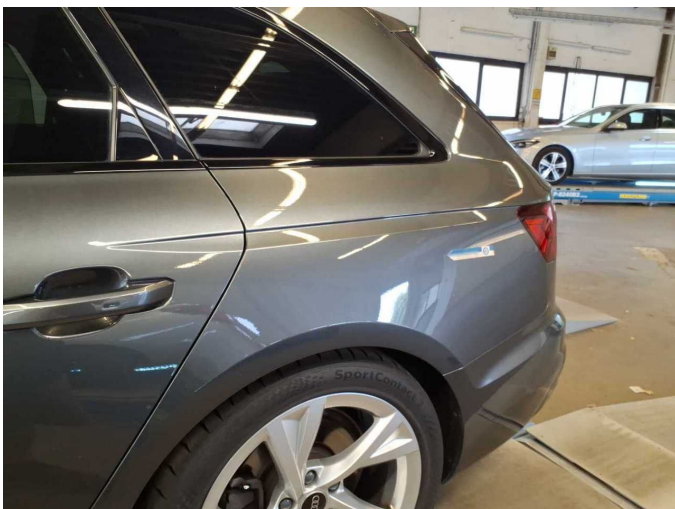

Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 2: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work



Damage 2: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work




Damage 2: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work



Damage 3: Door - front right side: Brightware - upper - Scratched - Smart repair



Damage 3: Door - front right side: Brightware - upper - Scratched - Smart repair

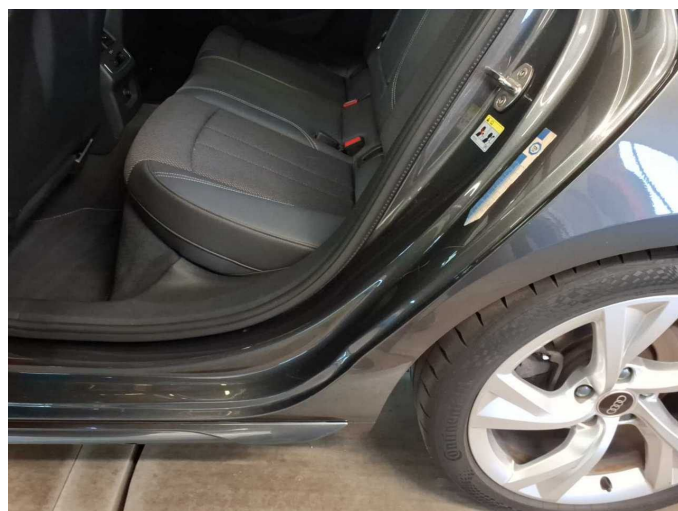


Damage 4: Side panel - rear left side: Sill - Scratched - Smart repair




Damage 4: Side panel - rear left side: Sill - Scratched - Smart repair



Damage 4: Side panel - rear left side: Sill - Scratched - Smart repair

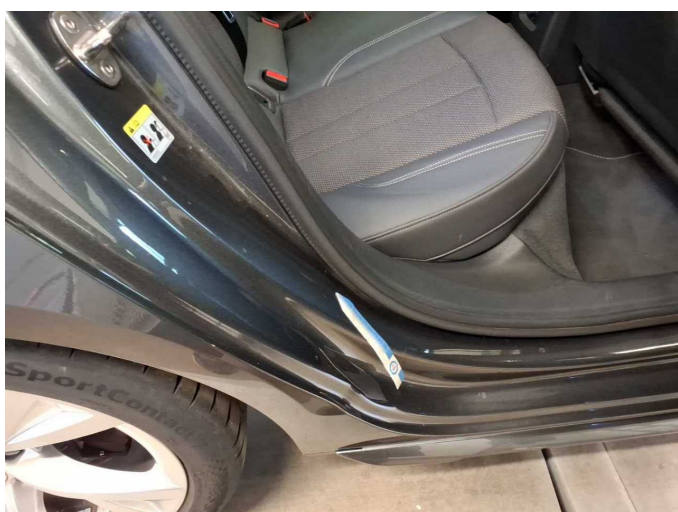


Damage 5: Side panel - rear right side: Sill - Scratched - Smart repair

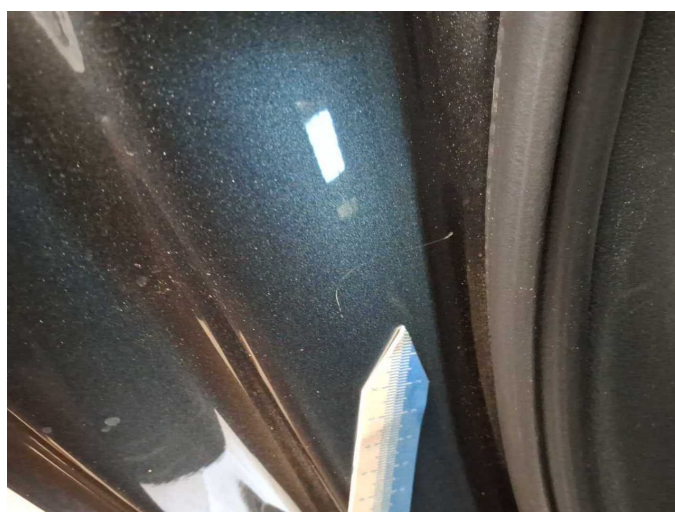

Damage 5: Side panel - rear right side: Sill - Scratched - Smart repair



Damage 5: Side panel - rear right side: Sill - Scratched - Smart repair

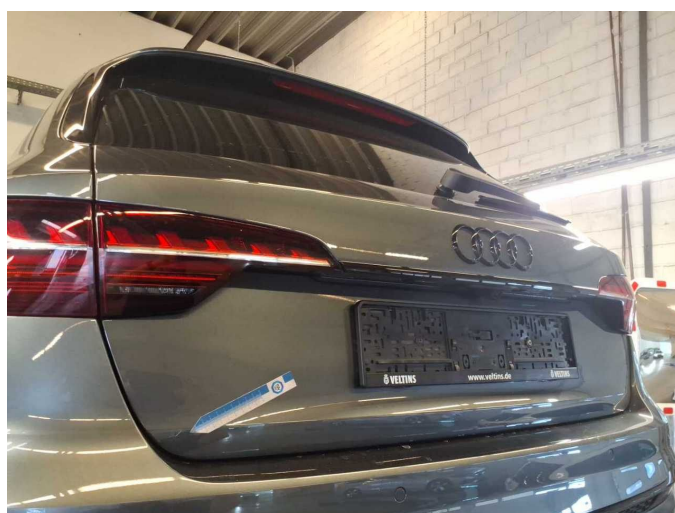

Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Loss in value




Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 8: Front bumper: Front bumper - Scratched - Paint



Damage 8: Front bumper: Front bumper - Scratched - Paint

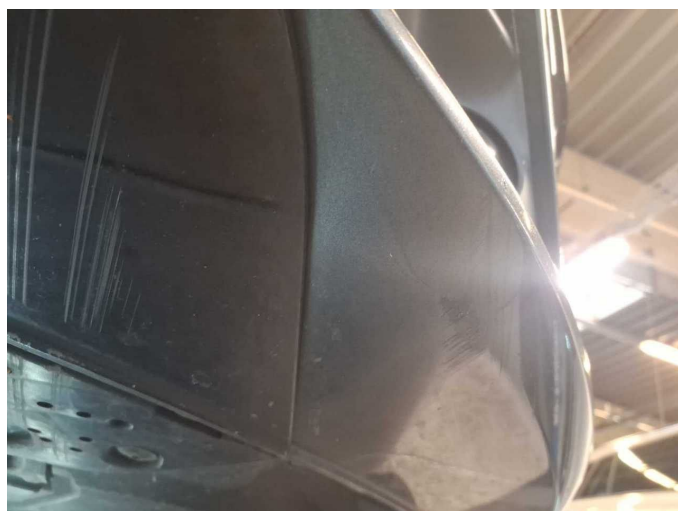


Damage 8: Front bumper: Front bumper - Scratched - Paint



Damage 8: Front bumper: Front bumper - Scratched - Paint



Damage 8: Front bumper: Front bumper - Scratched - Paint

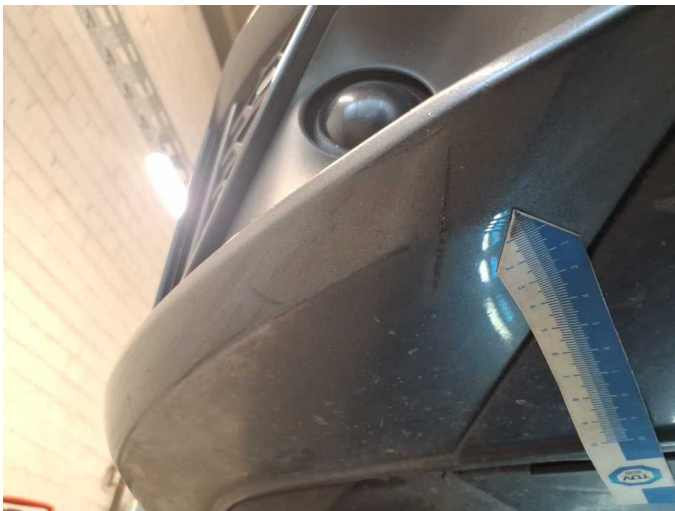

Damage 8: Front bumper: Front bumper - Scratched - Paint



Damage 8: Front bumper: Front bumper - Scratched - Paint



Damage 9: Door - front left side: Door - Scratched - Paint



Damage 9: Door - front left side: Door - Scratched - Paint



Damage 9: Door - front left side: Door - Scratched - Paint



Damage 9: Door - front left side: Door - Scratched - Paint




Damage 10: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 10: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 10: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

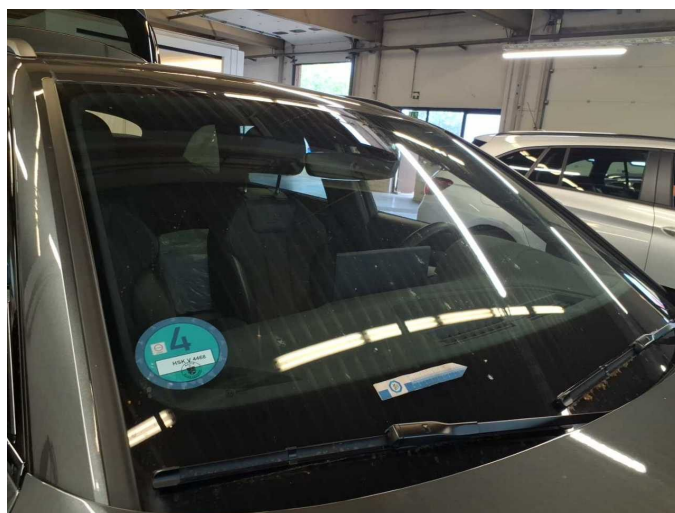

Damage 11: Vehicle glazing: Windscreen - Broken / torn - Replace

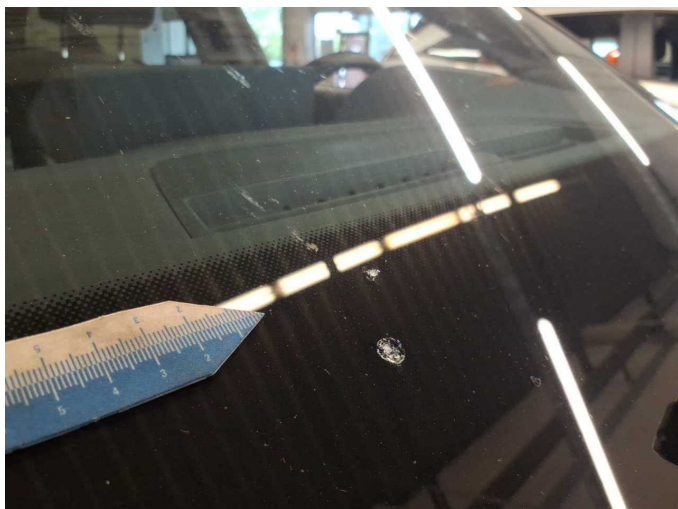

Damage 11: Vehicle glazing: Windscreen - Broken / torn - Replace

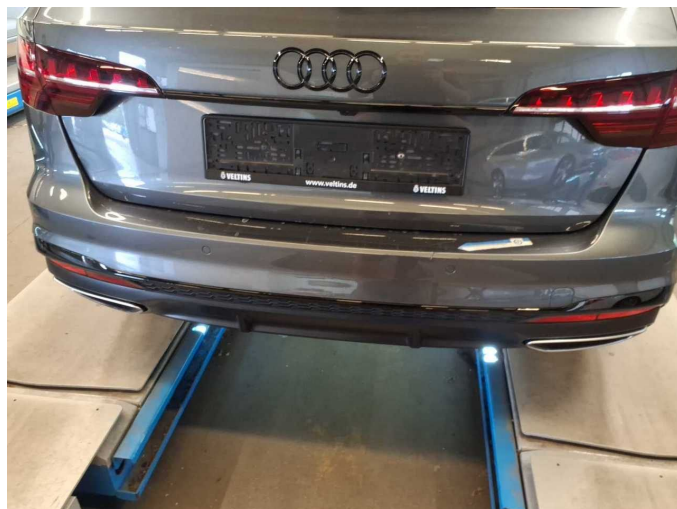

Damage 12: Rear bumper: Rear bumper (Fhgz. mit Sideassist) - Scratched - Replace



Damage 12: Rear bumper: Rear bumper (Fhgz. mit Sideassist) - Scratched - Replace



Damage 12: Rear bumper: Rear bumper (Fhgz. mit Sideassist) - Scratched - Replace




Damage 12: Rear bumper: Rear bumper (Fhgz. mit Sideassist) - Scratched - Replace



Damage 12: Rear bumper: Rear bumper (Fhgz. mit Sideassist) - Scratched - Replace



Damage 12: Rear bumper: Rear bumper (Fhzig. mit Sideassist) - Scratched - Replace

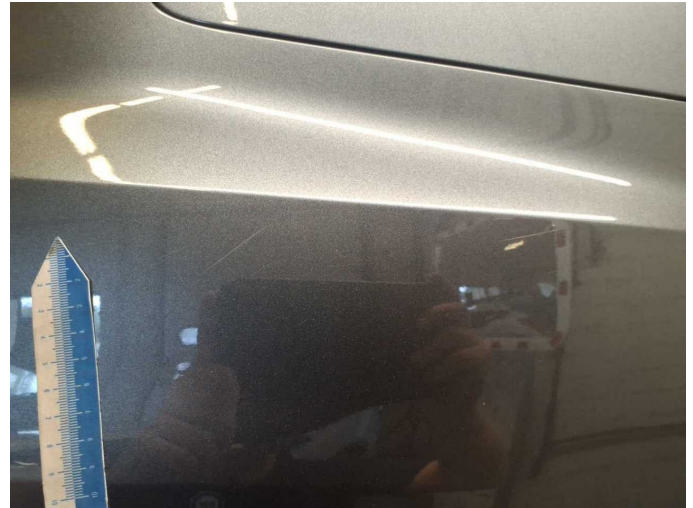

Damage 12: Rear bumper: Rear bumper (Fhzig. mit Sideassist) - Scratched - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF49RA111419
Hersteller / Modell: AUDI AUDI A4 Avant 35 TDI S tronic S line

Datum	KM-Stand	Beschreibung
05.05.2026	120.477	Getriebeöl ern/prüfen; Kraftstofffilter ern; Regelwartungsdienst; Reparatur Sonstiges
30.03.2026	113.658	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
14.11.2025	89.730	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
28.07.2025	71.161	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
19.05.2025	59.935	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Regelwartungsdienst; Reparatur Sonstiges
11.03.2025	48.249	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.11.2024	30.757	Regelwartungsdienst
24.10.2024	24.721	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges