



Expertise

Protocol number: 45918261
Order No. / Reference: 26397475
Inspection date: 12 Jun 2026

Manufacturer: Mercedes-Benz
VIN: W1N2539231V341735

Model: GLC 400 d 4Matic 9G-TRONIC AMG Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 400 d 4Matic 9G-TRONIC AMG Line	
Vehicle Identification number	W1N2539231V341735
Mileage (Read)	118,035 km
First registration	30 Nov 2021
Number of holders	1
Next periodical technical inspection	01/2027
(Report on hand)	
Power / Engine displacement	243 kw / 2,925 ccm
Fuel type / Cylinder	Diesel / 6
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Obsidianschwarz metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	182 Tag(e)
Last service on / at	12/2025 at 110,594 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF749024
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AJV 00081		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,575 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R20 101W	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	255/45 R20 101W	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Anti-lock braking system (ABS)
- Automatic passenger airbag deactivation
- On-board computer
- Brake system with larger brake discs on the front axle
- Diesel particulate filter
- Third brake light in LED technology
- EASY-Pack cargo cover (removable)
- Driving light assistant
- electric parking brake
- Transmission: 9G-TRONIC
- rear window wiper
- KEYLESS-GO start function
- Remote trunk lid release
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Headrests 5-way
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Mercedes-Benz emergency call system
- Package: Storage
- Package: OFF-ROAD Exterior
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable
- Seats: Front seats electrically adjustable
- High-visibility vest for drivers
- Heat and sound insulating acoustic glass
- Decorative elements: black piano lacquer finish/light longitudinally brushed aluminum
- Airbag: Kneebag for driver
- Airbag: Windowbags
- 4MATIC all-wheel drive
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Roof rails in polished aluminum
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Black floor mats with AMG lettering
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control with 2 climate zones
- Communication module (LTE) for the use of Mercedes me connect services
- Paint finish: Solid
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black Nappa leather
- Steering: Sport direct steering
- Navigation accessories: Extended MBUX functions
- Package: Interior light
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seat: Front sports seats
- Seats: i-Size child restraint system on the outer rear seats
- Cruise control
- Immobiliser
- Central locking



Extra equipment

- Ambient lighting (Design the interior according to your personal preference or current mood. With a total of 64 colors, the ambient lighting offers almost unlimited possibilities for lighting design and has the right color for every situation. Illuminated door sills on the driver and passenger sides.)
- Paint finish: Metallic
- Package: Advanced Comfort (Seat heating for driver and front passenger, driver's seat electrically adjustable with memory function, front right seat electrically adjustable with memory function)
- Package: Advanced Park
- Package: Business (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; larger fuel tank capacity)
- Package: Off-road technology (including 2 off-road driving programs, downhill speed regulation (DSR), chassis with higher ground clearance and technical underbody protection made of Gemtex)
- Upholstery: Black leather
- Wheels: 50.8 cm (20") AMG light-alloy wheels, 4-piece set in 5-twin-spoke design (high-gloss black painted and polished with 255/45 R 20 tires on 8.5 J x 20 ET 40 rims)
- Partition net for luggage compartment separation (and occupant protection)
- Running boards in aluminum look with rubber studs
- Decorative elements: open-pore black ash wood / light longitudinally brushed aluminum
- Towbar with ESP trailer stabilization (fully electrically foldable and retractable)
- Chassis: AIR BODY CONTROL air suspension (with continuously adjustable damping)
- KEYLESS-GO (Your KEYLESS-GO vehicle key can stay in your pocket; you don't need to take it out of your hand. Thanks to the stored access and driving authorization, the vehicle recognizes its owner. Simply grasp the door handle, open the door, get in, and drive off – KEYLESS-GO is always a convenient experience.)
- Package: Advanced Light (LED High Performance headlights and adaptive LED taillights, Adaptive Highbeam Assist)
- Package: High End Assistance (Mirror package: Electrically folding exterior mirrors, lowering right exterior mirror, automatic dimming function; Driving assistance package: Active Distance Assist DISTRONIC, Active Steering Assist, Active Brake Assist, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE PLUS)
- Package: High-end infotainment (Media display with touch controls, smartphone integration: Apple CarPlay and Android Auto, connectivity package, navigation, traffic sign assistant: thanks to intelligent linking of camera and map data, it can recognize not only speed limits, no-overtaking zones and their cancellation, but also fully digital instrument display, wireless charging system for mobile devices in the storage compartment)
- Seats: Seat climate control for driver and front passenger in conjunction with comfort packages (with seat heating and seat ventilation)
- Heat-insulating dark tinted glass all around from the B-pillar back

Retrofitted equipment

- Advanced Sound System 853

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel (Kante) - dent(s) - Paint



Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front left side - Scratched - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 8 Aug 2022	13.802,33 €

Repainting

No.	Repainting
1	Bonnet, Side panel - rear right side, Professionally carried out

Paint coat thickness measurement

Bonnet	275 µm	Side panel - rear right side	181 µm
--------	--------	------------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

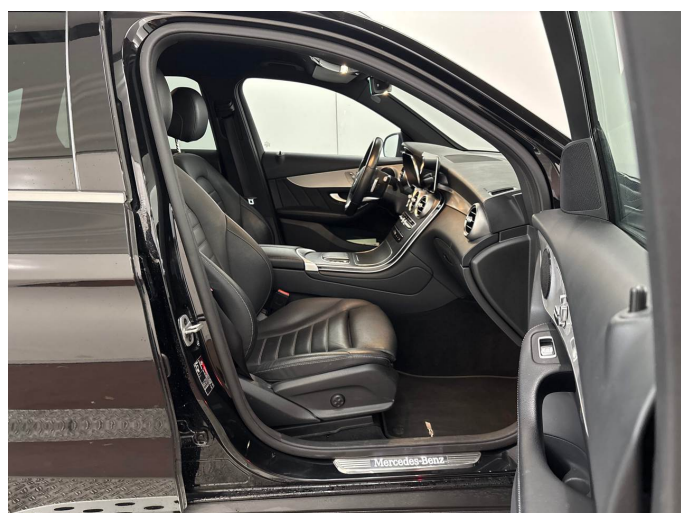


Figure 5: Interior - front

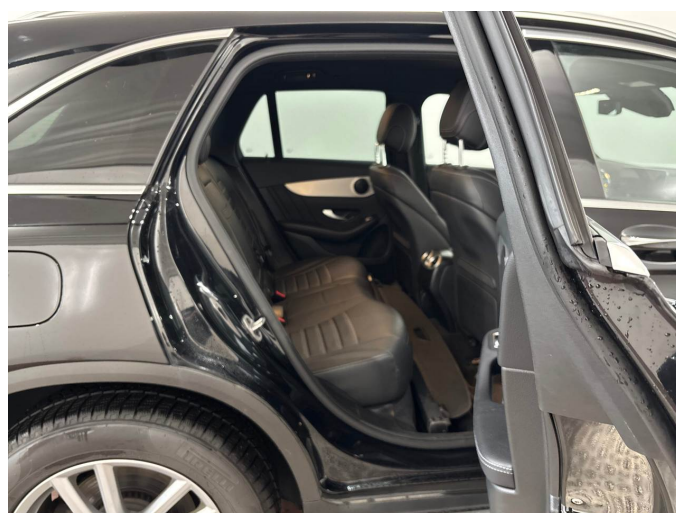


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

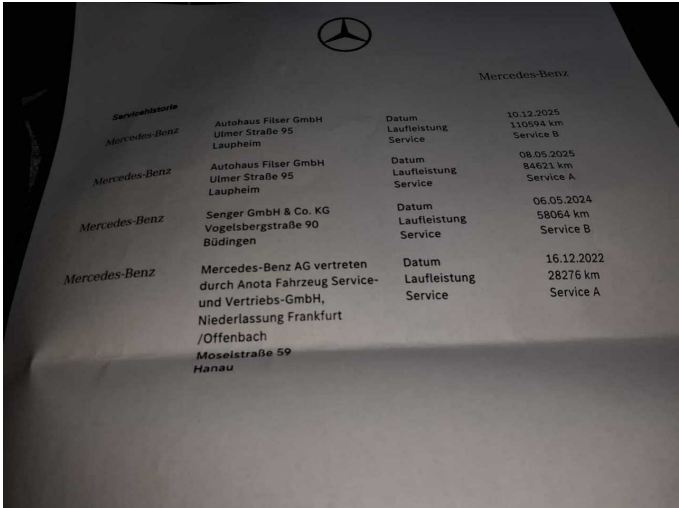


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

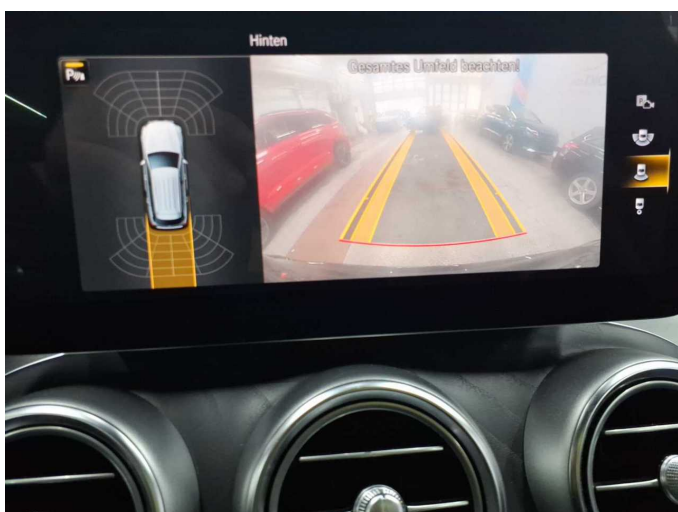


Figure 21: Misc.

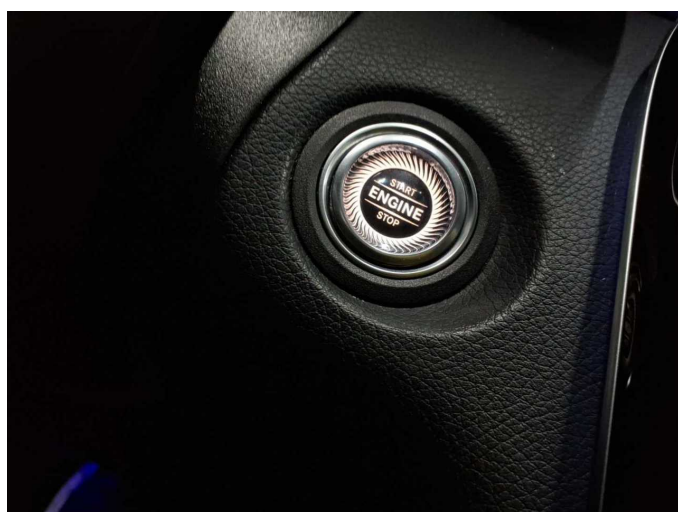


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

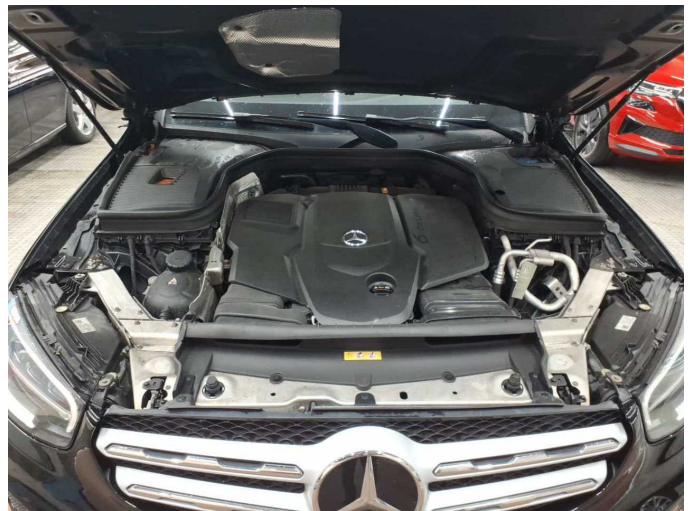


Figure 28: Misc.

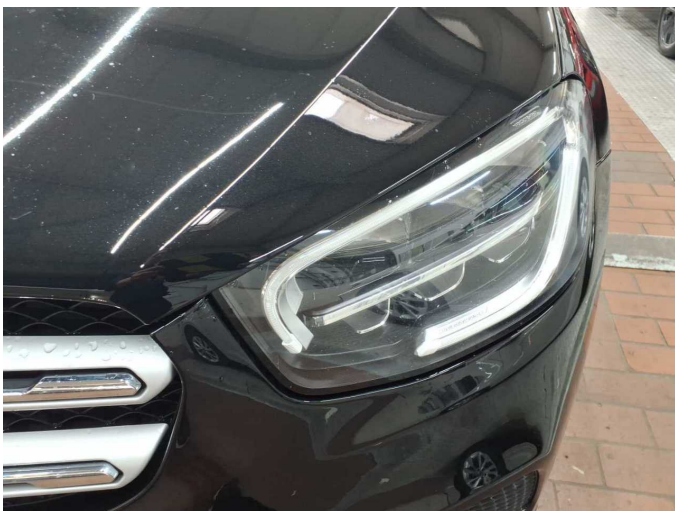


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

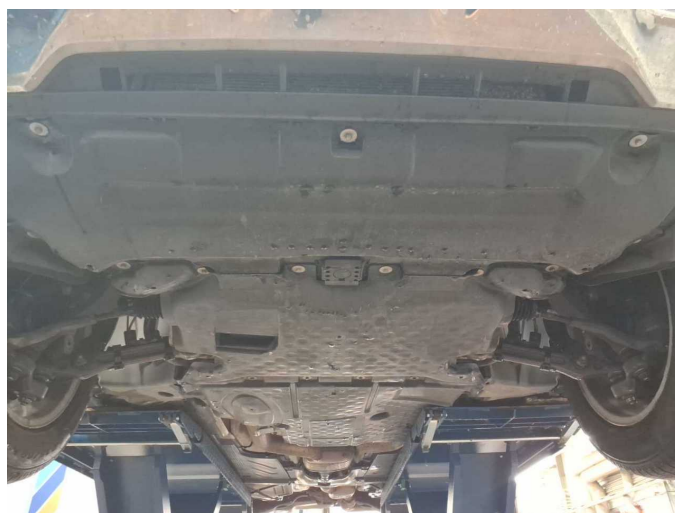



Figure 36: Misc.



Damage 1: Side panel - rear left side: Side panel (Kante) - dent(s) - Paint



Damage 1: Side panel - rear left side: Side panel (Kante) - dent(s) - Paint

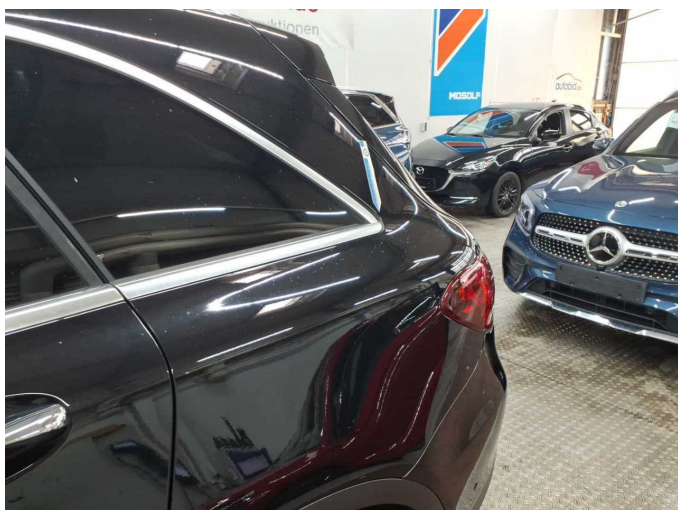

Damage 1: Side panel - rear left side: Side panel (Kante) - dent(s) - Paint



Damage 1: Side panel - rear left side: Side panel (Kante) - dent(s) - Paint



Repainting 1: Bonnet, Side panel - rear right side



Repainting 1: Bonnet, Side panel - rear right side



Repainting 1: Bonnet, Side panel - rear right side



Repainting 1: Bonnet, Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2539231V341735

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC 400 d 4Matic 9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
10.12.2025	110.594	Regelwartungsdienst
08.05.2025	84.621	Bremsscheiben hinten; Regelwartungsdienst
06.05.2024	58.064	Bremsscheiben vorne; Regelwartungsdienst
11.05.2023	40.438	Bremsklötze hinten
16.12.2022	28.276	Regelwartungsdienst