



Expertise

Protocol number: 46635743
Order No. / Reference: 26724018
Inspection date: 21 Jul 2026

Manufacturer: Audi

Model: A5 Sportback 35 TDI S tronic S line

VIN: WAUZZZF52NA036386



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A5 Sportback 35 TDI S tronic S line	
Vehicle Identification number	WAUZZZF52NA036386
Mileage (Read)	51,916 km
First registration	11 Aug 2022
Number of holders	1
Next periodical technical inspection	08/2027
(Report on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,968 ccm / 4
Power	120 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Coupe
Colour / colour code	Gletscherweiss Metallic
Doors / Seats	5 / 4
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Vehicle with smoke odor	Yes (not ozone-treated)



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	-20 Tag(e)
Last service on / at	04/2025 at 34,223 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ233036
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BPN 00654		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,120 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/35 R19 96Y	Summer tyres on Light alloy	Bridgestone	6mm / 6mm
2)	255/35 R19 96Y	Summer tyres on Light alloy	Bridgestone	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service including vehicle control
- Electrically adjustable/heated exterior mirrors
- Outdoor temperature display
- Fabric headliner
- Diesel particulate filter (DPF) with DeNox catalyst and AdBlue tank
- Door sill trims with aluminum inlay at the front, illuminated, with S lettering
- Driver information system
- Electric front windows
- front and rear floor mats
- Cruise control system with adjustable speed limiter
- Interior lighting
- Manual child lock
- boot floor mat
- Headrests (4)
- LED taillights
- Mild hybrid
- front center armrest
- Package Gloss
- Wheel: Tire repair kit
- Radio: MMI Radio Plus
- Radio accessories: Data module Europe
- Electromechanical power steering
- Front seats (standard seats)
- Phone: Bluetooth interface
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Airbag for driver and front passenger
- Accent areas matte black
- Drive slip control
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- third brake light
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Rear parking sensors
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Suspension (sports suspension)
- Remote key, without safe lock
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic (7-speed)
- Interior mirror dimming
- ISOFIX and Top Tether child seat anchors for the outer rear seats
- Fuel tank (40 liters)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Non-smoking version
- Wheel: Tire pressure monitoring system
- Wheel: Tires optimized for rolling resistance, speed-limited
- Radio accessories: 8 speakers
- Rear seat backrest foldable
- Seat belts: Three-point automatic seat belts for all seats
- Start-stop system
- First aid kit with warning triangle
- Electronic immobilizer
- Green thermal insulation glazing

Extra equipment

- Comfort key with sensor-controlled luggage compartment unlocking (wireless communication between the key and the vehicle allows opening the doors and luggage compartment lid, and locking via the sensors on the door handles. The comfort key simply needs to be carried with the vehicle. The engine is started and stopped using the engine start/stop button. The luggage compartment lid can also be conveniently unlocked with a foot gesture by kicking the rear of the vehicle if your hands are full.)
- Decorative inlays in matt brushed aluminum (for dashboard, door panels and center console)
- Deletion of model designation and performance/technology lettering
- Lane Departure Warning (within system limits, helps prevent unintentional lane departures. If the system is activated and ready, and the driver has not used the turn signal, the Lane Departure Warning helps prevent crossing detected lane markings by making corrective steering interventions. Additional steering wheel vibration can be set at the driver's request. Operating range from approximately 60 to a maximum of 250 km/h)
- Paint finish: Metallic
- S line interior package (sports seats in front - S line seat covers in black fabric/leather combination with S embossing on the backrests of the front seats - 3-spoke leather steering wheel with multifunction plus including steering wheel grips in perforated leather and S emblem; steering wheel and gearshift boot with contrast stitching, color-coordinated - headliner in black fabric - decorative inlays in matt brushed aluminum with accent surfaces in gloss black - pedals and footrest in stainless steel - floor mats front and rear with contrast stitching)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (height and reach of the leather steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons. Includes a leather gearshift/selector lever knob and a leatherette handbrake grip.)
- Storage and luggage compartment package (Sportback) (flexible transport of items and comfort on journeys; consisting of: - storage net on the back of the front seat backrests - cupholder in the rear center armrest - storage compartment on the driver's side - lockable glove compartment in the luggage compartment: - luggage compartment net - net in recesses on the left and right - tension strap on the right)
- Wheel: Alloy wheels "5-spoke Cavo design" graphite grey, polished (8.5 J x 19 with tires 255/35 R 19)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)
- AdBlue tank (24 liters)
- Black glass-look accent surfaces (for dashboard, door trim panels and center console insert; in conjunction with automatic transmission including cover for storage compartment in the center console)
- Business package (front seat heating - comfort package mirrors - infotainment package smartphone - navigation package - leather steering wheel in 3-spoke design with multifunction plus)
- Comfort automatic climate control 3-zone (in addition to the automatic climate control: - climate control unit with large TFT display and capacitive rocker switches - electronically regulates the air temperature and distribution individually for driver and front passenger - additional climate control unit for setting the rear passenger compartment temperature in the rear center console - automatic recirculation control via air quality sensor, with dust and odor-removing allergen filter - ventilated glove compartment - dust and odor-removing cabin air filter - residual heat utilization)
- Comfort package seats (variable headrests for the front seats - 4-way lumbar support for the front seats, electrically adjustable horizontally and vertically - comfort center armrest in the front, longitudinally adjustable and tiltable; additional storage option in the integrated storage compartment)
- Fuel tank (54 liters)
- Infotainment package Smartphone in conjunction with navigation package (Audi phone box light - Audi smartphone interface - USB charging interface for rear passengers (additional 2 USB-A charging interfaces for rear passengers in the rear center console))
- LED matrix headlights with dynamic turn signals front and rear (daytime running lights, low beam, high beam, position lights, turn signals, cornering lights, static curve lighting (supplementing lateral illumination in tight curves and when turning), all-weather light (to reduce glare in poor visibility conditions), maneuvering light (illuminating the swivel area when reversing), motorway light (extended beam range from a speed of 110 km/h), automatic dynamic headlight range control)
- Parking Assistance Package (Parking Aid Plus - Parking Assist - Rearview Camera)
- Upholstery: Fabric Sequenz/leather with S line embossing in the backrests of the front seats (seat center section of the front seats and the two outer rear seats in fabric Sequenz black - seat side bolsters, headrest center sections and middle seat in leather black with contrasting stitching - with S embossing in the backrests of the front seats)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Interior	Interior (Raucherauto) - Odour - Ozone treatment
3	Misc.	Inspection / maintenance - Due - Perform
4	Wheel / tyres	Alloy rim - rear left side - Scratched - Replace
5	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
6	Front bumper	Front bumper - Scratch(es) - Repair and paint
7	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - Replace

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

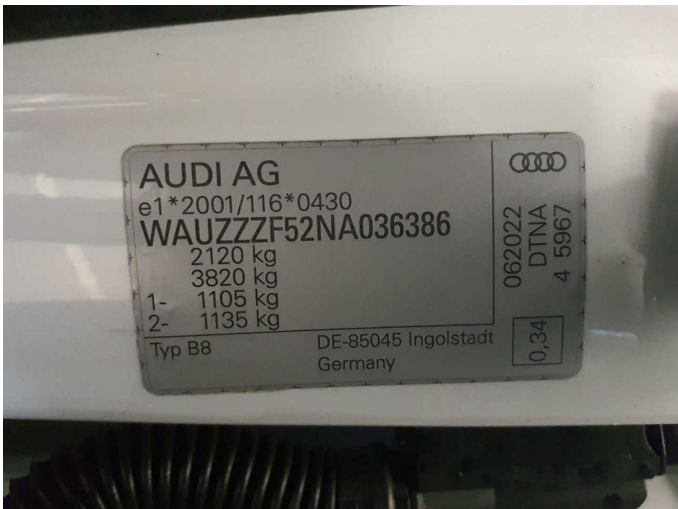


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

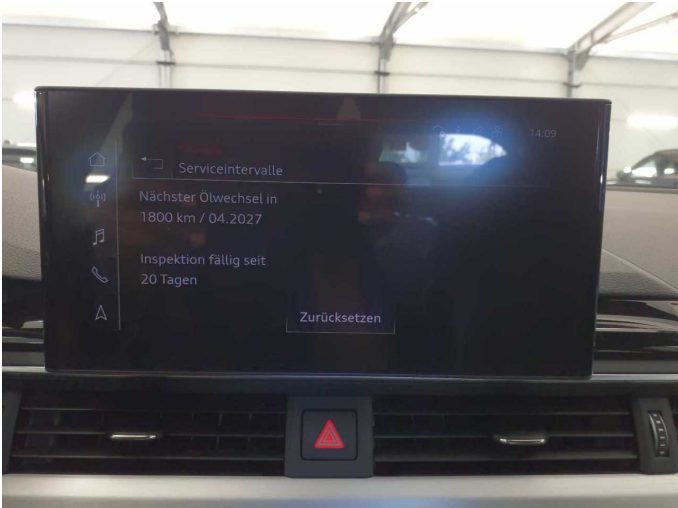


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.

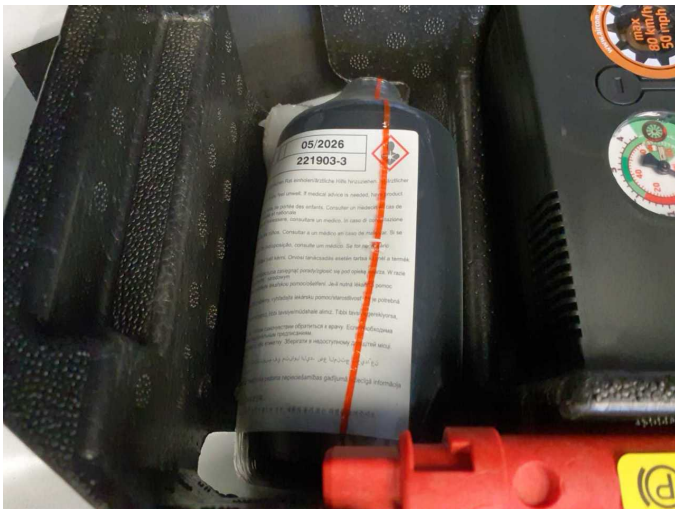

Damage 1: Equipment: Tirefit filler - Expired - Replace

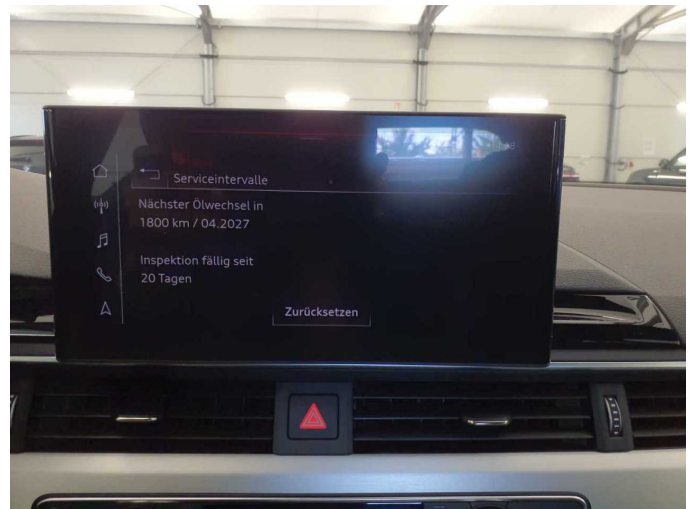

Damage 3: Misc.: Inspection / maintenance - Due - Perform



Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace




Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

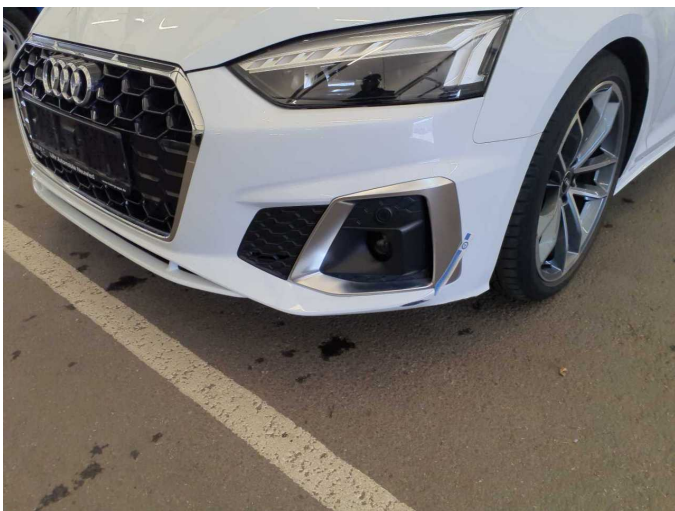

Damage 6: Front bumper: Front bumper - Scratch(es) - Repair and paint



Damage 6: Front bumper: Front bumper - Scratch(es) - Repair and paint



Damage 6: Front bumper: Front bumper - Scratch(es) - Repair and paint




Damage 6: Front bumper: Front bumper - Scratch(es) - Repair and paint



Damage 6: Front bumper: Front bumper - Scratch(es) - Repair and paint



Damage 7: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace

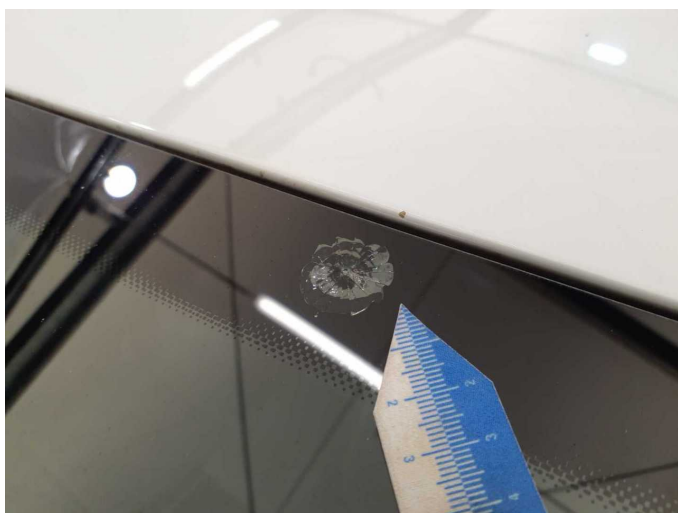

Damage 7: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF52NA036386

Hersteller / Modell: AUDI AUDI A5 Sportback 35 TDI S tronic S line

Datum	KM-Stand	Beschreibung
07.08.2025	39.623	AU
03.04.2025	34.223	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
01.07.2024	23.034	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
31.10.2023	15.628	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges