



Expertise

Protocol number: 46707864
Order No. / Reference: 26712617
Inspection date: 22 Jul 2026

Manufacturer: Mercedes-Benz

Model: Marco Polo 250 d HORIZON

VIN: W1VVMKEZXP4311847



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz Marco Polo 250 d HORIZON	
Vehicle Identification number	W1VVMKEZXP4311847
Mileage (Read)	54,425 km
First registration	22 Dec 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	140 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Van
Colour / colour code	Obsidianschwarz metallic
Doors / Seats	5 / 7
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	319 Tag(e)
Last service on / at	07/2025 at 27,616 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GZ060987
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ABH 03060		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,100 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100W	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	245/45 R18 100W	Summer tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100V	Winter tyres on Light alloy	Michelin	4mm / 4mm
2)	245/45 R18 100V	Winter tyres on Light alloy	Michelin	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Screw-in towing eye front/rear
- Driver's side airbag
- Airbag: Thorax-pelvis-sidebag for driver
- Airbag: Windowbag for driver and front passenger
- ATTENTION ASSIST (ATTENTION ASSIST can assist the driver on long, monotonous journeys by monitoring attention. If signs of fatigue or increasing inattention are detected, it suggests a break.)
- Heated and electrically adjustable exterior mirrors with integrated turn signals
- Battery: Backup battery for starting process
- Battery: fleece battery 12 V / 92 Ah
- Lighting: Lighting in the rear grab handle with reading light
- Brakes: Electric parking brake
- Brake lights, adaptive
- Roof bed
- Diesel particulate filter
- Electrical components for trailer socket
- Chassis: Comfort
- HVO-capable vehicle
- Front left window fixed in side wall/sliding door
- Windows: Electric vent windows in the rear passenger compartment
- Generator 14 V / 250 A
- 9G-TRONIC PLUS automatic transmission
- Seatbelt warning device for front passenger seat
- Seatbelt warning device for driver's seat
- Grab handle for entry
- Grab handle in the rear
- Lockable glove box
- Main tank 57 liters
- Boot lid
- HOLD function
- Interior mirror
- semi-automatic air conditioning system controlled by TEMPATIC
- Headrests (5)
- Steering wheel adjustable for tilt and height
- MBUX multimedia system 17.8 cm (7") touchscreen (AM/FM radio with dual tuner - Bluetooth connectivity - Integrated media interface - WiFi hotspot function - Personalization for up to 8 people - Predictive function - Voice control - Flash drive - USB-C port)
- Package: BlueEFFICIENCY (Fuel consumption-reducing measures are effectively combined. - The BlueEFFICIENCY package expands upon the BlueEFFICIENCY measures. It optimizes both fuel consumption and CO2 emissions (including aerodynamic underbody paneling). - Fuel efficiency generator reduces engine load. - ECO start/stop function (temporarily switches off the engine during stationary phases).
- Upholstery: Cloth
- Radio accessories: 2-way speakers front + rear.
- Radio accessories: Communication module (LTE) for digital services
- Passenger side airbag
- Airbag: Thorax airbag - Pelvis side airbag for front passenger
- Anti-lock braking system
- Increased load capacity to 3,100 kg
- Pop-top
- Pop-up roof in vehicle color
- Exit lights
- Outdoor temperature display
- Additional battery for retrofitted consumers
- Battery: Disconnect relay for additional battery.
- Front footwell lighting
- Hill start assist
- third brake light
- Comfort roof control unit
- Roof cladding
- Electronic tachometer
- Driving light assistant (automatically switching on driving lights)
- Window in rear door/tailgate (with wiper/washer system)
- Front right window fixed in side wall/sliding door
- Electric window regulator driver/passenger (with anti-pinch protection, quick lowering and raising)
- Generator management (Generator management helps reduce fuel consumption and CO2 emissions. The generator is switched off and the vehicle's electrical system is powered by the battery when it is sufficiently charged. This relieves the engine of the burden of charging the battery, for example, during acceleration. - When braking and during coasting downhill, the generator is switched on and the vehicle's kinetic energy is recuperated to charge the battery.)
- Interior headliner crystal grey
- Child safety locks on doors in the passenger compartment
- trunk light
- Instrument cluster with color display
- Paint finish: Solid color paint
- Headlight range control
- Mercedes-Benz emergency call system
- Center console with roller blind
- Multifunction steering wheel (with trip computer)
- Navigation: Navigation pre-installation
- Package: Aerodynamics
- Breakdown Management (By pressing the breakdown button or via the phone book entry in the vehicle's address book, the disabled vehicle automatically establishes a voice connection with the Customer Assistance Center (CAC). It transmits the current location and all relevant vehicle information. The CAC staff immediately inform the nearest Mercedes-Benz Service24h, which dispatches a repair service.)
- Radio: Digital radio DAB (for the DAB, DMB and DAB+ standards)
- Full wheel cover
- Rain sensor



- Tires: 225/55R17
 - Tires: Premium protection tires (3 years)
 - Tire pressure monitoring
 - Headlights: halogen technology
 - Key: Electronic key in chrome finish (The electronic vehicle key with high-quality chrome applications allows for convenient opening and closing of the vehicle at the touch of a button. The electronic vehicle key centrally locks or unlocks the driver's, passenger's, and sliding doors, as well as the tailgate. An emergency key integrated into the electronic key allows the driver's door lock cylinder to be opened mechanically, for example, should the key's battery be dead.)
 - Start-stop function (The ECO start-stop function plus temporarily switches off the engine during stationary phases, which reduces fuel consumption and emissions, especially in city and stop-and-go traffic, and increases the vehicle's range. With an automatic engine stop, the lights, air conditioning, and radio remain switched on during the stationary phase.)
 - Carpeted floor in the front of the vehicle interior (including luggage net in the passenger footwell)
 - Doors: active locking mechanism for sliding doors
 - First aid kit
 - Warm air duct to the passenger compartment
 - Windshield washer fluid level warning light
 - Immobiliser
 - Central locking with radio remote control
 - Auxiliary heater, electric
- Tires: Comfort tires
 - Tires: Summer tires
 - Wheels: Steel rims 6.5 J x 17
 - Sliding door on the right, cargo/passenger compartment
 - Crosswind Assist
 - electromechanical power steering
 - Seats: 2nd row, 3-seater comfort bench (comfort recliner)
 - Seats: 4-seat rail system (with quick-release mechanism)
 - Seats: Comfort passenger seat, swiveling
 - Seats: Swivel comfort driver's seat
 - Seats: Passenger seat cushion depth adjustment
 - Seats: Driver's seat cushion depth adjustment
 - Sun visor, driver/passenger side, illuminated mirror
 - Storage net on the passenger seat backrest
 - Storage net for driver's seat backrest
 - 12V socket for rear seat rails, right and left
 - 12V socket in the trunk/cargo area
 - 12V socket
 - Bumpers and attachments painted in body color
 - Cruise control
 - Carpet in the rear
 - Touchpad
 - Ambient lighting tailgate
 - Pre-installation for Remote Services Plus
 - Warning triangle
 - ASSYST maintenance interval indicator
 - Heat-insulating glass all around
 - Decorative elements with piano lacquer finish, black
 - Car registration



Extra equipment

- Storage compartments: 2 cupholders in the passenger compartment (2 cupholders can be attached to the rear armrest)
- Front opening pop-up roof
- Luggage securing net
- TEMPMATIC automatic climate control additionally in the rear
- THERMOTRONIC automatic climate control
- Comfort locking system with IR remote control
- Paint finish: Metallic
- Side awning anthracite
- Package: Assistance Package (Lane Keeping Assist - Blind Spot Assist - PRE-SAFE - Active Brake Assist)
- Package: Parking (Reversing camera - Active Parking Assist)
- Package: Mirrors (automatically dimming interior mirror - automatically dimming exterior mirror - electrically folding exterior mirror - ambient lighting in the exterior mirrors)
- Wheels: Alloy wheels 7.5 J x 18, 5-spoke design
- Sliding door - left side
- Seats: Passenger seat electrically adjustable
- Seats: Single seat in passenger compartment, 1st row right, in conjunction with interior design package (single seat on the right)
- Seats: Lumbar support, passenger seat
- Seat heating on passenger side
- Storage nets on the backrests of the individual rear seats
- Traffic Sign Assistant
- Chassis: AGILITY CONTROL with selective damping system (adapts the damping characteristics to the road conditions and driving situation. It ensures a balanced combination of ride comfort and agility by varying the rolling characteristics, damping effect, and stabilization according to the road surface and driving conditions. By constantly sensing the road surface, ride comfort is improved in the case of minor disturbances, while damping effect and vehicle stabilization are improved in the case of larger disturbances.)
- Navigation
- Package: Interior Design Package (Comfort seats for driver and front passenger, rotatable, in Lugano leather (VU0/VX9)2/(VX7) - Leather steering wheel (CL3) - Sport pedals - Trim elements in ebony wood look, dark anthracite glossy, or optional trim elements in piano black look, black (FH0), - optional trim elements in double stripe look (F2Z) (for Marco Polo HORIZON and Marco Polo HORIZON EDITION))
- Sleeping pad for bed bottom
- Seats: Single seat in passenger compartment, 1st row left. In conjunction with interior design package (additional single seat behind driver's seat)
- Seats: Driver's seat electrically adjustable
- Seats: Lumbar support for driver's seat
- Seat heating on driver's side
- Folding table
- Decorative elements in wood look, ebony, dark anthracite

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Instrument panel	Indicator light (Reifendruck) - on - Diagnosed and repair if necessary
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Bonnet	Bonnet (Mehrkosten können entstehen) - Soiled - Conditioning
4	Front bumper	Front bumper - Scratched - Smart repair
5	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
6	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
7	Vehicle glazing	Windscreen - Stone chips - Smart repair
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Sliding door - left side	Sliding door with glass panel - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Door - front right side	Door - Scratch(es) - No deduction
2	Sliding door, right	Sliding door with glass panel - Scratch(es) - No deduction
3	Roof	Roof rail - left side - Stone chips - No deduction
4	2nd wheel set	1 alloy rim - Scratched - No deduction
5	2nd wheel set	1 tyre - Broken / torn - No deduction
6	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
7	Wheel / tyres	Alloy rim - front right side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description
Equipment - Equipment (Heringe für Markise)
Equipment - Bed cushion/mattress (unten)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 14 Oct 2024	4.216,61 €

Repainting

No.	Repainting
1	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
2	Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - rear left side	184 µm	Door - front left side	207 µm
-----------------------	--------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:
• Description of key vehicle information • Documentation of equipment features (Delivery by third-party service providers) • Documentation of damage, defects, missing parts • Documentation of prior damage, unrepaired prior damage, repainting • A brief visual or functional inspection of the equipment details, if possible. (Functional testing of driver assistance systems is not included in the scope of services!) • a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.

Keine Besichtigung des Unterbodens, Begutachtung Fahrwerk/Achsen/Aggregate nur bedingt möglich, Zusatzkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

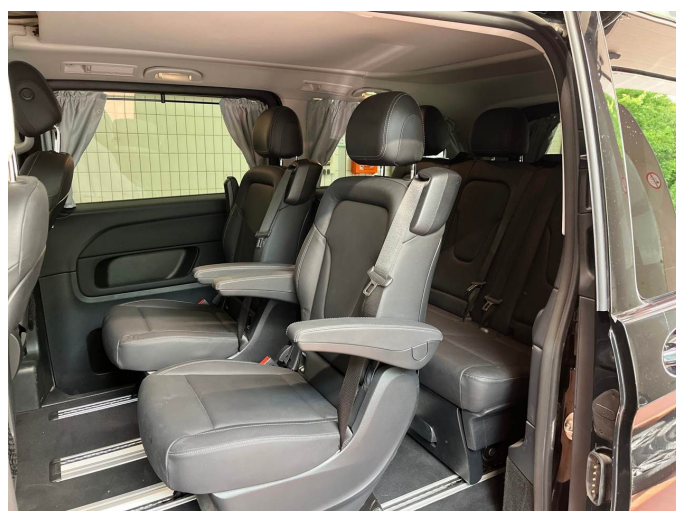


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

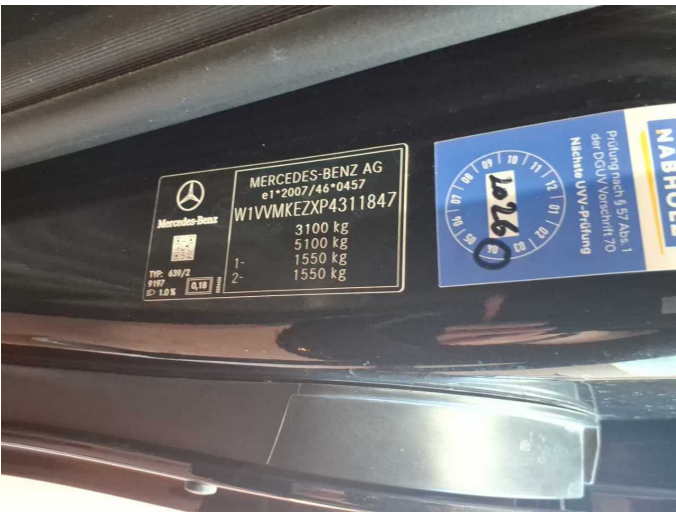


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

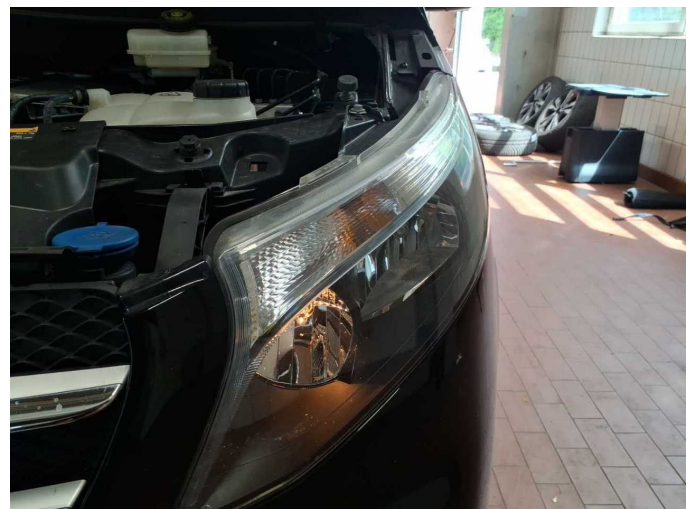


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

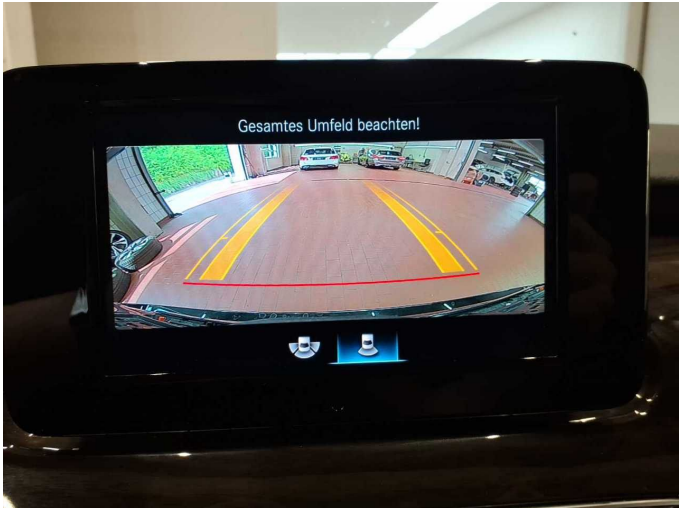


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

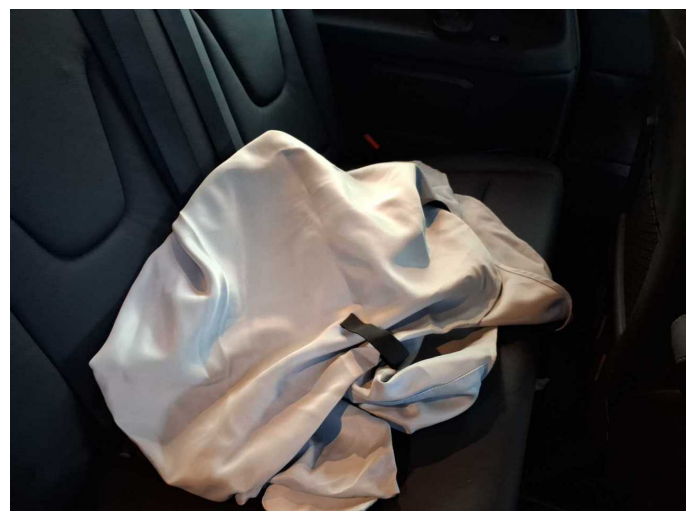


Figure 36: Misc.

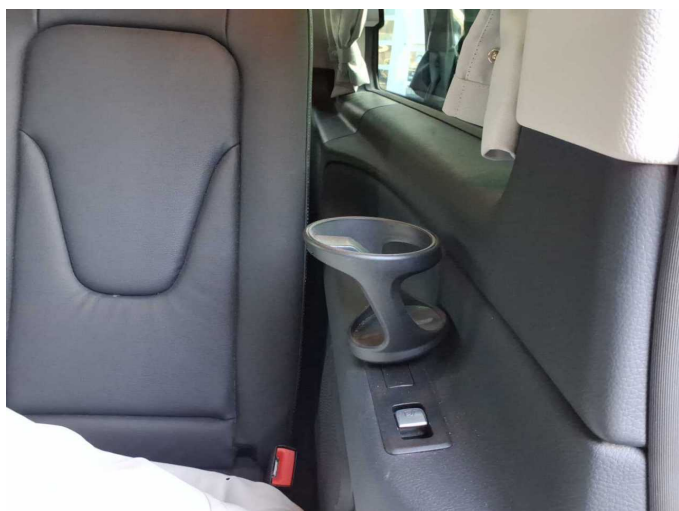


Figure 37: Misc.

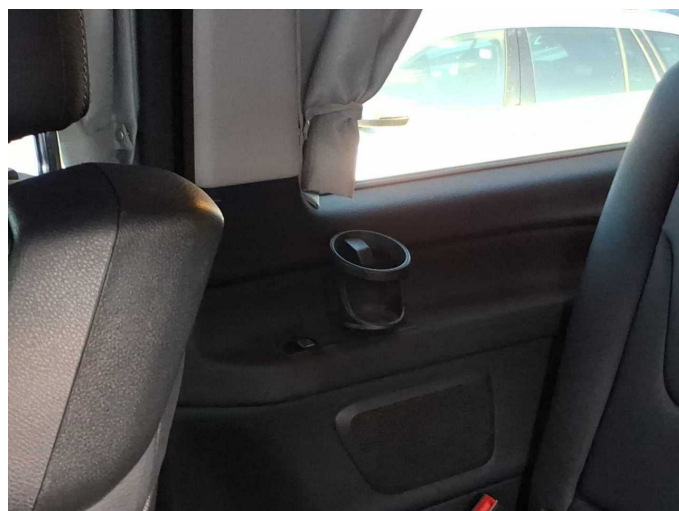


Figure 38: Misc.




Damage 1: Instrument panel: Indicator light (Reifendruck) - on - Diagnosed and repair if necessary



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair

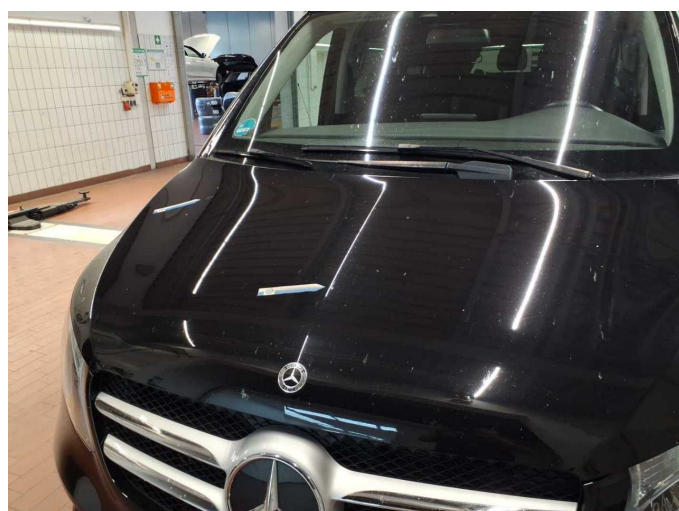

Damage 3: Bonnet: Bonnet (Mehrkosten können entstehen) - Soiled - Conditioning



Damage 3: Bonnet: Bonnet (Mehrkosten können entstehen) - Soiled - Conditioning



Damage 3: Bonnet: Bonnet (Mehrkosten können entstehen) - Soiled - Conditioning



Damage 4: Front bumper: Front bumper - Scratched - Smart repair



Damage 4: Front bumper: Front bumper - Scratched - Smart repair



Damage 4: Front bumper: Front bumper - Scratched - Smart repair




Damage 4: Front bumper: Front bumper - Scratched - Smart repair



Damage 5: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 5: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair

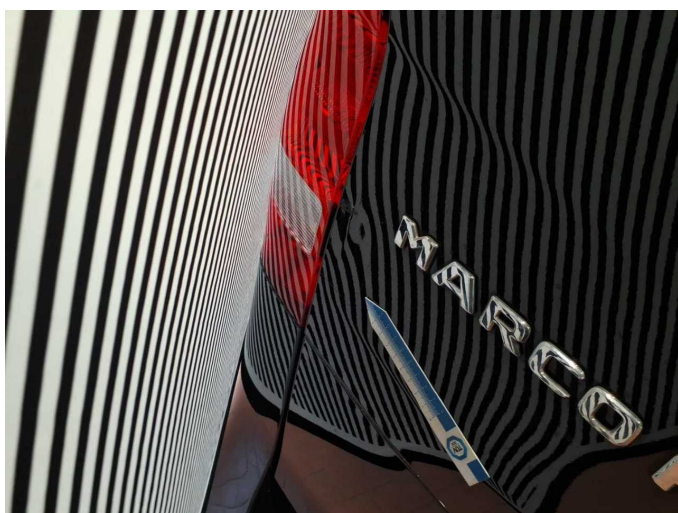

Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 7: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 7: Vehicle glazing: Windscreen - Stone chips - Smart repair




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

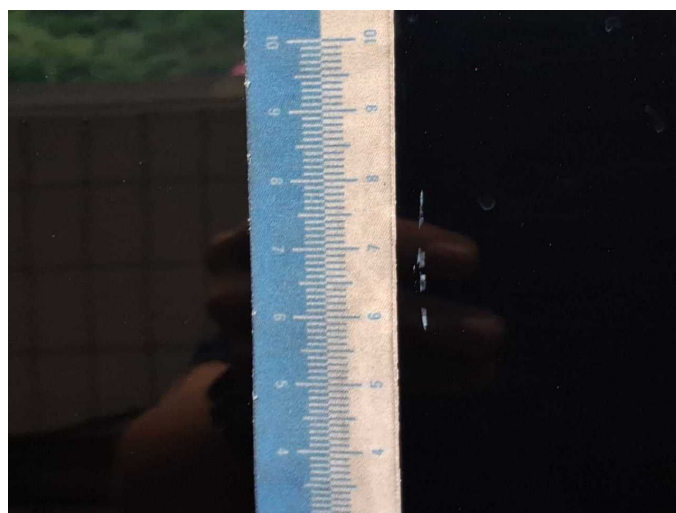

Damage 9: Sliding door - left side: Sliding door with glass panel - Scratch(es) - Paint

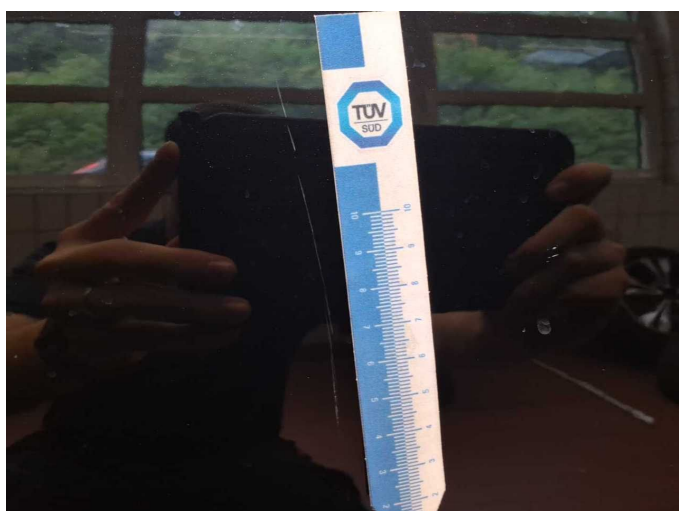

Damage 9: Sliding door - left side: Sliding door with glass panel - Scratch(es) - Paint



Damage 9: Sliding door - left side: Sliding door with glass panel - Scratch(es) - Paint



Wear and tear 2: Sliding door, right: Sliding door with glass panel - Scratch(es) - No deduction




Wear and tear 2: Sliding door, right: Sliding door with glass panel - Scratch(es) - No deduction



Wear and tear 4: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 4: 2nd wheel set: 1 alloy rim - Scratched - No deduction

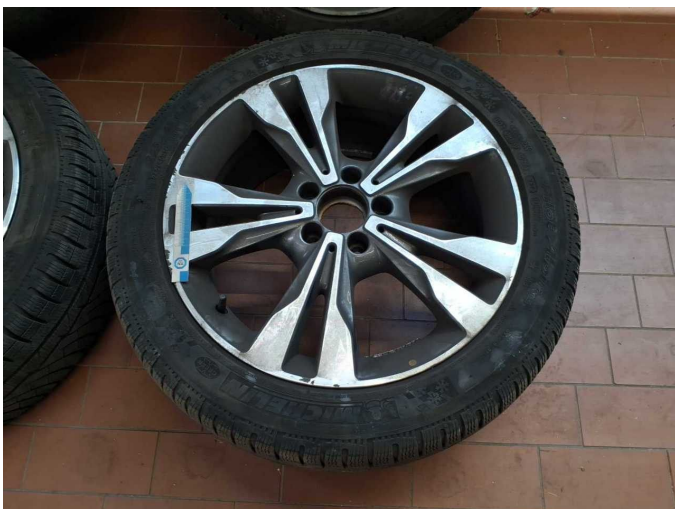

Wear and tear 4: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 5: 2nd wheel set: 1 tyre - Broken / torn - No deduction



Wear and tear 5: 2nd wheel set: 1 tyre - Broken / torn - No deduction



Wear and tear 6: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 6: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 6: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 6: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - No deduction



Wear and tear 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) -
No deduction



Repainting 1: Door - rear left side



Repainting 2: Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1VVMKEZXP4311847

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ Vito 250 d Marco Polo
HORIZON

Datum	KM-Stand	Beschreibung
08.07.2025	27.616	Regelwartungsdienst