



Expertise

Protocol number: 46480839
Order No. / Reference: 26595511
Inspection date: 10 Jul 2026

Manufacturer: Peugeot

Model: 208 Elektromotor 136 Allure

VIN: VR3UHZKXZPT565990



ALPHABET



ALPHABET

Vehicle details

Manufacturer / Type / Model / Equipment

Peugeot 208 Elektromotor 136 Allure

Vehicle Identification number VR3UHZKXZPT565990

Mileage (Read) 11,019 km

First registration 27 Jun 2023

Number of holders 1

Next periodical technical inspection 06/2026
(Report not on hand)

Power / Engine displacement 57 kw /

Fuel type / Cylinder Electric / 0

Gearbox / Number of gears Direct drive / 1

Type of drive Front drive

Type of vehicle Saloon car

Colour / colour code Faro Gelb Metallic

Doors / Seats 5 / 5

Upholstery type Cloth / leather combination

Colour of upholstery Black-Grey



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	20,900 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG064005
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / ACH 00040		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	1,910 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 87V	All-season tyres on Light alloy	Falken	5mm / 5mm
2)	195/55 R16 87V	All-season tyres on Light alloy	Falken	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 08/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- "e" logo on the C-pillar and e208 logo on the tailgate
- ABS (Anti-lock Braking System)
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Acoustic pedestrian warning system (AVAS)
- Electrically folding exterior mirrors
- Exterior mirror caps Perla Nera Black
- Hill start assist
- Turn signals with lane change indicator function
- third brake light
- Three-point seat belts at all seating positions (three-point seat belts with belt locks, pyrotechnic belt tensioners, warning light and warning signal when the seat belt is not fastened or is released for driver and front passenger, three-point seat belts, belt force limiters on the side seats, Isofix child seat anchors on the outer seats, warning light and warning signal when the seat belt is released)
- Electric front windows (with comfort operation and anti-pinch protection)
- Follow-me-home function (automatic)
- noise-reducing windshield
- Transmission: Direct drive
- Heated rear window
- Rear apron in black
- Interior mirror automatically dimming
- Manual child lock
- Headrests (5)
- Paintwork: Faro Yellow
- LED taillights
- Steering wheel adjustable for height and reach
- light sensor
- Front center armrests (with storage compartment)
- Emergency brake assist (with automatic activation of the hazard warning lights)
- Pollen filter
- Upholstery: Fabric/faux leather (Cozy)
- Radio: RCC audio system (mono tuner - 6 speakers - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - USB port - operation via steering wheel and touchscreen)
- Radio accessories: Multifunctional touchscreen with 7" color screen (capacitive screen - 7 piano key "toggle switches")
- Wheel arches in glossy black
- Rain sensor
- Tire pressure monitoring system
- Wheels: 16" "Elborn" alloy wheels (with 195/55 R 16 tires)
- Keyless start system
- Electric power steering
- Lane keeping assist with steering intervention
- Daytime running lights: LED daytime running lights
- Door handles painted in car color
- Doors lock automatically when driving off
- Storage compartment with smartphone holder
- Active Safety Brake
- Airbag: Front side airbag
- Airbag: Curtain airbags front and rear
- Analog instrument cluster with dot matrix in color
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- Trim panel between the taillights in glossy black
- On-board computer
- Ceiling light at the front, 2 reading lamps at the front
- EBV (Electronic Brakeforce Distribution)
- Eco-LED headlights
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Driving mode selector "Eco" and "Sport"
- Electric rear windows (with comfort operation and anti-pinch protection)
- electric parking brake
- Front collision warning
- Cruise control system with speed limiter
- Cup holder in the center console
- rear window wiper
- Rear spoiler, glossy black
- Map pockets on the front seatbacks
- Automatic climate control with activated carbon filter
- Radiator grille with applications in body color
- Charging cable: Mode 3 charging cable (Type 2, up to 7.4 kW), 6 meters long
- Steering wheel: Small multifunction leather steering wheel, flattened at the top and bottom.
- Fatigue warning
- Peugeot Connect Box & Real-time Navigation by TomTom Services (with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - Integrated European SIM card - Speaker and microphone - Emergency battery)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Mirror Screen (transmission of multimedia content and apps from a compatible smartphone to the vehicle's touchscreen, allowing direct control of compatible functions and apps - Android Auto and Mirror Link (for compatible smartphone models with Android operating system) - CarPlay (for compatible iPhone models from Apple))
- Tire repair kit (compressor and tire sealant spray)
- Rear seat backrest 40/60 split folding
- Side and rear windows are more heavily tinted.
- Seats: Driver's seat height adjustable
- 12-volt socket in the trunk



- Traffic sign recognition (with display of the speed recommendation in the instrument cluster)
- Central locking system, activatable from inside via remote control (doors lock automatically when driving off)
- Electric version technology (Combo connector (Combined Charging System CCS) on the vehicle - On-board charger 11 kW - three-phase - Heat pump to reduce energy consumption and increase range in real everyday use)
- Immobiliser

Extra equipment

- Paint finish: Special metallic paint
- On-board charger 11 kW, 3-phase
- Navigation system: 3D navigation system NAC (3D navigation including 3D display of buildings and monuments - voice recognition for navigation, telephone and media - touchscreen operation - real-time navigation by TomTom Services - including PEUGEOT Connect Box with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - integrated European SIM card - speaker and microphone - emergency battery)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Roof - dent(s) - Smooth repair work
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Door - front left side	Door - dent(s) - Smart repair
4	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
5	Rear bumper	Rear bumper - Scratch(es) - Smart repair
6	Door - front right side	Door - Scratch(es) - Smart repair
7	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace
8	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Replace

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Die Wartungshistorie ist nicht vorhanden und kann somit nicht auf Vollständigkeit geprüft werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

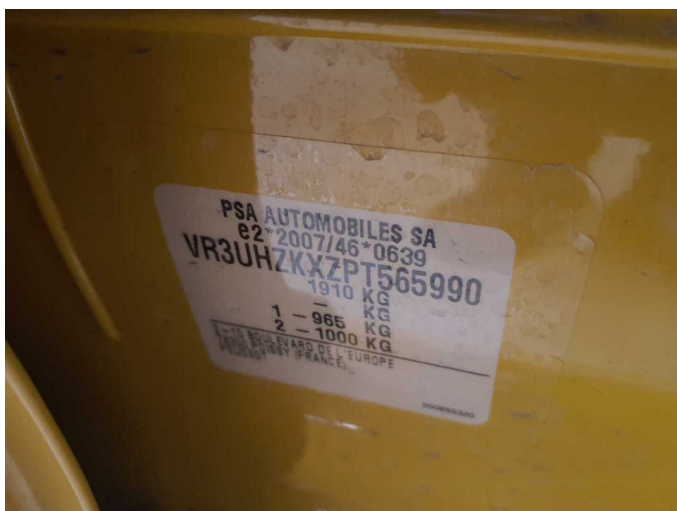


Figure 11: VIN

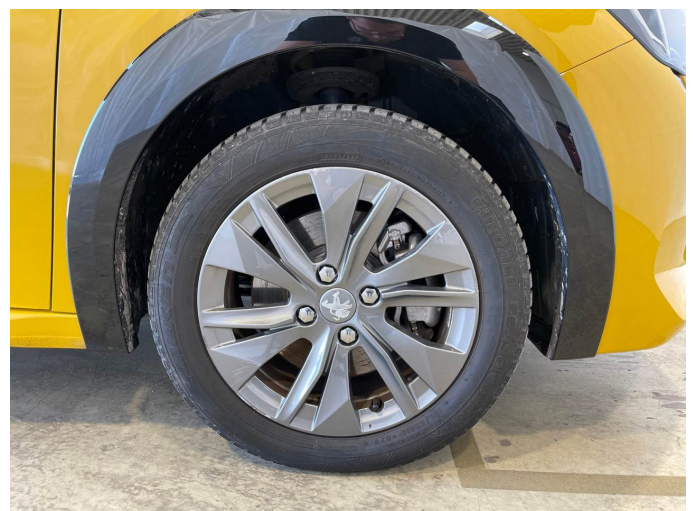


Figure 12: Mounted tyres

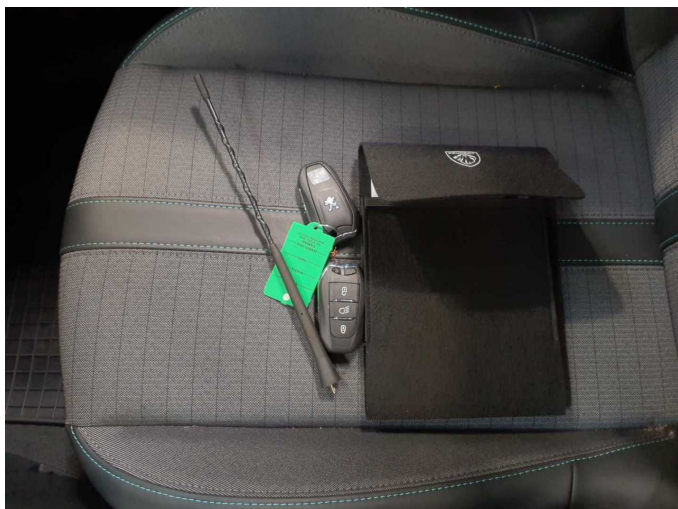


Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

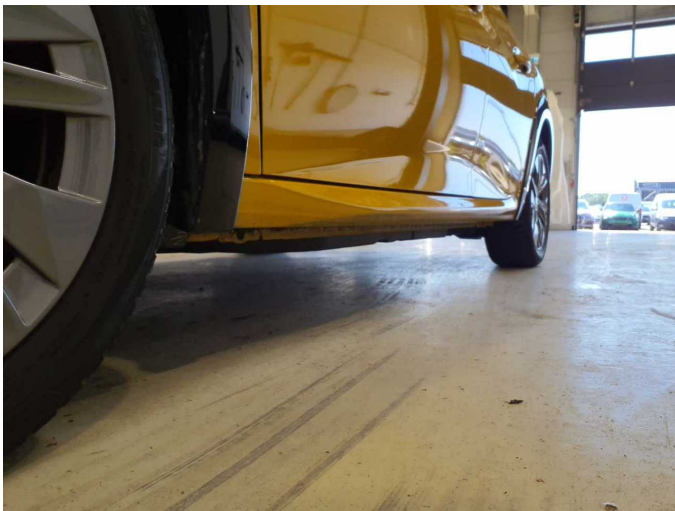


Figure 21: Misc.

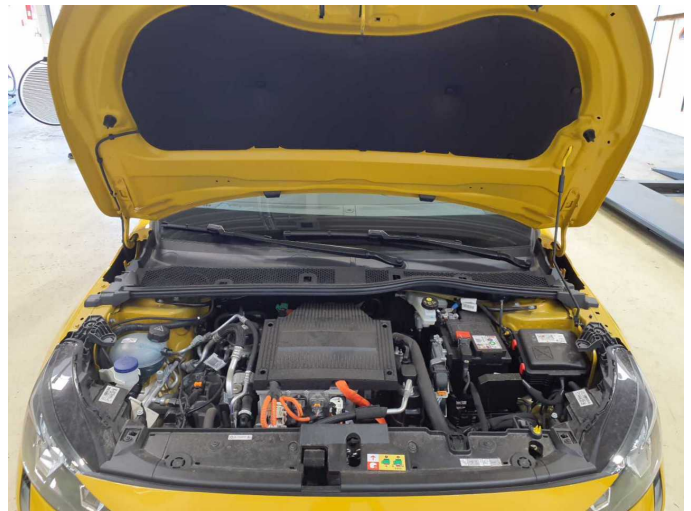


Figure 22: Misc.



Figure 23: Misc.




Figure 24: Misc.



Figure 25: Misc.




Damage 1: Roof: Roof - dent(s) - Smooth repair work

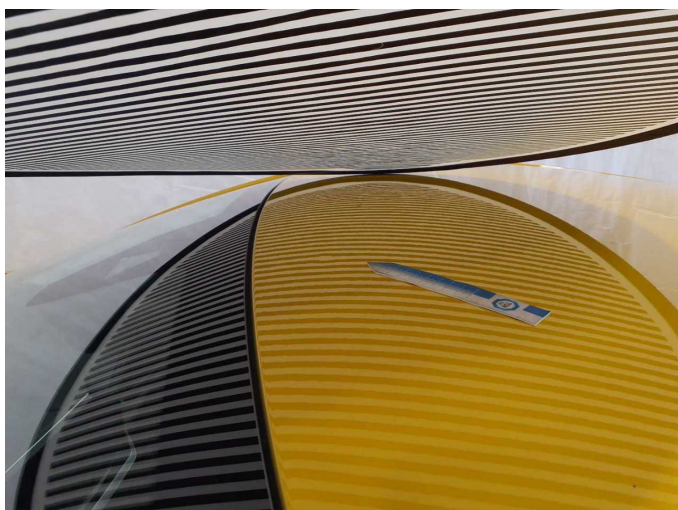

Damage 1: Roof: Roof - dent(s) - Smooth repair work




Damage 1: Roof: Roof - dent(s) - Smooth repair work

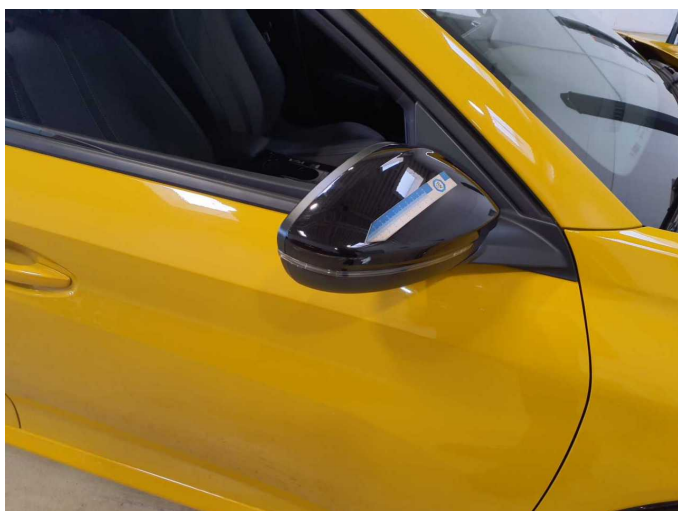


Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair

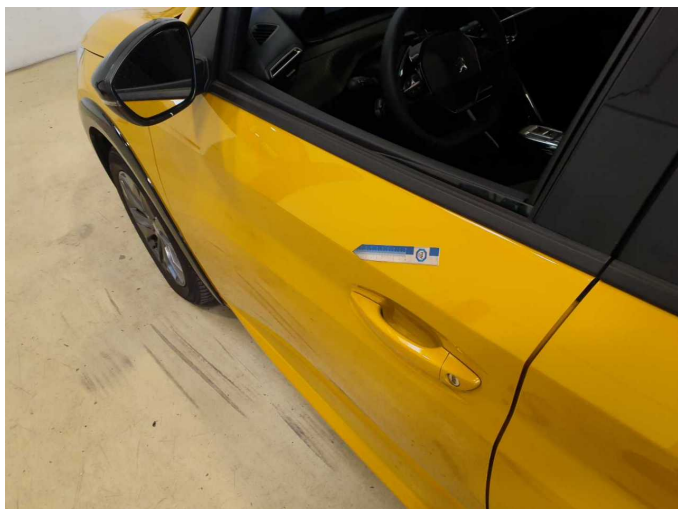

Damage 3: Door - front left side: Door - dent(s) - Smart repair

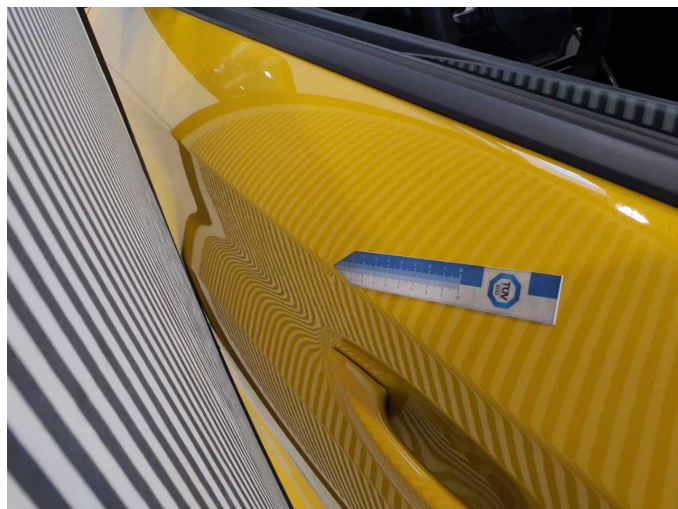


Damage 3: Door - front left side: Door - dent(s) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

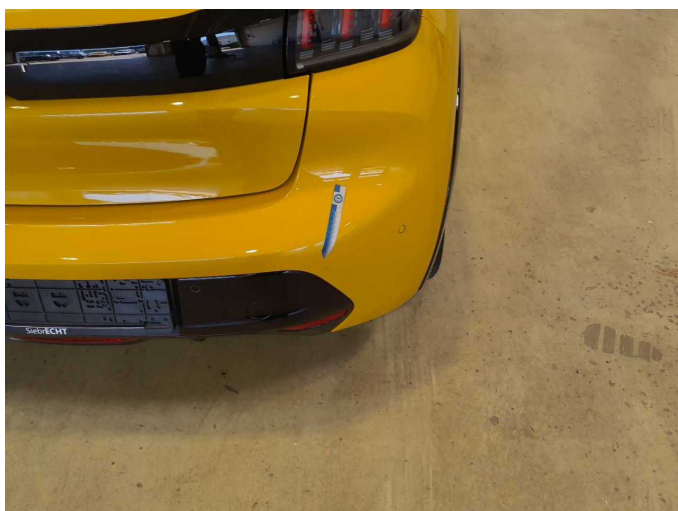


Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair

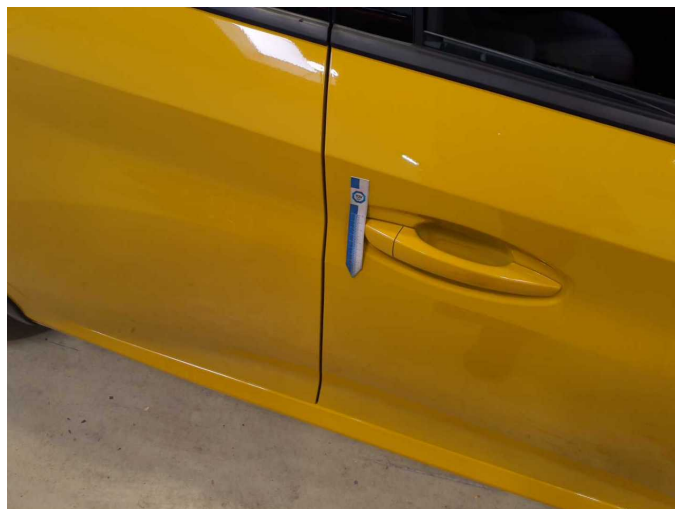

Damage 6: Door - front right side: Door - Scratch(es) - Smart repair

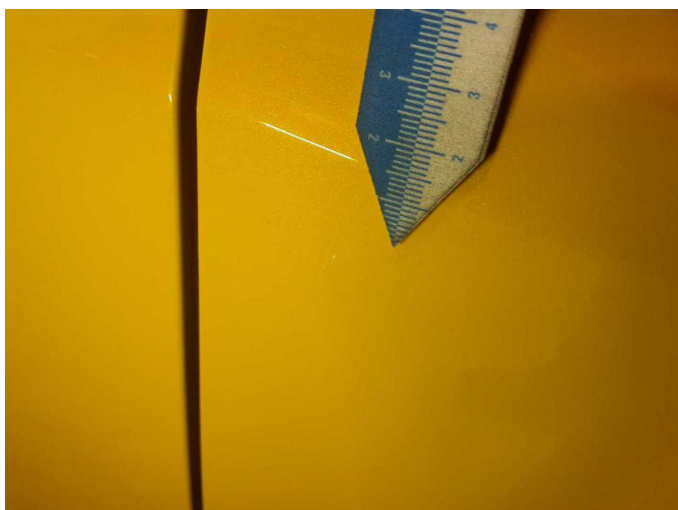


Damage 6: Door - front right side: Door - Scratch(es) - Smart repair

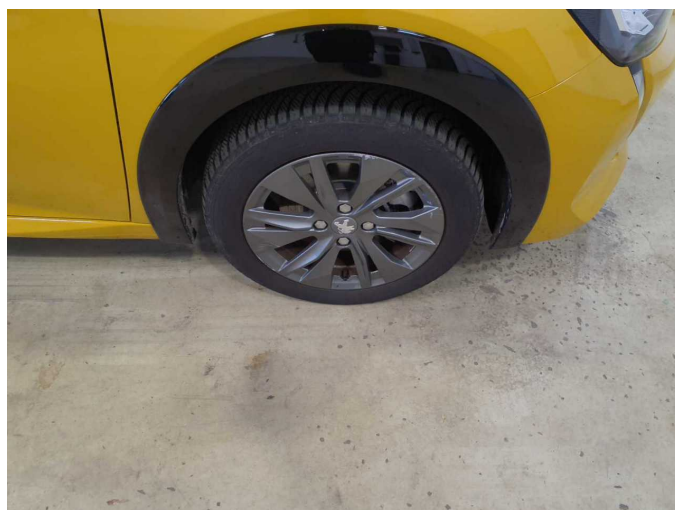

Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace

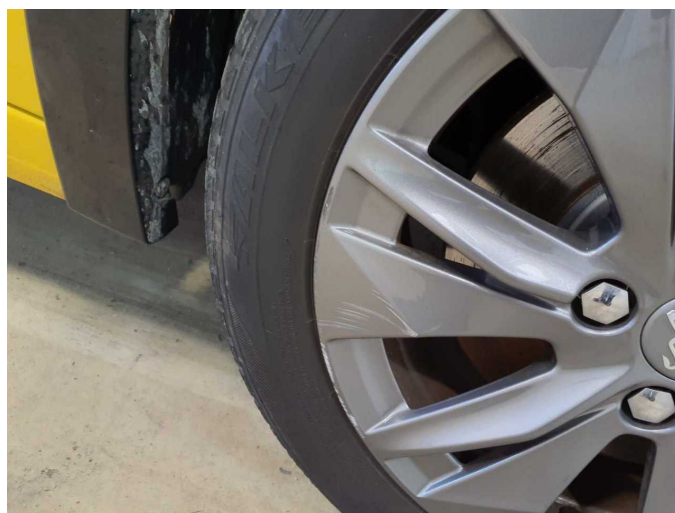

Damage 7: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace