



Expertise

Protocol number: 46802752
Order No. / Reference: 26584860
Inspection date: 29 Jul 2026

Manufacturer: Opel

Model: Insignia Sports Tourer 1.5 Diesel Business Edition

VIN: W0VZT8GN3M1029349



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Insignia Sports Tourer 1.5 Diesel Business Edition

Vehicle Identification number	W0VZT8GN3M1029349
Mileage (Read)	93,683 km
First registration	8 Feb 2022
Number of holders	1
Next periodical technical inspection	03/2027
(Report on hand)	

Fuel type	Diesel
Engine displacement / Cylinder	1,496 ccm / 3
Power	90 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Nautic Blau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	
Last service on / at	06/2026 at 91,843 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC792767
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AME 00185		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,175 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98H	Winter tyres on Light alloy	Bridgestone	3mm / 3mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Dunlop	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Storage compartments • Airbag: Front and rear outer head airbags • Anti-lock braking system (ABS) • Hill Start Assist • third brake light • Diesel particulate filter • Electronic brake force distribution (EBD) • Driver information display, 3.5" • Front collision warning system with pedestrian detection and automatic emergency braking • Speed controller • rear window wiper • Automatic climate control, two zones • Rear headrests (3 pieces) • LED headlights • LED daytime running lights including LED indicators, front and LED taillights • Center armrest, front • Parkpilot, front and rear parking aid • Quickheat rapid heating system • Radio: Multimedia navigation system with 7" color touchscreen display • Wheels: 7.5 J x 17 alloy wheels in a 5 double-spoke design • Seat belts: Three-point seat belts in all seats • Visibility equipment • Lane Keeping Assist • Bumpers painted in body color • Traffic sign assistant • Immobiliser • Central locking with remote control | <ul style="list-style-type: none"> • Airbag: Front airbags (multi-stage) and side airbags, driver and front passenger • Electrically adjustable and heated exterior mirrors for driver and passenger side • black roof rails • Tachometer • Electronic Stability Program (ESP Plus) • Electric windows front and rear • Pedestrian protection including active hood • luggage compartment cover • Transmission: 6-speed manual transmission • Child safety lock in the rear doors, manual • Front headrests • Paintwork: Solid special color Snow White • LED fog lights • Steering column adjustable for height and reach • Illuminated makeup mirrors in both sun visors • Electric parking brake • Upholstery: Billy fabric, black • Radio: Digital radio reception DAB+ • Tire repair kit • Tire pressure gauge • Rear seat backrest folds forward in a 60:40 split • Power steering • safety net • Seats: Ergonomic active seat (AGR) driver • Start/Stop System • Traction Control (TC) Plus • Pre-installation for child seat mounting system "ISOFIX" • Thermal insulation glazing, green tinted • Second folding ignition key |
|--|---|

Extra equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Swiveling trailer hitch (including trailer stability program) • Park & Go with digital reversing camera (digital reversing camera - reversing assistant - lane change assistant - blind spot warning in both exterior mirrors) | <ul style="list-style-type: none"> • Paint finish: Metallic • Upholstery: Monita fabric/Premium leather look • Radio: Multimedia Navi Pro with 8" color touchscreen display |
|---|--|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats (Vorne links) - Holes - Replace
2	Door - front left side	Door - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
4	Body	A-pillar - left side - Stone chips - Smart repair
5	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
6	Bonnet	Bonnet (Sandstrahleffekt) - Stone chips - Paint
7	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - rear right side	172 µm
------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

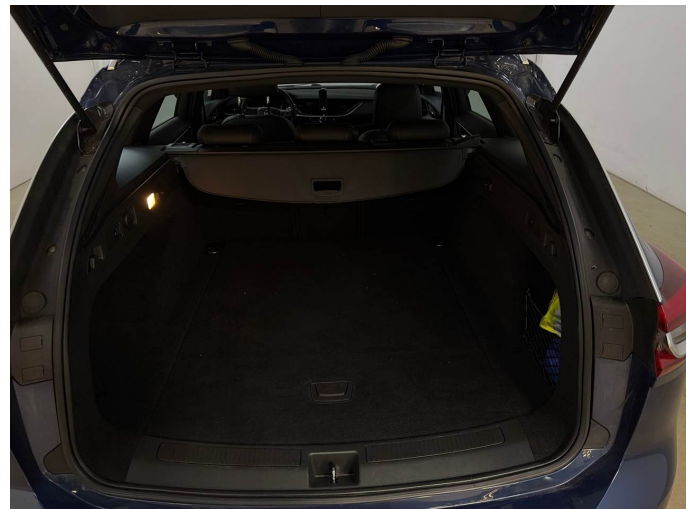


Figure 10: Cargo area

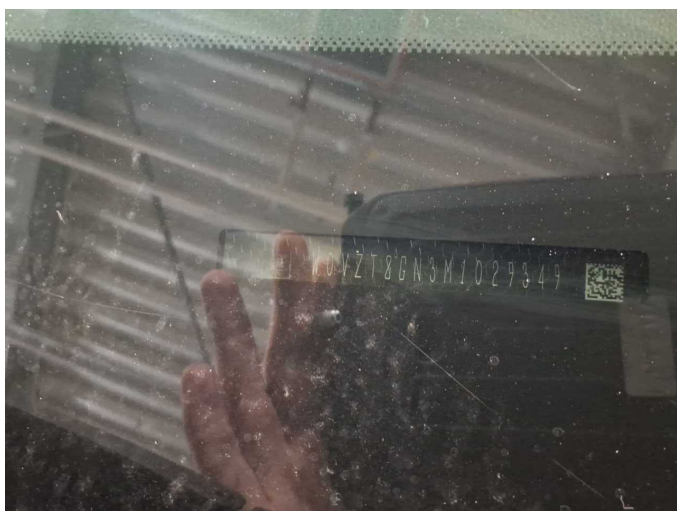


Figure 11: VIN



Figure 12: Mounted tyres

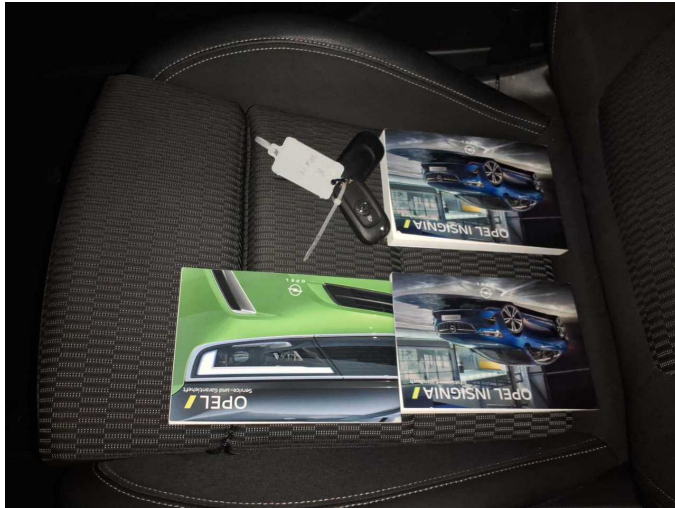


Figure 13: Documents

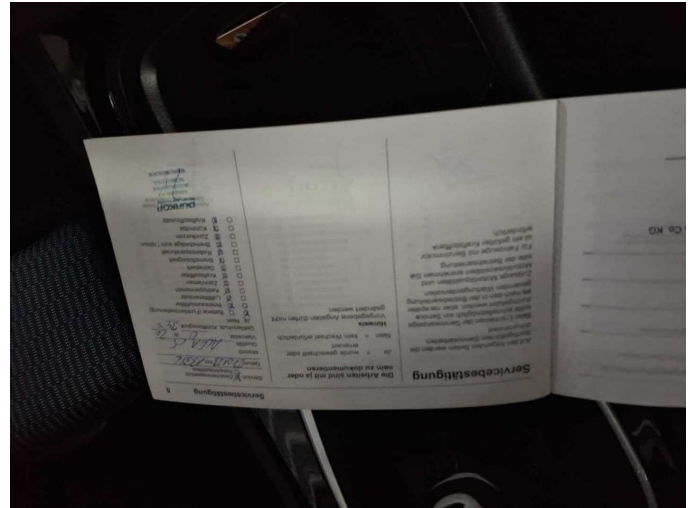


Figure 14: Documents

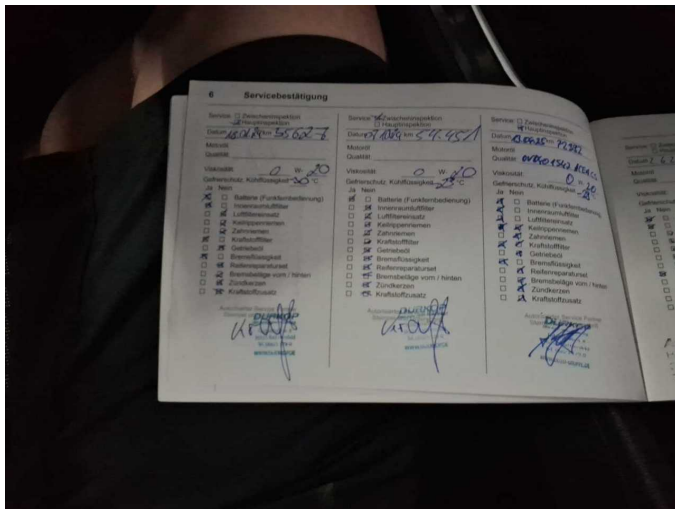


Figure 15: Documents

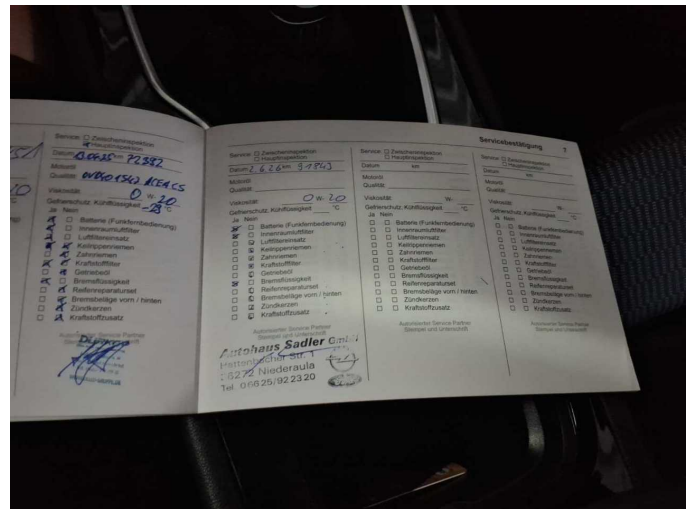


Figure 16: Documents



Figure 17: Documents

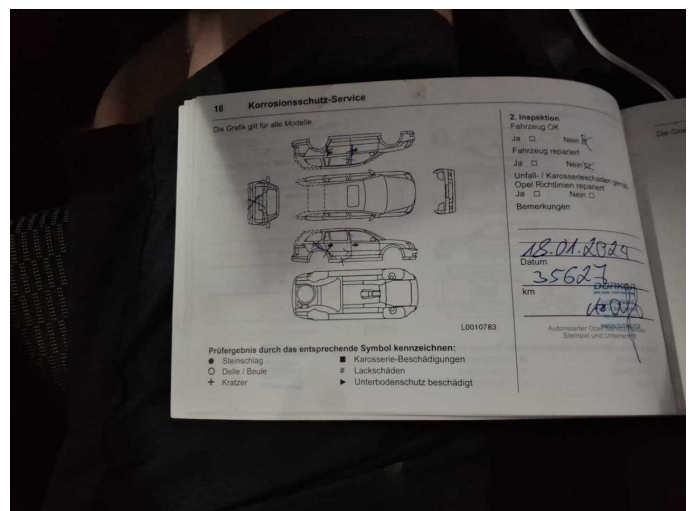


Figure 18: Documents

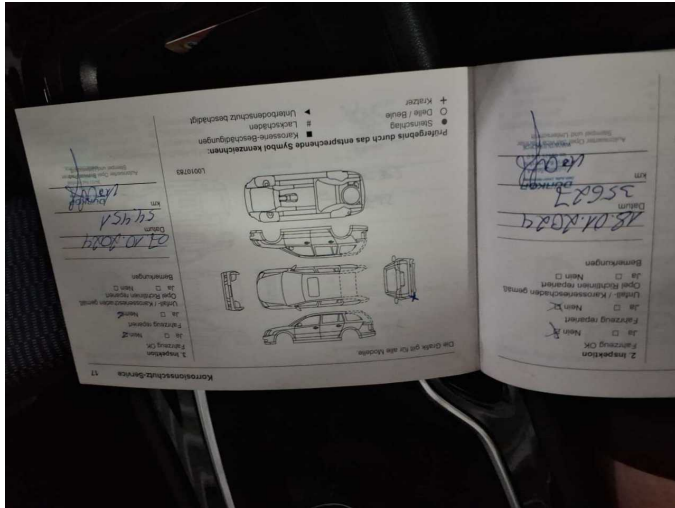


Figure 19: Documents

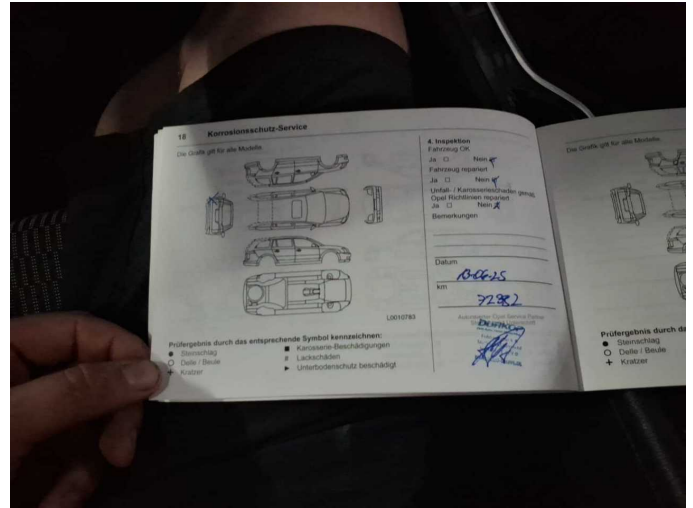


Figure 20: Documents

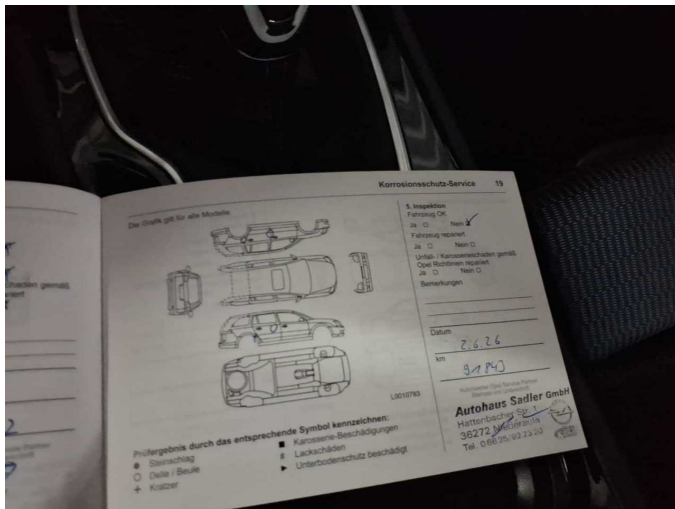


Figure 21: Documents

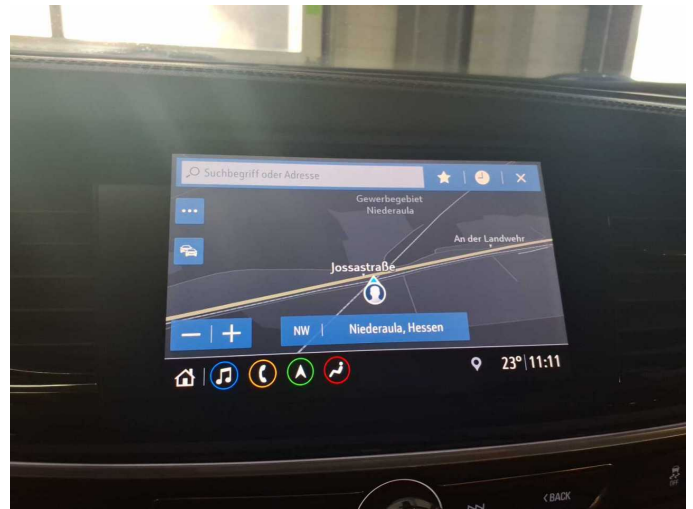


Figure 22: Navigation

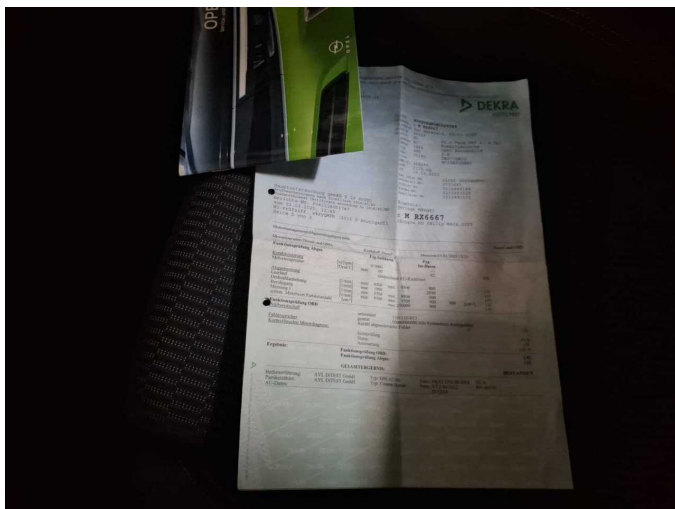


Figure 23: Misc.

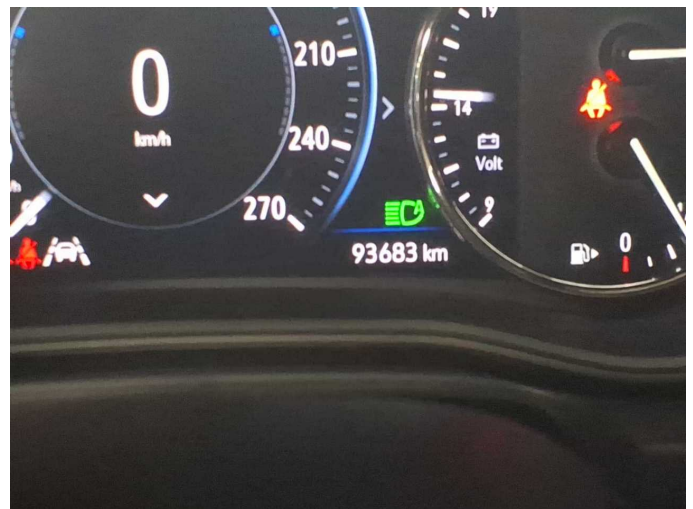


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

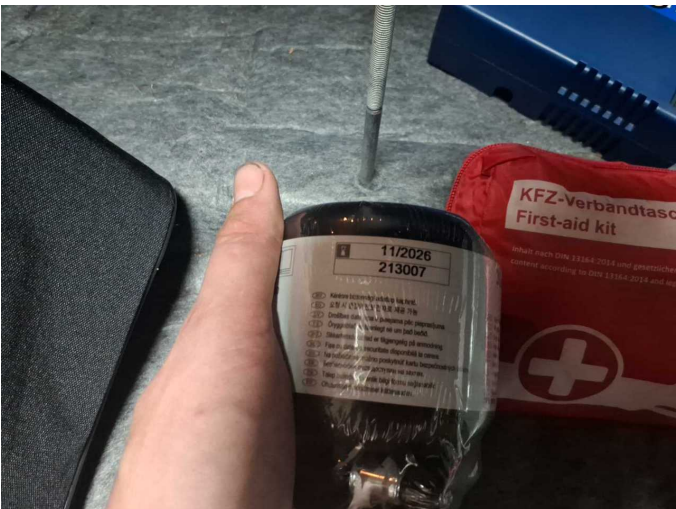


Figure 29: Misc.



Figure 30: Misc.

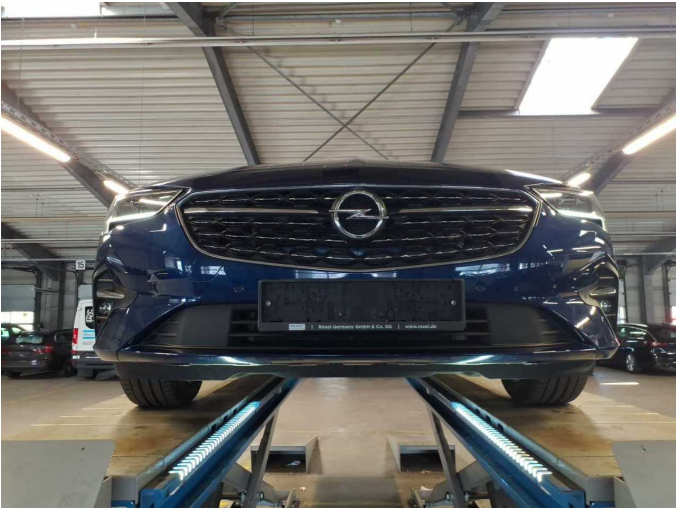


Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Damage 1: Trim / covers: Floor mats (Vorne links) - Holes - Replace



Damage 1: Trim / covers: Floor mats (Vorne links) - Holes - Replace



Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 4: Body: A-pillar - left side - Stone chips - Smart repair



Damage 4: Body: A-pillar - left side - Stone chips - Smart repair



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




Damage 6: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint




Damage 6: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint




Damage 6: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

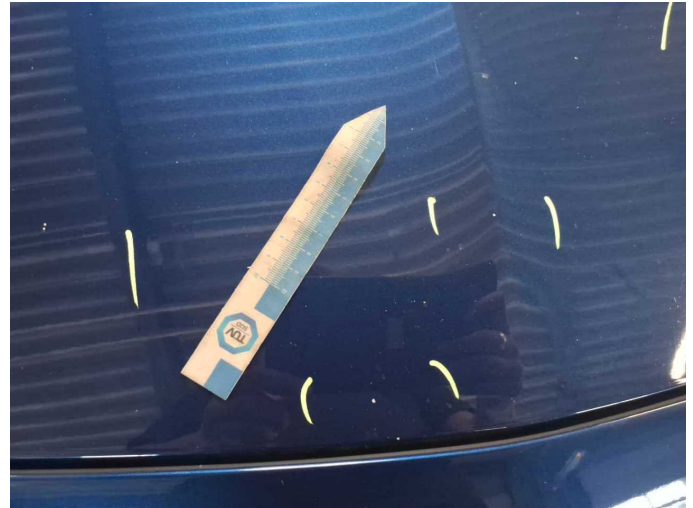


Damage 6: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

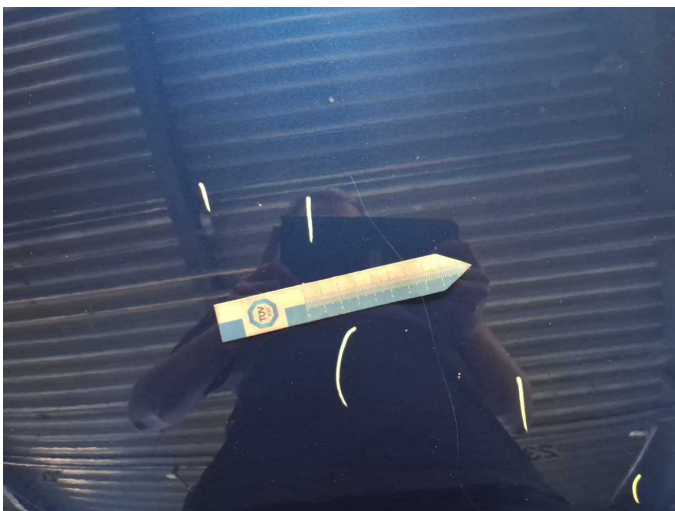


Damage 6: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

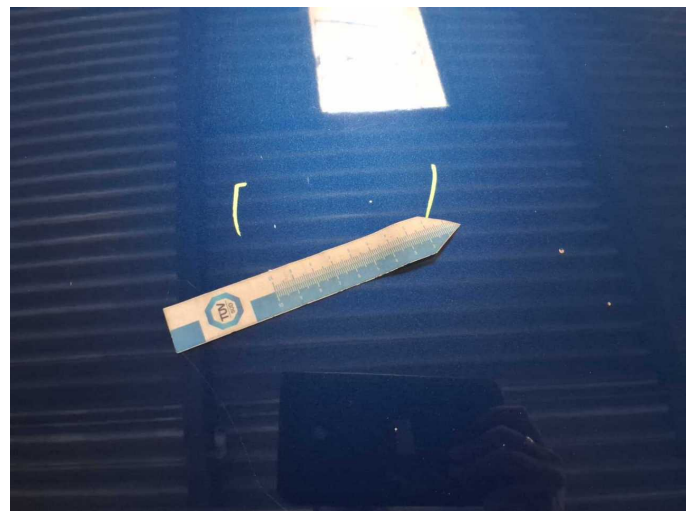

Damage 6: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

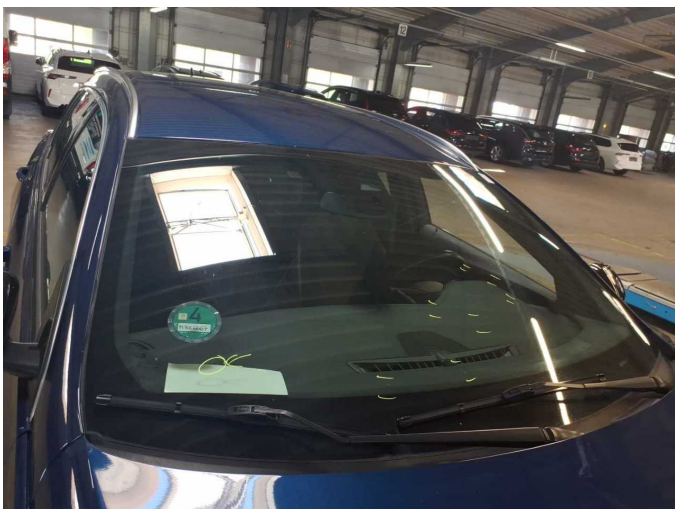

Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace

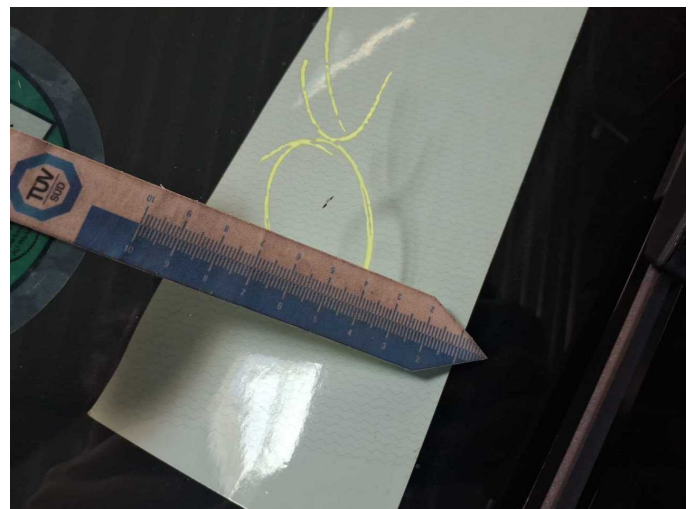

Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace




Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 1: Side panel - rear left side: Side panel - dent(s) - No deduction

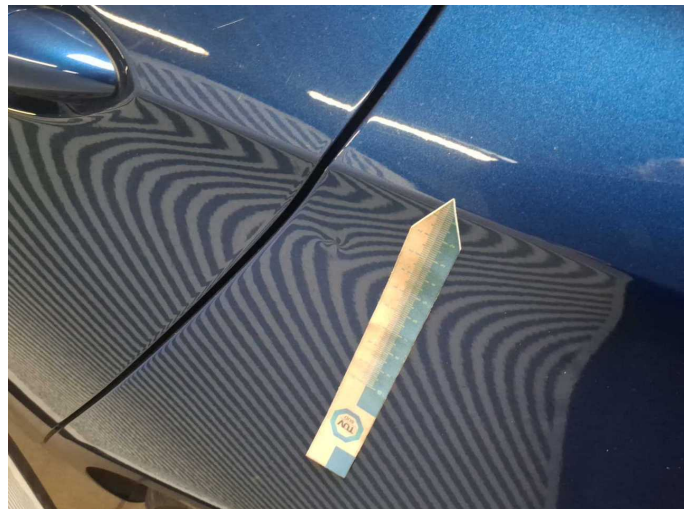

Wear and tear 1: Side panel - rear left side: Side panel - dent(s) - No deduction



Repainting 1: Door - rear right side



Repainting 1: Door - rear right side



Door - rear right side: 172 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZT8GN3M1029349

Hersteller / Modell: OPEL OPEL Insignia Sports Tourer 1.5 Diesel Business Edition

Datum	KM-Stand	Beschreibung
02.06.2026	91.843	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.07.2025	72.392	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.03.2025	66.019	HU + AU
15.10.2024	54.990	Systemtest/Eigendiagnose
08.10.2024	54.451	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.09.2024	52.584	Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten
18.01.2024	35.627	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.01.2023	13.382	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges