



Expertise

Protocol number: 45922080
Order No. / Reference: 26448910
Inspection date: 12 Jun 2026

Manufacturer: Mercedes-Benz
VIN: W1N4M1EB7PW294213

Model: GLB 220 d 8G-DCT AMG Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 220 d 8G-DCT AMG Line	
Vehicle Identification number	W1N4M1EB7PW294213
Mileage (Read)	110,568 km
First registration	17 Apr 2023
Number of holders	1
Power / Engine displacement	140 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Denim blue
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	214 Tag(e)
Last service on / at	01/2026 at 97,630 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS687991
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASE 00140		
Permitted total weight	2,195 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99W	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	235/50 R19 99W	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R18 98H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	215/60 R18 98H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- AMG floor mats
- AMG Styling
- Rear armrest
- Automatic passenger airbag deactivation
- On-board computer
- Brake assist
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Door sills with "Mercedes-Benz" lettering
- Chassis: Comfort chassis
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Headrests (2)
- Rear headrests (3)
- Paint finish: Solid
- Cargo area cover (roller blind)
- Steering column mechanically adjustable lengthwise and heightwise.
- Navigation accessories: Extended MBUX functions
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Tire pressure monitoring system (TPMS)
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4 in 5-twin-spoke design
- Seats: Rear seat backrests foldable
- 12V power outlet in center console
- High-visibility vest for drivers
- Decorative elements carbon structure
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- AMG sports pedal system
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Electronic Stability Program (ESP)
- Electric window regulators (4)
- Speed Limit Assistant
- Halogen headlights including integrated LED daytime running lights
- rear window wiper
- KEYLESS-GO start function
- Communication module (LTE) for the use of Mercedes me connect services
- Fuel tank with larger volume 60 l
- Loading floor height-adjustable and removable
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Package: Light and Visibility Package
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio accessories: Digital radio
- Rain and light sensor
- Remote Services Plus
- Windscreen wipers with rain sensor
- Power steering
- Seats: Sports seats
- Cruise control
- Immobiliser

Extra equipment

- Storage compartment in center console with roller blind (The roller blind for the storage compartment in the center console offers you an elegant privacy screen made of high-quality material. This looks good, the interior appears even tidier, and everything important is within easy reach. Typical everyday items such as a smartphone, wallet, or various keys fit into the practical storage compartment.)
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Parking assistant with PARKTRONIC - Preparation for live traffic information)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Steering Assist - Active Speed Limit Assist - Active Brake Assist with Cross-Traffic Function - Evasive Steering Assist - Active Blind Spot Assist - Active Lane Keeping Assist - Active Emergency Stop Assist - Route-Based Speed Adaptation - Extended Automatic Restart on Motorways)
- Package: Cargo area (12V socket - reversible mat - nets on the left and right sides (left net is omitted in conjunction with 3rd row of seats for 2 persons (847)) - open compartment under net on the left - tension straps on the left and right sides - chrome loading sill protector)
- Package: Parking package with 360° camera (Active Parking Assist including PARKTRONIC with visual and acoustic warnings of detected obstacles, notification of detected parking spaces in the instrument cluster via arrow display, convenient parking in and out of parallel and perpendicular parking spaces - 360° camera with four networked close-range cameras in the radiator grille, in the tailgate release handle and in the exterior mirror housings, displaying all four sides of the vehicle and visualizing the vehicle and its surroundings from a bird's-eye view in the multimedia system display)
- Package: Technology (brake system with larger brake discs on the front axle - adjustable damping - KEYLESS-GO - MULTIBEAM LED)
- Panoramic sunroof
- Heated windshield washer system
- Seats: Electrically adjustable driver's seat with memory function in conjunction with the mirror package (the memory programming includes all seat adjustment options such as seat height and fore/aft position, seat cushion tilt, and backrest tilt – exterior mirrors and the optional head-up display are also integrated – dynamic seating while driving. Small movements of the seat cushion and backrest in three programs and two speeds).
- Auxiliary heater (The auxiliary heater heats or ventilates the interior according to your preference even before you get in. A comfortable climate with clear windows at all times in winter, eliminating the stress and effort of defrosting. It's as if your car were parked in a garage instead of under a streetlamp – completely independent of a running engine.)
- TIREFIT with tire inflation compressor
- Type designation removed from luggage compartment lid
- Towbar with ESP trailer stabilization
- Door sill trims with Mercedes-Benz lettering, illuminated and with interchangeable cover
- Head-up display
- Black fabric headliner
- Paint finish: Metallic
- Steering: Direct steering
- Package: ENERGIZING Package Plus in conjunction with Business Package (Advanced sound system with 10 speakers and 225 watts system power - Heated seats for driver and front passenger - Ambient lighting - THERMOTRONIC automatic climate control - Freshness, vitality, training: video instructions - Tips: 3-minute audio information for the sustainable promotion of health and well-being in everyday life - for the body regions head, shoulders, upper body, lower back and pelvis - electrically adjustable lumbar support)
- Package: KEYLESS-GO Comfort (vehicle key with KEYLESS-GO functionality - KEYLESS-GO access and drive authorization system - start/stop button - comfort opening and closing - door handles with chrome inlay - HANDS-FREE ACCESS - handle recess lighting - remote trunk lid closing - EASY-PACK trunk lid)
- Package: MBUX High-End Package (Hard drive navigation - Smartphone integration - Wireless charging system for mobile devices - Preparation for digital key handover - Connectivity package navigation - Central Media Display 10.25" - Fully digital instrument display with high-resolution 10.25" display - MBUX Augmented Reality for navigation - Traffic sign assistant - Preparation for live traffic information)
- Package: Mirror package (Exterior mirrors electrically fold in and out via a button in the driver's door control panel - the menu allows you to set the exterior mirrors to fold in automatically when locking the vehicle and unfold again when unlocking - the exterior mirror on the driver's side and the interior mirror dim automatically and continuously depending on the incident glare and ambient light)
- Radio accessories: Advanced sound system
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Adjustable rear seats (A multi-talent - with the longitudinal adjustment of the rear seats, you can transform your vehicle in just a few moments from a small space miracle for rear passengers to a compact premium transporter. If required, you can slide the entire rear bench seat forward by up to 90 millimeters and back by 50 millimeters.)
- Seats: Front right seat electrically adjustable with memory function (memory programming with seat adjustment options such as height and longitudinal direction, seat cushion tilt and backrest tilt - Motion Seating with three programs and two speeds)
- Phone accessories: Wireless charging system for mobile devices
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)



- Heat-insulating dark tinted glass

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Mudguard - left side	Wheel well extension (3 mm Spalt zwischen Kotflügel und Radlauf) - Loose - Diagnosed and repair if necessary
2	Mudguard - right side	Wheel well extension (4 mm Spalt zwischen Kotflügel und Radlauf) - Loose - Diagnosed and repair if necessary
3	Front bumper	Spoiler (Zierleiste re) - Broken / torn - Replace
4	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Door - rear right side	Door - dent(s) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 4 May 2026	1.697,65 €
2	Front, Provided by user / customer, from 15 Jan 2025	9.735,77 €

Repainting

No.	Repainting
1	Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	35 µm	Mudguard - left side	163 µm
Mudguard - right side	174 µm	Bonnet	166 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

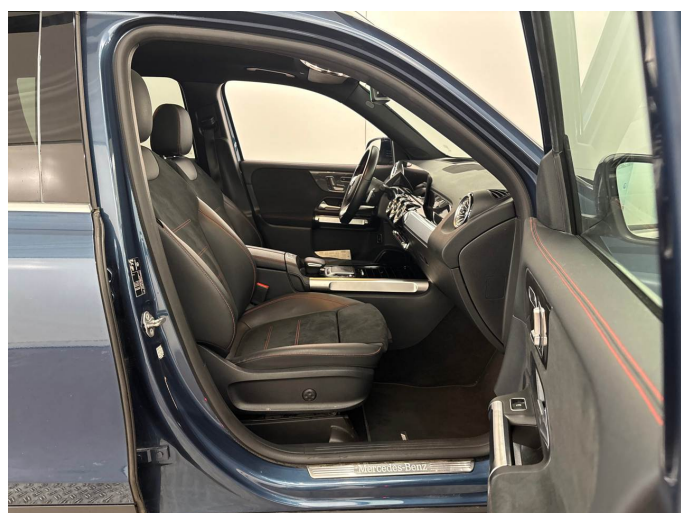


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

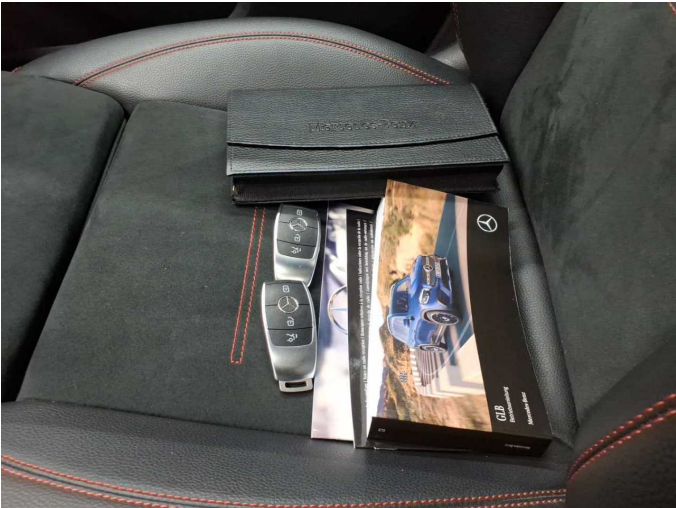


Figure 13: Documents

Servicehistorie			
Mercedes-Benz			
Mercedes-Benz	Felix Kloz GmbH Zuffenhauser Straße 95 Korntal-Münchingen	Datum Laufleistung Service	09.01.2026 97630 km Service B
Mercedes-Benz	Felix Kloz GmbH Zuffenhauser Straße 95 Korntal-Münchingen	Datum Laufleistung Service	12.03.2025 73152 km Service A
Mercedes-Benz	Felix Kloz GmbH Zuffenhauser Straße 95 Korntal-Münchingen	Datum Laufleistung Service	03.07.2024 48438 km Service B
Mercedes-Benz	Felix Kloz GmbH Zuffenhauser Straße 95 Korntal-Münchingen	Datum Laufleistung Service	16.10.2023 21950 km Service A

Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

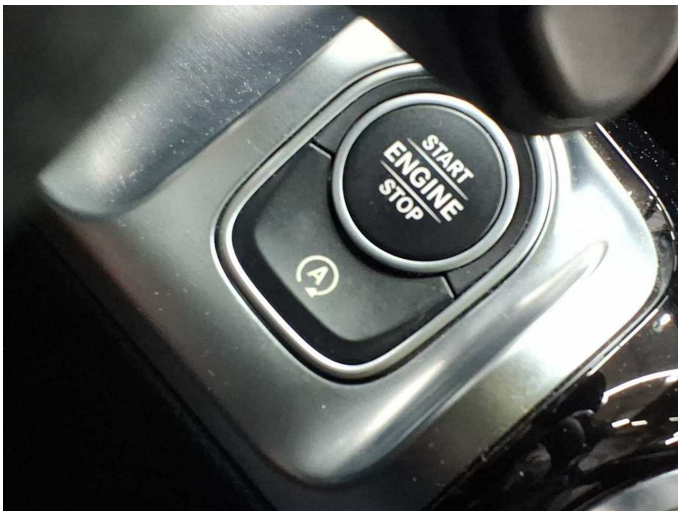


Figure 21: Misc.

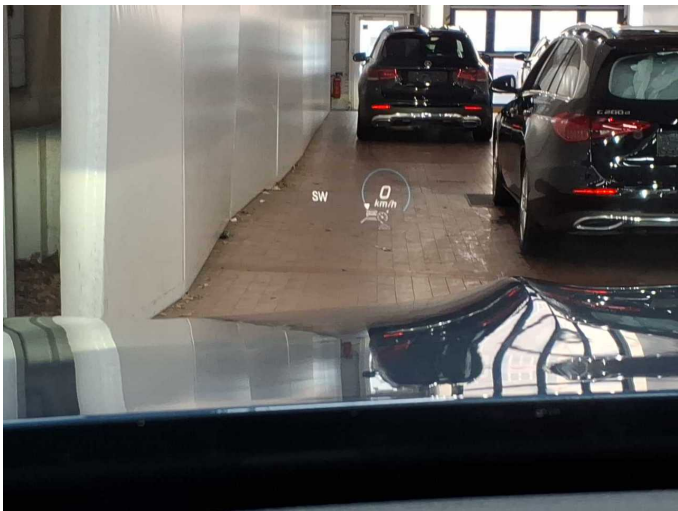


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

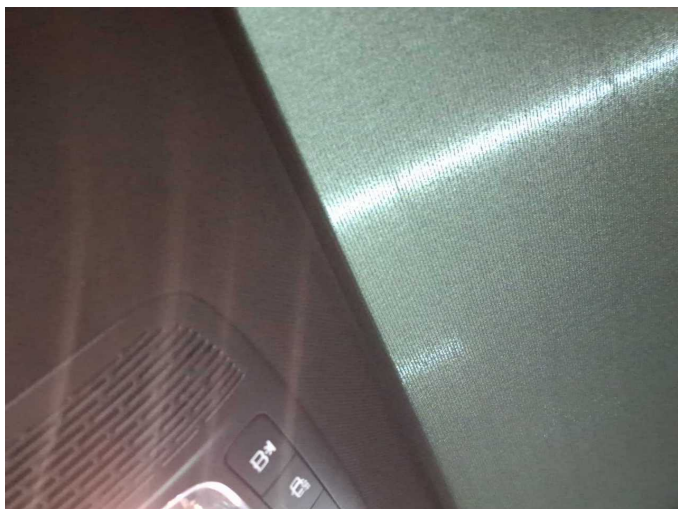


Figure 25: Misc.

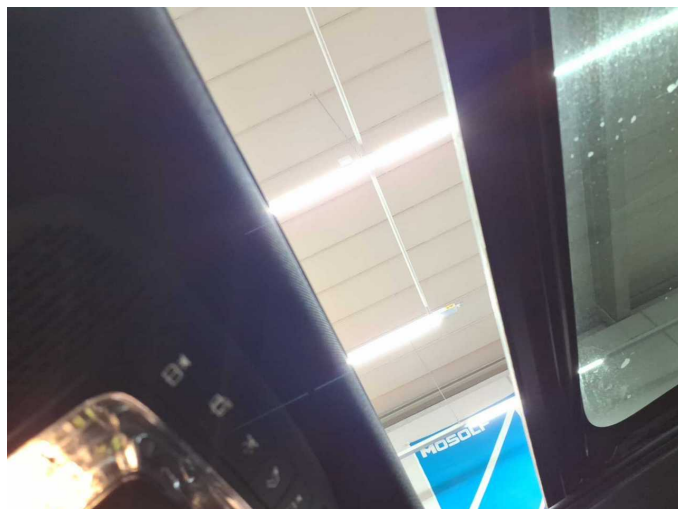


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

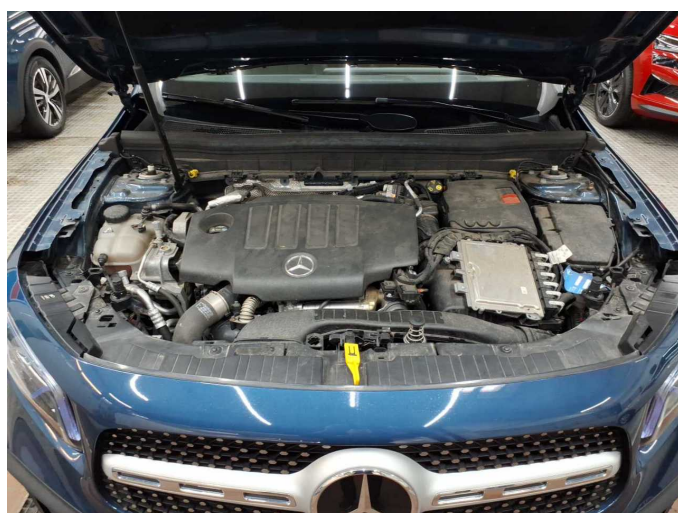


Figure 30: Misc.

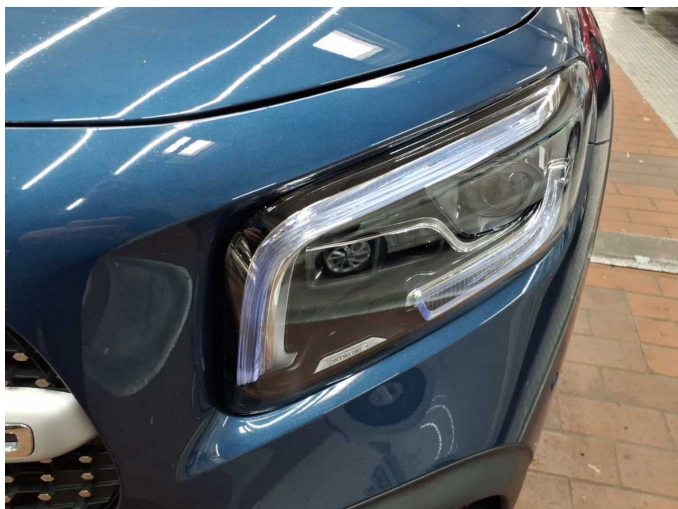


Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.


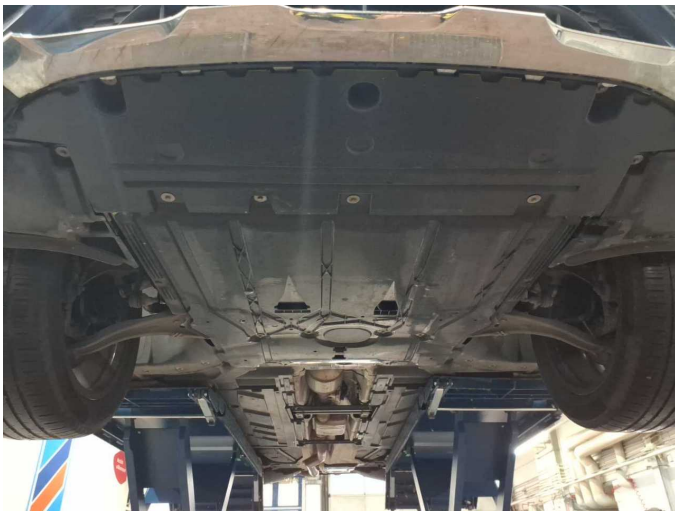



Figure 39: Misc.



Damage 1: Mudguard - left side: Wheel well extension (3 mm Spalt zwischen Kotflügel und Radlauf) - Loose - Diagnosed and repair if necessary

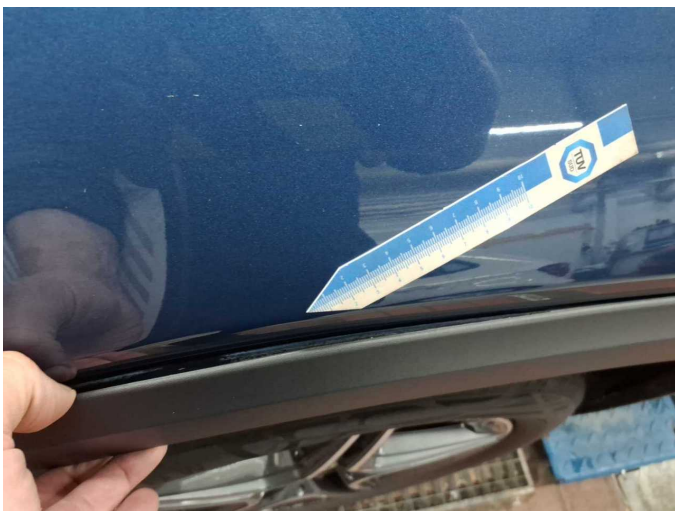

Damage 1: Mudguard - left side: Wheel well extension (3 mm Spalt zwischen Kotflügel und Radlauf) - Loose - Diagnosed and repair if necessary

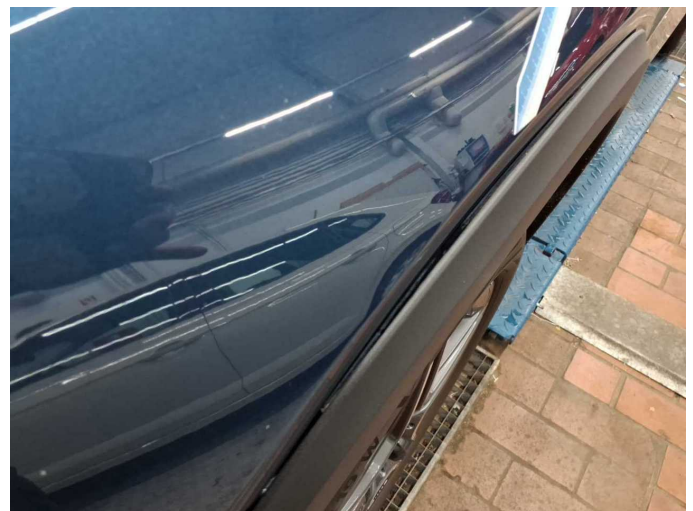

Damage 1: Mudguard - left side: Wheel well extension (3 mm Spalt zwischen Kotflügel und Radlauf) - Loose - Diagnosed and repair if necessary



Damage 2: Mudguard - right side: Wheel well extension (4 mm Spalt zwischen Kotflügel und Radlauf) - Loose - Diagnosed and repair if necessary



Damage 2: Mudguard - right side: Wheel well extension (4 mm Spalt zwischen Kotflügel und Radlauf) - Loose - Diagnosed and repair if necessary



Damage 3: Front bumper: Spoiler (Zierleiste re) - Broken / torn - Replace




Damage 3: Front bumper: Spoiler (Zierleiste re) - Broken / torn - Replace



Damage 3: Front bumper: Spoiler (Zierleiste re) - Broken / torn - Replace




Damage 3: Front bumper: Spoiler (Zierleiste re) - Broken / torn - Replace

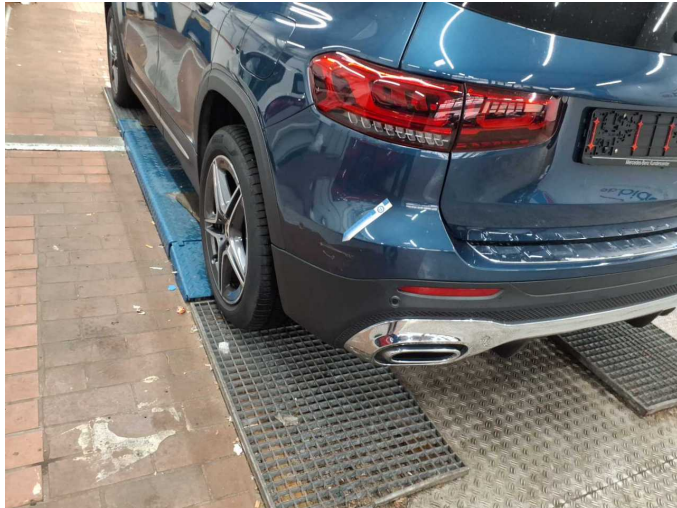

Damage 4: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 4: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

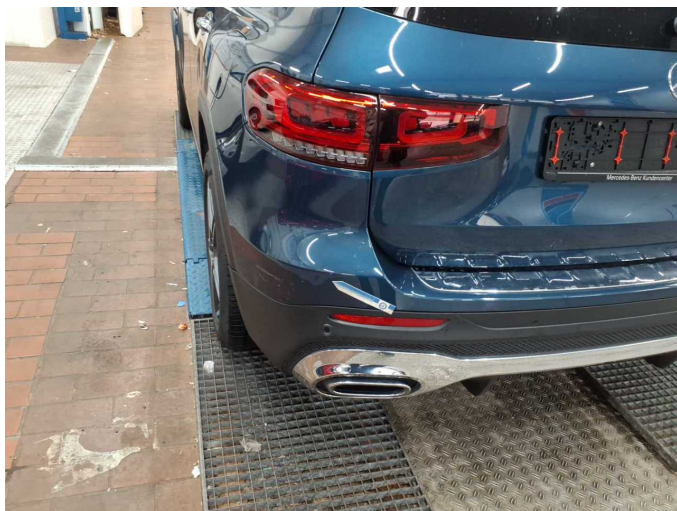

Damage 4: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 4: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

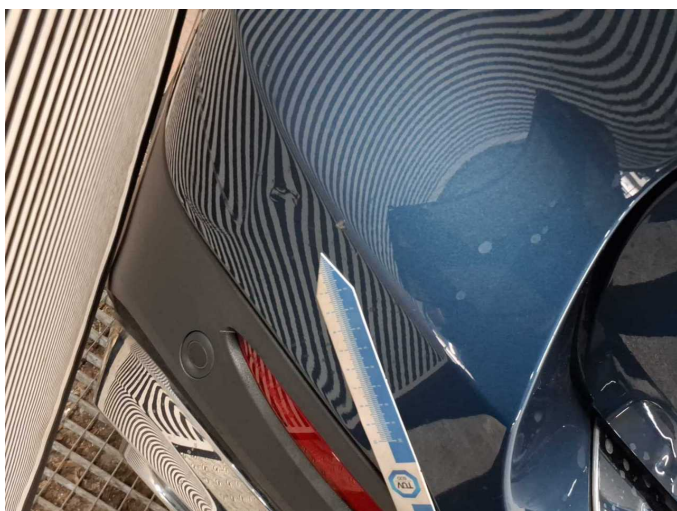

Damage 4: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet



Repainting 1: Boot lid / rear door, Mudguard - left side, Mudguard - right side, Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N4M1EB7PW294213

Hersteller / Modell: MERCEDES-BENZ MB GLB 220 d 8G-DCT AMG Line

Datum	KM-Stand	Beschreibung
11.05.2026	93.971	Systemtest/Eigendiagnose
19.03.2026	105.663	Reparatur Sonstiges; Systemtest/Eigendiagnose
09.01.2026	97.630	Regelwartungsdienst
18.10.2024	59.340	Bremsscheiben vorne
03.07.2024	48.438	Regelwartungsdienst
16.10.2023	21.955	Regelwartungsdienst