



Expertise

Protocol number: 46409667
Order No. / Reference: 26618904
Inspection date: 9 Jul 2026

Manufacturer: Volkswagen

Model: ID.4 4Motion GTX

VIN: WVGZZZE2ZNP063990



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.4 4Motion GTX	
Vehicle Identification number	WVGZZZE2ZNP063990
Mileage (Read)	51,354 km
First registration	21 Sept 2022
Number of holders	1
Power / Engine displacement	77 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Scala Silver Metallic / Dach Schwarz
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	66 Tag(e)
Last service on / at	09/2024 at 33,958 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM680315
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CLR 00017		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,750 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 100T	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	235/50 R20 100T	Summer tyres on Light alloy	Pirelli	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/50 R19 103T	Winter tyres on Steel	Bridgestone	5mm / 5mm
2)	255/50 R19 103T	Winter tyres on Steel	Bridgestone	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 USB-C ports at the front, 2 USB-C charging ports at the rear of the center console
- Airbags: Front and rear head airbags, front side airbags, center airbag
- 30-color ambient lighting
- Adaptive Cruise Control (ACC) "stop & go" including speed limiter
- Car2X
- e-Sound
- Parking assistance
- ESP Electronic Stability Program
- Windscreen made of laminated safety glass
- Back window, heater
- Interior mirror automatically dimming
- Air conditioning system "Air Care Climatronic"
- Paint finish: Metallic, different roof color
- Charging: 11 kW AC charging power (alternating current)
- LED matrix headlights - IQ.LIGHT
- The strip between the headlights is illuminated.
- Makeup mirrors in the sun visors
- Variable center console
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Upholstery: Seat center panels of the front seats and the outer rear seats in "GTX" fabric
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- LED taillights: 3D LED taillights with dynamic turn signals
- Windows: Rear side windows and rear window tinted
- Keyless Start system
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Heated front seats
- Seats: Front seats with height adjustment
- Lane keeping assistant "Lane Assist"
- Telephone interface
- Ambient lighting with logo projection
- Traffic sign recognition
- Central locking including remote control
- Turning brake function and evasive steering support
- Airbag for driver and front passenger, with front passenger airbag deactivation
- Permanent 4MOTION all-wheel drive
- App-Connect Wireless for Apple CarPlay and Android Auto
- Electrically adjustable, folding and heated exterior mirrors
- third brake light
- black roof rails
- Black surround for the infotainment display and central controls
- Driving profile selection
- Transmission: 1-speed automatic
- rear window wiper
- ISOFIX mounting points for child car seats
- Front and rear headrests (5)
- Mode 3 Type 2 charging cable, 16 A
- Charging: Maximum DC charging power depends on the traction battery.
- Steering wheel: Multifunction leather steering wheel, heated, with touch controls
- Fatigue detection
- Emergency call service
- Stainless steel pedals in a "Play/Pause" design
- Radio "Ready 2 Discover"
- Radio accessories: 6 + 1 speakers
- Rain sensor
- Wheels: "Ystad" alloy wheels 8 J x 20 front, 9 J x 20 rear, in black, polished finish
- Front windshield washer nozzles automatically heated
- electromechanical power steering
- Seats: Armrest for front seats
- Seats: Rear seat backrest asymmetrically split and foldable, with pass-through and center armrest
- Voice control
- Bumpers in a sporty design
- Engine underguard
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer



Extra equipment

- Charging cable: Mains charging cable for household socket
- Package: Design Package "Plus" (3D LED taillights with dynamic turn signals - Dynamic Light Assist high beam control for LED matrix headlights - IQ.LIGHT - LED matrix headlights with automatic headlight control, bad weather light, welcome function - Illuminated strip between the headlights - Panoramic roof - Laminated safety glass for front side windows; tinted rear window and rear side windows)
- Package: Infotainment package "Plus" (Head-up display - Navigation system "Discover Pro" - Radio "Ready 2 Discover Max" - Telephone interface "Comfort" with inductive charging function - Sound system, 6 speakers, digital 12-channel amplifier, subwoofer, 450 watts total power)
- Package: Sport package "Plus" (Adaptive chassis control DCC incl. driving profile selection - progressive steering)
- Textile floor mats front and rear
- Heat pump for range optimization
- Package: Assistance Package "Plus" incl. "IQ.DRIVE" with "Travel Assist" (GTX) (Easy Open & Close - tailgate with sensor-controlled opening and closing, with remote control, Adaptive Cruise Control (ACC) stop&go, speed limiter, anti-theft alarm with interior monitoring and towing, Travel Assist, Lane Assist and Emergency Assist, illuminated strip between the headlights and door handle recesses, memory radio for Park Assist, Park Assist Proactive, occupant protection, keyless entry and start system, Keyless Access with Safe-Side, Lane Change Assist, Side Assist, Area View including Rear View camera)
- Package: Comfort Package "Plus" (2 USB-C ports in front, 2 USB-C charging sockets in rear center console - Windscreen in laminated safety glass, wirelessly heated and infrared-reflecting, noise-insulating - Luggage net - Luggage compartment floor - Air Care Climatronic with active combination filter and 3-zone temperature control - Variable center console - Leather multifunction steering wheel, heated, with touch controls - Cargo net partition - Without headlight cleaning system with washer fluid level indicator - Rain sensor - Automatically heated windscreen washer nozzles - Heated front seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Body	Body - Glued / labelled - De-glue / neutralise

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 18 Feb 2023	879,46 €

Accident damages

No. Accident

1 Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Wartungshistorie gemäß Auftraggeber Informationen.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

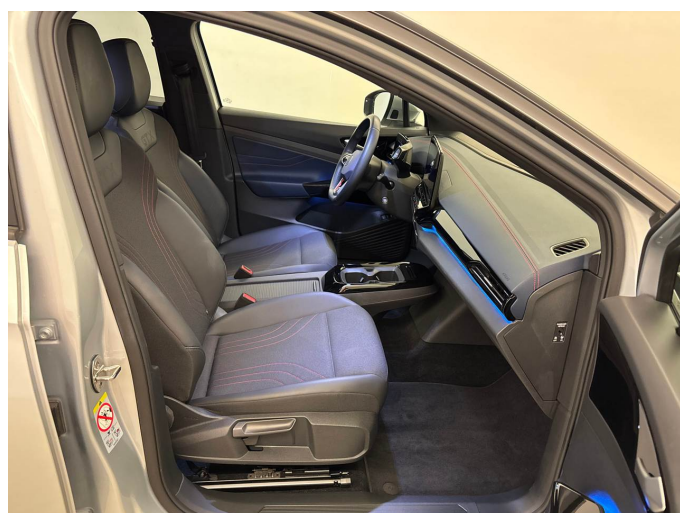


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

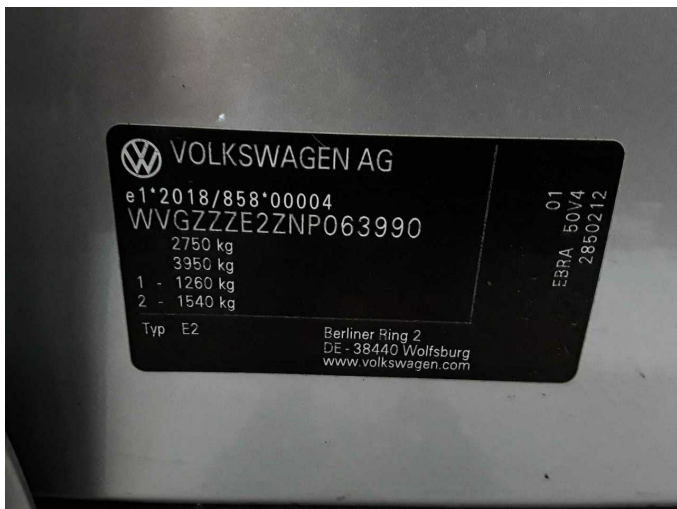


Figure 11: VIN



Figure 12: Mounted tyres

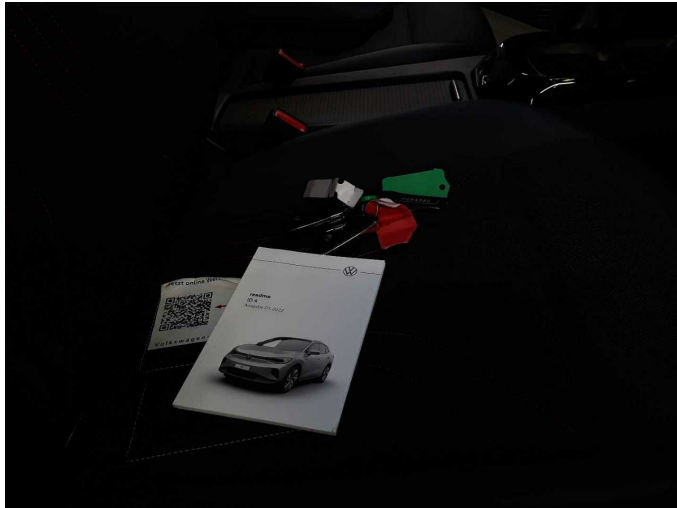


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

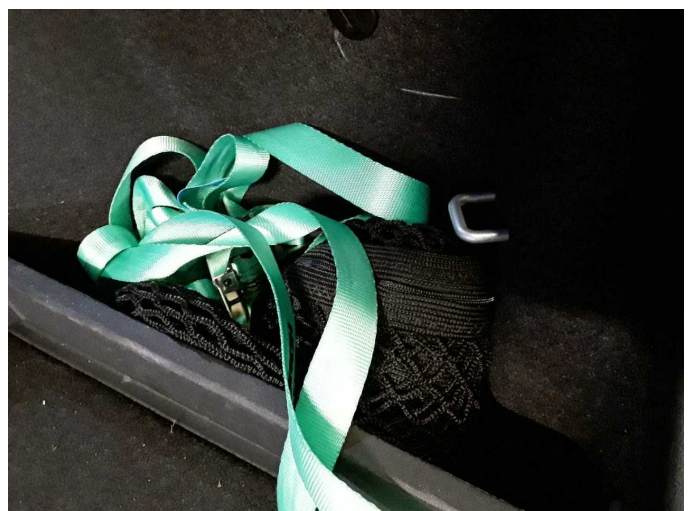


Figure 18: Misc.



Figure 19: Misc.

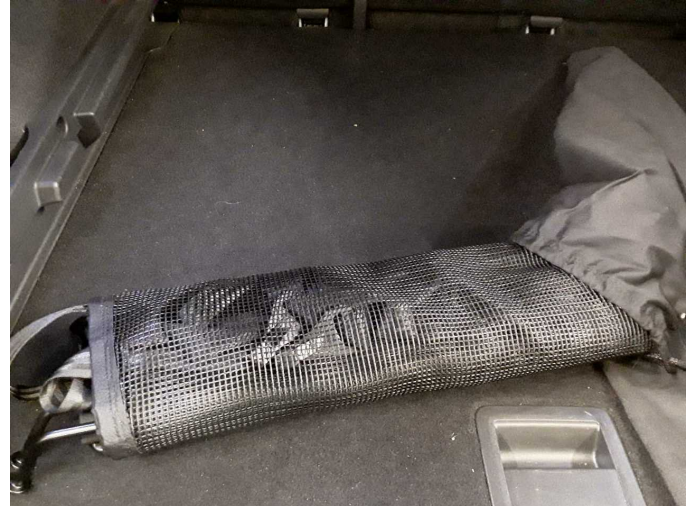


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

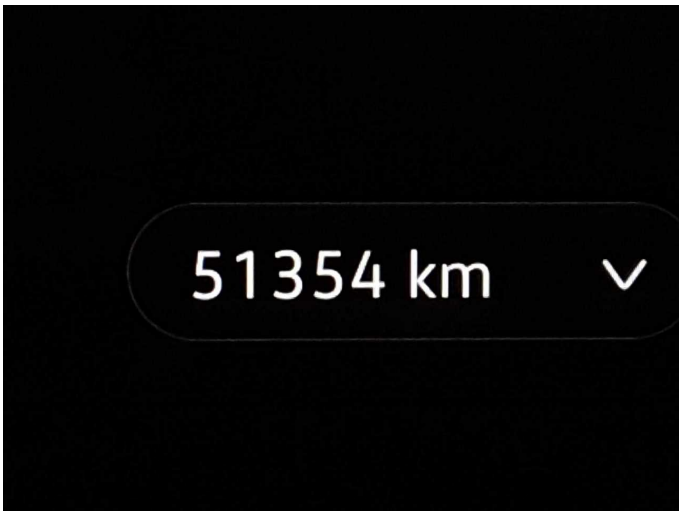



Figure 28: Misc.



Figure 29: Misc.



Damage 2: Body: Body - Glued / labelled - De-glue / neutralise

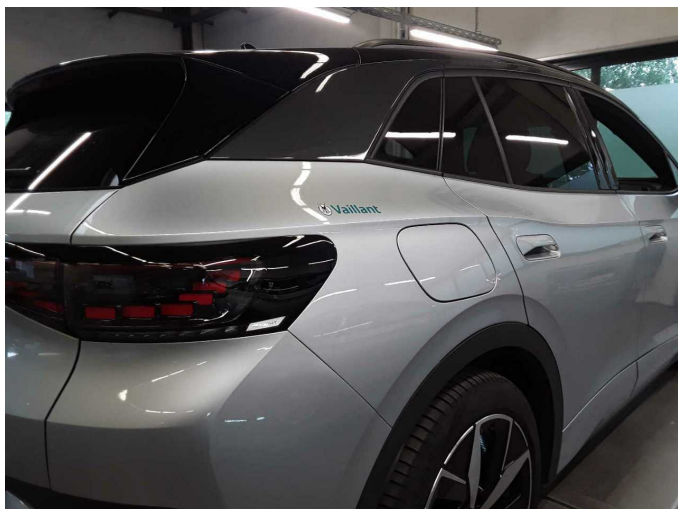

Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZE2ZNP063990

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN ID.4 GTX

Datum	KM-Stand	Beschreibung
02.12.2025	48.125	Reparatur Sonstiges; Systemtest/Eigendiagnose
26.05.2025	39.903	Klimaanlage inst.; Reparatur Sonstiges; Systemtest/Eigendiagnose
23.05.2025	39.903	Reparatur Sonstiges; Systemtest/Eigendiagnose
13.09.2024	33.958	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst