



Expertise

Protocol number: 46545144
Order No. / Reference: 26640190
Inspection date: 14 Jul 2026

Manufacturer: Volkswagen

Model: Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

VIN: WVVZZZ3CZME090970



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE	
Vehicle Identification number	WVVZZZ3CZME090970
Mileage (Read)	170,074 km
First registration	10 Mar 2021
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Blue
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	12,700 km
Last service on / at	06/2026 at 169,264 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA733373
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BRZ 00071		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94W	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	215/55 R17 94W	Summer tyres on Light alloy	unterschiedliche Hersteller	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Continental	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger (airbag deactivation switch on the passenger side)
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go", including speed limiter
- Electrically adjustable and heated exterior mirrors (driver's side aspherical)
- third brake light
- black roof rails
- Electronic parking brake including auto-hold function
- Electronic stability program and electromechanical brake booster
- Pedestrian detection
- Adjustable luggage compartment floor
- Interior lights front and rear with delayed shut-off and dimming function (2 reading lights at the front)
- Air conditioning system "Air Care Climatronic" with 3-zone temperature control and allergen filter
- Rear headrests (3)
- Front headrests (safety-optimized)
- LED headlights with daytime running lights
- Headlight range control
- Makeup mirrors in the sun visors
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Navigation system "Discover Media" incl. "Streaming & Internet" (4x20 watts, user interface with proximity sensor, dual tuner with phase diversity, vehicle menu, speed, volume adjustment, map, 2D display, tone control, 3-way TFT display with touchscreen operation, navigation "Discover Media" incl. "Streaming & Internet", MP3 radio, telephone contact addresses for navigation, telephone interface, 2 USB ports also for iPod/iPhone, traffic sign recognition "VW Media Control", We Connect Plus, 3 years, incl. We Connect route guidance, dynamic RDS, TMC tuner)
- Package: Light and Sight Package "Plus" (LED lights in the front footwell - Electrically adjustable and heated exterior mirrors, automatically dimming on the driver's side - Entry/warning lights in the front doors, in LED technology - Automatic headlight control, with daytime running lights, "Leaving Home" function and manual "Coming Home" function - Interior light with delayed shut-off and dimming function, 2 LED reading lights each in the front and rear - Automatically dimming interior mirror - Illuminated vanity mirrors - Extendable sun visors - Rain sensor)
- Tire pressure monitoring system (passive)
- Wheels: 4 "Montpellier" alloy wheels 7 J x 17 (rolling resistance optimized - AirStop tires 215/55 R 17 - wheel locks with enhanced theft protection)
- LED taillights
- Rear bench seat undivided, backrest asymmetrically split and foldable, with center armrest (and pass-through option)
- Seats: Front seats are height-adjustable
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- App-Connect Wireless (Volkswagen offers three interfaces for connecting smartphones with numerous possibilities: - Apple CarPlay - Android Auto from Google - MirrorLink)
- Cup holders (2) front
- Hill start assist
- Headliner in Mistral Grey
- Parking aid - warning signals for obstacles in the front and rear area
- Remote release for luggage compartment lid
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 6-speed DSG (6-speed dual-clutch transmission DSG)
- ISOFIX mounting points (for attaching 2 child seats to the rear seats, also for i-Size child seats)
- Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer
- LED taillights
- Steering wheel: Multifunction sports steering wheel in leather, with paddle shifters (gearshift knob in leather)
- Multifunction display "Premium" with multi-color display (showing, among other things: - Outside temperature - Average consumption - Average speed - Trip distance - Trip time - Gear recommendation - Speed warning - Comfort - Current consumption - Range - Service - Time with extended display options, e.g.: - Digital speedometer - Digital oil temperature display - Lights & visibility - Language - Auxiliary heater - Winter tires)
- Mesh partition
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Fabric "Weave" (center panels of the front seats and outer rear seats in fabric "Weave")
- Proactive occupant protection system in conjunction with "Front Assist" (detects critical traffic situations with increased accident potential - prepares vehicle occupants and the vehicle for a possible accident by tightening the front, fastened seat belts and securing the driver and front passenger, and closing open windows and the sunroof except for a gap)
- Radio accessories: Digital radio reception DAB+ (reception of digitally broadcast radio stations and traffic information in addition to the analog station offering - reception depends on the local availability of digital networks - expanded range of radio programs - improved reception performance)
- Keyless start system without safe locking
- Power steering (electromechanical, speed-dependent)



- Start-stop system (with brake energy recuperation)
- 12V power outlet on the rear of the center console
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Black trim strips on the side windows

Extra equipment

- Towbar, foldable (with electric release)
- Paint finish: Pearl effect
- Package: "Business Premium" package incl. navigation (from Business trim level) (2 USB-C ports in the front, 1 USB-C charging port in the rear, 230V socket, App-Connect incl. wireless, Apple CarPlay, Android Auto, "Travel Assist" driver assistance system and "Lane Assist" lane keeping system, Air Care Climatronic with 3-zone temperature control, allergen filter and rear controls, lumbar support in the front, electric on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)

- Seat belts: Three-point automatic seat belt (seat belt for middle rear seat - seat belts for outer rear seats - front seat belts with height adjustment and belt tensioner)
- Bumpers in body color
- Textile floor mats (front and rear)
- Warning tone and light for unfastened seat belts front and rear

- Cable for AC charging station (incl. standard mains charging cable for household socket)
- Wheels: Tire Mobility Set omitted
- Seats: ergoComfort seat with 14-way electric adjustment, memory and massage on driver's side in conjunction with Business Package (electrically folding exterior mirrors, auto-dimming on driver's side, ambient lighting and memory - electrically adjustable lumbar support in front, massage function on driver's side - electrically adjustable front seats, ergoComfort seat on driver's side, with memory function and comfort entry)
- "Comfort" telephone interface with inductive charging function (hands-free system)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - Smart repair
2	Boot lid / rear door	Boot lid - dent(s) - Smart repair
3	Door - rear left side	Door - dent(s) - Smart repair
4	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
5	Front bumper	Spoiler - Scratched - Smart repair
6	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
7	Door - rear right side	Door - Scratch(es) - Paint
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Bonnet	Bonnet - Dent / paintcoat damage - Paint
10	Vehicle glazing	Windscreen - Broken / torn - Replace



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

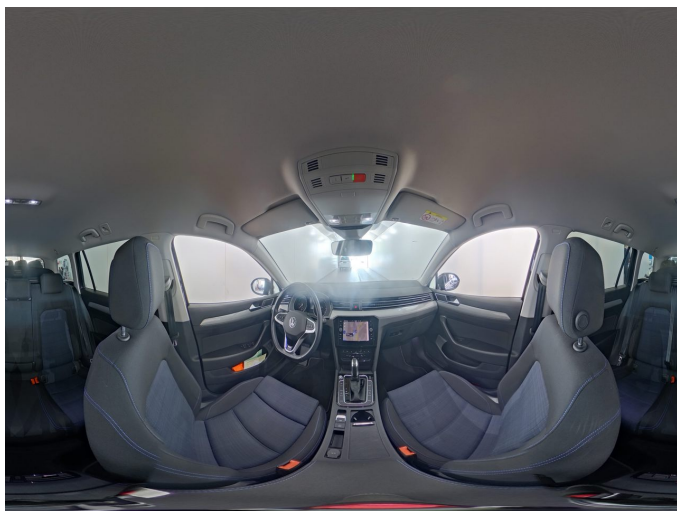


Figure 9: Interior 360° view



Figure 10: Cargo area

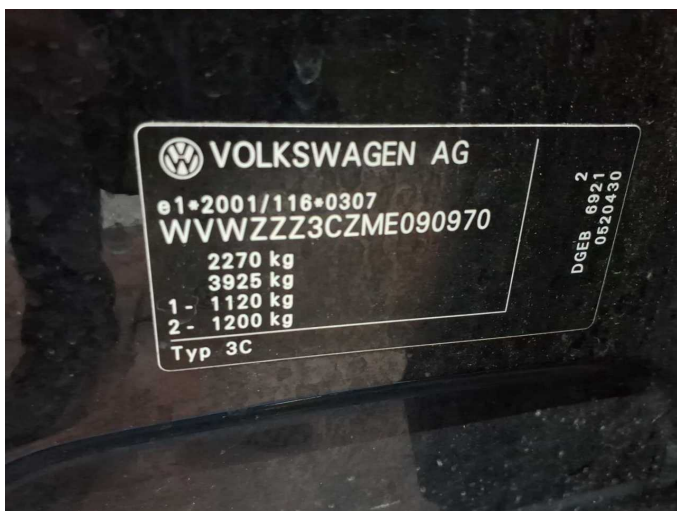


Figure 11: VIN



Figure 12: Mounted tyres

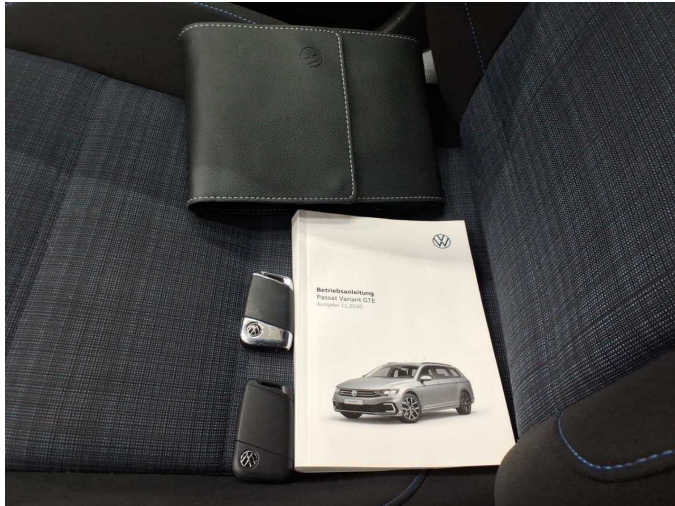


Figure 13: Documents

18 Bericht

(1) Fz-Id.Nr.: **WWWZZZ3CZME090970**

(2) Amtl. Kennz.: **VS FN223E (D)**

(3) Ausstellungsdatum: 02.04.2026 11:06 Uhr

Prüfart: 92637 Weiden i.d.OPf.

(4) km-Stand: 160266 km

(5) Klasse: Fz z. Pers. bef. b. 8 Spl.

Aufbau: Kombilimousine

Hersteller: VOLKSWAGEN-VW

Typ: 3C

Var./Ver./Ausf.: ACDGEBX0 / FD6FD6DD001PH4BIVR21AA00

Antriebsart: Hybr. B/E ext. Aufl.

Emissionsschl: EURO6/VL TP/AP/PI/CI/ M.

zGM: 2270 kg

Letzte HU: 03.2024

Kundenkennzeichen: FSD.HU/Mangel:

M1
AC
0603
BRZ00071
0025
36AP
EZ: 10.03.2021
4.28.10.6/2.0.22

Seite 1 von 1

Prüfbescheinigung nach Richtlinie 2014/45/EU
Roadworthiness certificate according to Directive 2014/45/EU

(8) Nächste HU
April 2028

Prüfplakette
zugeteilt

Figure 14: Documents

Volkswagen
Service-Nachweis

Kumpfleistungscheck

Prüfungstermin: WWWZZZ3CZME090970

Fahrzeugtyp: PASSAT 1.8 TSI 150 kW

Fahrzeugnummer: 2021-03-12

Datum der Ausfertigung: 2026-04-06

Ölwechsel Service

Datum: 169264 km

Laufleistung: 202105078

Auftragnummer: Moschak

Durchgeführt von: Obere Bauscherstraße 16

92637 Weiden

Deutschland

Ja

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Bis Anzeigedatum, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Inspektion mit Ölwechsel

Datum: 2026-02-04

Laufleistung: 152728 km

Auftragnummer: 2026100828

Durchgeführt von: Moschak

Obere Bauscherstraße 16

92637 Weiden

Deutschland

Ja

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Bis Anzeigedatum, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Figure 15: Documents

Volkswagen
Service-Nachweis

Ölwechsel-Service

Datum: 2025-10-06

Laufleistung: 119994 km

Auftragnummer: 2025107228

Durchgeführt von: Moschak

Obere Bauscherstraße 16

92637 Weiden

Deutschland

Ja

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Bis Anzeigedatum, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Inspektion mit Ölwechsel

Datum: 2025-04-06

Laufleistung: 120227 km

Auftragnummer: 2025105029

Durchgeführte Zusatzarbeiten: ☒ Brennpflege Service

☒ Gensetöl

☒ Stocher-Pollenfilter

Durchgeführt von: Moschak

Obere Bauscherstraße 16

92637 Weiden

Deutschland

Ja

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Bis Anzeigedatum, bei allen Fahrzeugen mit individuellen Konditionen bis Laufzeitende

Ölwechsel-Service

Datum: 2024-11-12

Laufleistung: 103592 km

Auftragnummer: 402205

Durchgeführt von: Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetrieb nur enthalten, soweit der Servicebetrieb auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.

Figure 16: Documents

Volkswagen
Service-Nachweis

Eintragung der Werkstatt

Datum: 2024-11-12

Laufleistung: 103592 km

Durchgeführt von: Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetrieb nur enthalten, soweit der Servicebetrieb auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Ja

Inspektion mit Ölwechsel

Datum: 2024-05-14

Laufleistung: 90385 km

Auftragnummer: 24418

Durchgeführte Zusatzarbeiten: ☒ Luftfilterwechsel

Durchgeführt von: Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetrieb nur enthalten, soweit der Servicebetrieb auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Ja

Ölwechsel-Service

Datum: 2023-08-05

Laufleistung: 75691 km

Auftragnummer: 4197

Durchgeführt von: Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetrieb nur enthalten, soweit der Servicebetrieb auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Ja

Figure 17: Documents

Volkswagen
Service-Nachweis

Inspektion mit Ölwechsel

Datum: 2023-01-20

Laufleistung: 59688 km

Auftragnummer: 30305

Durchgeführte Zusatzarbeiten: ☒ Brennpflege Service

☒ Gensetöl

☒ Stocher-Pollenfilter

☒ Zündkerze

Durchgeführt von: Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetrieb nur enthalten, soweit der Servicebetrieb auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Ja

Ölwechsel-Service

Datum: 2023-09-02

Laufleistung: 46092 km

Auftragnummer: 39936

Durchgeführt von: Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetrieb nur enthalten, soweit der Servicebetrieb auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.

Autorisierter Volkswagen Service Partner

Mobiletätgarantie: Ja

Eintragung der Werkstatt

Datum: 2022-05-19

Laufleistung: 37549 km

Auftragnummer: AKTION 93N4 / 02

Durchgeführt von: Aus rechtlichen Gründen sind Angaben zum durchführenden Servicebetrieb nur enthalten, soweit der Servicebetrieb auch der Ersteller dieses Nachweises des Digitalen Serviceplans ist.

Figure 18: Documents

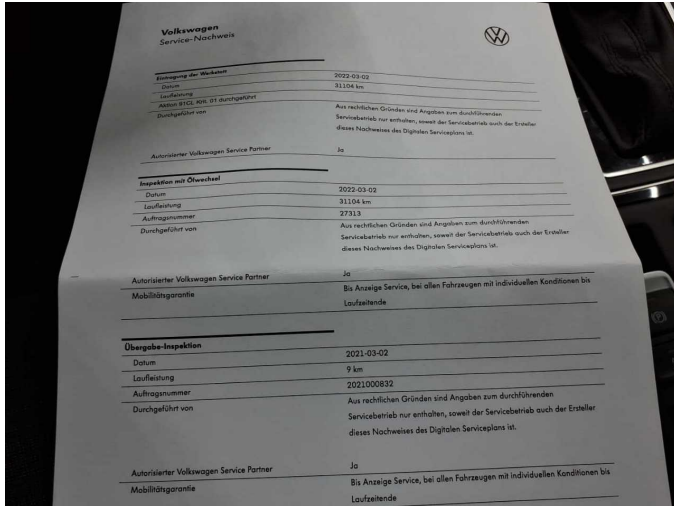


Figure 19: Documents

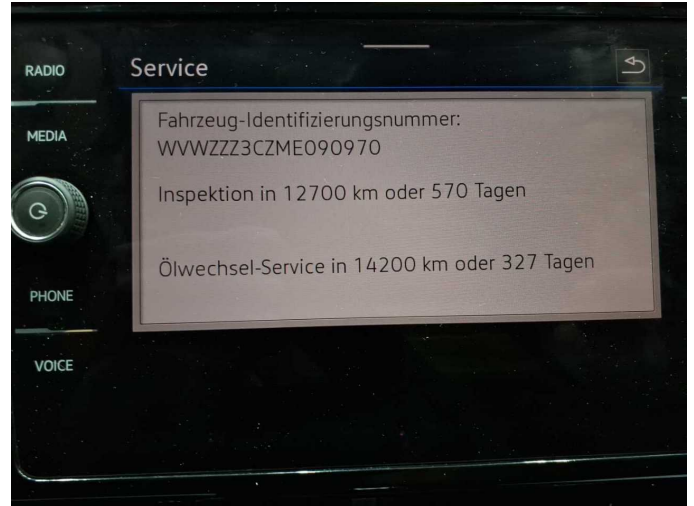


Figure 20: Documents



Figure 21: Additional tyres

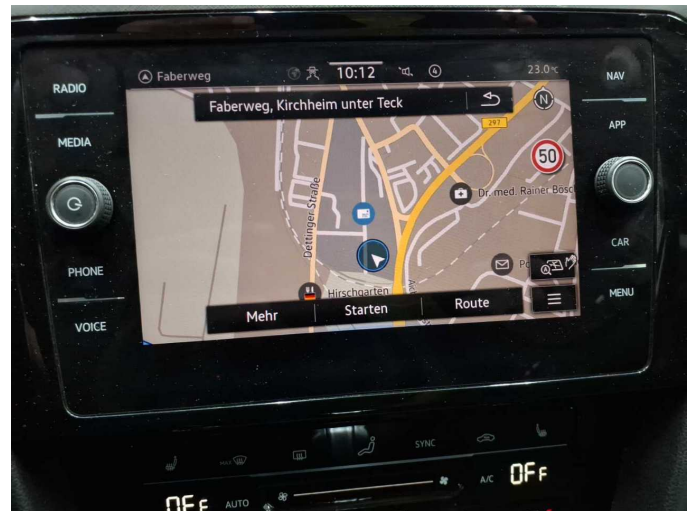


Figure 22: Navigation



Figure 23: Misc.

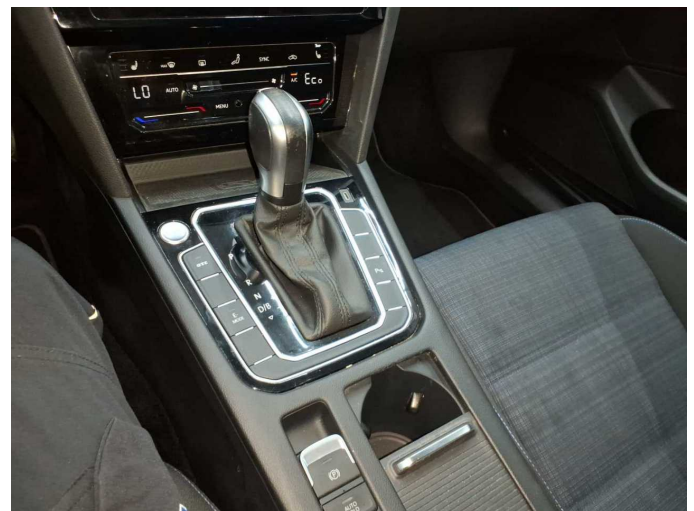


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

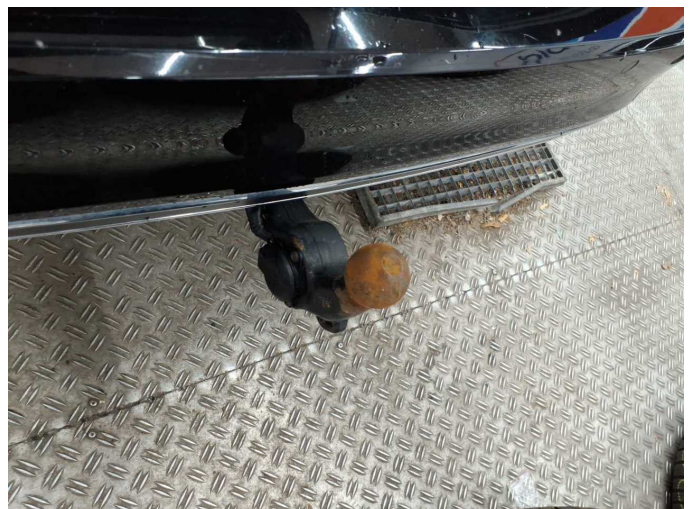


Figure 36: Misc.



Figure 37: Misc.




Figure 38: Misc.




Figure 39: Misc.



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smart repair

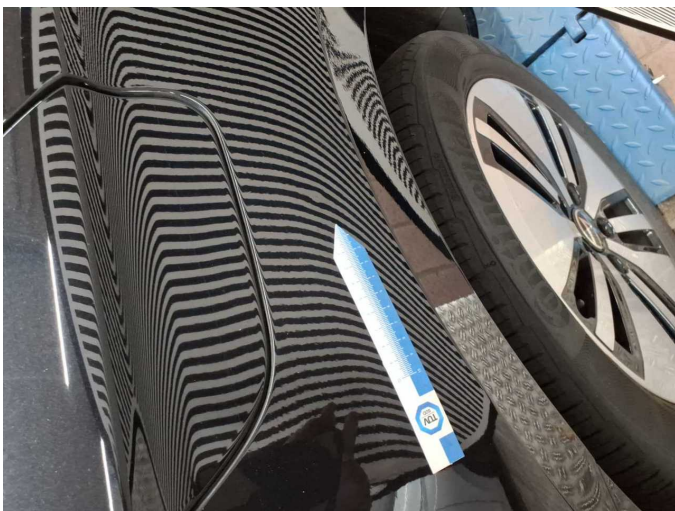

Damage 1: Side panel - rear right side: Side panel - dent(s) - Smart repair

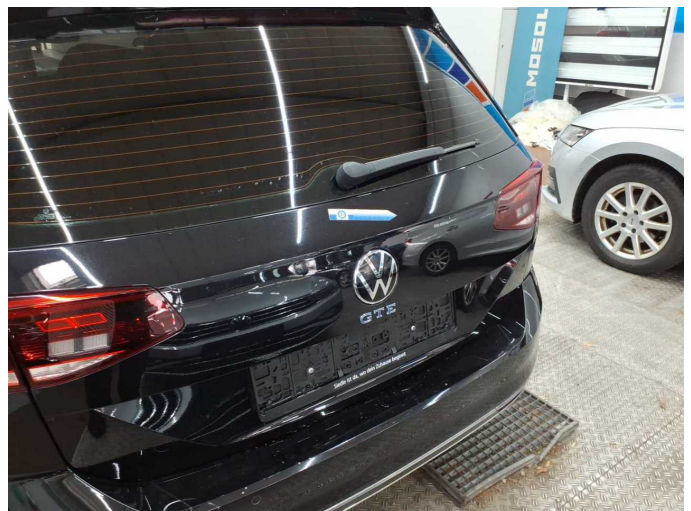

Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smart repair



Damage 3: Door - rear left side: Door - dent(s) - Smart repair



Damage 3: Door - rear left side: Door - dent(s) - Smart repair



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 5: Front bumper: Spoiler - Scratched - Smart repair



Damage 5: Front bumper: Spoiler - Scratched - Smart repair




Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value

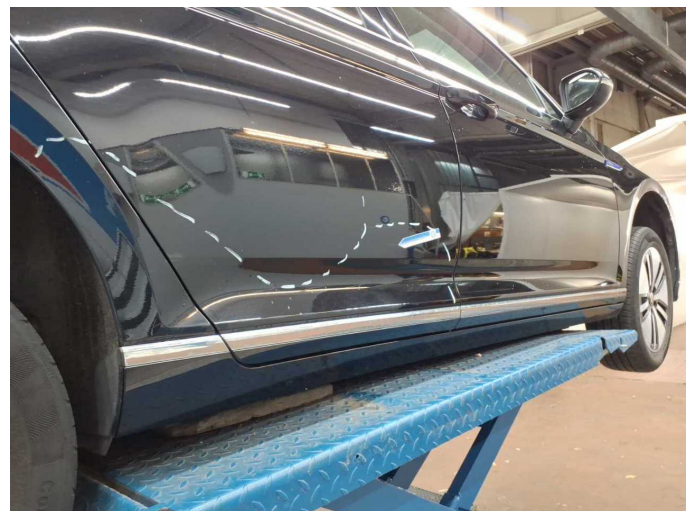


Damage 7: Door - rear right side: Door - Scratch(es) - Paint



Damage 7: Door - rear right side: Door - Scratch(es) - Paint




Damage 7: Door - rear right side: Door - Scratch(es) - Paint

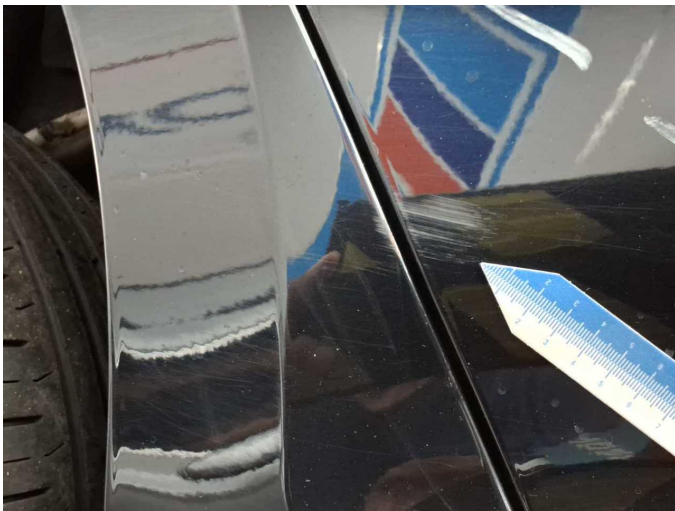


Damage 7: Door - rear right side: Door - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

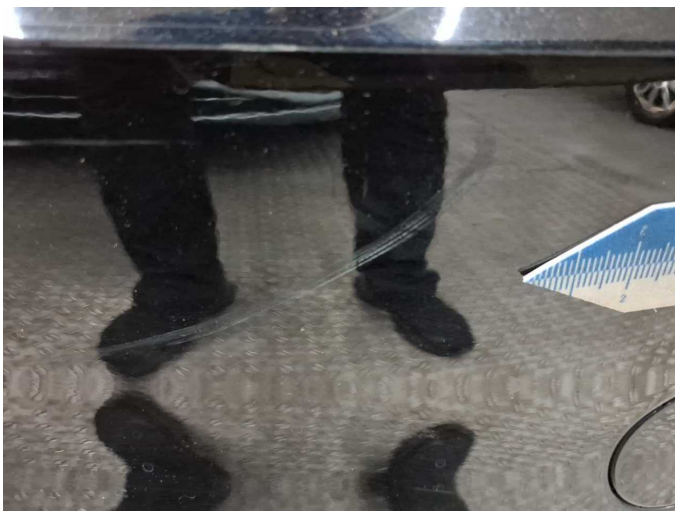

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

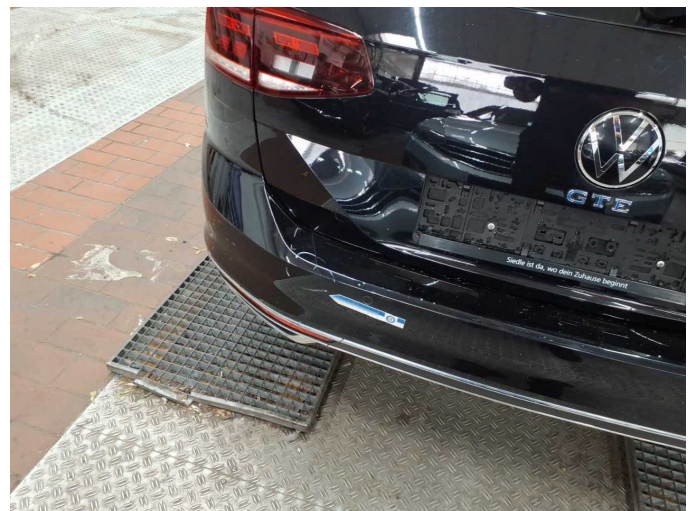

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

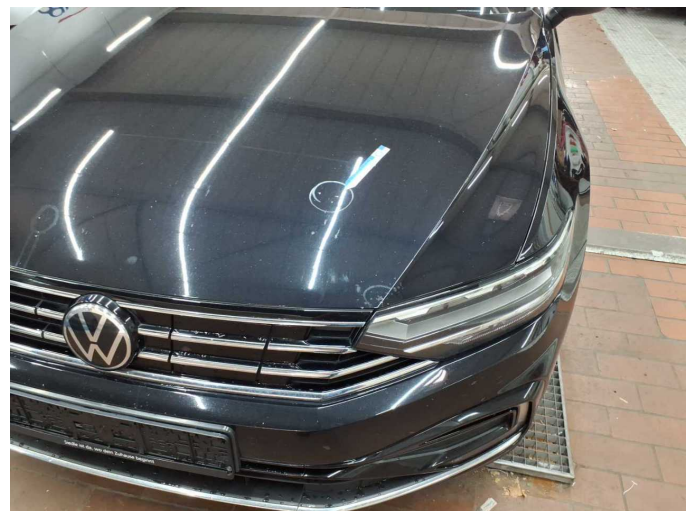


Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint




Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint




Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint

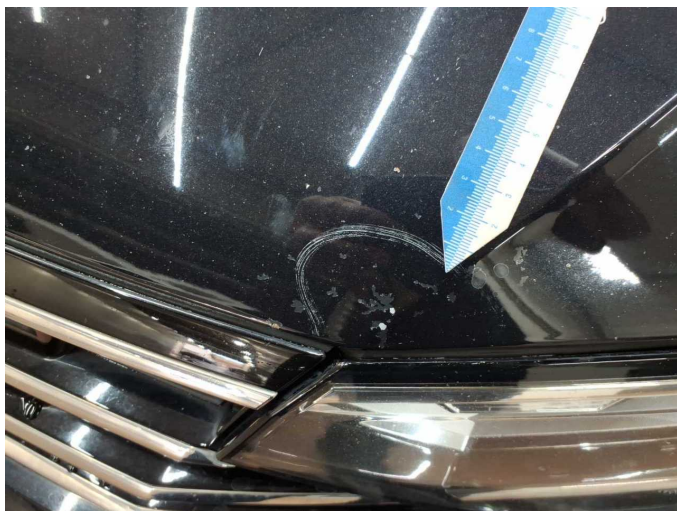

Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint

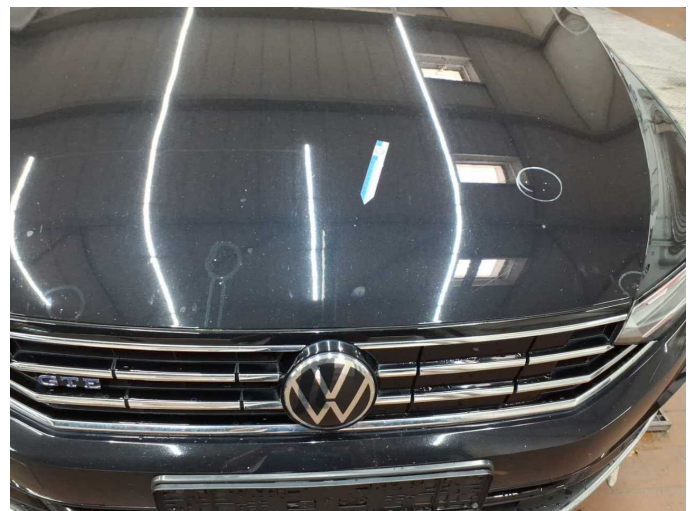

Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint

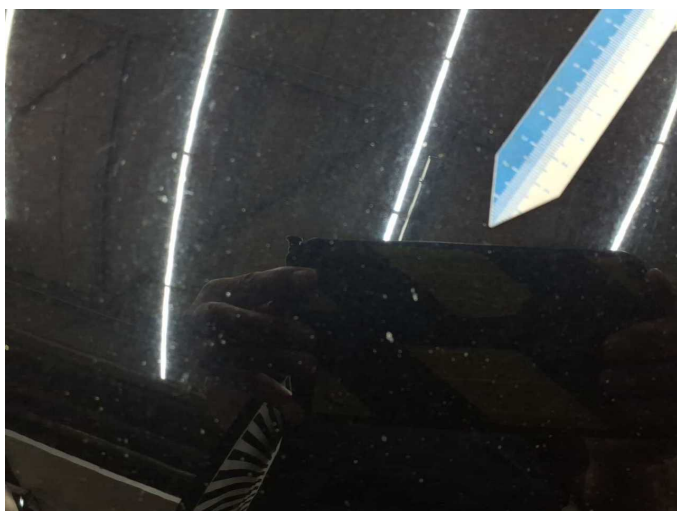

Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint




Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint




Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint

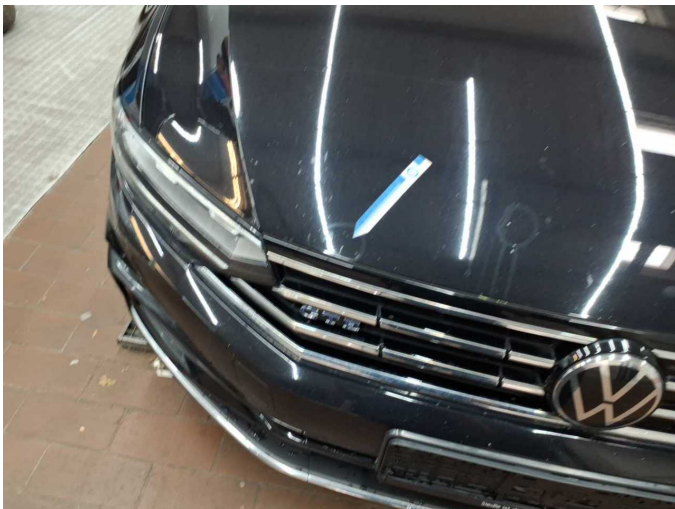


Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Paint

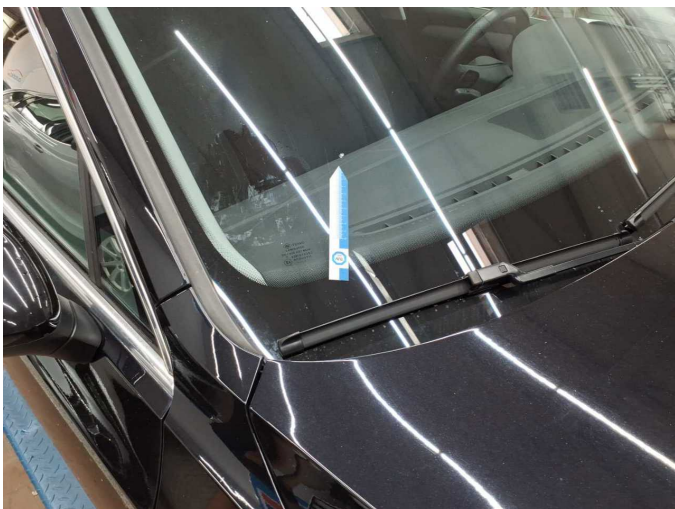

Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace

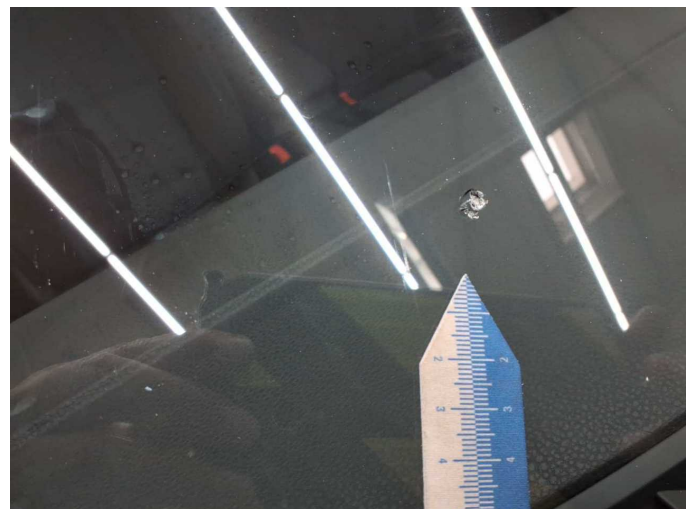

Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVWZZZ3CZME090970

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

Datum	KM-Stand	Beschreibung
13.02.2026	153.671	Systemtest/Eigendiagnose
04.02.2026	152.728	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
08.10.2025	135.984	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
29.07.2025	127.091	Reparatur Sonstiges
06.06.2025	120.527	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
12.11.2024	103.626	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
14.05.2024	90.368	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.03.2024	85.469	AU
14.09.2023	79.012	Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
07.08.2023	75.692	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
20.01.2023	59.872	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
02.09.2022	46.053	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
02.03.2022	31.110	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.07.2021	16.115	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges