



Expertise

Protocol number: 46630817  
Order No. / Reference: 26604483  
Inspection date: 15 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TDI SCR DSG Life

VIN: WVGZZZ5N0PM081702



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Tiguan Allspace 2.0 TDI SCR DSG Life

Vehicle Identification number WVGZZZ5N0PM081702

Mileage (Read) 44,382 km

First registration 9 May 2023

Number of holders 1

Fuel type Diesel

Engine displacement / Cylinder 1,968 ccm / 4

Power 110 kW

Gearbox / Number of gears Automatic / 7

Type of drive Front drive

Type of vehicle SUV

Colour / colour code Pure White

Doors / Seats 5 / 5

Upholstery type Cloth

Colour of upholstery Anthracite-Black

readiness to drive Not roadworthy /  
moveable



## Vehicle details

|                                                      |                               |                                |                                                            |
|------------------------------------------------------|-------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>                   | digital evidence / incomplete | <b>Next maintenance in</b>     | 12,900 km                                                  |
| <b>Last service on / at</b>                          | 03/2026 at 40,801 km          |                                |                                                            |
| <b>Key is / should be</b>                            | 2 / 2                         | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                      |                               | <b>Letter No.</b>              | GS512387                                                   |
| <b>Previous damage / Accident</b>                    | None detectable               | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                         | sufficient                    | <b>Lifting equipment / pit</b> | No                                                         |
| <b>Test drive</b>                                    | Not performed                 | <b>Engine function test</b>    | Performed                                                  |
| <b>readiness to drive</b>                            | Not roadworthy / moveable     |                                |                                                            |
| <b>Manufacturer key number/<br/>type code number</b> | 0603 / BZG 29095              |                                |                                                            |
| <b>Emission standard</b>                             | EURO6                         | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                        | 2,270 kg                      | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                                      | Manufacturer | Tread depth |
|----|-----------------|---------------------------------------------------|--------------|-------------|
| 1) | 235/55 R18 100V | Summer tires (with run-flat tires) on Light alloy | Continental  | 4mm / 4mm   |
| 2) | 235/55 R18 100V | Summer tires (with run-flat tires) on Light alloy | Continental  | 5mm / 5mm   |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment

### Standard equipment

- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- third brake light
- Chrome trim on the side windows
- Silver anodized roof rails
- Diesel particulate filter
- Parking assistance
- Electronic parking brake including auto-hold function
- Automatic headlight control, with daytime running lights
- High beam control Light Assist
- Pedestrian detection
- Luggage compartment lighting
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Front headrests
- LED headlights
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- front center armrest
- Non-smoking version
- Emergency call service
- Proactive occupant protection system in conjunction with "Front Assist"
- Rain sensor
- Wheels: AirStop tires 235/55 R 18, optimized for low rolling resistance
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt socket
- Bumpers in body color
- Textile floor mats front and rear
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys
- Airbag for driver and front passenger including knee airbag on the driver's side
- Electrically adjustable and heated exterior mirrors
- Exterior mirror housings painted silver
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles
- Decorative inlays "Horizon Black"
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic Stability Program with counter-steering support
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment floor height adjustable in 2 stages
- Tailgate with electric opening and closing, adjustable opening angle
- Interior mirror automatically dimming
- LED license plate lighting
- Rear headrests (3)
- Paint finish: Solid
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels: Tire Mobility Set omitted
- Wheels: Light alloy (4) "Frankfurt" 7 J x 18
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear



## Extra equipment

- Airbag: Side airbags for the outer seats of the 2nd row.
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Electrically adjustable, folding and heated exterior mirrors (with passenger-side mirror lowering function)
- Mesh partition
- Package: "Easy Open & Close" with safe locking mechanism ("Easy Open & Close" - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking mechanism)
- Package: Top Package (Adaptive chassis control DCC incl. driving profile selection - Panoramic tilt/slide sunroof with panoramic roof at the rear - Darkened rear side windows and rear window)
- Rear View reversing camera
- Wirelessly heated windshield (infrared-reflective)
- Navigation system "Discover Media" incl. "Streaming & Internet" (8 speakers - Radio Data System (RDS) - Traffic sign recognition)
- Package: Business Premium incl. Navigation (DSG) (2 USB-C ports in the front, 1 USB-C charging port on the rear center console - Head-up display - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated windshield washer nozzles in the front - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Package: Winter (front windshield washer nozzles automatically heated - front seats heated)
- Seats: ergoActive front seats (front passenger seat backrest not foldable - ergoActive front seats height-adjustable, seat and backrest tilt adjustable, thigh support longitudinally adjustable - front lumbar support electrically adjustable and with massage function - seat center panels of the front seats and the outer rear seats in microfleece "ArtVelours" - top comfort seats in front)

## Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |
| readiness to drive   | The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.                                                                                            |

## Value reducing factors

| No. | Component group        | Description                                                                                                       |
|-----|------------------------|-------------------------------------------------------------------------------------------------------------------|
| 1   | Misc.                  | Inspection / maintenance (1. Inspektion überzogen oder Nachweis 1. Inspektion fehlt) - No evidence - No deduction |
| 2   | Door - rear left side  | Door edge - Scratched - Smart repair                                                                              |
| 3   | Wheel / tyres          | Tyre - front left side (Flankenbeschädigung) - Damaged - Replace                                                  |
| 4   | Door - front left side | Brightware - lower - Scratched - Replace                                                                          |

## Wear and tear

| No. | Component group | Description                              |
|-----|-----------------|------------------------------------------|
| 1   | Rear bumper     | Rear bumper - Scratch(es) - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area



Figure 12: VIN



Figure 13: Mounted tyres



Figure 14: Mounted tyres



Figure 15: Documents

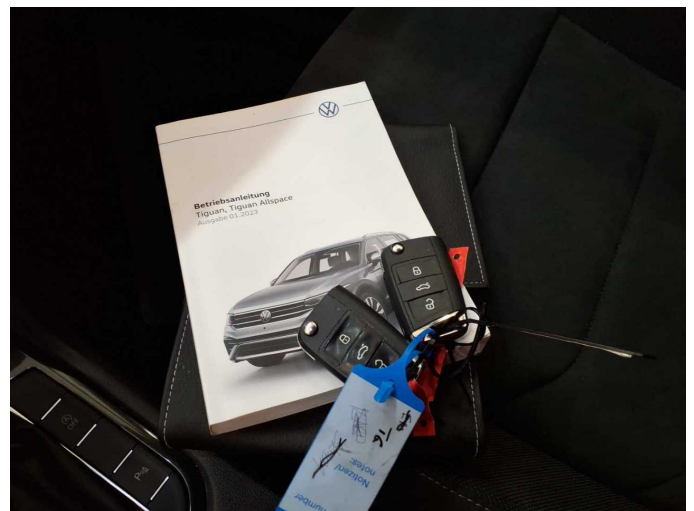


Figure 16: Documents



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

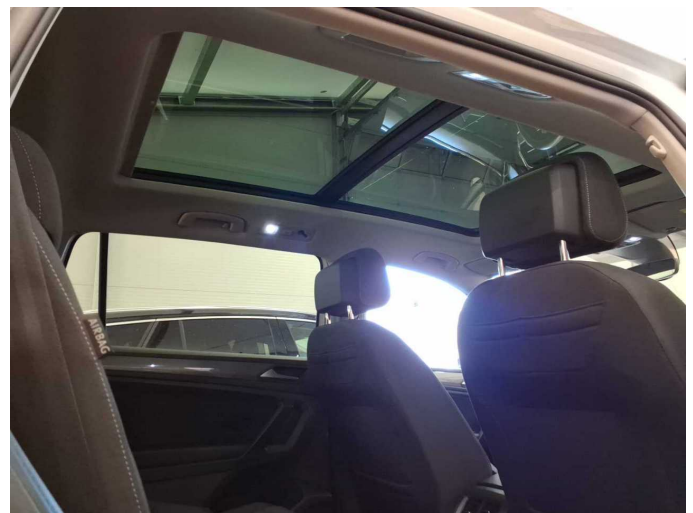


Figure 28: Misc.

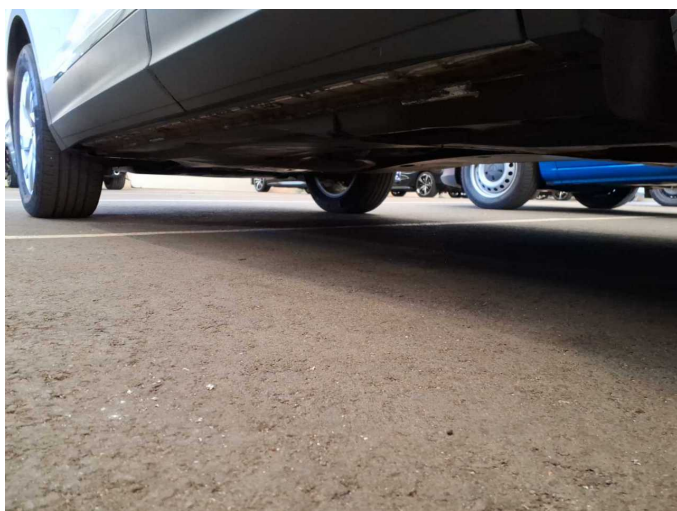


Figure 29: Misc.



Figure 30: Misc.



**Figure 31:** Misc.



**Figure 32:** Misc.



**Figure 33:** Misc.



**Damage 2:** Door - rear left side: Door edge - Scratched - Smart repair



**Damage 2:** Door - rear left side: Door edge - Scratched - Smart repair



**Damage 3:** Wheel / tyres: Tyre - front left side (Flankenbeschädigung) - Damaged - Replace



**Damage 4:** Door - front left side: Brightware - lower - Scratched - Replace



**Damage 4:** Door - front left side: Brightware - lower - Scratched - Replace



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5N0PM081702

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan Allspace 2.0 TDI SCR  
DSG Life

| Datum      | KM-Stand | Beschreibung                                                                                                                      |
|------------|----------|-----------------------------------------------------------------------------------------------------------------------------------|
| 13.03.2026 | 40.801   | Bremse Sonstiges; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern;<br>Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges |