



Expertise

Protocol number: 46876766
Order No. / Reference: 26821431
Inspection date: 31 Jul 2026

Manufacturer: Ford

Model: Kuga 2.5 Duratec PHEV VIGNALE

VIN: WF0FXXWPMHPK59040



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 2.5 Duratec PHEV VIGNALE	
Vehicle Identification number	WF0FXXWPMHPK59040
Mileage (Read)	83,160 km
First registration	29 Jun 2023
Number of holders	1
Fuel type	Hybr.B/E ext.auf
Engine displacement / Cylinder	2,488 ccm / 4
Power	112 kW
Gearbox / Number of gears	Automatic / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Agate Black Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	74 %
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT884151
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BTM 00020		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,320 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R18 104V	Summer tyres on Light alloy	Continental	3mm / 3mm
2)	225/60 R18 104V	Summer tyres on Light alloy	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Acoustic Vehicle Alerting System (AVAS)
- Anti-lock braking system
- Passenger airbag deactivation
- Tires: 7.5 J x 18 light alloy wheels (4) in 5x4 spoke design Luster Nickel premium paint finish (with tires 225/60 R 18)
- third brake light
- Roof rails, silver-colored
- 12.3-inch digital instrument panel
- Front door sill trims, Vignale design
- Selective driving mode switch (5 driving modes to choose from: Normal, Sport, Eco, Slippery and Unpaved Roads)
- Electric front and rear windows with all-around closing function
- Ford EcoCoach (shows the efficiency of current driving behavior)
- Ford Power Start function & Ford Key Free system (keyless locking/unlocking)
- FordPass Connect including eCall, Live Traffic information (information about the current status or location of the vehicle, as well as control of selected vehicle functions via a compatible smartphone with the FordPass app - Real-time traffic information)
- Transmission: continuously variable automatic transmission (CVT)
- Heated rear window
- rear window wiper
- Intelligent Protection System (IPS) (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts on all seats, height-adjustable in the front - warning system for unfastened seat belts in the front and in the 2nd row)
- LED taillights
- Steering column, adjustable in height and reach
- Illuminated makeup mirrors in the driver's and passenger's sun visors
- MyKey key system (individually programmable second key)
- Navigation system: Ford navigation system including Ford SYNC 3 (AppLink, Android Auto, Apple CarPlay - 8" touchscreen (20.3 cm screen diagonal) - DAB/DAB+ radio reception (Digital Audio Broadcasting) - 6 speakers - Steering wheel controls - Bluetooth hands-free system and audio streaming - USB port - Voice control for audio and telephone - Acoustic and visual route guidance - Dynamic navigation with enhanced traffic information system - Lane guidance - Road map for Europe)
- Post-Collision Assist
- Pre-Collision Assist (including Forward Alert system with pedestrian and bicycle detection)
- Tire Pressure Monitoring System (TPMS)
- Rear view camera
- Windscreen wipers with rain sensor
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Passenger seat, 8-way manually adjustable (including adjustable lumbar support)
- Ambient lighting at the front
- Electrically adjustable, heated and folding exterior mirrors (VIGNALE) (painted in body color - with memory function - with integrated turn signals and ambient lighting)
- Tires: Tire repair kit (maximum speed 80 km/h when used)
- Fabric headliner
- Roof spoiler (painted in car color)
- Tachometer
- Electronic Stability Program (ESP) (additionally with electronic brake booster)
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto hold function
- Ford Easy Fuel (Ford Easy Fuel comfort refueling system (Eliminates the need for a separate internal fuel cap and prevents misfueling by detecting the size difference between petrol and diesel nozzles. The filler neck only opens when the correct fuel is used.)
- Geofencing - Display of emission zones with Euro 6 and higher in the SYNC navigation device
- Luggage compartment cover, roller blind, removable
- Luggage compartment lighting
- Cruise control
- Illuminated glove compartment
- Electric tailgate, sensor-controlled (opens via foot movement)
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Front and rear headrests (5) height adjustable
- Charging cable for household socket
- Steering wheel: Steering wheel, Vignale design, Sensico in leather look
- Rear center armrest with two cup holders
- Front center console with integrated armrest (2 front cup holders)
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Package: Winter II (Heated windscreen - Heated leather steering wheel - Heated outer rear seats)
- Front and rear parking pilot system
- Upholstery: Premium Sensico upholstery in leather look with leather seat center panels (including driver's seat 10-way electrically adjustable with memory function and electrically adjustable lumbar support - seat back and side bolsters as well as interior applications in leather look)
- Radio accessories: B&O Sound System (575 Watt premium sound system with 10 speakers, including subwoofer - based on the renowned sound and design expertise of Bang & Olufsen)
- Headlights with delayed shut-off



- Seats: Backrest for front passenger, adjustable tilt
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front seats, individually and variably heated
- Power outlet: 12-volt connection in the luggage compartment
- Variable radiator air intake
- Central locking with remote control and remote luggage compartment release

- Power steering (electro-mechanical, speed-dependent (EPAS - Electric Power Assisted Steering))
- Seats: Map pockets on the driver's and front passenger's seat backrests
- Seats: Driver's backrest, electrically adjustable for tilt
- Seats: Front sports seats with integrated headrests
- Static LED headlights (high beam assist - LED fog lights)
- Front and rear bumpers in Vignale design
- Carpet floor mats front and rear
- Immobiliser

Extra equipment

- Swiveling towbar (incl. ESP trailer stabilization)
- Inductive charging station for mobile devices (The inductive charging station allows you to charge your compatible smartphone while driving without the hassle of connecting it to a cable. The charging station is located in the vehicle's center console and is only activated when it comes into contact with a compatible device. If you place a wallet or other items on the charging station, it remains inactive.)
- Package: Technology (Adaptive LED headlights with glare-free high beam assist and dynamic cornering lights, automatic headlight range control and LED fog lights - Head-up display)
- Safety partition net for attachment behind the 2nd row of seats (including attachment points behind the first and second rows of seats)

- Mounting points behind the first and second row of seats according to ISO 27955,
- Paint finish: Agate Black Metallic
- Paint finish: Special metallic paint finish
- Package: Driver Assistance Package (Automatic Transmission) (Intelligent Adaptive Cruise Control with Traffic Sign Recognition System - Traffic Jam Assist with Stop&Go Function and Lane Keeping Assist - Wrong-Way Driver Warning System - Evasive Steering Assist - Driver Drowsiness Detection - Pre-Collision Assist including Forward Collision Warning System with Cross Traffic Alert - Blind Spot Assist with Emergency Braking Function and Trailer Detection - Active Park Assist with Parking Assist and Semi-Autonomous Vehicle Steering - Front Camera with Split View - Door Edge Protectors - Intelligent Speed Limiter with Speed Limit Display)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyres - complete set (Reifendruck) - Specify findings - Perform diagnosis
2	Trim / covers	Roof lining - Burn hole (cigarettes) - Smart repair
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Smart repair
5	Vehicle glazing	Windscreen - Stone chips - Smart repair
6	Rear bumper	Rear bumper - Scratch(es) - Smart repair
7	Body	A-pillar - left side (Einschlüsse-Mehrkosten möglich) - Paint defect - Conditioning
8	Door - front right side	Door - Dent / paintcoat damage - Smart repair
9	Mudguard - left side	Mudguard - left side (Spachtel eingefallen) - Unprofessionally repaired - Repair and paint
10	Mudguard - right side	Mudguard - right side (Kratzer im Spachtel) - Unprofessionally repaired - Repair and paint
11	Side panel - rear right side	Side panel - Scratch(es) - Paint
12	Door - rear right side	Door - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Roof	Roof - dent(s) - No deduction
3	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
4	Front bumper	Front bumper - Stone chips - No deduction
5	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

1	Bonnet, Professionally carried out, Invoice of repair done Non-existent
2	Door - front left side, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - left side, Unprofessionally carried out, Invoice of repair done Non-existent
4	Mudguard - right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	213 µm	Mudguard - right side	230 µm
Bonnet	228 µm	Door - front left side	172 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Die Wartungshistorie ist nicht vorhanden und kann somit nicht auf Vollständigkeit geprüft werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

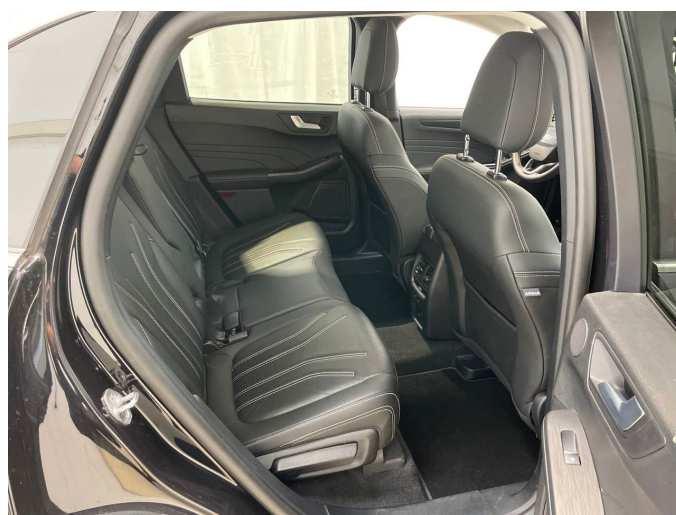


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

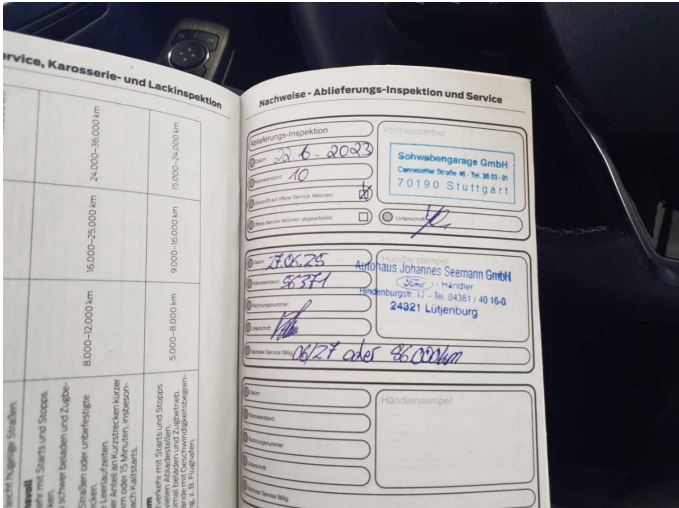


Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

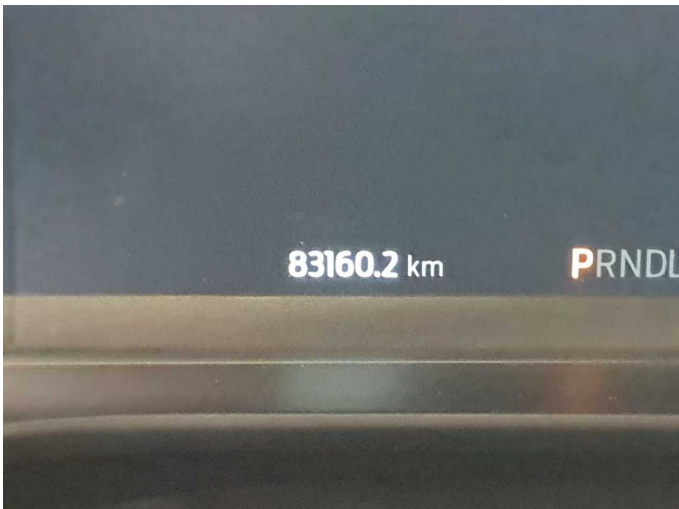


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

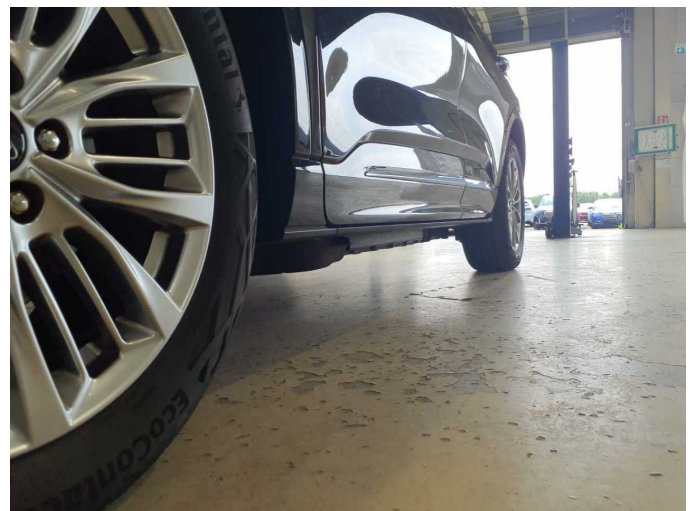


Figure 22: Misc.

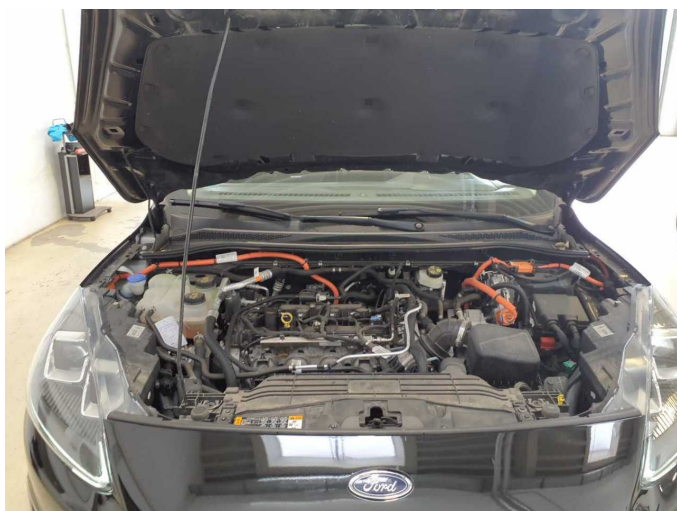


Figure 23: Misc.

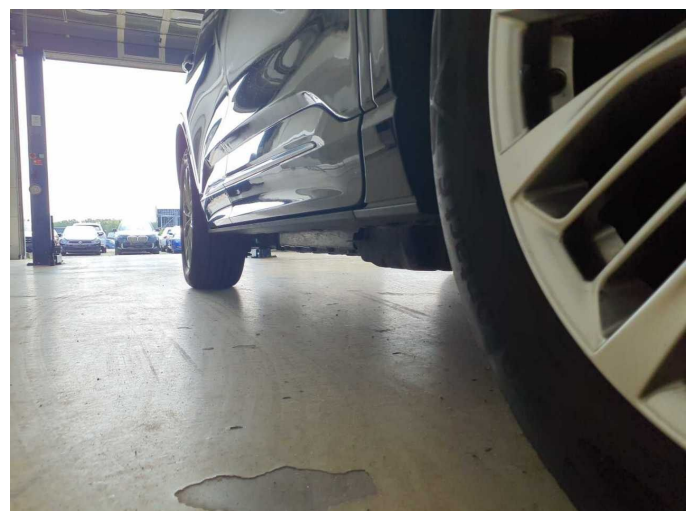


Figure 24: Misc.

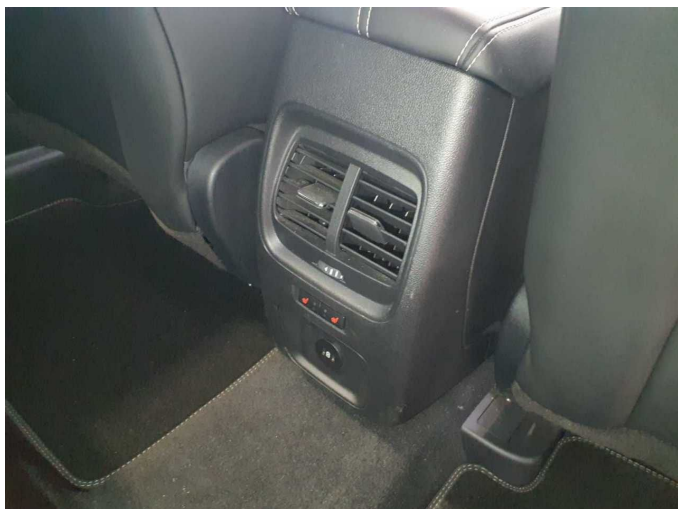


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

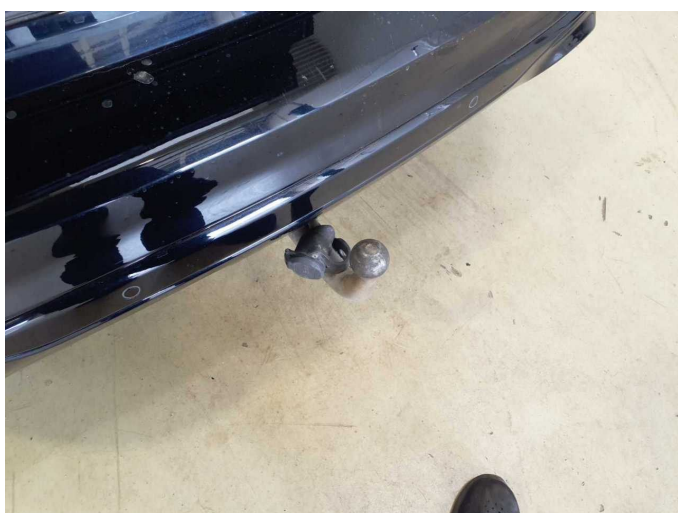



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

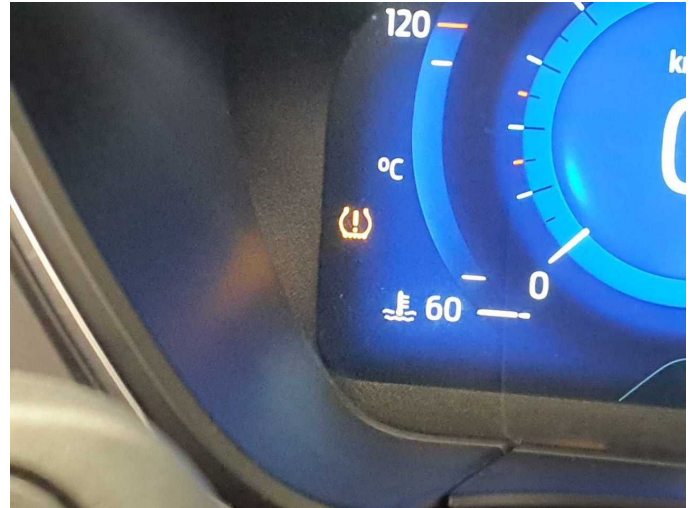


Damage 1: Wheel / tyres: Tyres - complete set (Reifendruck) - Specify findings - Perform diagnosis




Damage 2: Trim / covers: Roof lining - Burn hole (cigarettes) - Smart repair



Damage 2: Trim / covers: Roof lining - Burn hole (cigarettes) - Smart repair

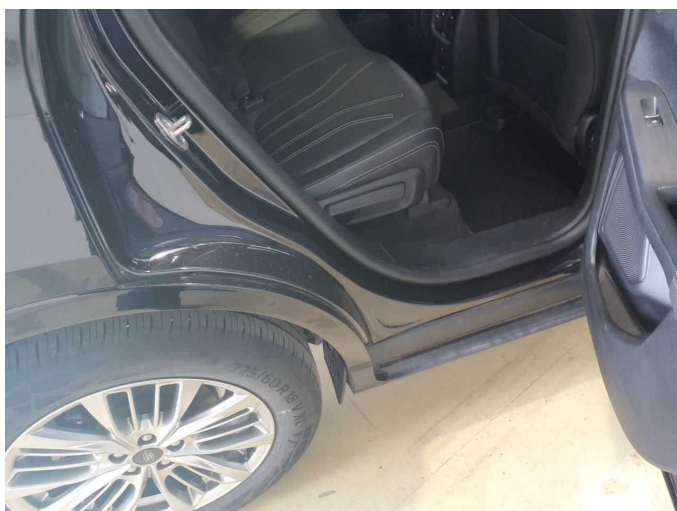

Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair

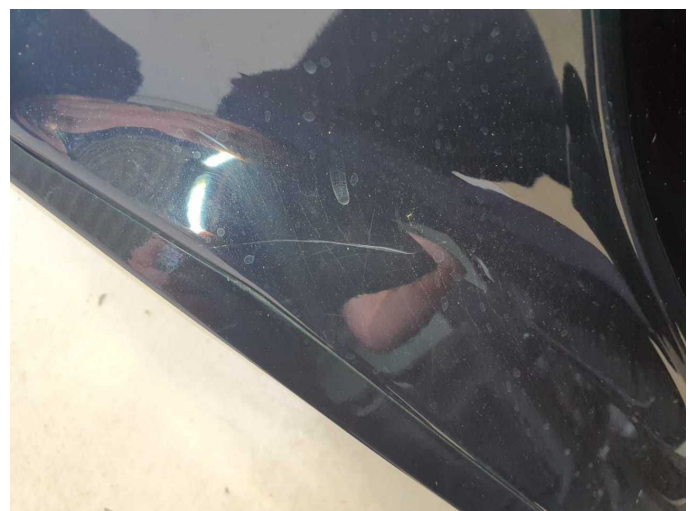

Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Smart repair



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Smart repair



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Smart repair



Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair




Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair

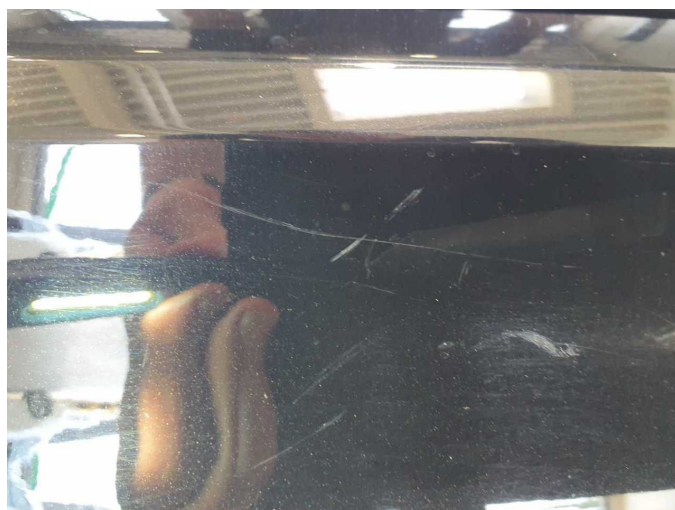

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 7: Body: A-pillar - left side (Einschlüsse-Mehrkosten möglich) - Paint defect - Conditioning

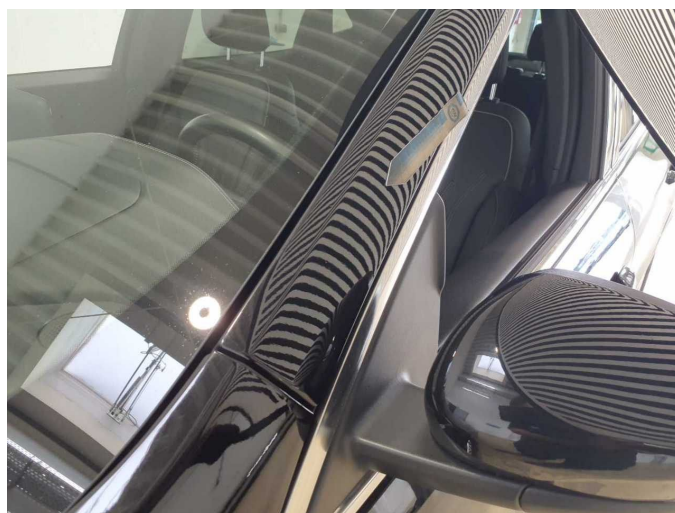


Damage 7: Body: A-pillar - left side (Einschlüsse-Mehrkosten möglich) - Paint defect - Conditioning




Damage 7: Body: A-pillar - left side (Einschlüsse-Mehrkosten möglich) - Paint defect - Conditioning



Damage 8: Door - front right side: Door - Dent / paintcoat damage - Smart repair

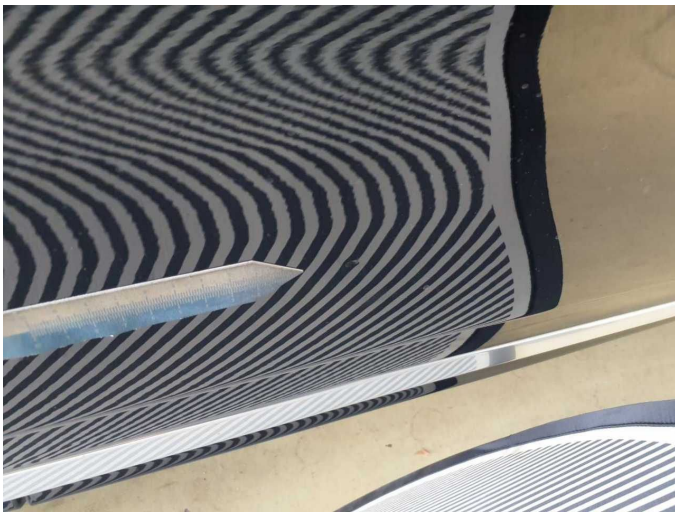

Damage 8: Door - front right side: Door - Dent / paintcoat damage - Smart repair

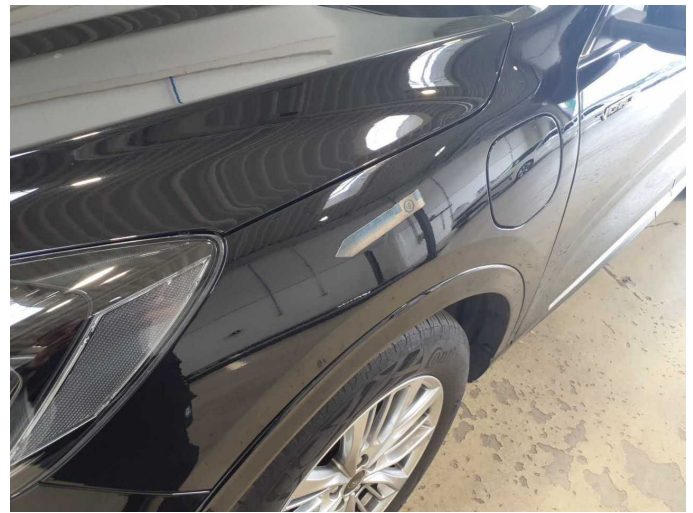

Damage 9: Mudguard - left side: Mudguard - left side (Spachtel eingefallen) - Unprofessionally repaired - Repair and paint



Damage 9: Mudguard - left side: Mudguard - left side (Spachtel eingefallen) - Unprofessionally repaired - Repair and paint



Damage 9: Mudguard - left side: Mudguard - left side (Spachtel eingefallen) - Unprofessionally repaired - Repair and paint



Damage 10: Mudguard - right side: Mudguard - right side (Kratzer im Spachtel) - Unprofessionally repaired - Repair and paint




Damage 10: Mudguard - right side: Mudguard - right side (Kratzer im Spachtel) - Unprofessionally repaired - Repair and paint




Damage 10: Mudguard - right side: Mudguard - right side (Kratzer im Spachtel) - Unprofessionally repaired - Repair and paint



Damage 11: Side panel - rear right side: Side panel - Scratch(es) - Paint

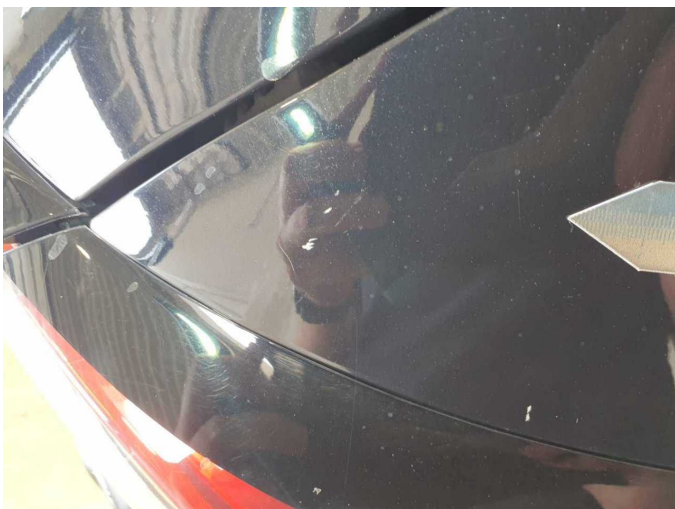

Damage 11: Side panel - rear right side: Side panel - Scratch(es) - Paint

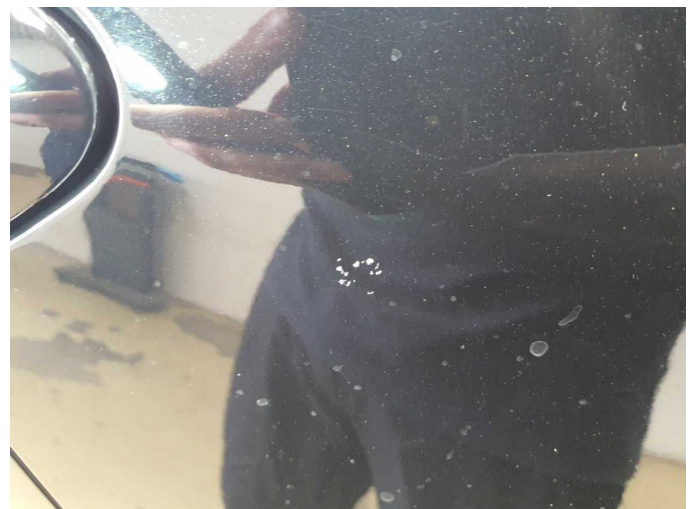

Damage 11: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 12: Door - rear right side: Door - Scratch(es) - Paint




Damage 12: Door - rear right side: Door - Scratch(es) - Paint



Repainting 1: Bonnet



Repainting 1: Bonnet

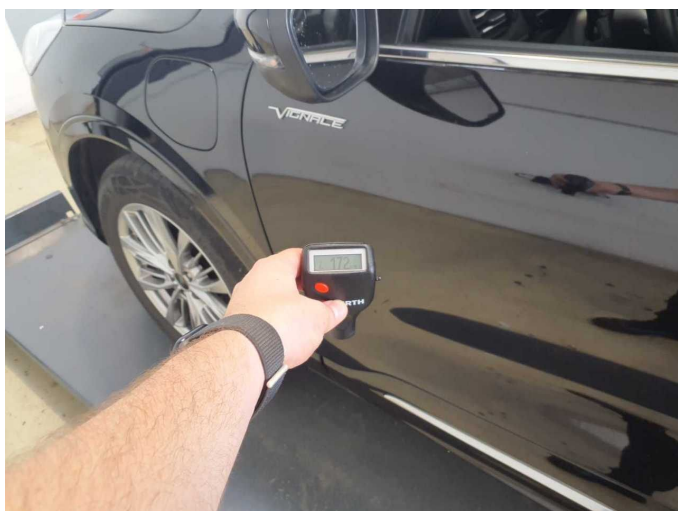

Repainting 2: Door - front left side




Repainting 2: Door - front left side



Repainting 3: Mudguard - left side



Repainting 3: Mudguard - left side

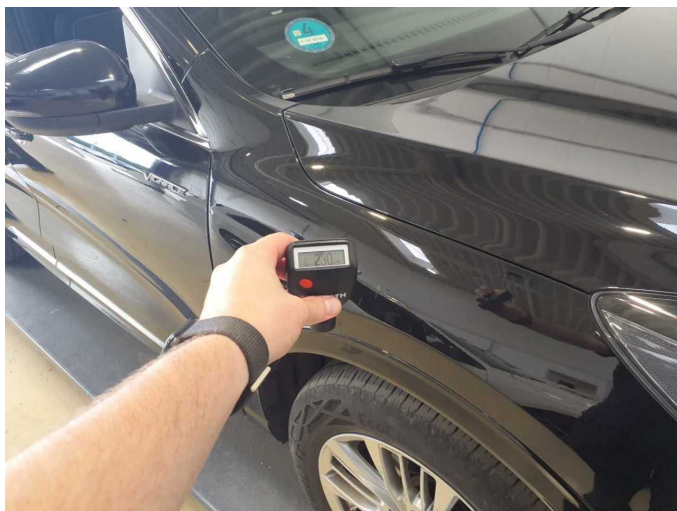

Repainting 4: Mudguard - right side



Repainting 4: Mudguard - right side