


DEKRA Automotive Solutions

Vehicle details

VIN	WBAYN9106 05T56136	Registration date	01/01/1900	Exterior Color	Unknown
Brand	BMW	Licence Plate	2CET624	Odometer	95 759 km
Model	X2				

Inspection Details

Arrival Date	10/07/2026	Inspection ID	7056595	Inspection date	15/07/2026
Assign Date	10/07/2026	Fleet owner	LIZY Belgique	Inspection loc.	Parc Lizy

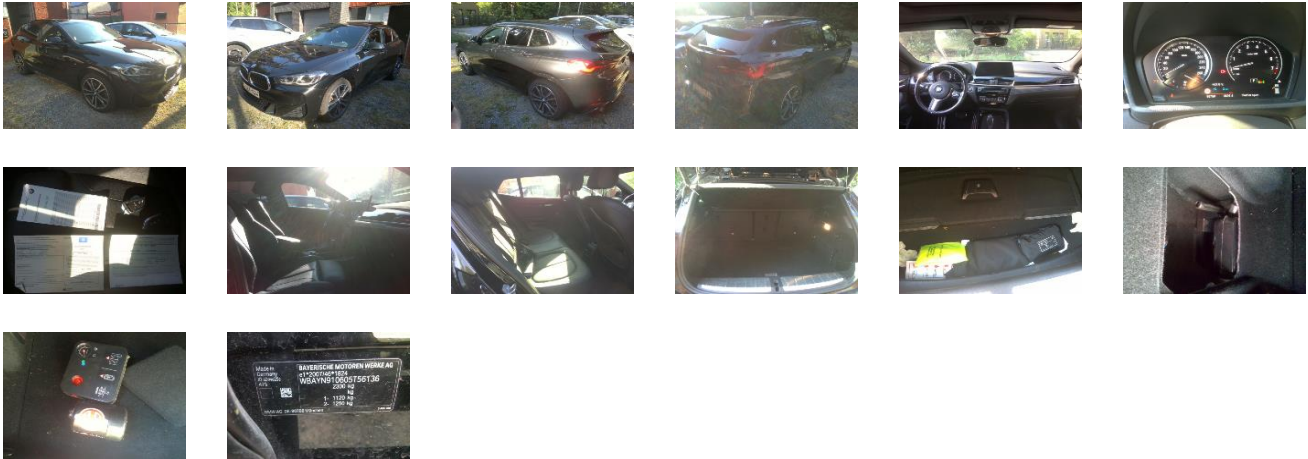

Generic equipment

Automated air-conditioning	✓
Rain and light sensor	✓
GPS system	✓
Front radars	✓
Alloy wheel rims	✓
Heating seats	✓

Removable element

Spare wheel kit	✓
Emergency compressor kit	✓
Triangle	✓
Safety vest	✓
Rear parcel shelf	✓
Floor mat BR	✓
Floor mat BL	✓
Floor mat FR	✓
Floor mat FL	✓
Fire extinguisher	✓

Technical Document

Service manual holder	✗
User manual	✗
Warranty booklet	✗
First aid kit	✓
Spare key	✓
Certificate of conformity	✓
Title / License document	✓

Tyres

Hankook 225/45/19 W All seasons 7.0 mm		Hankook 225/45/19 W All seasons 7.0 mm	
Hankook 225/45/19 W All seasons 7.0 mm		Hankook 225/45/19 W All seasons 7.0 mm	

Damages

1		Part	Special rim 19"	Repair Time	-	Part Cost	-
		Position	Front right	Repair Cost	-	Gross Cost	225.00€
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	Smart Repair	Flat Rate	225.00€	Net Cost	225.00€

DEKRA Automotive Solutions

2		Part	Special rim 19"	Repair Time	-	Part Cost	-
		Position	Front left	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
3		Part	Wing	Repair Time	-	Part Cost	-
		Position	Front left	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
4		Part	Door	Repair Time	-	Part Cost	-
		Position	Back left	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
5		Part	Door sill	Repair Time	-	Part Cost	-
		Position	Front left	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
6		Part	Bumper	Repair Time	-	Part Cost	-
		Position	Back	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
7		Part	Special rim 19"	Repair Time	-	Part Cost	-
		Position	Back right	Repair Cost	-	Gross Cost	225.00€
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	Smart Repair	Flat Rate	225.00€	Net Cost	225.00€
8		Part	Wing moulding	Repair Time	-	Part Cost	-
		Position	Back right	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
9		Part	Door sill	Repair Time	-	Part Cost	-
		Position	Back right	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-

DEKRA Automotive Solutions

10		Part	Roof	Repair Time	-	Part Cost	-
		Position	-	Repair Cost	-	Gross Cost	-
		Damages	Dented	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
11		Part	Service manual holder	Repair Time	-	Part Cost	-
		Position	-	Repair Cost	-	Gross Cost	-
		Damages	Missing	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
12		Part	User manual	Repair Time	-	Part Cost	-
		Position	-	Repair Cost	-	Gross Cost	-
		Damages	Missing	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
13		Part	Warranty booklet	Repair Time	-	Part Cost	-
		Position	-	Repair Cost	-	Gross Cost	-
		Damages	Missing	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-

Summary Inspection

Gross Price	450.00€	Depreciation	-	Net Price	450.00€
-------------	---------	--------------	---	-----------	---------

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	0.00€	0.00	0.00€	-	-	0.00€
Paintwork	0.00€	0.00	0.00€	-	-	0.00€
Paint preparation	0.00€	0.00	0.00€	-	-	0.00€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	0.00€	-	-	0.00€
Flat Rate	450.00€	-	-	450.00€

Signatures

Signature Receiver	Signature Expert	Signature Customer / Driver
		van der Steen  15/07/2026 8:38