



Expertise

Protocol number: 46659116
Order No. / Reference: 26692000
Inspection date: 23 Jul 2026

Manufacturer: Volkswagen
VIN: WVGZZZCD2RW857060

Model: Golf Variant 2.0 TDI SCR DSG Life



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf Variant 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZZCD2RW857060
Mileage (Read)	84,895 km
First registration	25 Jun 2024
Number of holders	1
Next periodical technical inspection	06/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Uranograu
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	1,600 km
Last service on / at	12/2025 at 60,302 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HB049143
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CNN 02090		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,060 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Nexen	5mm / 5mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Nexen	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/50 R17 93H	Winter tyres on Light alloy	Bridgestone	3mm / 3mm
2)	205/50 R17 93H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports at the front, 2 USB-C charging ports at the rear of the center console
- Distraction and fatigue detection
- Airbags: Front and rear head airbags, front side airbags, center airbag
- App-Connect Wireless for Apple CarPlay and Android Auto
- Electrically adjustable, folding and heated exterior mirrors
- Hill start assist
- third brake light
- black roof rails
- Decorative inlays "Nature Cross Brushed"
- Digital Cockpit Pro, multicolor
- Parking assistance
- Electronic parking brake including auto-hold function
- Electronic stability program and electromechanical brake booster
- Chassis: Rear damping, base 1
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG
- Rear window wiper with intermittent function
- ISOFIX mounting points
- Front headrests
- LED reading lights at the front (2) and 2 at the rear
- LED headlights with daytime running lights
- Dynamic headlight range control
- Illuminated makeup mirrors in the sun visors
- Non-smoking version
- Emergency call service
- Radio accessories: 6 + 1 speakers
- Tire pressure monitoring system (passive)
- Wheels: Wheel locks with enhanced theft protection
- Rear bench seat undivided, backrest asymmetrically split and foldable, with center armrest
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet in the luggage compartment
- "Comfort" telephone interface with inductive charging function
- First aid kit, warning triangle and high-visibility vest
- Preparation Alcohol Interlock
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear
- Turning brake function and evasive steering support
- Rear exhaust tailpipe (standard)
- Airbag for driver and front passenger
- Ambient lighting, 10 colors
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC)
- Exterior mirror housings and door handles in body color
- Vehicle tool kit
- Chrome applications on mirror adjustment and window regulator switches, chrome strips on the air vents
- Diesel particulate filter and SCR catalyst
- Tachometer
- Electronic differential lock XDS
- Electronic voice amplification
- Automatic headlight control, with LED daytime running lights
- Electric windows, front and rear
- Pedestrian protection measures expanded
- Speed limiter with predictive control
- Rear window heated
- Infotainment system with 32 cm (12.9 inch) display
- Rear headrests (3)
- Paint finish: Solid
- LED taillights
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Front center armrest adjustable in height and length
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Radio accessories: Digital radio reception DAB+
- Wheels: Alloy wheels (4) "Norfolk" 7 J x 16
- Wheels: Tire Mobility Set
- Keyless start system without safe locking
- electromechanical power steering
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in "Life" fabric (center panels of the front seats and the outer rear seats in "Life" fabric)
- Seats: Front seats are height-adjustable
- Start-stop system
- Bumpers in body color
- Illuminated door handle recesses
- Ambient lighting with light projection
- Traffic sign recognition
- Warning tone and light for unfastened seat belts front and rear
- Central locking with remote control



Extra equipment

- Mesh partition
- Package: Winter (DSG) (Multifunction steering wheel in leather, heated, with shift paddles - Without headlight cleaning system with washer fluid level indicator - Heated front seats)
- Towbar, foldable with electric release
- Wheels: Alloy wheels (4) "Nottingham" 7.5 J x 17 (tires 225/45 R17)
- Air conditioning system "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Seats: ergoActive front seats (lumbar support in front, electrically adjustable on the driver's side, massage function on the driver's side - seat center panels of the front seats and the outer rear seats in microfleece "ArtVelours Eco" - sport comfort seats in front - ergoActive driver's seat with electric adjustment, memory function and sliding thigh support)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	2nd wheel set	2 tyres (Winterreifen) - Worn - No deduction

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

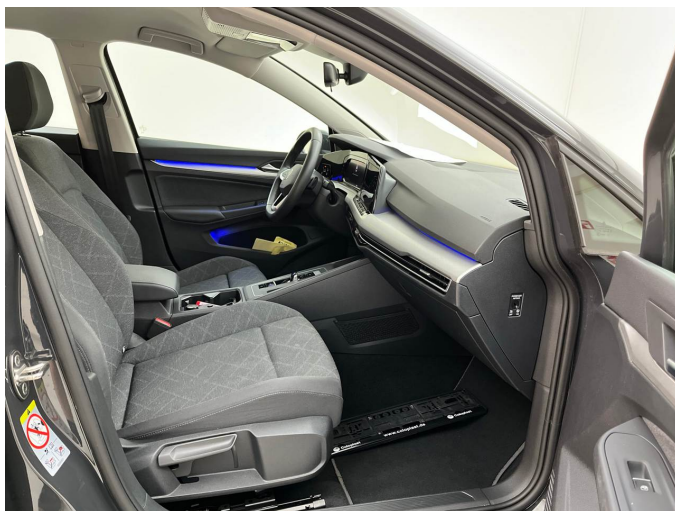


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

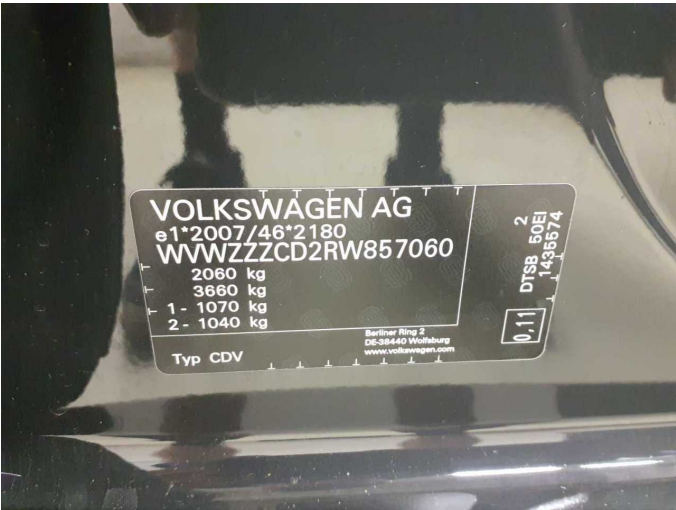


Figure 11: VIN



Figure 12: Mounted tyres

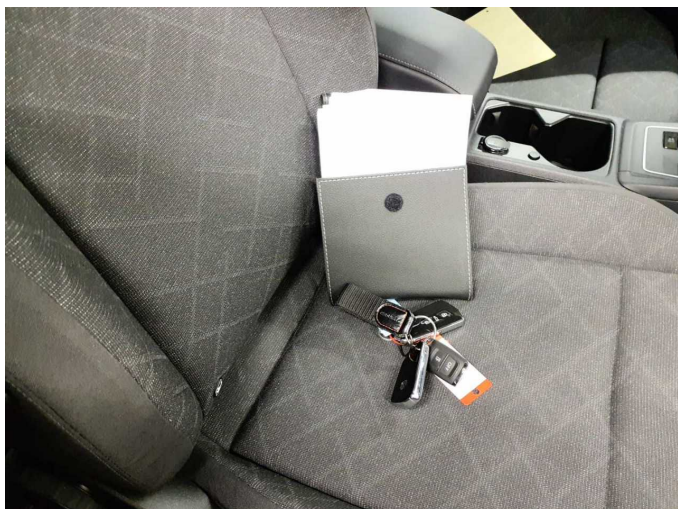


Figure 13: Documents

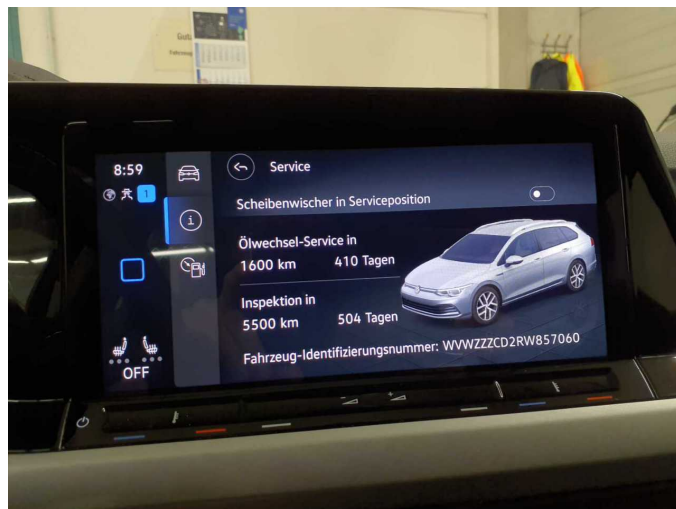


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

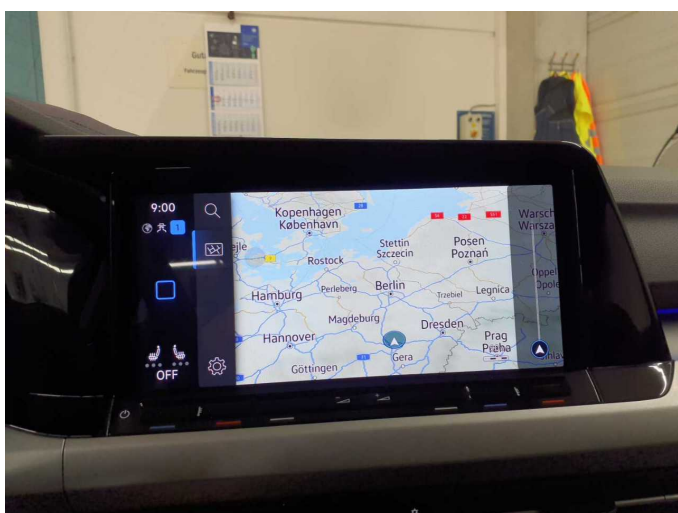


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Damage 1: 2nd wheel set: 2 tyres (Winterreifen) - Worn - No deduction



Damage 1: 2nd wheel set: 2 tyres (Winterreifen) - Worn - No deduction



Damage 1: 2nd wheel set: 2 tyres (Winterreifen) - Worn - No deduction



Damage 1: 2nd wheel set: 2 tyres (Winterreifen) - Worn - No deduction