



RENAULT MASTER: FH-425-LZ

Vinnumber:	VF1MA000862516472	Versionname:	RENAULT MASTER FG GCf Trac F3500 L3H2 dCi 130 Euro6 VU [4P] bvm 6-130CH-8cv (fourgon tA 1A@simple cabine)
First Registrationdate:	28/06/2019	Fiscalpower:	
Expertise Mileage:	153913	Power Kw:	96
Bodytype:	Transporter	Body colour:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Type of rims (mounted):	Steel		
Category:	Light Commercial Vehicle		

Options

Number of keys total	2	Tow bar	
Number keys remote	2	Radio	
Windows electric F		Central consol F	
Cruise Control		Roof rack	
Steering wheel multifunctional		Sliding door right-side	
Type of climate control	Manual climate control	Seat cover lining	Lining Leather

Tyres

	225/65/16/112 R			
Summer tyres:	Fr.L.	Falken: 55%	Fr.R.	Falken: 55%
	Re.L.	Falken: 35%	Re.R.	Michelin: 0%
Tyre profile depth FL				4.6
Tyre profile depth FR				4.5
Tyre profile depth RL				6.0
Tyre profile depth RR				9.0
Tyre size FL				225/65 R 16 112 R
Tyre size FR				225/65 R 16 112 R
Tyre size RL				225/65 R 16 112 R
Tyre size RR				225/65 R 16 112 R
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				Summer
Tyre make FL				1957074
Tyre make FR				1957074
Tyre make RL				1957074
Tyre make RR				261

Assistance equipment

Spare wheel	Yes	Jack	Yes
Steering wheel, Worn, Repair/replace (lump sum)			



Seat cover FR, Tear, Replace



Seat cover FL, Tear, Replace



Tyre RR, Out of tolerance, Replace



Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing L, Broken, Replace



Side panel moulding L, Scratch(es), Replace



Side panel L, Scratch(es), Paint



Side panel L, Scratch(es), Paint




Side panel moulding L, Broken, Replace



Side panel moulding L, Bad repair, Replace



Side panel moulding L, Bad repair, Replace

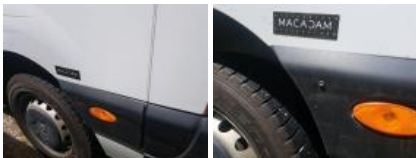

Side wall RL, Dent(s) and scratch(es), Repair and paint (complete)



Step L, Broken, Acceptable



Windscreen, Crack, Replace



Windscreen glue kit, Required to install glazing, Repair/replace (lump sum)



Side panel R, Dent(s), Repair and paint (complete)



Side panel moulding R, Missing, Replace



Side panel moulding R, Bad repair, Replace



Side panel moulding R, Bad repair, Replace



Side panel moulding R, Broken, Replace



Side panel R, Dent(s) and scratch(es), Repair and paint (complete)



Sliding door R, Dent(s) and scratch(es), Repair and paint (complete)



Outer sill R, Dent(s) and scratch(es), Replace and paint



Step R, Broken, Acceptable



Boot door panel RL, Adjust, Adjust



Bumper corner RL, Scratch(es), Repair and paint (complete)



Rear light L, Broken, Replace



Rear light R, Broken, Replace



Shutter / cover R, Broken, Replace



Boot door panel RR, Dent(s) and scratch(es), Repair and paint (complete)



Other exterior parts, Missing, Replace



Historique Maintenance

Immatriculation: **FH-425-LZ** Date de 1ère immatriculation: **28/06/2019**

Modèle: **Renault MASTER FG GCf Trac F3500 L3H2 dCi 130 Euro6 VU [4P] bvm 6-130CH-8cv (fourgon tôle simple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
31/03/2026	152.854	AUTO TINTENIAC SERVICES	PURGE CIRCUIT FREIN CTRL
	0		CABLES FREIN A MAIN RPLT
	0		CABLES FREIN A MAIN RPLT
	0		DISQUES PLAQUETTES AR RPLT
	0		LIQUIDE DE FREIN
	0		CABLES FREIN A MAIN RPLT
	0		CABLES FREIN A MAIN RPLT
24/01/2026	149.100	PLANCOET AUTOMOBILES	KIT ACCESSOIRES RPLT
	0		LAMPE CODE AVD RPLT
	0		RECYCLAGE
	0		DISQUES PLAQUETTES AV RPLT
	0		REVISION
	0		LIQUIDE DE REFROIDISSEMENT RPLT
	0		REVISION ET CLIM
17/10/2025	145.447	PLANCOET AUTOMOBILES	DISQUES PLAQUETTES AR RPLT
	0		RECYCLAGE
17/09/2025	143.337	DEKRA AUTOMOTIVE S.A	CONTRE VISITE CT
23/07/2025	141.800	PLANCOET AUTOMOBILES	ECLAIRAGE DE PLAQUE RPLT
	0		RECYCLAGE
21/07/2025	141.474	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
16/07/2025	141.100	PLANCOET AUTOMOBILES	RECYCLAGE
	0		LAMPE CODE AVD RPLT
14/11/2024	140.454	STE EXPLOITATION DU GARAGE HAMON	DIVERS
	0		DIVERS ECHAPPEMENT
	0		TELECHARGEMENT CALCULATEUR
01/07/2024	123.450	PLANCOET AUTOMOBILES	PLAQUETTES AR RPLT
	0		RECYCLAGE
	0		DISQUES PLAQUETTES AV RPLT
07/06/2024	121.240	DEKRA AUTOMOTIVE S.A	ANTI POLLUTION
22/04/2024	119.055	PLANCOET AUTOMOBILES	RECYCLAGE
	0		LAMPE CODE AVD RPLT
28/02/2024	115.840	PLANCOET AUTOMOBILES	LAMPE RPLT

Historique Maintenance

Immatriculation: **FH-425-LZ**

Date de 1ère immatriculation: **28/06/2019**

Modèle: **Renault MASTER FG GCf Trac F3500 L3H2 dCi 130 Euro6 VU [4P] bvm 6-130CH-8cv (fourgon tôle simple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
	0		LAMPE CODE AVD RPLT
	0		LIQUIDE DE FREIN
	0		RECYCLAGE
	0		REVISION ET CLIM ET AIR
04/08/2023	103.074	PLANCOET AUTOMOBILES	PLAQUETTES AR RPLT
	0		RECYCLAGE
	0		BALAISSUIE GLACE AV
	0		PLAQUETTES AV RPLT
	0		LAMPE RPLT
07/06/2023	97.568		CONTROLE TECHNIQUE
24/04/2023	94.365	PLANCOET AUTOMOBILES	BATTERIE RPLT
22/07/2022	75.022	PLANCOET AUTOMOBILES	ETRIERS AV RPLT
	0		DISQUES PLAQUETTES AR RPLT
	0		REVISION ET CLIM ET AIR ET CARBURANT
	0		DISQUES PLAQUETTES AV RPLT
12/02/2022	55.543	PLANCOET AUTOMOBILES	PLAQUETTES AR RPLT
	0		PLAQUETTES AV RPLT
	0		PLAQUETTES AV RPLT
14/06/2021	37.105	PLANCOET AUTOMOBILES	DISQUES PLAQUETTES AV RPLT
	0		BALAISSUIE GLACE AV
	0		REVISION ET CLIM
	0		RECYCLAGE
	0		ADBLUE
25/02/2021	28.868	PLANCOET AUTOMOBILES	PLAQUETTES AR RPLT
	0		PLAQUETTES AV RPLT