



Expertise

Protocol number: 46203538
Order No. / Reference: 26509697
Inspection date: 19 Jun 2026

Manufacturer: Volkswagen

Model: Touareg 3.0 V6 TDI SCR 4Motion Aut. R-Line

VIN: WVGZZZCR8RD021532



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touareg 3.0 V6 TDI SCR 4Motion Aut. R-Line	
Vehicle Identification number	WVGZZZCR8RD021532
Mileage (Read)	50,846 km
First registration	27 Jun 2024
Number of holders	1
Next periodical technical inspection	06/2027
(Report not on hand)	
Power / Engine displacement	210 kw / 2,967 ccm
Fuel type / Cylinder	Diesel / 6
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Grenadillschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Grey-Black
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	9,400 km
Last service on / at	03/2026 at 47,108 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HD513619
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / COC 00272		
Emission standard	EURO6;WLTP;EA;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	2,850 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	285/45 R20 108W	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	285/45 R20 108W	Summer tyres on Light alloy	Bridgestone	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	285/45 R20 112V	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	285/45 R20 112V	Winter tyres on Light alloy	Continental	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Turning and bad weather lights
- AdBlue tank with 24 l
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- Exterior mirror housings in body color
- third brake light
- Headliner in Soul Black
- Diesel particulate filter
- Stainless steel door sill trims, front with "R-Line" logo
- Driving profile selection
- Pedestrian protection measures expanded
- Luggage compartment cover with electric opening
- Tailgate with electric opening and closing
- rear window wiper
- Front headrests
- Stainless steel loading sill protector
- Dynamic headlight range control
- Lights: Dynamic high beam control "Dynamic Light Assist"
- Lights: IQ.LIGHT - HD matrix headlights with bad weather light
- Illuminated makeup mirrors in the sun visors
- Center console in high-gloss black, trim in dark anodized aluminum
- Non-smoking version
- Emergency call service
- Radio accessories: 8 speakers
- Tire pressure monitoring system
- Rear View reversing camera
- Headlight cleaning system
- Seat belts: Three-point automatic seat belts with belt tensioners for the outer rear seats
- Seats: Comfort seats in the front
- Seats: Rear bench seat and backrest asymmetrically split and foldable
- Seats: Front seats electrically adjustable, driver's seat with longitudinally adjustable thigh support
- Power outlets: 3 USB-C ports on the front
- Telephone interface
- Textile floor mats front and rear
- Traffic sign recognition
- Electronic immobilizer
- Luggage compartment closing aid
- Exhaust tailpipe left and right
- Airbag for driver and front passenger, with front passenger airbag deactivation
- white ambient lighting
- Automatic locking differential
- Electrically adjustable, folding and heated exterior mirrors
- Vehicle tool kit
- Chrome trim on the side windows
- Decorative inlays: Dark brushed aluminum
- Display: Active Info Display
- Electronic parking brake
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 8-speed automatic Tiptronic
- Back window, heater
- Rear headrests (3)
- Fuel tank with a capacity of 75 liters
- Steering wheel: Multifunction sports steering wheel in leather, heated, with paddle shifters
- Lights: Automatic headlight control, with LED daytime running lights
- Lights: LED taillights with welcome and farewell lights
- Armrest - centre, rear
- Fatigue detection and distraction detection
- Navigation system "Discover Pro Max"
- Emergency braking assistant "Front Assist"
- Park Assist system including parking aid
- Radio accessories: Digital radio reception DAB+
- Wheels: Tire Mobility Set
- Front windshield washer nozzles automatically heated
- Keyless Start system
- Seat belts: Warning tone and light for unfastened seat belts in the front and rear.
- Seats: Pneumatically adjustable lumbar support in the front
- Seats: Heated front seats
- Lane keeping assistant "Lane Assist"
- Start-stop system with brake energy recuperation
- Bumpers in "R" styling, bumper and door lower sections in body color
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus"
- Central locking including remote control



Extra equipment

- Airbag: Knee airbag on driver and front passenger side, side airbags for outer rear seats (airbag for driver and front passenger, with front passenger airbag deactivation, incl. knee airbag on driver & front passenger side - side airbags for the outer rear seats, incl. front side airbags and head airbag system)
- Package: "Comfort" R-Line (Easy Open & Close - Electrically adjustable, folding, heated and dimming exterior mirrors with memory function - Anti-theft alarm system with interior monitoring, backup horn and tow-away protection - Driving profile selection - Standard rear axle - 90L fuel tank - Electrically adjustable steering column with memory function - Air suspension - Keyless Access - All-wheel steering - Electrically adjustable front seats with memory function - Heated front seats and outer rear seats - Auxiliary heater)
- Package: Leather package "Varenn" for R-Line (seat center panels and inner side bolsters of the front and outer rear seats in "Varenn" leather, "R-Line" logo on the front)
- Package: Travel package (230V socket in the luggage compartment - luggage net - luggage compartment reversible mat - luggage compartment floor incl. luggage management system with sliding fixing strap and rod on rails - illuminated make-up mirror in the double sun visors - net partition - sunshade roller blind on the rear door windows)
- Electrically folding towbar including trailer maneuvering assistant "Trailer Assist"
- black roof rails
- Air conditioning "Air Care Climatronic" (active combination filter - 4-zone climate control - rear controls)
- Paint finish: Metallic
- Package: "IQ.DRIVE" assistance package (Adaptive Cruise Control ACC "stop & go", with speed limiter - Three-point automatic front seat belts with height adjustment and belt tensioners, for proactive occupant protection system - "Travel Assist" driving assistant and "Lane Assist" lane keeping assistant - Intersection Assist - Proactive occupant protection system - "Side Assist" lane change assistant)
- Package: Connectivity Package incl. App-Connect Wireless (3 USB-C ports in the front, 2 USB-C charging ports in the rear of the center console; charging power up to 45 W - App-Connect Wireless for Apple CarPlay and Android Auto - phone interface with inductive charging function)
- Wheels: Alloy (4) "Nevada" 9 J x 20, in black, Volkswagen R (tires 285/45 R 20)
- Windows: Laminated safety glass, noise-reducing, for side windows (rear and rear side windows tinted)
- "Dynaudio Consequence" sound system (16-channel amplifier, 12+1 speakers, subwoofer, 730 watts total power)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim (Clip) - Broken / torn - Replace
2	Rear bumper	Rear bumper - Scratched - Smart repair
3	Door - rear right side	Brightware - lower - Scratched - Smart repair

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer	1.020,72 €



Repainting

No. Repainting

1 Door - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - rear right side 173 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

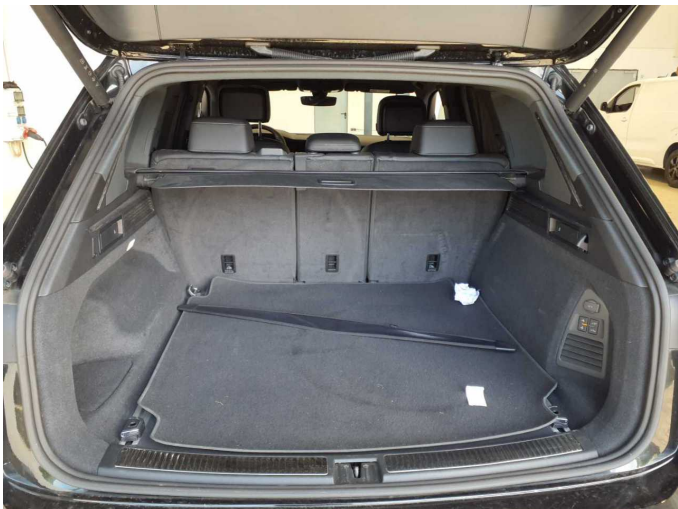


Figure 11: Cargo area



Figure 12: VIN



Figure 13: Mounted tyres

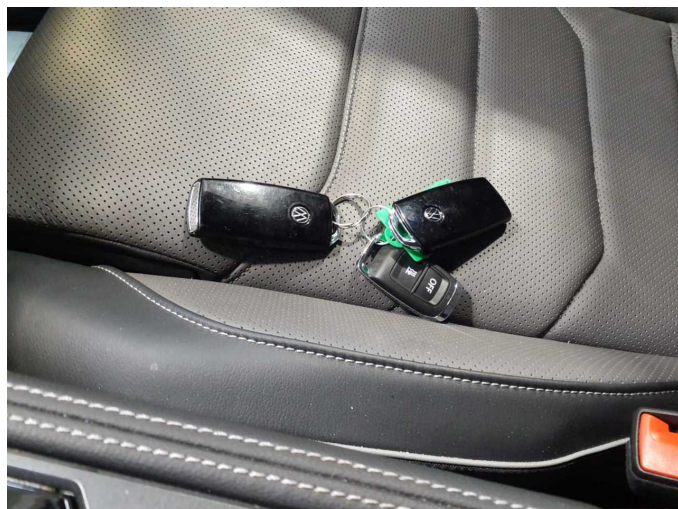


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

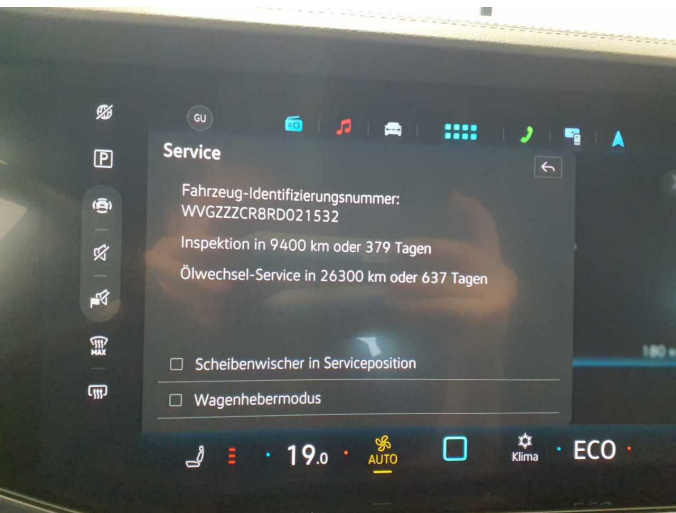


Figure 20: Misc.



Figure 21: Misc.

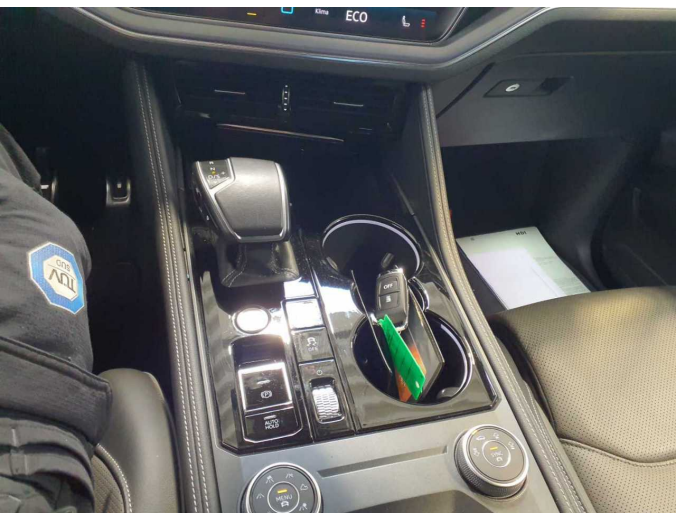


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

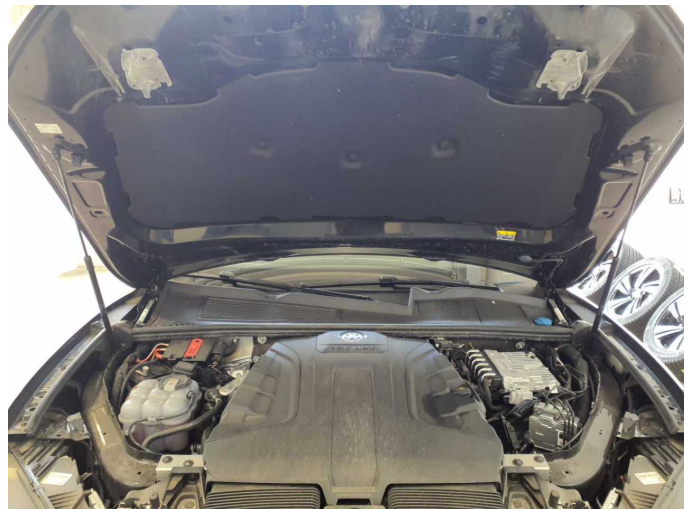


Figure 28: Misc.

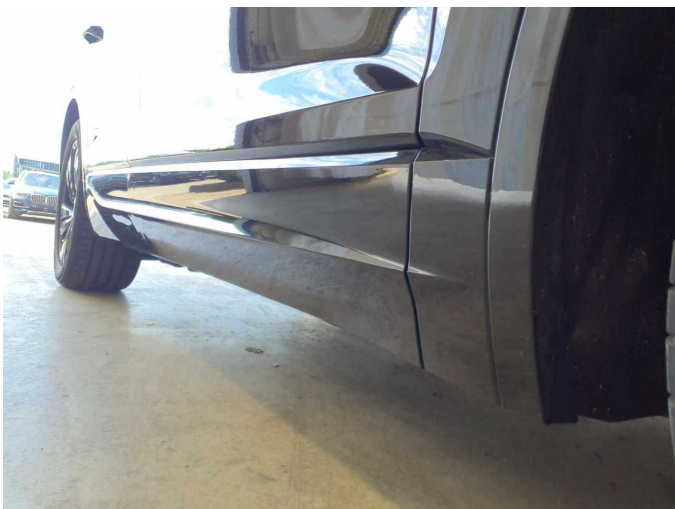


Figure 29: Misc.




Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.

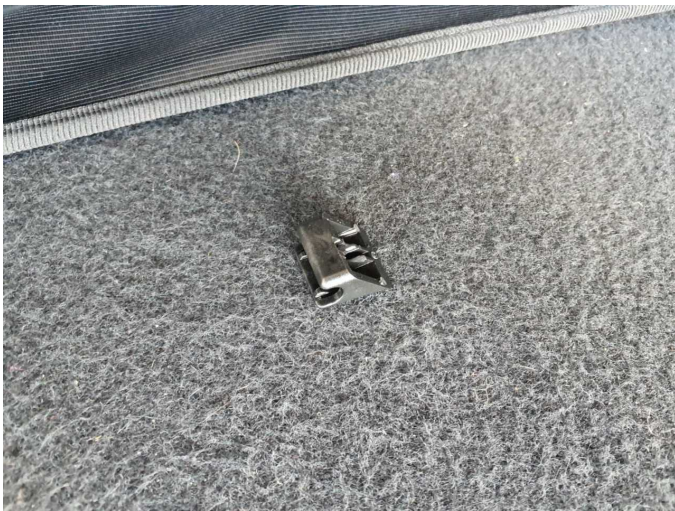

Damage 1: Trim / covers: Boot lid - interior trim (Clip) - Broken / torn - Replace

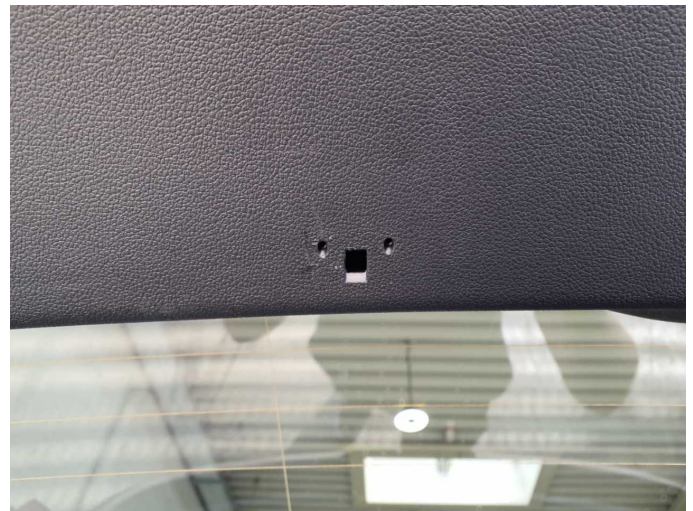

Damage 1: Trim / covers: Boot lid - interior trim (Clip) - Broken / torn - Replace



Damage 1: Trim / covers: Boot lid - interior trim (Clip) - Broken / torn - Replace



Damage 2: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 3: Door - rear right side: Brightware - lower - Scratched - Smart repair



Damage 3: Door - rear right side: Brightware - lower - Scratched - Smart repair



Repainting 1: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZCR8RD021532

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touareg 3.0 V6 TDI 4Motion DPF
Aut. R-Line

Datum	KM-Stand	Beschreibung
18.03.2026	47.108	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
04.07.2025	30.020	Regelwartungsdienst
28.03.2025	23.589	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges