



Expertise

Protocol number: 46531705  
Order No. / Reference: 26679426  
Inspection date: 10 Jul 2026

Manufacturer: Ford

Model: S-Max 2.0 EcoBlue Allrad Aut. ST-LINE

VIN: WF0JXXWPCJNS88999



| Vehicle details                            |                    |
|--------------------------------------------|--------------------|
| Manufacturer / Type / Model / Equipment    |                    |
| Ford S-Max 2.0 EcoBlue Allrad Aut. ST-LINE |                    |
| Vehicle Identification number              | WF0JXXWPCJNS88999  |
| Mileage (Read)                             | 120,551 km         |
| First registration                         | 5 May 2022         |
| Number of holders                          | 1                  |
| Power / Engine displacement                | 140 kw / 1,995 ccm |
| Fuel type / Cylinder                       | Diesel / 4         |
| Gearbox / Number of gears                  | Automatic / 8      |
| Type of drive                              | All-wheel drive    |
| Type of vehicle                            | Van                |
| Colour / colour code                       | Chroma-Blau        |
| Doors / Seats                              | 5 / 7              |
| Upholstery type                            | Leather            |
| Colour of upholstery                       | Black-Anthracite   |



| Vehicle details                              |                              |                         |                                                            |
|----------------------------------------------|------------------------------|-------------------------|------------------------------------------------------------|
| Maintenance booklet / proof                  | digital proof / complete     | Next maintenance in     |                                                            |
| Last service on / at                         | 05/2026 at 118,780 km        |                         |                                                            |
| Key is / should be                           | 2 / 2                        | FZG documents           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                              |                              | Letter No.              | GK799432                                                   |
| Previous damage / Accident                   | Detectable                   | Repainting              | Detectable                                                 |
| Inspection conditions                        | sufficient                   | Lifting equipment / pit | No                                                         |
| Test drive                                   | Not performed                | Engine function test    | Performed                                                  |
| Manufacturer key number/<br>type code number | 8566 / BQS 00235             |                         |                                                            |
| Emission standard                            | EURO6;WLTP;AP;PI/CI; M, N1 I | fine dust sticker       |                                                            |
| Permitted total weight                       | 2,635 kg                     | Empty weight            |                                                            |

| Tyres            |                 |                             |              |             |
|------------------|-----------------|-----------------------------|--------------|-------------|
| Mounted tyres    |                 |                             |              |             |
| #                | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 235/50 R18 101Y | Summer tyres on Light alloy | Continental  | 5mm / 5mm   |
| 2)               | 235/50 R18 101Y | Summer tyres on Light alloy | Michelin     | 4mm / 4mm   |
| Additional tyres |                 |                             |              |             |
| #                | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 235/55 R17 103V | Winter tyres on Light alloy | Nokian       | 1mm / 1mm   |
| 2)               | 235/55 R17 103V | Winter tyres on Light alloy | Nokian       | 7mm / 7mm   |

| Replacement |           |                         |              |             |
|-------------|-----------|-------------------------|--------------|-------------|
| Typ         | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|             | Tirefit   | Expiration date 03/2026 |              |             |

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment



## Standard equipment

- Storage compartments
- Ambient lighting in the front (including door storage, front door handle and footwell lighting)
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated turn signals and ambient lighting and electrically foldable)
- Attachment points for safety partition grilles (attachment points 2nd row of seats)
- Hill start assist
- Body styling kit (front apron in special design and painted in body color - rear apron painted in body color with glossy black diffuser (not in conjunction with trailer hitch, removable) - fog lights with LED technology with glossy black painted surround - radiator grille (upper and lower part) in special honeycomb design, painted glossy black)
- Roof rails, black
- Diesel particulate filter (DPF)
- Front door sill trims with ST-Line design
- Driver information system display 25.4 cm color (on-board computer with fuel consumption and mileage information as well as outside temperature display)
- Chassis: Sport chassis
- Electric front and rear windows (with anti-pinch protection and automatic opening and closing function)
- Electronic parking brake
- Ford EasyFold: 2nd row seat backrests fold down electrically at the touch of a button.
- Ford Power Start function (keyless start)
- Ford Power Start function with Ford Key Free system (keyless starting and locking/unlocking)
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission (with manual shift option)
- Back window, heater
- Rear spoiler
- Interior mirror, automatically dimming
- Isofix mounting (on all seats in the 2nd row)
- Electric child safety lock
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Steering wheel: Steering column, adjustable in height and reach
- Steering wheel: Multifunction leather steering wheel
- Front and rear reading lights (with LED technology)
- MyKey key system (individually programmable second key) (setting options include: - Limiting the maximum speed and radio volume (to max. volume 15 out of 32) - Speed warning (when the set speed limit is exceeded) - Safety assistance systems cannot be deactivated - Extended warning system for unfastened seat belts)
- Fog light
- All-wheel drive (electronically controlled (permanently controlled torque distribution))
- Anti-lock braking system (ABS) (with Electronic Stability Program (ESP), Roll Stability Control (RSC) and Traction Control System (TCS))
- Attachment points for safety partition grilles (attachment points 1st row of seats)
- Tires: 7.5 J x 18 alloy wheels (4) with 235/50 R 18 tires (10-spoke design in pearl grey premium paint finish, diamond-turned; with matte black pockets)
- third brake light
- Brake calipers, painted red
- Black woven fabric headliner
- Overhead console (with glasses storage compartment and fold-out additional mirror for eye contact with rear passengers)
- Tachometer
- Electronic Shifter
- Lane Assist including Lane Keeping Assist and Driver Alert (warns the driver of an unintentional lane change via short steering wheel vibrations (without activation of the turn signal) - additionally, active steering support assists in returning to the lane)
- High Beam Assist
- Ford Easy Fuel (The Ford Easy Fuel convenience refueling system eliminates the need for a separate internal fuel filler cap and prevents misfueling by detecting the size difference between petrol and diesel nozzles. The filler neck only opens when the correct fuel is used.)
- Luggage compartment cover (removable)
- Cruise control system with intelligent speed limiter (interior mirror, automatically dimming - traffic sign recognition system)
- rear window wiper
- Interior lighting with delay circuit
- Intelligent Protection System (IPS): - Front headrests, 4-way height and tilt adjustable - Front airbag for driver and front passenger - Driver's knee airbag - Head and shoulder airbags, front and for 2nd row of seats - Side airbag for driver and front passenger - Side airbag for outer rear seats of the 2nd row - Seat belt tensioners and belt force limiters, front - 3-point seat belts on all seats, height adjustable in the front)
- Steering wheel: Paddle shifters on the steering wheel
- Front center console with padded armrest (storage compartment and 2 cup holders)



- Emergency brake light (pulsating illumination of the brake lights during hard braking)
- Package: Winter (Heated windscreen - Heated leather steering wheel - Individually and variably heated front seats)
- Front and rear parking pilot system
- Upholstery: Leather/fabric in suede look (seat center panels in fabric (suede look) and seat bolsters in leather - driver's seat, 10-way electrically adjustable with memory function - passenger seat, 10-way electrically adjustable)
- Headlight dipped beam with switch-off delay including "greeting function"
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Seats: Front sports seats (with enhanced lateral support)
- Seats: Front seats can be heated individually and variably.
- Start-stop system
- 230 volt socket
- Bumpers painted in body color
- Trays on the front seatbacks
- Premium carpet floor mats front and rear (as well as in the 3rd row of seats if ordered as an optional extra)
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats (as well as the 3rd row of seats if ordered as an optional extra)
- Cigarette lighter (and ashtray in the center console)

### Extra equipment

- Air conditioning with automatic temperature control (3 zones) (separately adjustable for driver and front passenger side as well as rear)
- Panoramic roof (non-opening) (sun protection blinds integrated into the rear side doors - windshield and panoramic roof with "Solar-Reflect" heat protection)
- Upholstery: Premium leather (seat center panels and door inserts in leather - exterior mirror, driver's side, automatically dimming - driver's seat, 10-way electrically adjustable with memory function - passenger seat, 10-way electrically adjustable)
- Seats: 3rd row of seats with 2 individual seats (Easy FoldFlat System) (seat backrests can be folded down individually at the touch of a button and folded up manually - headrests can be lowered - easy entry to the 3rd row of seats (Easy Entry) - reading lights in the 3rd row of seats, LED)

- Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect (communication and entertainment with voice control - Android Auto, Apple CarPlay - Bluetooth hands-free system and audio streaming - eCall emergency call system - live traffic - Wi-Fi hotspot - radio/CD player, 2 USB ports, 8 speakers, steering wheel controls - 20.3 cm screen - DAB/DAB+ - acoustic and visual route guidance, dynamic navigation, lane keeping assist, road map for Europe - extended voice control and voice output - Michelin travel guide for Europe - quick address search)
- Pedal assembly with aluminum pads
- Tire repair kit (for use at a maximum speed of 80 km/h)
- Tire Pressure Monitoring System (TPMS)
- LED taillights
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Flexible seating system "FoldFlatSystem (FFS)" (2nd row of seats with 3 individual seats - adjustable longitudinally - seat backrests adjustable for tilt and individually foldable - headrests retractable)
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- LED daytime running lights
- Traffic sign recognition system
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control (remote luggage compartment release - second folding vehicle key)

- Paint finish: Metallic
- Package: Business III (Automatic) (Sony Navigation incl. Ford SYNC 3, AppLink, Touchscreen, Voice Control, Radio/CD Player, MP3-compatible, 2 USB ports, 390-watt premium sound system, 12 speakers, steering wheel remote control, Bluetooth hands-free system, FordPass Connect, eCall, DAB/DAB+, Adaptive LED headlights with glare-free high beam, ACC, Traffic Jam Assist, Pre-Collision Assist, Forward Collision Warning, Emergency Brake Assist, Front and Rear View Camera, Blind Spot Assist, Cross Traffic Alert, Dynamic Distance Control, Power Tailgate with Sensors, Ford Key Free System, Park Assist)
- Sunshades in the rear side doors (manual)



## Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |

## Value reducing factors

| No. | Component group              | Description                                        |
|-----|------------------------------|----------------------------------------------------|
| 1   | Equipment                    | Tirefit filler - Expired - Replace                 |
| 2   | Boot lid / rear door         | Boot lid - Glued / labelled - De-glue / neutralise |
| 3   | Side panel - rear right side | Sill - Scratch(es) - Smart repair                  |
| 4   | Sill - left side             | Trim - Scratched - Paint                           |
| 5   | Vehicle glazing              | Windscreen - Damaged - Replace                     |

## Wear and tear

| No. | Component group | Description                         |
|-----|-----------------|-------------------------------------|
| 1   | Bonnet          | Bonnet - Stone chips - No deduction |
| 2   | 2nd wheel set   | 2 tyres - Worn - No deduction       |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Previous damages

| No. | Previous damage                                           | Extent of damage (Net) |
|-----|-----------------------------------------------------------|------------------------|
| 1   | Side right, Provided by user / customer, from 21 May 2026 | 3.182,51 €             |

## Repainting

| No. | Repainting                                                                               |
|-----|------------------------------------------------------------------------------------------|
| 1   | Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent   |
| 2   | Door - rear right side, Professionally carried out, Invoice of repair done Non-existent  |
| 3   | Door - front right side, Professionally carried out, Invoice of repair done Non-existent |

## Paint coat thickness measurement

|                         |        |                        |        |
|-------------------------|--------|------------------------|--------|
| Mudguard - right side   | 234 µm | Door - rear right side | 209 µm |
| Door - front right side | 366 µm |                        |        |



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

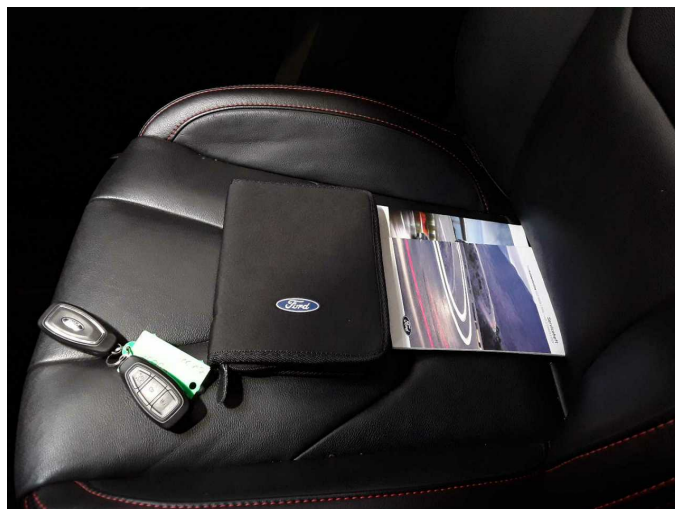


Figure 14: Documents



Figure 15: Additional tyres

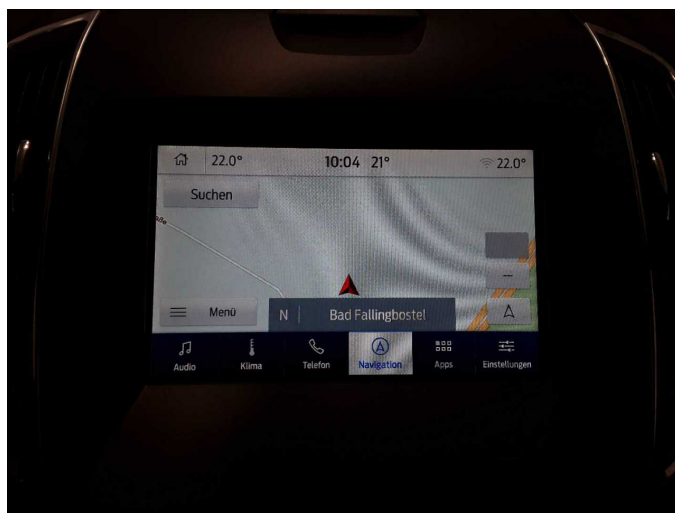


Figure 16: Navigation



Figure 17: Misc.

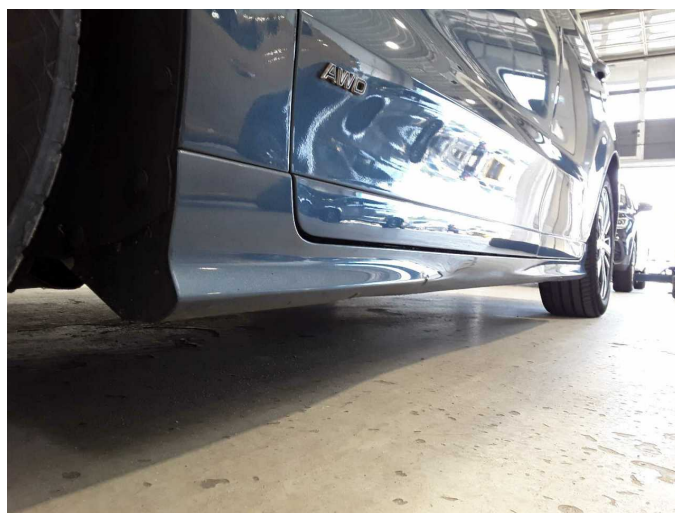


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

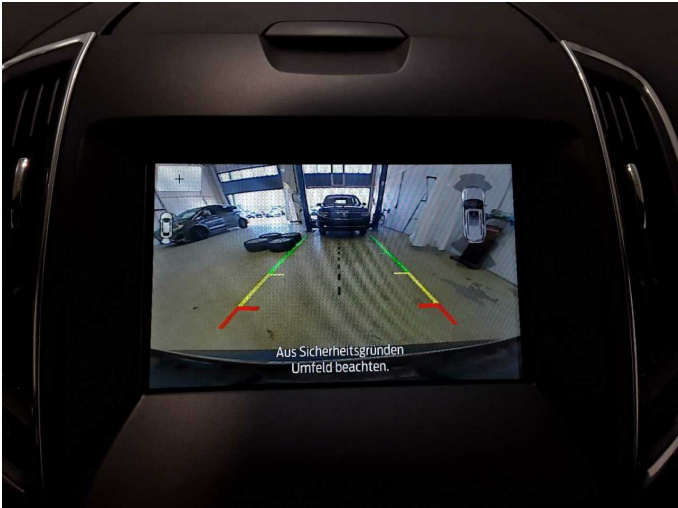


Figure 22: Misc.



Figure 23: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace




**Damage 2:** Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise




**Damage 2:** Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



**Damage 3:** Side panel - rear right side: Sill - Scratch(es) - Smart repair

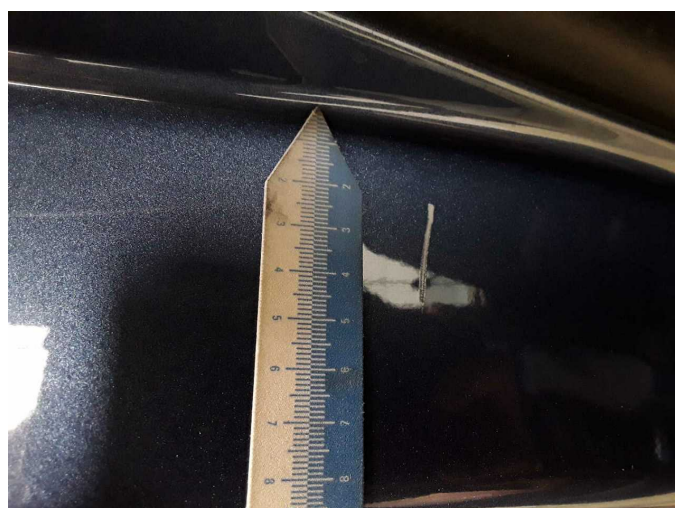

**Damage 3:** Side panel - rear right side: Sill - Scratch(es) - Smart repair

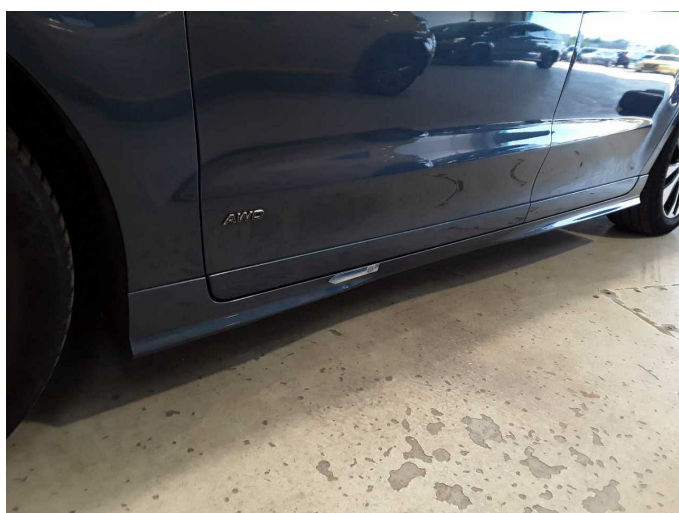

**Damage 4:** Sill - left side: Trim - Scratched - Paint



**Damage 4:** Sill - left side: Trim - Scratched - Paint



**Damage 5:** Vehicle glazing: Windscreen - Damaged - Replace




**Damage 5:** Vehicle glazing: Windscreen - Damaged - Replace



**Wear and tear 2:** 2nd wheel set: 2 tyres - Worn - No deduction



**Wear and tear 2:** 2nd wheel set: 2 tyres - Worn - No deduction

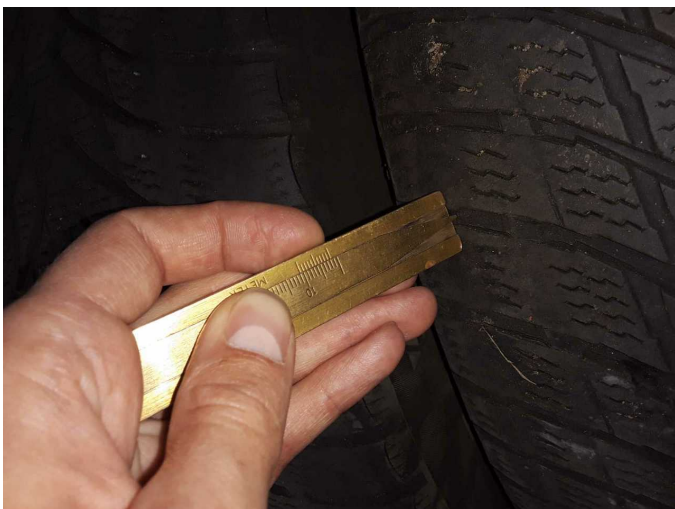


**Wear and tear 2:** 2nd wheel set: 2 tyres - Worn - No deduction



**Repainting 1:** Mudguard - right side




**Repainting 1:** Mudguard - right side

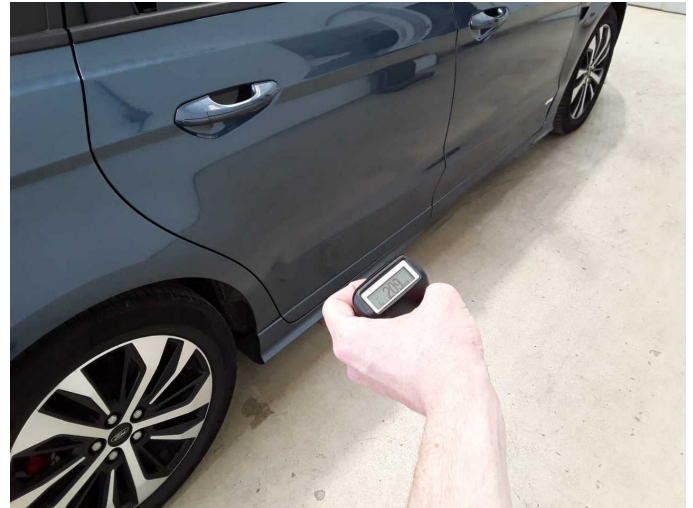

**Repainting 2:** Door - rear right side



**Repainting 2:** Door - rear right side

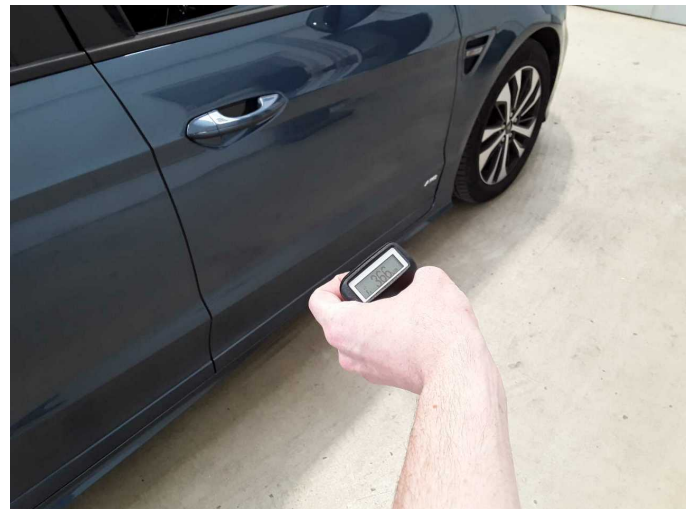

**Repainting 3:** Door - front right side



**Repainting 3:** Door - front right side



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0JXXWPCJNS88999

Hersteller / Modell: FORD FORD S-Max 2.0 EcoBlue Allrad Aut. ST-LINE

| Datum      | KM-Stand | Beschreibung                                                                                                                                                                                         |
|------------|----------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 20.05.2026 | 118.780  | Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                |
| 04.02.2025 | 88.810   | Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges |
| 07.01.2025 | 87.600   | Batterie ern; Systemtest/Eigendiagnose                                                                                                                                                               |
| 07.05.2024 | 75.208   | Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten                                                                                                                 |
| 15.08.2023 | 60.175   | Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                |
| 28.11.2022 | 30.102   | Motoröl b. Wartung; Regelwartungsdienst                                                                                                                                                              |