



Expertise

Protocol number: 46639241
Order No. / Reference: 26687401
Inspection date: 21 Jul 2026

Manufacturer: Volkswagen

Model: ID.4 GTX

VIN: WVGZZZE2ZNP051196



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.4 GTX	
Vehicle Identification number	WVGZZZE2ZNP051196
Mileage (Read)	87,666 km
First registration	2 Sept 2022
Number of holders	1
Fuel type	Electric
Power	77 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Mangangrau Metallic / Dach Schwarz
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Dark grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	38 Tag(e)
Last service on / at	08/2024 at 49,423 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM613970
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLR 00019		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,750 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	255/50 R19 103T	Winter tyres on Light alloy	Bridgestone	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 100T	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	255/45 R20 101T	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports at the front, 2 USB-C charging ports at the rear of the center console
- Airbags: Front and rear head airbags, front side airbags, center airbag
- 30-color ambient lighting
- Adaptive Cruise Control (ACC) "stop & go" including speed limiter
- black roof rails
- Black surround for the infotainment display and central controls
- Driving profile selection
- Transmission: 1-speed automatic
- rear window wiper
- ISOFIX mounting points for child car seats
- Front and rear headrests (5)
- Mode 3 Type 2 charging cable, 16 A
- Charging: Maximum DC charging power depends on the traction battery.
- Steering wheel: Multifunction leather steering wheel, heated, with touch controls
- Fatigue detection
- Emergency call service
- Stainless steel pedals in a "Play/Pause" design
- Radio "Ready 2 Discover"
- Radio accessories: 6 + 1 speakers
- Rain sensor
- Wheels: "Ystad" alloy wheels 8 J x 20 front, 9 J x 20 rear, in black, polished finish
- Front windshield washer nozzles automatically heated
- electromechanical power steering
- Seats: Armrest for front seats
- Seats: Rear seat backrest asymmetrically split and foldable, with pass-through and center armrest
- Voice control
- Bumpers in a sporty design
- Engine underguard
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Turning brake function and evasive steering support
- Airbag for driver and front passenger, with front passenger airbag deactivation
- Permanent 4MOTION all-wheel drive
- App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- Car2X
- e-Sound
- Parking assistance
- ESP Electronic Stability Program
- Windscreen made of laminated safety glass
- Back window, heater
- Interior mirror automatically dimming
- Air conditioning system "Air Care Climatronic"
- Paint finish: Solid color, with differing roof color
- Charging: 11 kW AC charging power (alternating current)
- LED matrix headlights - IQ.LIGHT
- The strip between the headlights is illuminated.
- Makeup mirrors in the sun visors
- Variable center console
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Upholstery: Seat center panels of the front seats and the outer rear seats in "GTX" fabric
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- LED taillights: 3D LED taillights with dynamic turn signals
- Windows: Rear side windows and rear window tinted
- Keyless Start system
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Heated front seats
- Seats: Front seats with height adjustment
- Lane keeping assistant "Lane Assist"
- Telephone interface
- Ambient lighting with logo projection
- Traffic sign recognition
- Central locking including remote control



Extra equipment

- Interior Top-Sport "Plus" with black steering wheel (electrically adjustable, folding and heated exterior mirrors with passenger-side mirror lowering function; pneumatically adjustable lumbar support in front with massage function; seat center panels of the front seats and outer rear seats in microfleece "ArtVelours"; ambient lighting with logo projection; ergoActive front seats with electric adjustment, memory function and sliding thigh support)
- Package: Comfort Package "Plus" (2 USB-C ports in front, 2 USB-C charging sockets in rear center console - Windscreen in laminated safety glass, wirelessly heated and infrared-reflecting, noise-insulating - Luggage net - Luggage compartment floor - Air Care Climatronic with active combination filter and 3-zone temperature control - Variable center console - Leather multifunction steering wheel, heated, with touch controls - Cargo net partition - Without headlight cleaning system with washer fluid level indicator - Rain sensor - Automatically heated windscreen washer nozzles - Heated front seats)
- Automatic distance control ACC "stop & go"
- Foldable towbar (electric release)
- Package: Assistance Package (GTX) (Anti-theft alarm system with interior monitoring, backup horn and tow-away protection - Illuminated strip between the headlights and door handle recesses - "Park Assist Plus" parking assistant including parking aid - Proactive occupant protection system in conjunction with "Front Assist" - "Rear View" reversing camera - "Keyless Access" keyless locking and starting system with safe locking)
- Package: Infotainment package "Plus" (Head-up display - Navigation system "Discover Pro" - Radio "Ready 2 Discover Max" - Telephone interface "Comfort" with inductive charging function - Sound system, 6 speakers, digital 12-channel amplifier, subwoofer, 450 watts total power)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Broken / torn - Replace
2	Door - front left side	Door (Schleifspuren im Lack) - Unprofessionally repaired - Repair and paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Door - rear left side, Door - rear right side, Door - front left side, Door - front right side

Paint coat thickness measurement

Door - rear left side	146 µm	Door - rear right side	163 µm
Door - front left side	161 µm	Door - front right side	156 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

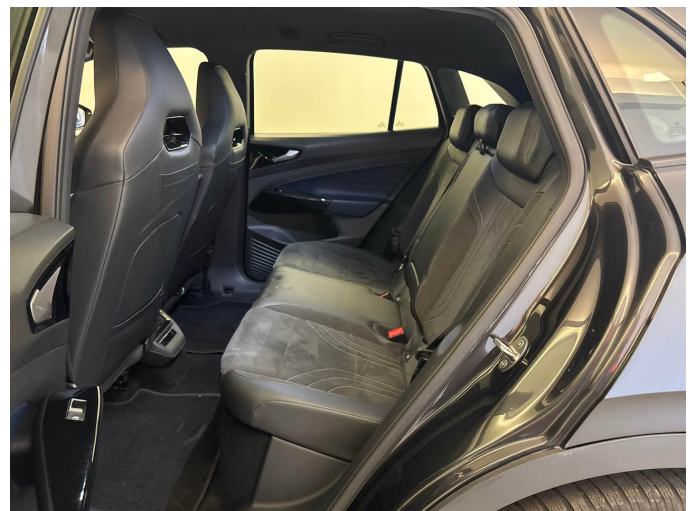


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

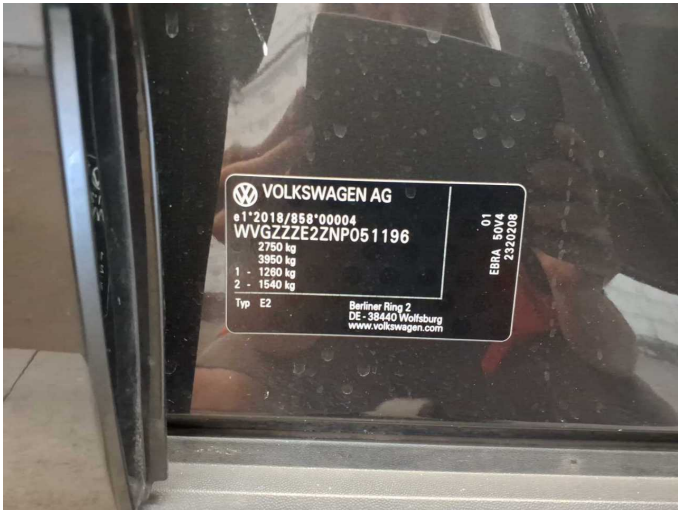


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

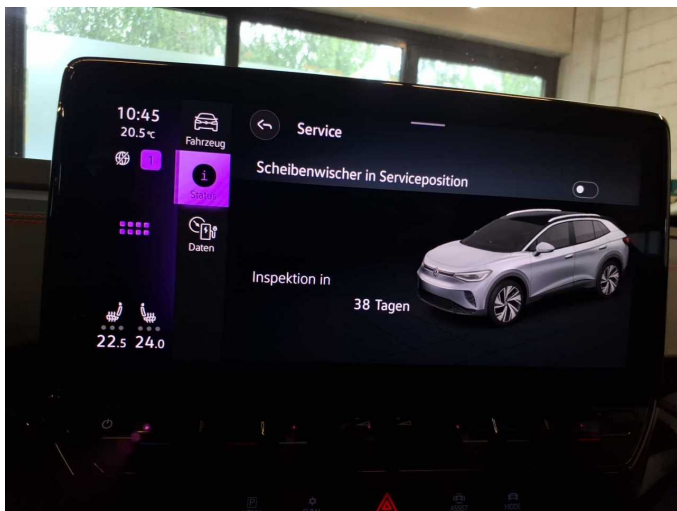


Figure 15: Documents



Figure 16: Additional tyres

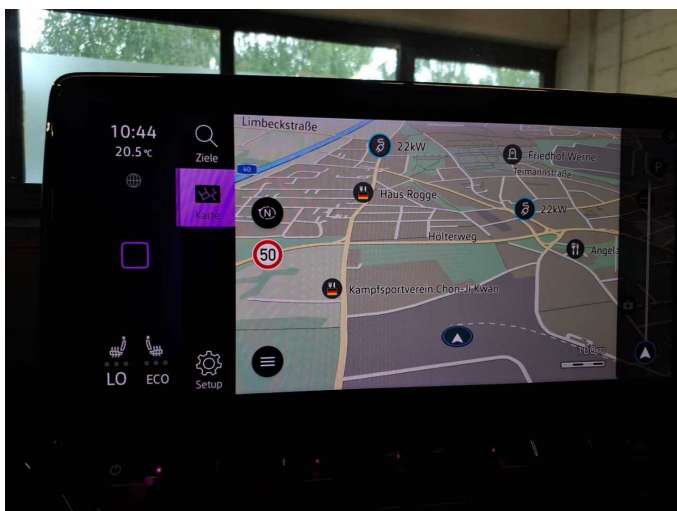


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

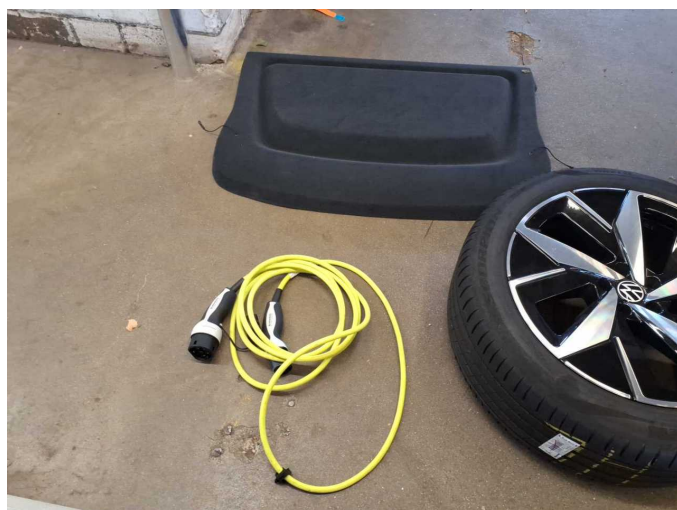


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

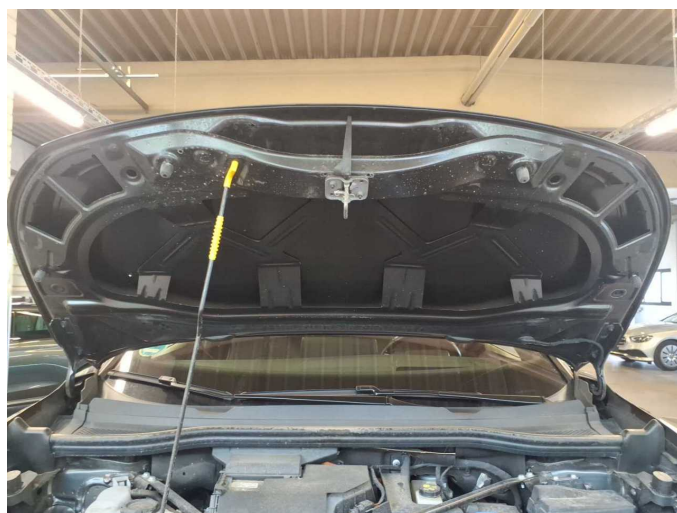


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.




Damage 1: Trim / covers: Floor mats - Broken / torn - Replace



Damage 1: Trim / covers: Floor mats - Broken / torn - Replace



Damage 2: Door - front left side: Door (Schleifspuren im Lack) - Unprofessionally repaired - Repair and paint

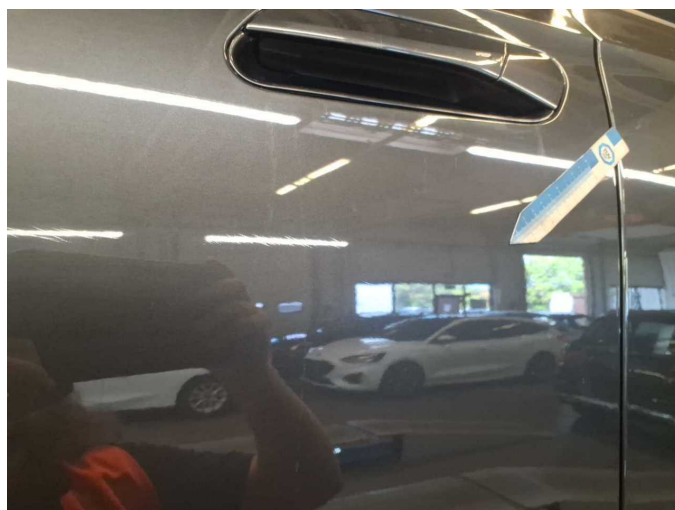

Damage 2: Door - front left side: Door (Schleifspuren im Lack) - Unprofessionally repaired - Repair and paint




Damage 2: Door - front left side: Door (Schleifspuren im Lack) - Unprofessionally repaired - Repair and paint




Damage 2: Door - front left side: Door (Schleifspuren im Lack) - Unprofessionally repaired - Repair and paint



Damage 2: Door - front left side: Door (Schleifspuren im Lack) - Unprofessionally repaired - Repair and paint

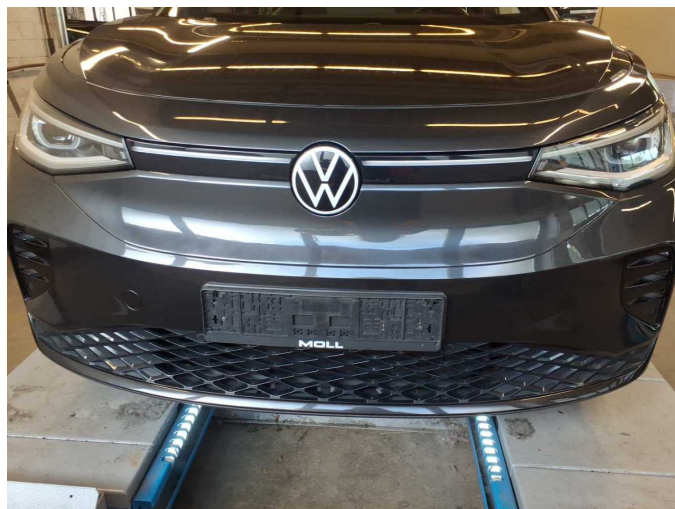


Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction

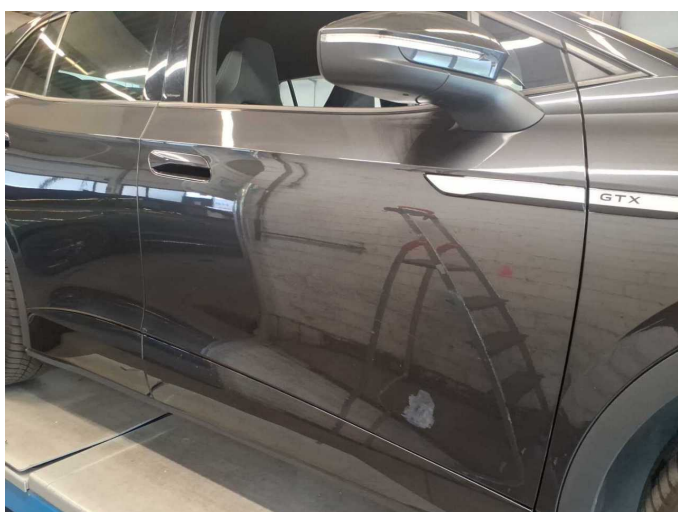

Repainting 1: Door - rear left side, Door - rear right side, Door - front left side, Door - front right side




Repainting 1: Door - rear left side, Door - rear right side, Door - front left side, Door - front right side

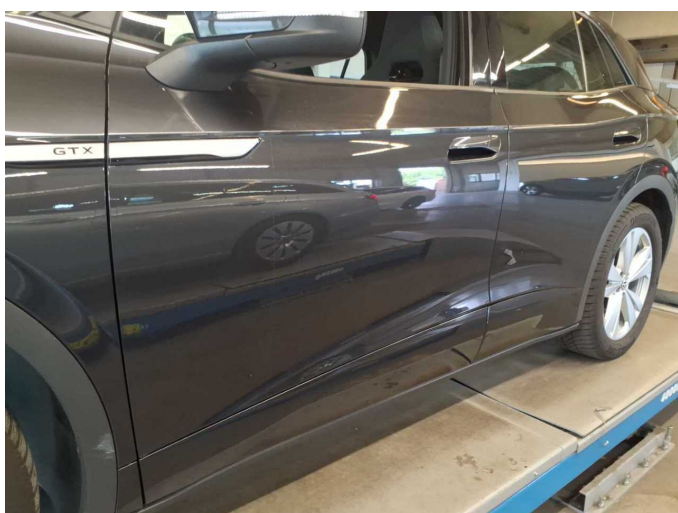

Repainting 1: Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Door - rear left side, Door - rear right side, Door - front left side, Door - front right side

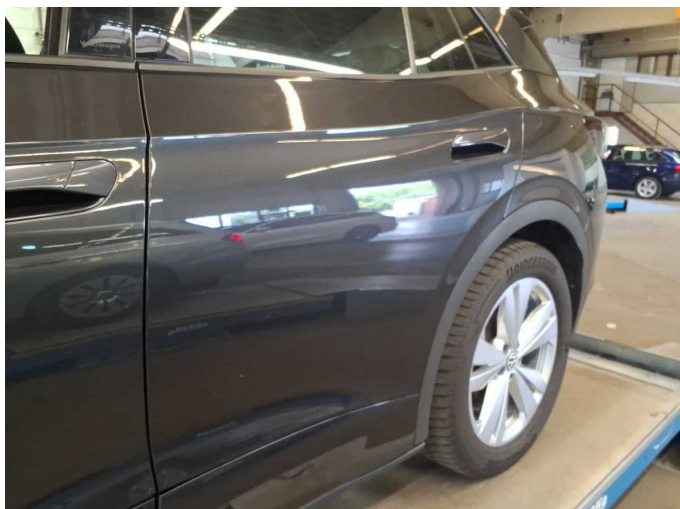

Repainting 1: Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZE2ZNP051196

Hersteller / Modell: VOLKSWAGEN VW ID.4 GTX

Datum	KM-Stand	Beschreibung
30.08.2024	49.423	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst