



Expertise

Protocol number: 46058405
Order No. / Reference: 26539954
Inspection date: 19 Jun 2026

Manufacturer: Ford

Model: Grand Tourneo Connect 1.5 EcoBlue Start/Stop Trend

VIN: WF0UXXWPGULT31182



Vehicle details

Manufacturer / Type / Model / Equipment	
Ford Grand Tourneo Connect 1.5 EcoBlue Start/Stop Trend	
Vehicle Identification number	WF0UXXWPGULT31182
Mileage (Read)	238,433 km
First registration	1 Feb 2021
Number of holders	1
Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frost-Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	59 %
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FZ450068
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BLK 00284		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,380 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Michelin	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	205/60 R16 96H	Summer tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Battery, reinforced
- Hill start assist
- On-board computer
- Diesel particulate filter (DPF)
- Electronic Safety and Stability Program (ESP)
- Rear power windows, right and left, electric
- Front electric windows with one-touch down function for the driver's side
- Cruise control
- Transmission: 6-speed manual transmission
- Rear swing door including heated rear window and wiper/washer system
- Intelligent battery management system
- Isofix bracket
- Headrests 2 front, height adjustable
- Paint finish: Solid
- Front center console, open, with storage area
- Emergency brake light
- Pre-Collision Assist
- Tire repair kit, space and weight saving
- Windscreen wipers with rain sensor
- Black plastic side protection strips
- Safety Brake Assist (EBA)
- Sun visor with mirror on driver and passenger side (for drivers with ticket holder)
- Concealed storage compartment on dashboard
- Power outlet: 12-volt connection on the center console, front and rear
- Front bumper painted in body color
- Carpet floor mats for the front (2-piece set)
- Traffic sign recognition system
- Immobilizer EPATS
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front
- Electrically adjustable and heated exterior mirrors
- Black exterior mirror caps (plastic)
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R 16 tires and wheel lock
- Front overhead storage compartment
- Third brake light
- Lane keeping assist including lane keeping assist and driver fatigue warning
- Ford EcoSelect: a selectable driving mode
- FordPass Connect including live traffic information and Wi-Fi hotspot
- Glove compartment with lid
- Interior lighting for passenger/cargo compartment
- Interior lighting front and rear with delay function
- Intelligent security system
- Rear headrests (3)
- Radiator grille with 5 crossbars, black plastic
- Adjustable steering column
- Fog light
- Pollen and dust filter
- Radio equipment: Ford Audio System 2
- Tire pressure monitoring system
- Sliding door, right and left
- Electromechanical power steering
- Bench seat (in the 2nd row, 3 seats). 60:40 split, foldable.
- Front spoiler lip
- Start-stop system
- 12-volt socket in storage compartment on dashboard (driver's side)
- Rear bumper, black plastic
- Daytime running light
- Child safety lock on sliding doors
- Warning system for unfastened driver and front passenger seat belts
- Central locking with remote control (door lock only on driver's door)



Extra equipment

- Heated windshield
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Navigation: Ford Audio System 9 navigation systems, including Ford SYNC 3 with AppLink, touchscreen, and reversing camera (Ford SYNC 3 communication and entertainment system with voice control, 6" color touchscreen, high resolution, 15.2 cm screen diagonal, radio (FM/AM), 2 USB ports, 6 speakers, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, premium center console, reversing camera including rear parking assist system, phase-differentiated antenna, DAB/DAB+, voice control for audio and telephone, support for Android Auto and Apple CarPlay, dynamic navigation TMCpro, live traffic, 3D display)
- Adaptive cruise control with intelligent speed limiter (Pre-Collision Assist, radar and camera-based, with pedestrian and cyclist detection) - Lane Keeping Assist including Lane Departure Warning and Driver Alert - Leather multifunction steering wheel - Traffic Sign Recognition System)
- Package: Seat Package 6 (fabric, Capitol/City in Ebony (black) - driver's seat, 3-way manually adjustable (forward/backward, height, backrest), with lumbar support - single passenger seat, 2-way manually adjustable (forward/backward, backrest) and foldable - map pocket for driver's seat - seat heating for driver and single passenger seats)
- Safety partition net for separating passenger and luggage compartments (including attachment points)
- Heat-insulating glazing, tinted (from the B-pillar)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
3	Side panel - rear left side	Interior trim - Scratched - Loss in value
4	Side panel - rear right side	Interior trim - Scratched - Loss in value
5	Front bumper	Front bumper - Scratch(es) - Smart repair
6	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Smart repair

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

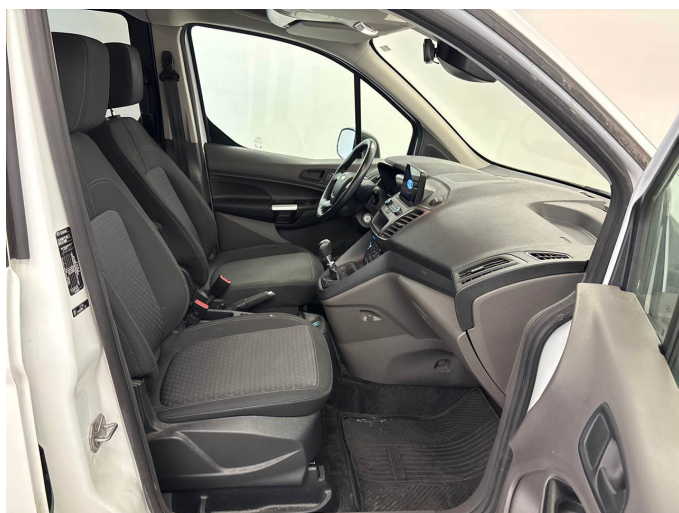


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

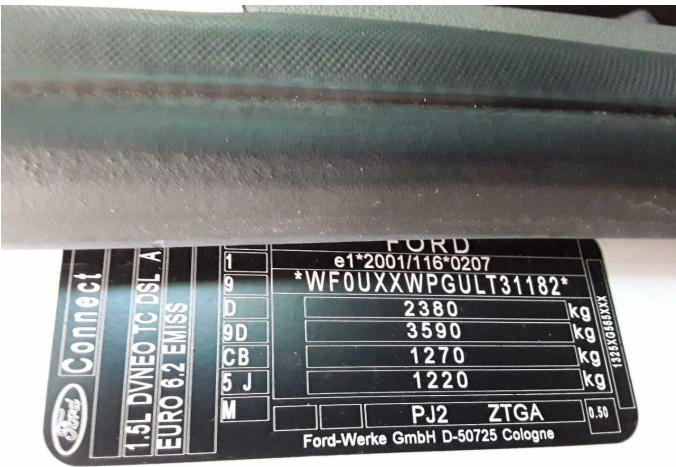


Figure 11: VIN



Figure 12: Mounted tyres

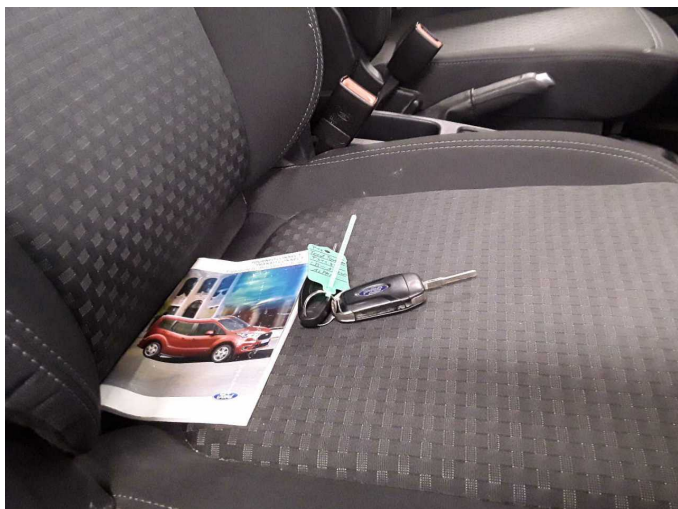


Figure 13: Documents



Figure 14: Additional tyres

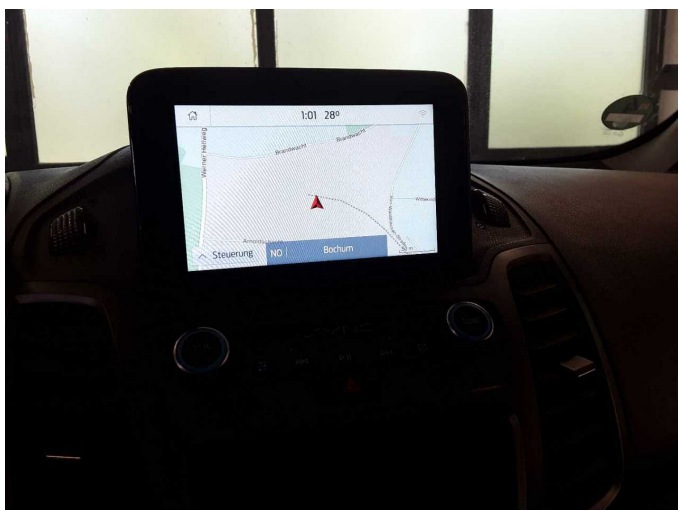


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

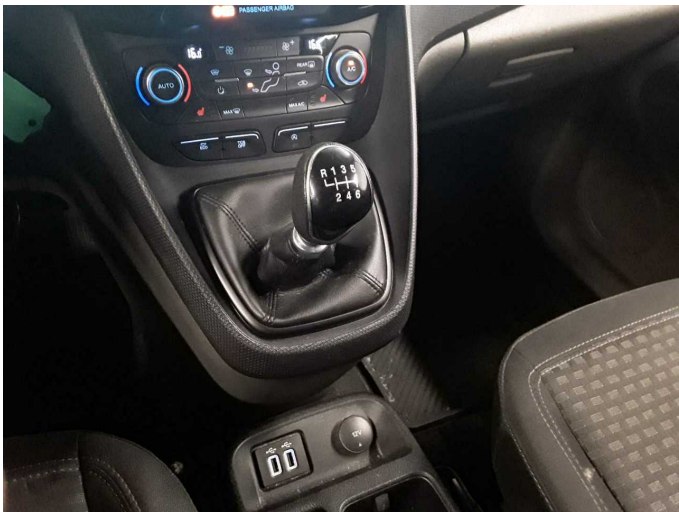


Figure 24: Misc.

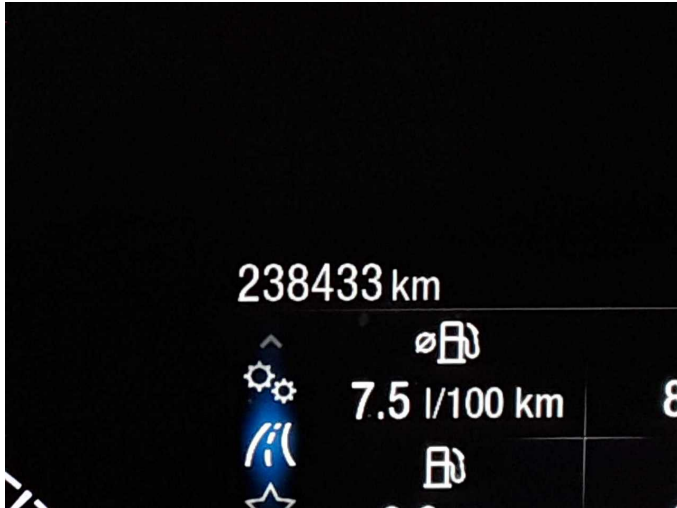


Figure 25: Misc.




Figure 26: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

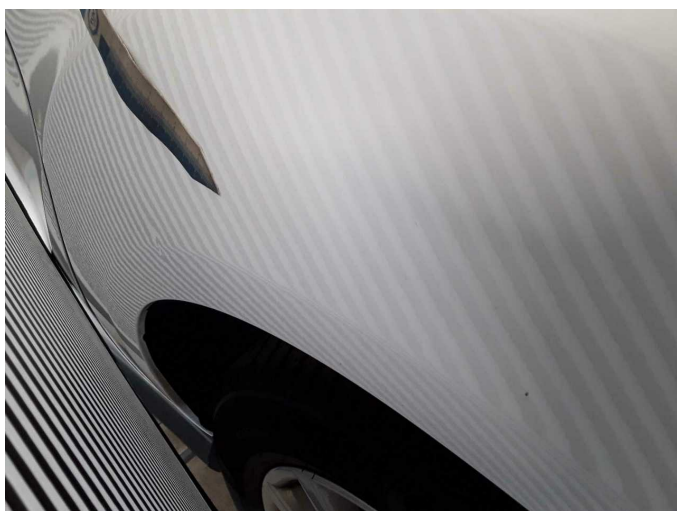

Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

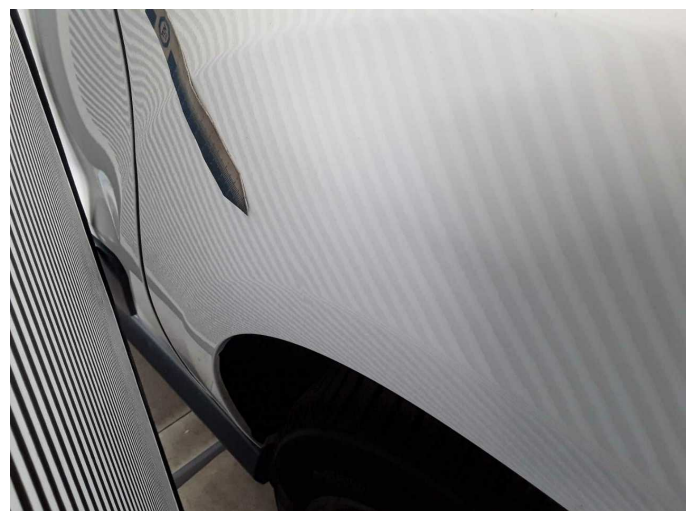

Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 3: Side panel - rear left side: Interior trim - Scratched - Loss in value



Damage 3: Side panel - rear left side: Interior trim - Scratched - Loss in value




Damage 4: Side panel - rear right side: Interior trim - Scratched - Loss in value



Damage 4: Side panel - rear right side: Interior trim - Scratched - Loss in value



Damage 5: Front bumper: Front bumper - Scratch(es) - Smart repair

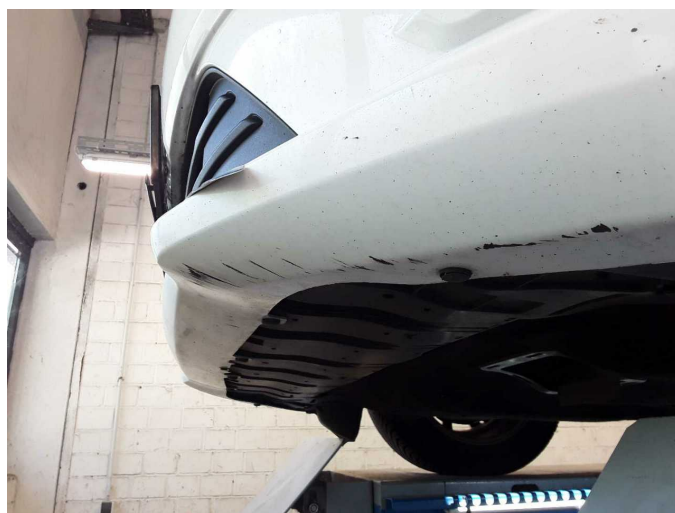

Damage 5: Front bumper: Front bumper - Scratch(es) - Smart repair




Damage 5: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair



Damage 6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair

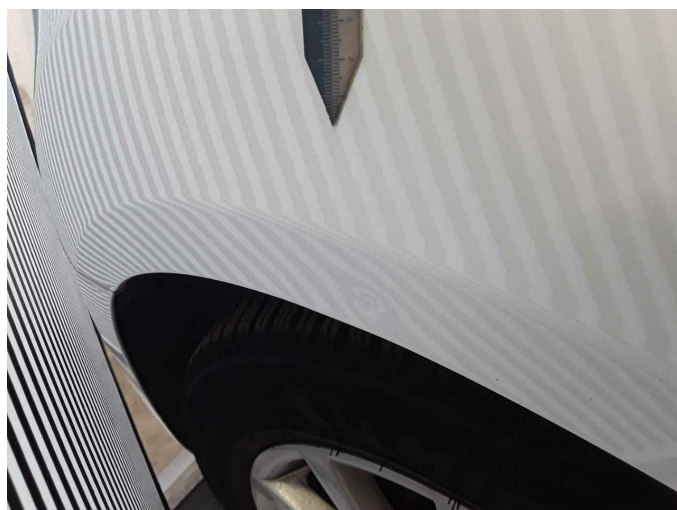

Damage 6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair



Damage 6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Wear and tear 2: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction