



Expertise

Protocol number: 46883626
Order No. / Reference: 26747152
Inspection date: 4 Aug 2026

Manufacturer: Mercedes-Benz
VIN: W1KAH0EB3PF109542

Model: C 220 d T 9G-TRONIC AMG Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz C 220 d T 9G-TRONIC AMG Line	
Vehicle Identification number	W1KAH0EB3PF109542
Mileage (Read)	137,478 km
First registration	12 Jun 2023
Number of holders	1
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,993 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Station wagon
Colour / colour code	Hightechsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	303 Tag(e)
Last service on / at	05/2026 at 130,943 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS712336
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AYH 00311		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,400 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	245/40 R18 97Y	Summer tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	225/45 R18 95H	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag for driver and front passenger
- AMG floor mats
- Basic services
- Brake system with larger brake discs on the front axle
- black roof rails
- Double cup holder at the front
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Transmission: 9-speed automatic, 9G-TRONIC
- Heated rear window
- Instrument panel and door sills in ARTICO man-made leather in black nappa look
- Mechanical child safety lock for the rear doors
- Front headrests
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Package: Storage
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio: MBUX
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Remote Services Plus
- Windscreen wipers with rain sensor
- Seats: Rear seat backrests foldable
- Cruise control
- Electronic immobilizer
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Ambient lighting with 64 light colors
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Brake assist, active
- Diesel particulate filter
- DYNAMIC SELECT
- ECO start/stop function
- Chassis: Sport chassis with sport direct steering
- Speed Limit Assistant
- rear window wiper
- Interior headliner fabric crystal grey
- ISOFIX child seat attachment with top tether in the rear
- KEYLESS-GO start function
- Rear headrests (3)
- Cargo area cover including EASY-PACK safety net
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Package: Interior lighting package
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: Central display
- Tire pressure monitoring system (TPMS)
- Wheels: 45.7 cm (18") AMG light-alloy wheels in a 5-spoke design
- Lane Keeping Assist, active
- High-visibility vest for drivers
- Central locking with remote control



Extra equipment

- Active Distance Assist DISTRONIC (Automatically regulates the distance to the vehicle in front.)
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- KEYLESS-GO (access and driving authorization system)
- Fuel tank with larger capacity
- Paint finish: Metallic
- Center console diamond pattern silver grey
- Package: Advanced Infotainment Package (MBUX Navigation Premium (hard drive navigation, pre-installation for Live Traffic Information), Traffic Sign Assist, Smartphone Integration (connects the mobile phone wirelessly to the multimedia system via Apple CarPlay and Android Auto), Wireless charging system for mobile devices in the front, Driver display - 31.2 cm (12.3") color LCD display, Central display - 30.2 cm (11.9") touch display with LCD technology)
- Package: Assistance (Blind Spot Assist: The system can warn you of side collisions with other road users in your blind spot, especially as soon as you activate the turn signal. Even after driving, the system remains vigilant and warns you if you open the door at the wrong moment. An important safety feature – especially for cyclists.)
- Package: High-End Business DB3
- Package: High-End Comfort Package (Seat heating for driver and front passenger - Memory Package: Driver and front passenger seats, steering column and exterior mirrors electrically adjustable and storable; Seat longitudinal position and headrest height additionally electrically adjustable; 3 memory settings each for driver and front passenger; 4-way lumbar support for driver and front passenger; Seat cushion depth adjustment with gapless cushion; PRE-SAFE positioning function for the front passenger seat)
- Package: Mirror package (both exterior mirrors electrically folding (button in the driver's door control panel) - interior mirror and exterior mirror on the driver's side automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area with projection of the Mercedes-Benz logo)
- Radio accessories: Advanced sound system (with 9 speakers and 225 watts system power)
- Seats: Sports seats
- Heat and noise insulating acoustic glass (for windshield and front doors)
- Towbar with ESP trailer stabilization
- Illuminated entry sills with Mercedes-Benz lettering
- Head-up display
- Black fabric headliner
- THERMOTRONIC automatic climate control with 4 climate zones (controlled via the central display or the climate control unit in the center console, with Auto button for automatic control of temperature, air volume and air distribution - control unit on the back of the center console - automatic recirculation when a tunnel is detected via GPS, only in conjunction with navigation system - sensors for detecting e.g. inside/outside temperature - fine dust activated carbon filter - ventilation system - dew point sensors - residual heat function for efficient use of engine waste heat)
- Package: Advanced Light Package (DIGITAL LIGHT: -HD system with projection module (more than 1.3 million pixels per headlight) and MULTIBEAM LED background module -Adaptive Highbeam Assist Plus -ULTRA RANGE high beam with a range of more than 600 m -Topography compensation -Cornering light with roundabout and intersection function -Active curve light with predictive control -Extended fog light, city light, country road light, motorway light, motorway high beam and bad weather light)
- Package: Luggage compartment comfort (electrically folding rear seat backrests via switches on the right and left in the control panel in the load compartment - electric opening and closing of the load compartment roller blind - 12V socket on the left in the control panel in the load compartment - reversible mat, with a rubberized, non-slip side and a soft velour side)
- Package: Parking (12 ultrasonic sensors - reversing camera - Active Parking Assist with PARKTRONIC: detects free parking spaces, assisted parking, visual and acoustic warning, display of camera and ultrasonic data in the media display - Cross traffic warning: can provide visual and acoustic warnings when reversing out of a parking space and, if necessary, automatically initiate emergency braking - Reverse maneuvering brake: can trigger a braking process - Drive-away assist)
- Sunroof: Electric panoramic sunroof
- Type designation removed from trunk lid
- Heat-insulating dark tinted glass
- Decorative elements in diamond pattern, silver-grey



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Broken / torn - Replace
2	Vehicle glazing	Windscreen seal - Scratched - Replace
3	Door - front right side	Door - Deformed - Smooth repair work
4	Sill - left side	Sill - Dent / paintcoat damage - Smart repair
5	Wheel / tyres	Tyre - rear right side - Broken / torn - Replace
6	Mudguard - right side	Mudguard - right side - Dent / paintcoat damage - Repair and paint
7	Rear bumper	Rear bumper - Scratched - Paint
8	Front bumper	Front bumper - Stone chips - Paint
9	Door - front left side	Door - Scratched - Paint
10	Side panel - rear right side	Side panel - Scratch(es) - Paint
11	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
12	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Scratched - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	Boot lid / rear door	Boot lid - dent(s) - No deduction
3	Steering system	Steering wheel sheath - Scratch(es) - No deduction
4	Side panel - rear left side	Side panel - Soiled - No deduction
5	Door - rear right side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Log book

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 19 Feb 2025	1.635,13 €

Repainting

No. Repainting

1	Side panel - rear right side
---	------------------------------



Paint coat thickness measurement

Side panel - rear right side

704 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Fahrzeug weist dem Alter und Laufleistung entsprechende Gebrauchspuren auf.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

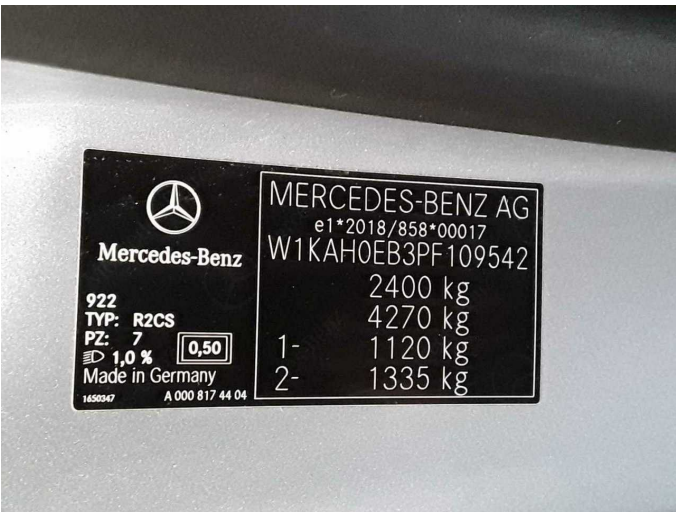


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

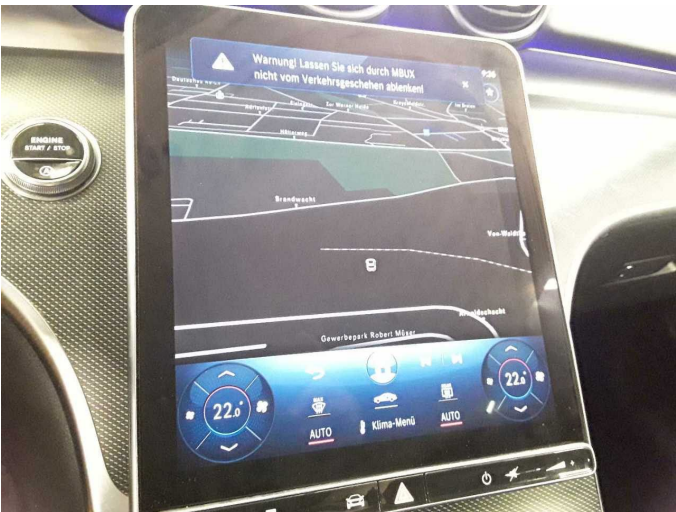


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

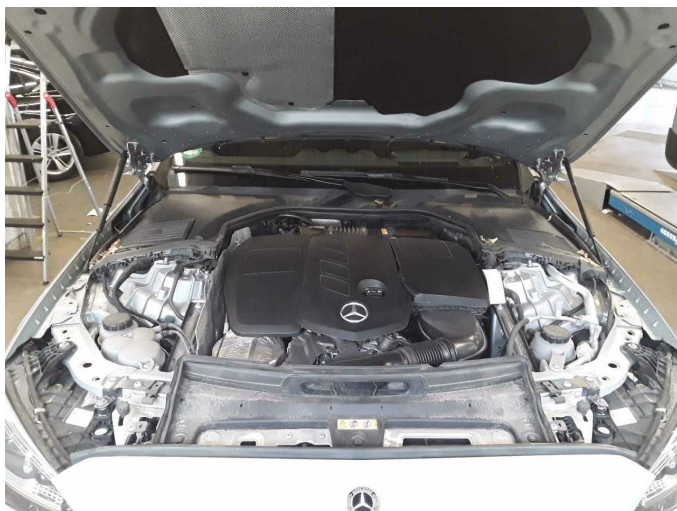


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Damage 1: Trim / covers: Floor mats - Broken / torn - Replace



Damage 1: Trim / covers: Floor mats - Broken / torn - Replace



Damage 2: Vehicle glazing: Windscreen seal - Scratched - Replace



Damage 2: Vehicle glazing: Windscreen seal - Scratched - Replace



Damage 3: Door - front right side: Door - Deformed - Smooth repair work




Damage 3: Door - front right side: Door - Deformed - Smooth repair work



Damage 3: Door - front right side: Door - Deformed - Smooth repair work



Damage 4: Sill - left side: Sill - Dent / paintcoat damage - Smart repair

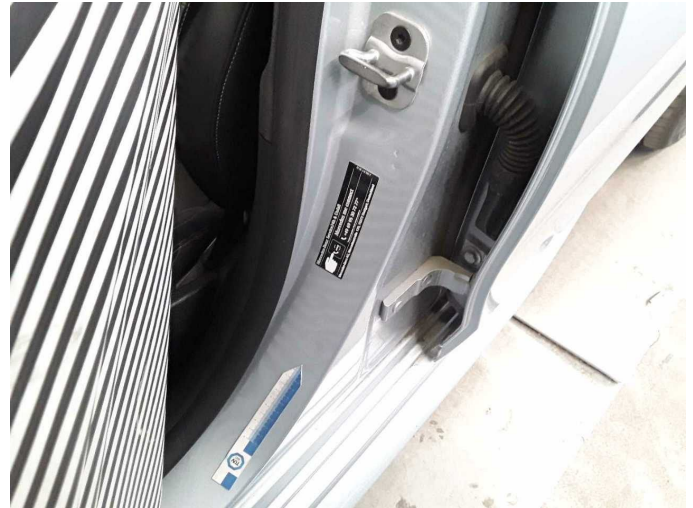

Damage 4: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 4: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 4: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Wheel / tyres: Tyre - rear right side - Broken / torn - Replace



Damage 5: Wheel / tyres: Tyre - rear right side - Broken / torn - Replace



Damage 6: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Repair and paint



Damage 6: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Repair and paint



Damage 6: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Repair and paint



Damage 7: Rear bumper: Rear bumper - Scratched - Paint



Damage 7: Rear bumper: Rear bumper - Scratched - Paint




Damage 7: Rear bumper: Rear bumper - Scratched - Paint



Damage 7: Rear bumper: Rear bumper - Scratched - Paint



Damage 7: Rear bumper: Rear bumper - Scratched - Paint

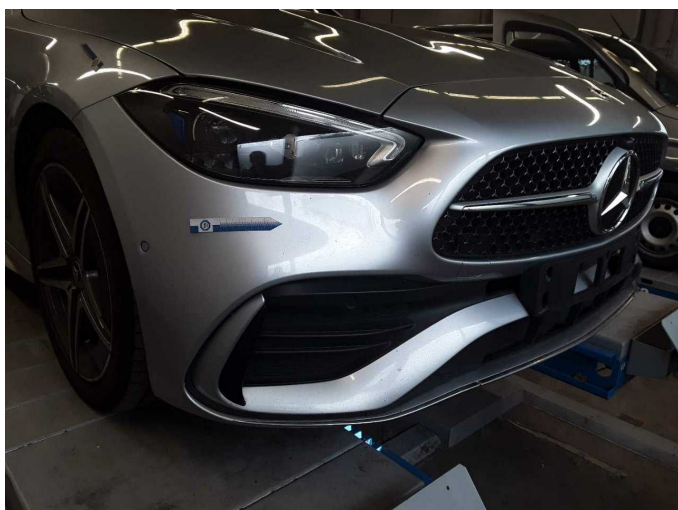


Damage 8: Front bumper: Front bumper - Stone chips - Paint



Damage 8: Front bumper: Front bumper - Stone chips - Paint



Damage 8: Front bumper: Front bumper - Stone chips - Paint

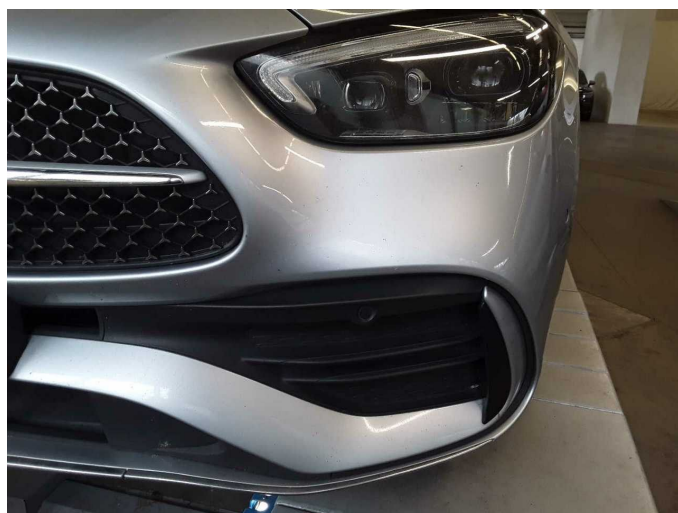

Damage 8: Front bumper: Front bumper - Stone chips - Paint



Damage 9: Door - front left side: Door - Scratched - Paint



Damage 9: Door - front left side: Door - Scratched - Paint



Damage 9: Door - front left side: Door - Scratched - Paint



Damage 10: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 10: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 10: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 12: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 12: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 12: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction




Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction




Wear and tear 3: Steering system: Steering wheel sheath - Scratch(es) - No deduction



Wear and tear 3: Steering system: Steering wheel sheath - Scratch(es) - No deduction

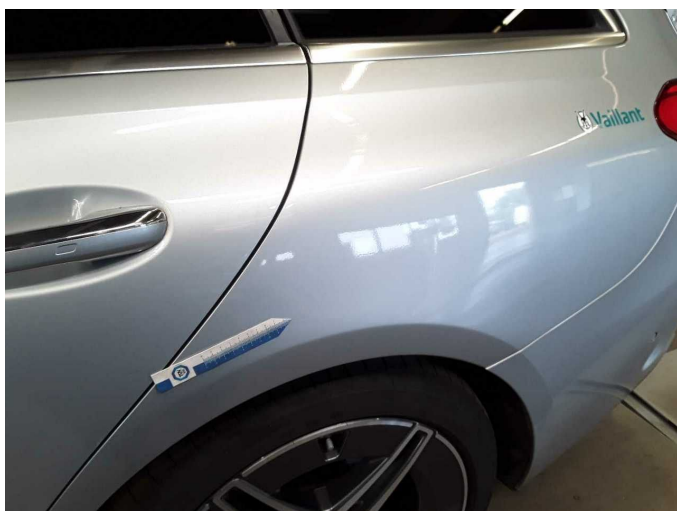

Wear and tear 4: Side panel - rear left side: Side panel - Soiled - No deduction

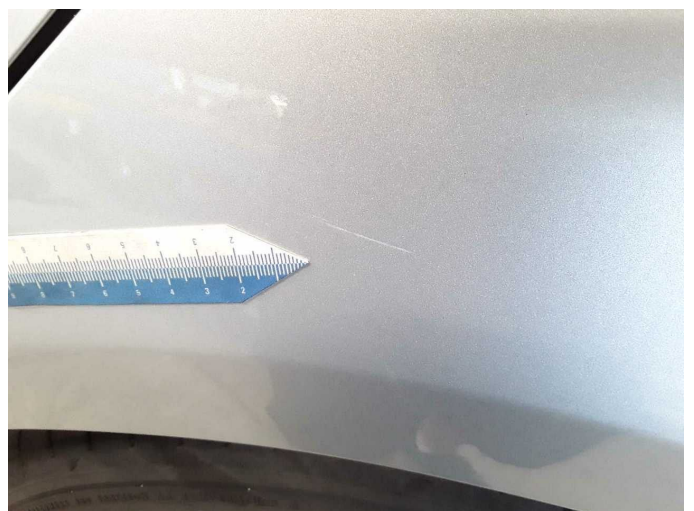


Wear and tear 4: Side panel - rear left side: Side panel - Soiled - No deduction



Wear and tear 5: Door - rear right side: Door - dent(s) - No deduction



Wear and tear 5: Door - rear right side: Door - dent(s) - No deduction

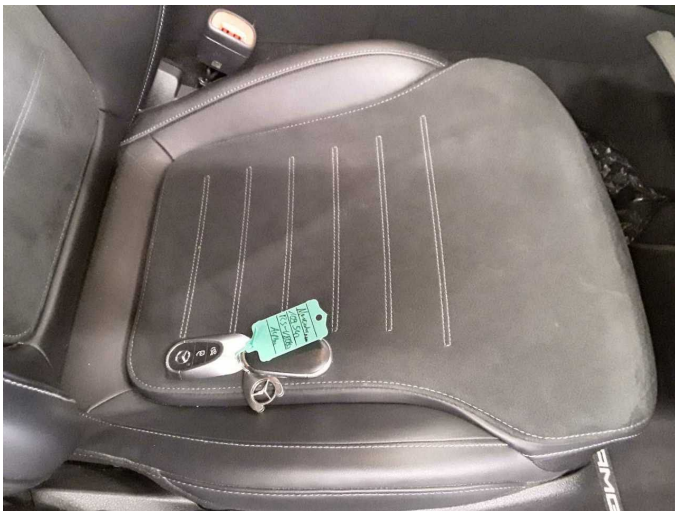

Missing part 1: Documents: Log book - Missing - Replace



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KAH0EB3PF109542

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ C 220 d T 9G-TRONIC
AMG Line

Datum	KM-Stand	Beschreibung
20.05.2026	130.943	Regelwartungsdienst
11.09.2025	104.489	Bremsscheiben vorne; Regelwartungsdienst
31.03.2025	82.979	Bremsscheiben hinten; Regelwartungsdienst
08.08.2024	53.679	Bremsscheiben vorne; Regelwartungsdienst
17.01.2024	28.597	Regelwartungsdienst