



Expertise

Protocol number: 46538794
Order No. / Reference: 26744655
Inspection date: 15 Jul 2026

Manufacturer: Kia

Model: e-Soul Vision

VIN: KNAJ3811FP7030441



Vehicle details	
Manufacturer / Type / Model / Equipment	
Kia e-Soul Vision	
Vehicle Identification number	KNAJ3811FP7030441
Mileage (Read)	29,571 km
First registration	28 Jun 2023
Number of holders	1
Power / Engine displacement	29 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Blue University
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	156 Tag(e)
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV867804
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2233 / AAA 00005		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,180 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Nexen	5mm / 5mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Nexen	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS (Anti-lock Braking System) with electronic brake force distribution
- Airbag: 2 front airbags (passenger airbag can be deactivated)
- Active lane keeping assist with corrective steering intervention (Lane Keep Assist, LKA)
- Electrically adjustable exterior mirrors
- Exterior mirrors with integrated turn signals
- Hill Start Assist (HAC)
- Brake Assist (BAS)
- Front overhead console with reading lights
- Three-point safety belts with belt force limiter at all seating positions, height-adjustable at the front (belt pretensioners at the front and on the outer rear seats - belt warning system for all seating positions (SBR))
- Electronic Stability Control (ESC) with Traction Control System (TCS)
- High Beam Assist (HBA)
- floor mat set
- Countersteering support (Vehicle Stability Management, VSM)
- Luggage compartment lighting
- Intelligent Speed Limit Assist (ISLA)
- Gearbox: Reduction gearbox
- rear window wiper
- Interior rearview mirror self-dimming (electrochromatic)
- ISOFIX mounts on outer rear seats
- Comfort turn signal (one-touch function)
- Paint finish: Solid
- Charging port (CCS charging port for Type 2 plugs (AC charging) or Combo 2 plugs (fast DC charging))
- Type 2 to Type 2 charging cable
- LED fog lights
- LED taillights
- Heated steering wheel
- Steering wheel: Leather steering wheel
- Steering wheel: Paddle shifters on the steering wheel (for adjusting recuperation intensity and activating smart regeneration)
- Windscreen washer fluid refill indicator
- Emergency call service eCall
- On-board charger (3-phase, 10.5 kW)
- Rear parking sensors
- Upholstery: Cloth
- Radio: Kia touchscreen radio (7 inch) with RDS and MP3 function (2 front speakers, 2 rear speakers, 2 tweeters in front)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Harman/Kardon premium sound system with a total of 10 speakers (including tweeters and subwoofer - external amplifier with 640 watts total power - QuantumLogic Surround Sound - ClariFi technology)
- Tire repair kit
- Reversing camera (transmission to the multimedia screen display)
- Adaptive cruise control including Stop&Go function (Smart Cruise Control, SCC with S&G)
- Airbag: 2 side airbags
- Airbag: 2 curtain airbags
- Active brake light (Emergency Stop Signal, ESS)
- Heated exterior mirrors
- Exterior mirrors painted in roof color
- Battery: Battery preheating system
- On-board computer
- Overhead console with glasses compartment
- Roof rails
- Third brake light with LED
- Drive Mode Select (Eco / Eco+ / Comfort / Sport)
- twilight sensor
- Electronic parking brake with auto-hold function
- Electric windows front and rear (momentary function and anti-pinch protection at the front)
- Forward Collision Avoidance Assist (FCA) with pedestrian and cyclist detection
- Luggage net loops in the luggage compartment
- luggage compartment cover
- Removable luggage compartment floor
- Speed limiter
- Back window, heater
- Interior lighting (rear lighting)
- Instrument unit with supervision LCD display (7.0 inch)
- Automatic climate control with anti-fog system
- Headrests on all seats are height-adjustable (front seats are also tilt-adjustable)
- Charging port (for Type 1 plug (AC) at the front of the vehicle)
- LED headlights (low and high beam) with automatic headlight range control
- LED daytime running lights
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction steering wheel
- rear air vents
- Front center armrest (with storage compartment)
- Driver Attention Warning (DAW)
- Navigation: Kia map navigation with 26 cm (10.25 inch) screen diagonal (incl. 7-year Kia navigation map update)
- Kia Connect online services with Kia Live (real-time traffic information, weather forecast, local search, parking options, charging stations, and the ability to access vehicle information and control vehicle functions via the Kia UVO app)
- Radio accessories: Bluetooth hands-free system (with voice control)
- Radio accessories: USB port
- Rain sensor
- Tire pressure monitoring system (TPMS) (with pressure display for each wheel on the on-board computer display)



- Power steering (electronically assisted)
- Seats: Rear seat backrest split 60:40, foldable
- Seats: Pocket on the back of the passenger seat
- Sun visors with illuminated makeup mirrors
- 12V power outlet (in the center console)
- Power outlet: USB charging port on the front
- Phone: Smartphone interface Android Auto and Apple CarPlay
- Door handles in car color
- Glazing: Privacy glazing (dark tinted windows from the B-pillar back)
- Virtual Engine Sound System (VESS) for pedestrian protection
- thermal insulation glazing
- Wheels: 17-inch alloy wheels with 215/55 R17 94W tires (rims: 7.0 J x 17 ET50)
- Chrome side trim
- Seats: Driver's seat height adjustable
- Seats: Heated front seats
- Smart Key and Start Button
- Lane Follow Assist (LFA)
- Power outlet: USB - 2 charging ports at the rear
- Bumpers in body color (front bumper in body color with silver trim frame, rear bumper with silver underride protection design)
- Interior door handles in satin chrome
- Glazing: Windshield and front side windows in solar glass (UV protection)
- Immobiliser
- Heat pump (for more efficient indoor air conditioning)
- Central locking

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
4	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
5	Front bumper	Spoiler (+ gestaucht) - Scratched - Replace
6	Rear bumper	Rear bumper - Scratched - Paint
7	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
8	Door - rear left side	Door - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Sill - dent(s) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key with remote control



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

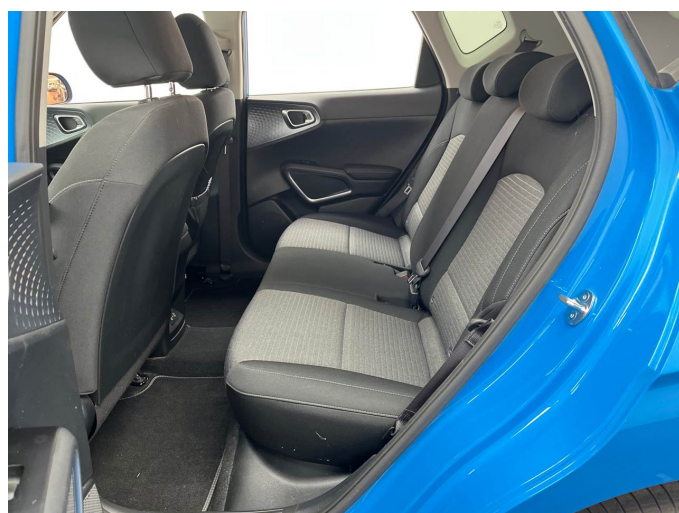


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

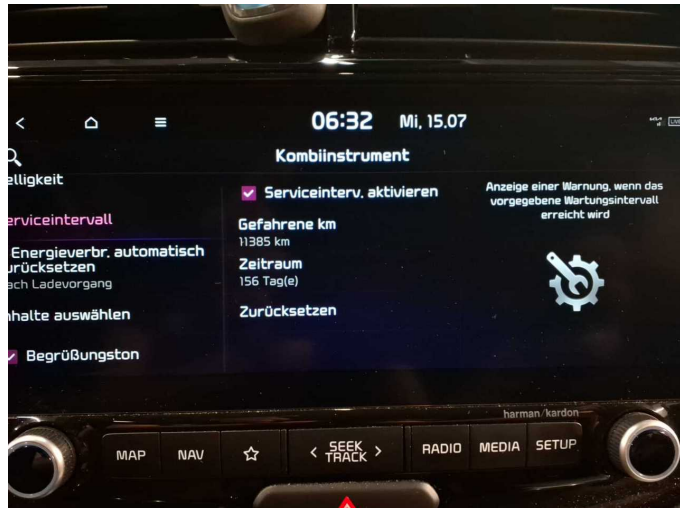


Figure 13: Documents



Figure 14: Documents

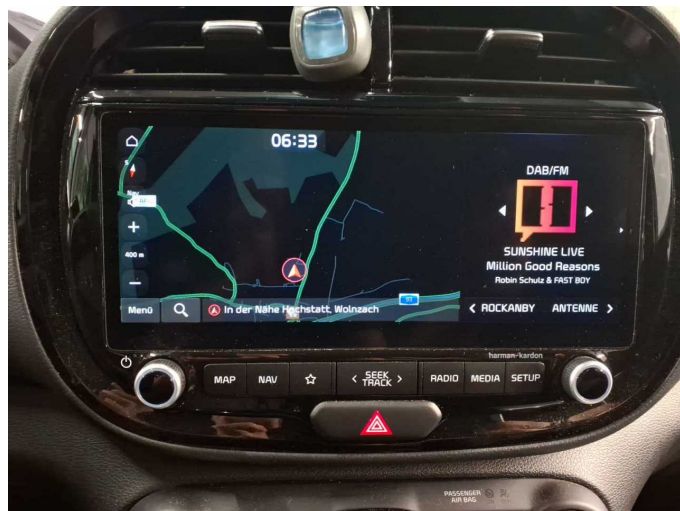


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair

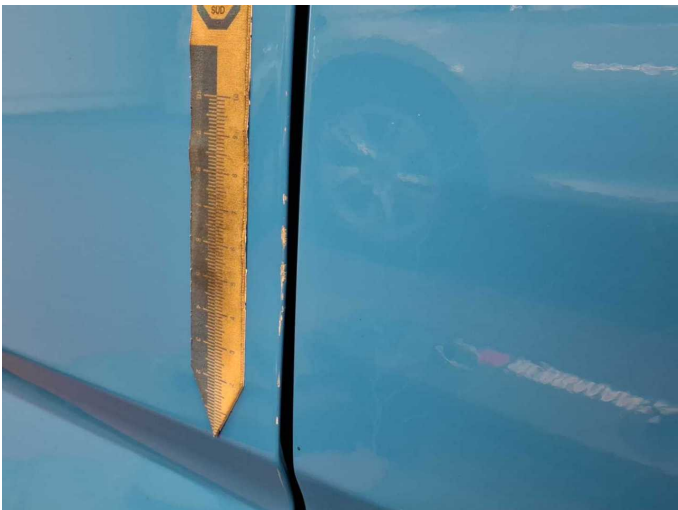

Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

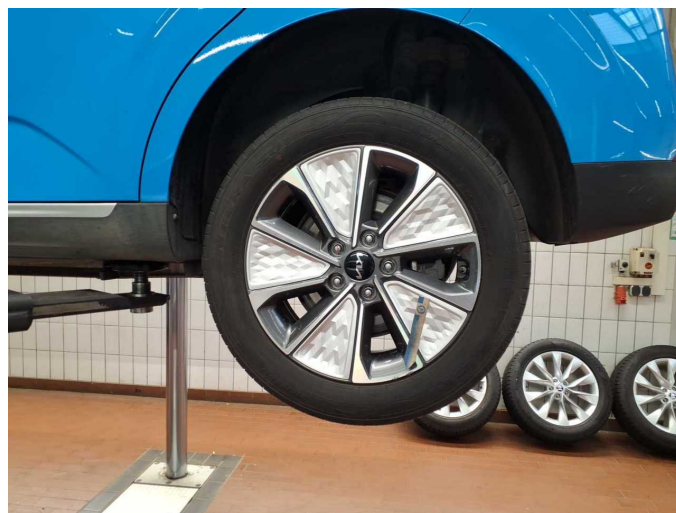

Damage 3: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




Damage 3: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value

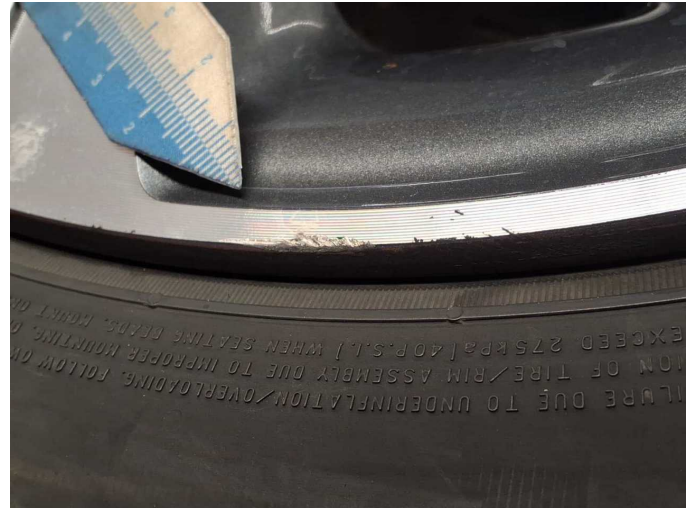

Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 5: Front bumper: Spoiler (+ gestaucht) - Scratched - Replace



Damage 5: Front bumper: Spoiler (+ gestaucht) - Scratched - Replace




Damage 5: Front bumper: Spoiler (+ gestaucht) - Scratched - Replace



Damage 5: Front bumper: Spoiler (+ gestaucht) - Scratched - Replace



Damage 6: Rear bumper: Rear bumper - Scratched - Paint

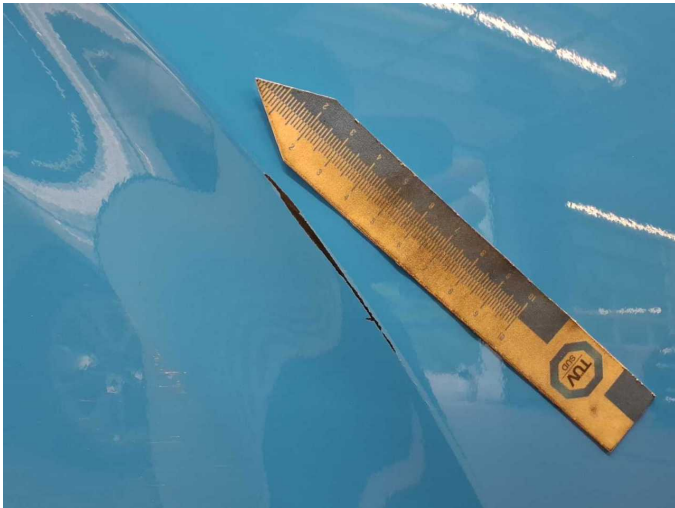


Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

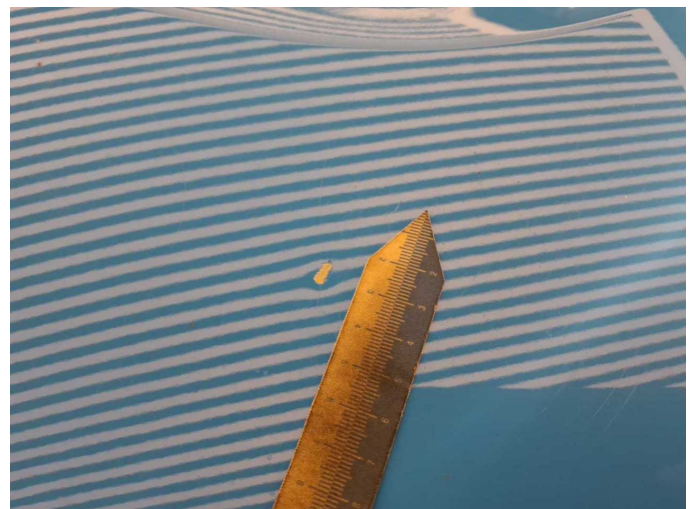

Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 8: Door - rear left side: Door - Scratch(es) - Paint

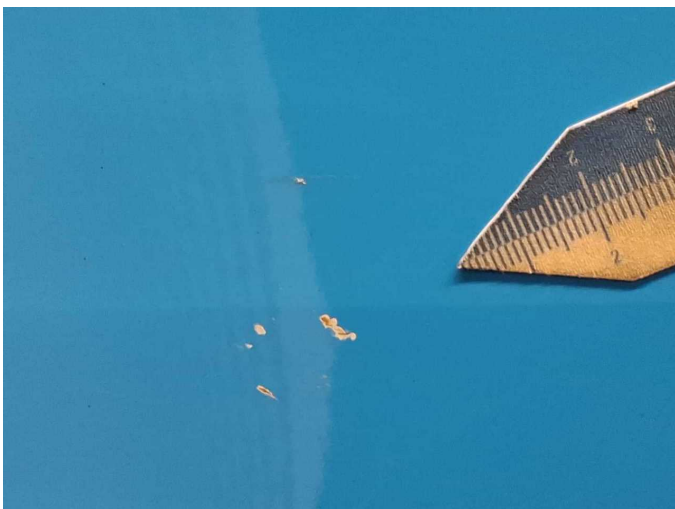

Damage 8: Door - rear left side: Door - Scratch(es) - Paint




Damage 8: Door - rear left side: Door - Scratch(es) - Paint



Damage 8: Door - rear left side: Door - Scratch(es) - Paint



Wear and tear 1: Side panel - rear right side: Sill - dent(s) - No deduction

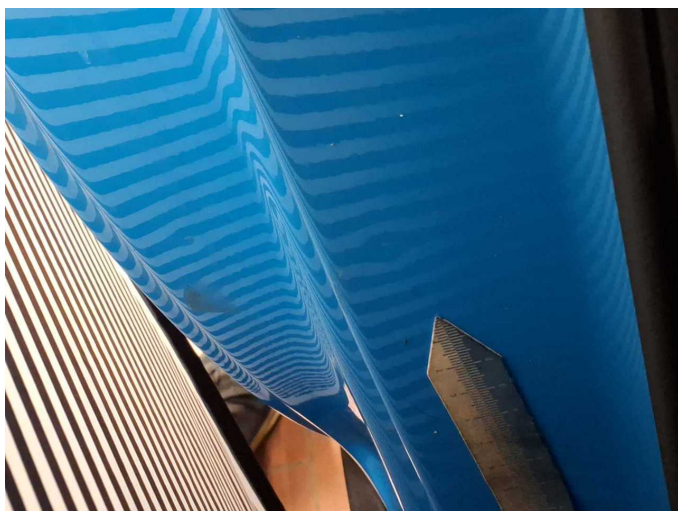

Wear and tear 1: Side panel - rear right side: Sill - dent(s) - No deduction