



CITROËN BERLINGO: ET-944-AG

Vinnumber:	VF77BBHW6HN549045	Versionname:	CITROËN BERLINGO BlueHDi 75 BVM Business M VU [3P] bvm 5-75CH-5cv (fourgonnette-)
First Registrationdate:	27/12/2017	Fiscalpower:	
Expertise Mileage:	137215	Power Kw:	55
Bodytype:	Transporter	Body colour:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	3		
Number of seats:	3		
Number head rests:	3		
Type of rims (mounted):	Steel		
Category:	Light Commercial Vehicle		

Options

Number of keys total	1	Radio	
Number keys remote	1	Rear parking sensors	
GPS big screen color		Seat cover lining	Lining Other
Windows electric F			
Cruise Control			
Type of climate control	Manual climate control		

Tyres

	195/65/15/95 V			
Summer tyres:	Fr.L.	Michelin: 30%	Fr.R.	Michelin: 25%
	Re.L.	Michelin: 25%	Re.R.	Michelin: 30%
Tyre profile depth FL				6.3
Tyre profile depth FR				6.5
Tyre profile depth RL				6.6
Tyre profile depth RR				6.3
Tyre size FL				195/65 R 15 95 V
Tyre size FR				195/65 R 15 95 V
Tyre size RL				195/65 R 15 95 V
Tyre size RR				195/65 R 15 95 V
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Spare wheel	Yes	Jack	Yes
Remote ignition key, Missing, Repair/replace (lump sum)			



Interior, Dirty, Cleaning



Wheel cover FR, Broken, Replace



Outside rear-view mirror base L, Broken, Replace




Side wall RL, Scratch(es), Polish



Door FL, Scratch(es), Paint



Bonnet, Stone chip(s), Paint

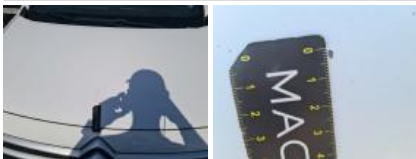

Bumper moulding FL, Scratch(es), Replace



Wing FR, Dent(s) and scratch(es), Repair and paint (complete)



Side wall RR, Dent(s) and scratch(es), Repair and paint (complete)



Rubber seal for boot lid, Tear, Replace



Boot door panel RL, Dent(s) and scratch(es), Repair and paint (complete)



Bodywork, Glue residues, Sticker removal small



Historique Maintenance

Immatriculation: ET-944-AG Date de 1ère immatriculation: 27/12/2017

Modèle: Citroen BERLINGO BlueHDi 75 BVM Business M VU [3P] bvm 5-75CH-5cv (fourgonnette-)

Date	Kilométrage	Fournisseur	Descriptif
21/04/2026	136.984	GARAGE 2000	CONTROLE PH LIQUIDE REFROIDISSEMENT
			ROTULE DE DIRECTION AVG RPLT
			LIQUIDE DE FREIN
			DIVERS
			LAMPE AR RPLT
			ROTULE DE DIRECTION AVD RPLT
			REVISION
			COURROIE DISTRIBUTION RPLT
			DIVERS MOTEUR
			ADDITIF FAP CTRL
			BIELLES RPLT
24/12/2025	131.900	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
22/07/2025	128.357	PARASCANDOLA-CTO	BATTERIE RPLT
21/01/2025	124.027	GARAGE 2000	REVISION ET CLIM
09/01/2025	123.980	DEKRA AUTOMOTIVE S.A	ANTIPOLLUTION
07/11/2024	122.411	GARAGE 2000	LAMPE CODE AVD RPLT
01/07/2024	112.821	EUROMASTER FRANCE	REMPLACEMENT PNEUS 4 SAISONS
06/02/2024	102.201	GARAGE 2000	LAMPE CODE AVD RPLT
08/01/2024	99.448	GARAGE 2000	DISQUES PLAQUETTES AV RPLT
			REVISION ET CLIM ET AIR ET CARBURANT
			DIVERS ELEC
			INJECTEUR ADBLUE RPLT
			BOITIER D EAU RPLT
			TRIANGLE INFERIEUR AVD RPLT
			TRIANGLE INFERIEUR AVG RPLT
			PLAQUETTES AR RPLT
			CLE TELECOMMANDE DE DEMARRAGE RPLT
26/12/2023	98.851	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
21/09/2023	92.491	EUROMASTER FRANCE	REMPLACEMENT PNEUS ETE
24/08/2023	92.161	EUROMASTER FRANCE	REPARATION DE ROUE
30/06/2023	87.511	DEKRA AUTOMOTIVE S.A	ANTIPOLLUTION
25/05/2023	85.814	EUROMASTER FRANCE	REPARATION DE ROUE

Historique Maintenance

Immatriculation: **ET-944-AG**

Date de 1ère immatriculation: **27/12/2017**

Modèle: **Citroen BERLINGO BlueHDi 75 BVM Business M VU [3P] bvm 5-75CH-5cv (fourgonnette-)**

Date	Kilométrage	Fournisseur	Descriptif
02/05/2023	85.333	EUROMASTER FRANCE	REPARATION DE ROUE
13/01/2023	80.960	GARAGE 2000	REVISION
			BALAIS ESSUIE GLACE AV
			FILTRE CLIM RPLT
27/04/2023	74.538	EUROMASTER FRANCE	GEOMETRIE CTRL
27/04/2023	74.538	EUROMASTER FRANCE	REMPLACEMENT PNEUS ETE
13/01/2022	62.563	PARASCANDOLA-CTO	BOUGIES DE PRECHAUFFAGE RPLT
11/01/2022	62.563	PARASCANDOLA-CTO	REVISION
			PLAQUETTES AR RPLT
			PLAQUETTES AV RPLT
			FILTRE CLIM RPLT
			LIQUIDE DE FREIN
			REVISION
			FILTRE A AIR RPLT
			DIVERS CLIM
27/12/2021	61.654	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
07/01/2021	44.981	PARASCANDOLA-CTO	BALAIS ESSUIE GLACE AV
			REVISION
28/09/2020	39.317	EUROMASTER FRANCE	REMPLACEMENT PNEUS ETE
20/04/2020	32.850	GARAGE 2000	DIVERS ECHAPPEMENT
24/12/2019	27.856	PARASCANDOLA-CTO	BALAIS ESSUIE GLACE AV
			FILTRE CLIM RPLT
			LIQUIDE DE FREIN
			REVISION
			DISQUES PLAQUETTES AV RPLT
24/09/2019	20.928	PARASCANDOLA-CTO	ADBLUE
06/08/2019	18.153	EUROMASTER FRANCE	REPARATION DE ROUE
02/01/2019	9.336	PARASCANDOLA-CTO	BALAIS ESSUIE GLACE AV
			REVISION