



Expertise

Protocol number: 46168959
Order No. / Reference: 26622940
Inspection date: 25 Jun 2026

Manufacturer: Audi

Model: A4 Avant 35 TDI S tronic

VIN: WAUZZZF41RA002114



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 35 TDI S tronic	
Vehicle Identification number	WAUZZZF41RA002114
Mileage (Read)	133,363 km
First registration	9 Aug 2023
Number of holders	1
Power / Engine displacement	120 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Manhattangrau Metallic (X7L)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	3,100 km
Last service on / at	10/2025 at 116,359 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV352207
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BPK 01196		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,165 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94Y	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	225/50 R17 94Y	Summer tyres on Light alloy	Hankook	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Exterior mirror housings in body color
- third brake light, raised
- Black roof rails
- Diesel particulate filter (DPF)
- Parking assistance plus
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Window channel strips in black (rubber)
- front and rear floor mats
- Transmission: S tronic 7-speed
- Top speed limited to 210 km/h
- Interior mirror dimming
- Child lock
- Automatic air conditioning
- boot floor mat
- Loading floor
- LED taillights
- Steering column, manually adjustable in height and axis
- Light/rain sensor
- front center armrest
- Wheel: Alloy wheels, 5-arm
- Radio: MMI Radio plus
- Tire repair kit
- Electromechanical power steering
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Airbag for driver and front passenger
- Accent areas matte black
- Traction control (ASR)
- Audi pre sense city
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Fabric headliner
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver information system with color display
- electric window regulator
- Remote key, without SafeLock
- Cruise control system with speed limiter
- rear window wiper
- Interior lighting
- Camera-based traffic sign recognition
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Headrests (5)
- Manual cargo cover
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Mild hybrid
- Non-smoking version
- Wheel: Tires optimized for rolling resistance, speed-limited
- Tire pressure monitoring system
- Headlights using LED technology
- Fabric seat covers Index
- Seats: Rear seat backrest foldable
- Lane Departure Warning
- First aid kit with warning triangle
- Electronic immobilizer
- Central locking "Keyless-Go" without deadbolt



Extra equipment

- AdBlue tank (24 liters) (larger tank for AdBlue solution to reduce nitrogen oxides in the exhaust gas using an SCR system)
- Deletion of performance/technology lettering
- Electrically operated tailgate (The tailgate can be opened electrically by pressing the button on the vehicle key, in the driver's door, or the soft-touch button on the tailgate handle. Closing the tailgate is just as easy and convenient: simply press the button on the inside of the tailgate, the button in the driver's door, or the button on the vehicle key. A soft-close mechanism makes manual closing easier when necessary.)
- Fuel tank with increased filling volume (54 l)
- Paint finish: Metallic
- LED headlights and LED taillights with dynamic turn signals (daytime running lights - low beam - high beam - position lights - turn signals - cornering lights - all-weather lights - maneuvering lights - motorway lights - static cornering lights - automatic dynamic headlight range control - intersection lights (in conjunction with MMI Navigation plus). LED taillights plus include: dynamic rear turn signals - brake lights - taillights - rear license plate lights - reversing lights).
- Business package (MMI Navigation plus with MMI touch - Audi phone box - 3-spoke leather steering wheel with multifunction plus - Heated front seats - Frameless, automatically dimming interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides - High-beam assistant - Manual sunshade for rear door windows)
- Wheel: Alloy wheels, 10-spoke crystal (size 7.5J x 17 with tires 225/50 R17)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt, headrest and belt height; with pronounced seat side bolsters for better lateral support in curves, extendable thigh support)
- Audi connect navigation & infotainment
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles; the curb view function folds the passenger-side mirror down when reverse gear is engaged, giving the driver a better view of the curb edge)
- Comfort automatic climate control 3-zone (in addition to the automatic climate control: - climate control unit with large TFT display and capacitive rocker switches - electronically regulates the air temperature and distribution individually for driver and front passenger - additional climate control unit for setting the rear compartment temperature in the rear center console - automatic recirculation control with dust and odor separating allergen filter - residual heat utilization)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (The steering wheel impresses with its high-quality look and aluminum trim and feels good in the hand. Height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons. It also includes paddle shifters for manually changing gears with an automatic transmission.)
- Wheel: Deselect low rolling resistance tires, remove speed limiter (17 inch) (Tires 225/50 R 17 94Y)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)
- Seat covers in fabric system (seat center panels in fabric system black or black-red - seat side bolsters, thigh support, headrests in solid black fabric)
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and S sport seats also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Screen cleaning	Wiper arm - rear (Abdeckkappe) - Missing - Replace
2	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
3	Body	B-pillar - left side - Dent / paintcoat damage - Smart repair
4	Rear bumper	Rear bumper - Scratched - Paint
5	Door - rear left side	Door - Scratch(es) - Paint
6	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
7	Roof	Roof (Steinschläge) - Corrosion - Paint
8	Bonnet	Bonnet - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Sill - left side	Sill - Scratch(es) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Door - front left side	Door edge - Scratch(es) - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction
5	Side panel - rear left side	Sill - dent(s) - No deduction
6	Side panel - rear left side	Sill - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 5 Oct 2025	1.742,69 €

Repainting

No.	Repainting
1	Mudguard - left side

Paint coat thickness measurement

Mudguard - left side	187 µm
----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

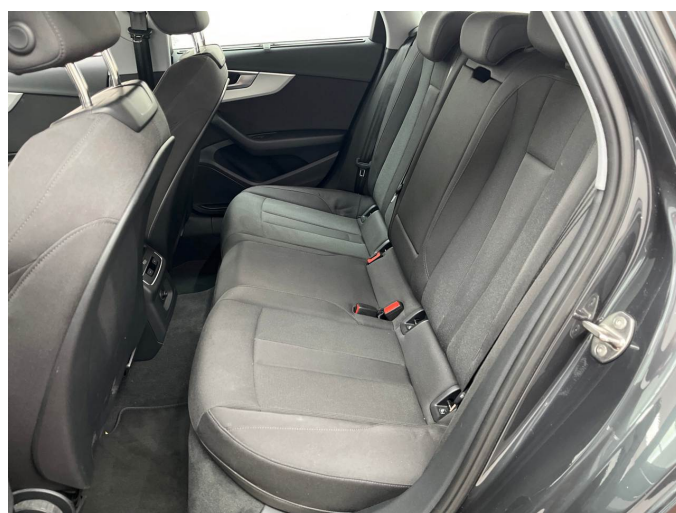


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

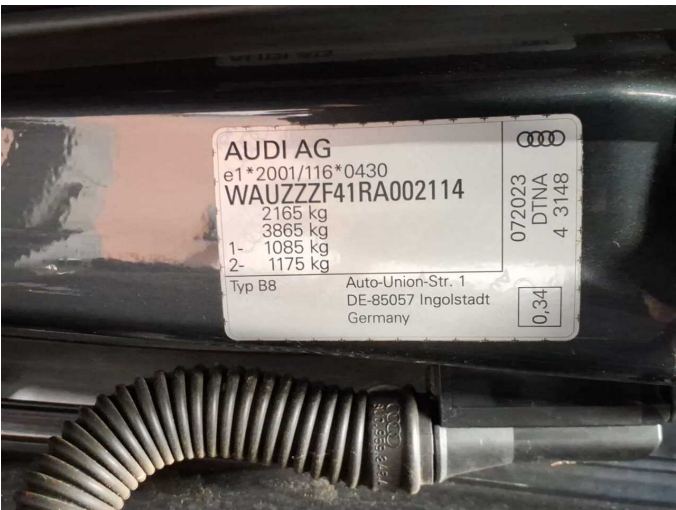


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

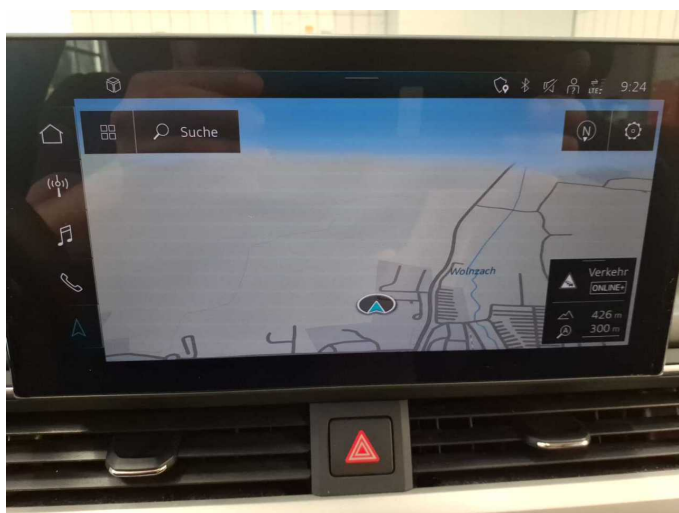


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.




Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

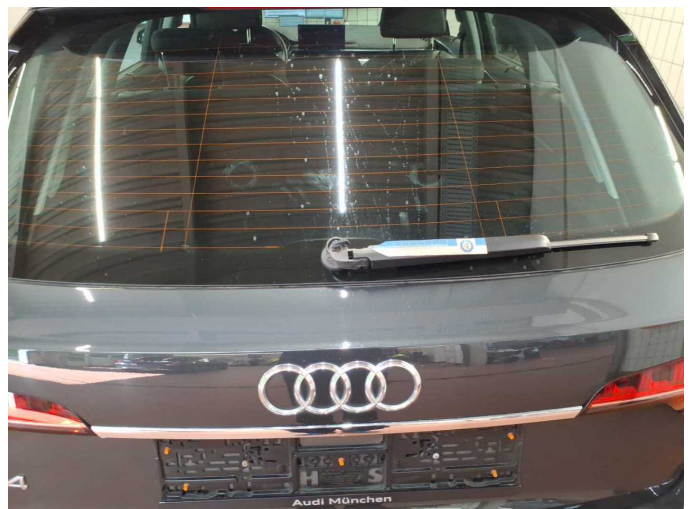


Damage 1: Screen cleaning: Wiper arm - rear (Abdeckkappe) - Missing - Replace




Damage 1: Screen cleaning: Wiper arm - rear (Abdeckkappe) - Missing - Replace



Damage 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

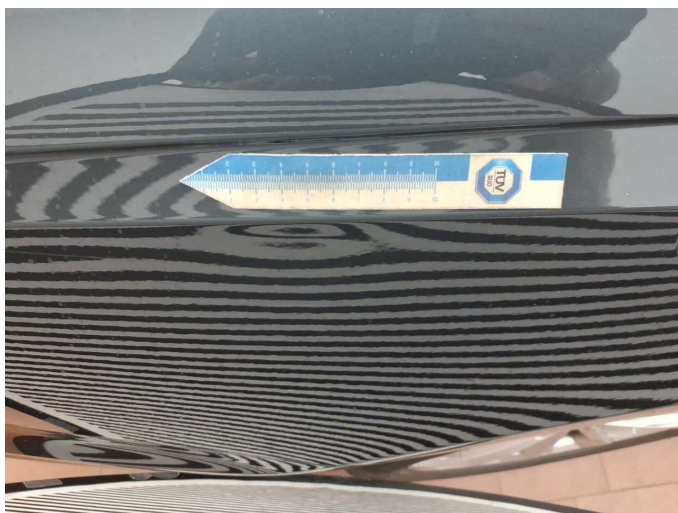

Damage 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

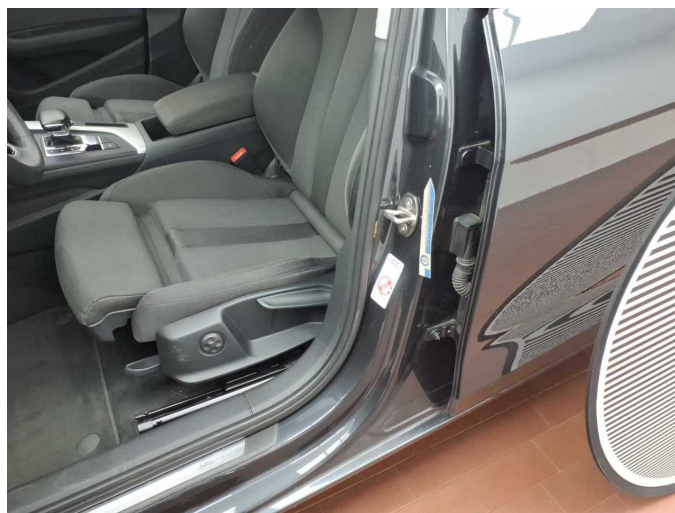

Damage 3: Body: B-pillar - left side - Dent / paintcoat damage - Smart repair



Damage 3: Body: B-pillar - left side - Dent / paintcoat damage - Smart repair



Damage 3: Body: B-pillar - left side - Dent / paintcoat damage - Smart repair



Damage 3: Body: B-pillar - left side - Dent / paintcoat damage - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratched - Paint



Damage 4: Rear bumper: Rear bumper - Scratched - Paint



Damage 4: Rear bumper: Rear bumper - Scratched - Paint



Damage 4: Rear bumper: Rear bumper - Scratched - Paint



Damage 4: Rear bumper: Rear bumper - Scratched - Paint




Damage 4: Rear bumper: Rear bumper - Scratched - Paint



Damage 5: Door - rear left side: Door - Scratch(es) - Paint




Damage 5: Door - rear left side: Door - Scratch(es) - Paint

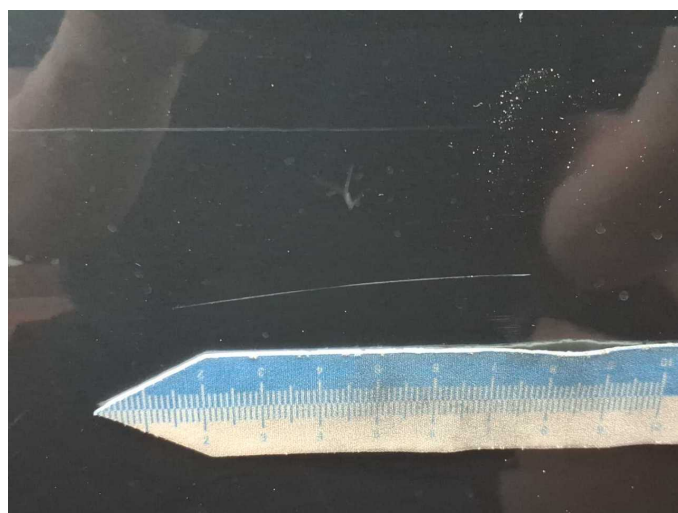


Damage 5: Door - rear left side: Door - Scratch(es) - Paint



Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

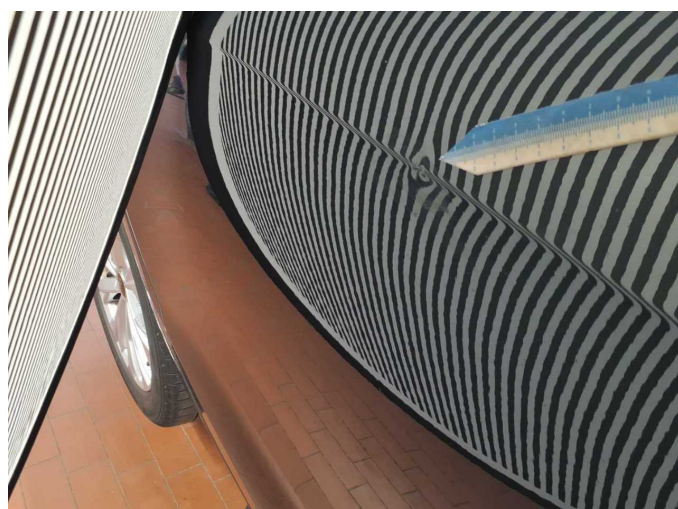

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

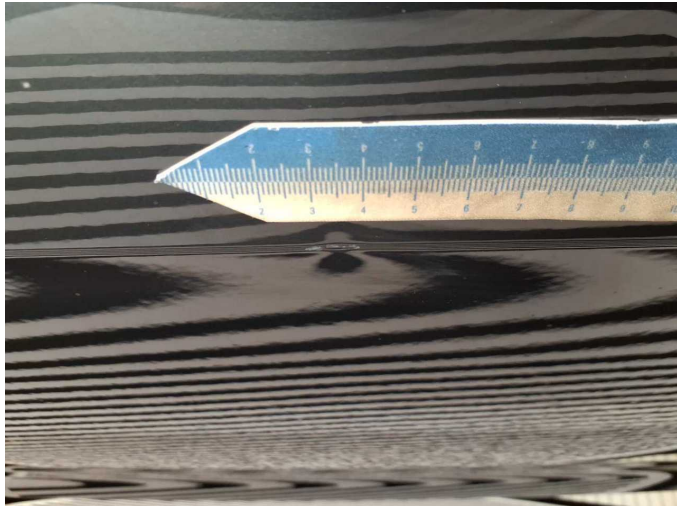

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 7: Roof: Roof (Steinschläge) - Corrosion - Paint



Damage 7: Roof: Roof (Steinschläge) - Corrosion - Paint



Damage 7: Roof: Roof (Steinschläge) - Corrosion - Paint

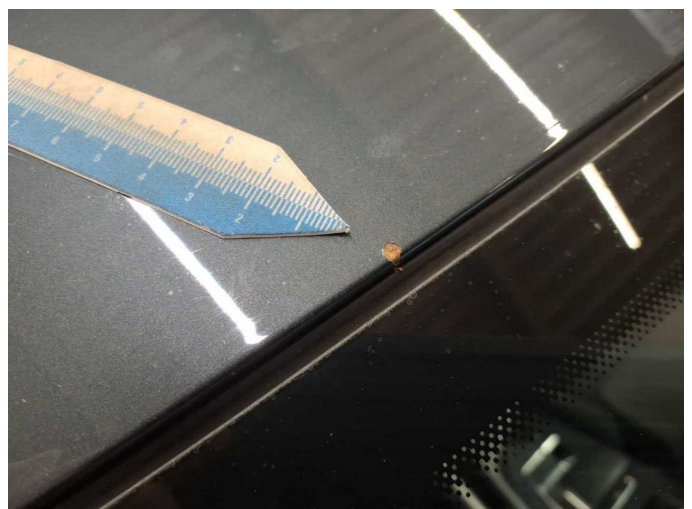

Damage 7: Roof: Roof (Steinschläge) - Corrosion - Paint



Damage 8: Bonnet: Bonnet - Stone chips - Paint



Damage 8: Bonnet: Bonnet - Stone chips - Paint



Damage 8: Bonnet: Bonnet - Stone chips - Paint



Damage 8: Bonnet: Bonnet - Stone chips - Paint



Repainting 1: Mudguard - left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF41RA002114
Hersteller / Modell: AUDI AUDI A4 Avant 35 TDI S tronic

Datum	KM-Stand	Beschreibung
15.10.2025	116.359	Getriebeöl ern/prüfen; Kraftstofffilter ern; Regelwartungsdienst; Reparatur Sonstiges
17.07.2025	108.044	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
09.07.2025	107.447	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
16.09.2024	87.078	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.06.2024	67.815	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
24.04.2024	57.375	Getriebeöl ern/prüfen; Kraftstofffilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
20.03.2024	50.676	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
30.01.2024	41.704	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne
22.12.2023	31.948	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
24.11.2023	28.207	Regelwartungsdienst
28.10.2023	17.487	Motoröl b. Wartung; Ölwechsel