



Expertise

Protocol number: 46553765
Order No. / Reference: 26657065
Inspection date: 14 Jul 2026

Manufacturer: Ford

Model: S-Max 2.0 EcoBlue Aut. Titanium

VIN: WF0JXXWPCJNS12112



Vehicle details

Manufacturer / Type / Model / Equipment

Ford S-Max 2.0 EcoBlue Aut. Titanium

Vehicle Identification number WF0JXXWPCJNS12112

Mileage (Read) 162,158 km

First registration 8 Jun 2022

Number of holders 1

Next periodical technical inspection 06/2027
(Report not on hand)

Power / Engine displacement 140 kw / 1,995 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 8

Type of drive Front drive

Type of vehicle Station wagon

Colour / colour code Frozen White

Doors / Seats 5 / 7

Upholstery type Cloth

Colour of upholstery Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	03/2026 at 150,792 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK807511
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BQR 00331		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,555 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Summer tyres on Light alloy	Continental	2mm / 2mm
2)	235/55 R17 103Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 99H	Winter tyres on Light alloy	Continental	4mm / 4mm
2)	235/55 R17 99H	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (illuminated glove compartment - map pockets on the driver's and passenger's seat backrests)
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated turn signals and ambient lighting and electrically foldable)
- Hill start assist
- third brake light
- Dual exhaust system (integrated into the rear bumper)
- Front door sill trim in chrome finish
- Lane Assist including Lane Keeping Assist and Driver Alert (warns the driver of an unintentional lane change via short steering wheel vibrations (without activation of the turn signal) - additionally, active steering support assists in returning to the lane)
- Ford Power Start function (keyless start)
- Luggage compartment cover (removable)
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission (with manual shift option)
- Back window, heater
- Interior lighting with delay circuit
- Isofix mounting (on all seats in the 2nd row)
- Electric child safety lock
- Radiator grille (upper part) - with chrome decorative trim)
- Radiator grille with chrome trim (lower part)
- Paint finish: Solid
- Steering wheel: Steering column, adjustable in height and reach
- Steering wheel: Paddle shifters on the steering wheel
- Front and rear reading lights (with LED technology)
- MyKey key system (individually programmable second key) (setting options include: - Limiting the maximum speed and radio volume (to max. volume 15 out of 32) - Speed warning (when the set speed limit is exceeded) - Safety assistance systems cannot be deactivated - Extended warning system for unfastened seat belts)
- Front and rear parking pilot system
- Upholstery: Cloth
- Tire repair kit (for use at a maximum speed of 80 km/h)
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlight dipped beam with switch-off delay including "greeting function"
- Headlight assistant with day/night sensor
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Seats: Driver and front passenger seats, 4-way manually adjustable (including manually adjustable lumbar support)
- Seats: Flexible seating system "FoldFlatSystem (FFS)" (2nd row of seats with 3 individual seats - adjustable longitudinally - seat backrests adjustable for tilt and individually foldable - headrests retractable)
- Ambient lighting in the front (including door storage, front door handle and footwell lighting)
- Anti-lock braking system (ABS) (with Electronic Stability Program (ESP), Roll Stability Control (RSC) and Traction Control System (TCS))
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires (in 10x2-spoke design)
- Diesel particulate filter (DPF)
- Tachometer
- Driver information system display 25.4 cm color (on-board computer with fuel consumption and mileage information as well as outside temperature display)
- Electric front and rear windows (with anti-pinch protection and automatic opening and closing function)
- Electronic parking brake
- Ford Power Start function with Ford Key Free system (keyless starting and locking/unlocking)
- Cruise control system with intelligent speed limiter (interior mirror, automatically dimming - traffic sign recognition system)
- rear window wiper
- Intelligent Protection System (IPS): - Active headrests, front, height-adjustable - Front airbag for driver and front passenger - Knee airbag for driver - Head and shoulder airbags, front and for 2nd row of seats - Side airbag for driver and front passenger - Seat belt tensioners and belt force limiters, front - 3-point seat belts on all seats, height-adjustable in the front)
- Steering wheel: Multifunction leather steering wheel and leather gear knob
- Front center console with padded armrest (storage compartment under the armrest - 2 cup holders - 12-volt socket at the rear)
- Fog lights (with static cornering lights)
- Emergency brake light (pulsating illumination of the brake lights during hard braking)
- Package: Winter (heated windscreen - individually and variably heated front seats)
- Radio equipment: CD audio system including Ford SYNC 3 with AppLink, touchscreen and Ford navigation system (radio/CD player, MP3-compatible, 2 USB ports, 8 speakers, steering wheel remote control, 20.3 cm screen diagonal), communication and entertainment system with extended voice control, Bluetooth interface, integration of various telephony functions and hands-free systems with voice command control, SMS text-to-speech function with display, music playback, Bluetooth audio streaming, emergency call assist, control of selected smartphone apps, support for Android Auto and Apple CarPlay)
- Seats: Front sports seats
- Seats: Front seats can be heated individually and variably.
- Start-stop system
- Storage compartment under driver and passenger seats
- LED daytime running lights



- Power outlet: 12-volt connection at the front (and in the first row of seats in the passenger compartment)
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Central locking with remote control (and remote luggage compartment release; door lock only on driver's side)

Extra equipment

- Airbag: Side airbags on the outer seats of the 2nd row.
- Exterior mirrors in body color, driver and front passenger side, electrically adjustable and heated (with integrated turn signals and puddle lights and electrically folding with blind spot assist including cross traffic alert. Cross traffic alert is a function that uses the radar sensors of the blind spot assist to monitor an area of approximately 40 m to the left and right of the vehicle when reversing out of perpendicular parking spaces. - dynamic distance control)
- tailgate (electric)
- Paint finish: Frost White
- Heated steering wheel
- Sony navigation system including Ford SYNC 3 with AppLink, DAB and touchscreen (radio/CD player, MP3-compatible, 2 USB ports, 9 premium speakers, steering wheel remote control, 20.3 cm screen diagonal, communication and entertainment system with extended voice control, Bluetooth interface, integration of various telephony functions and hands-free devices with voice command control, SMS text-to-speech function with display, music playback, Bluetooth audio streaming, emergency call assistant, control of selected smartphone apps, support for Android Auto and Apple CarPlay, DAB/DAB+)
- Wheels: LM 7.5Jx17 with 235/55 R17 10x2Sp. D2YDP
- Protective film for rear bumper
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: 3rd row of seats with 2 individual seats (Easy FoldFlat System) (seat backrests can be folded down individually at the touch of a button - headrests can be lowered - easy entry into the 3rd row of seats (Easy Entry))
- Sunshades in the rear side doors (manual)
- Fuel-operated auxiliary heater (including remote control, reinforced battery and heated windscreen)
- Power outlet: 230-volt connection (150 watts) (in the passenger compartment)

- Premium carpet floor mats (for the 1st and 2nd row of seats)
- Immobiliser
- Electrically swiveling trailer hitch (ESP trailer stabilization - continuous power supply - switched power supply - hill start assist)
- Roof rails "aluminum look"
- Anti-theft alarm system with interior monitoring and double locking.
- Vehicle lettering Dräger small
- Ford Ergonomic Seat Driver+Passenger BYQAL
- Front camera with split view technology (rearview camera)
- Air conditioning with automatic temperature control (3 zones) (separately adjustable for driver and front passenger side as well as rear)
- Package: Business III with adaptive cruise control (digital radio reception DAB/DAB+ (Digital Audio Broadcasting) - Active Park Assist with parallel and perpendicular parking function - reversing camera - adaptive cruise control (ACC) - pre-collision assist (distance display and distance warning, collision warning system and active emergency braking assist) - traffic jam assist with stop & go function)
- Active Park Assist (with parking and exiting function)
- Pre-Collision Assist (Forward Alert system - distance display and distance warning - active emergency braking assist)
- Radio equipment: CD audio system including Ford SYNC 3 with AppLink, touchscreen, DAB and Ford navigation system (radio/CD player, MP3-compatible, 2 USB ports, 8 speakers, steering wheel remote control, 20.3 cm screen diagonal, communication and entertainment system with extended voice control, Bluetooth interface, integration of various telephony functions and hands-free systems with voice command control, SMS text-to-speech function with display, music playback, Bluetooth audio streaming, emergency call assist, control of selected smartphone apps, support for Android Auto and Apple CarPlay, DAB/DAB+)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Roof	Roof - Stone chips - Smart repair
3	Body	Body (Flugrost) - Paint defect - Conditioning
4	Wheel / tyres	Tyre - front - does not meet manufacturer specifications - Replace
5	Side panel - rear left side	Side panel - Corrosion - Paint
6	Rear bumper	Rear bumper - Scratch(es) - Paint
7	Front bumper	Front bumper - Scratch(es) - Paint
8	Bonnet	Bonnet - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Roof	Roof rail - left side - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

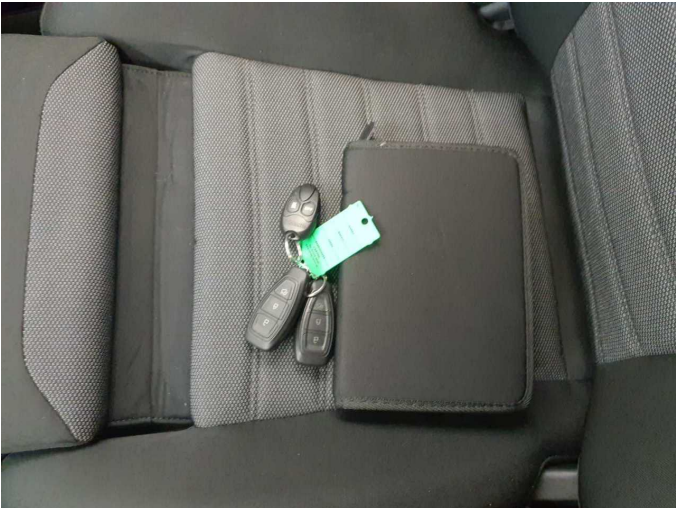


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

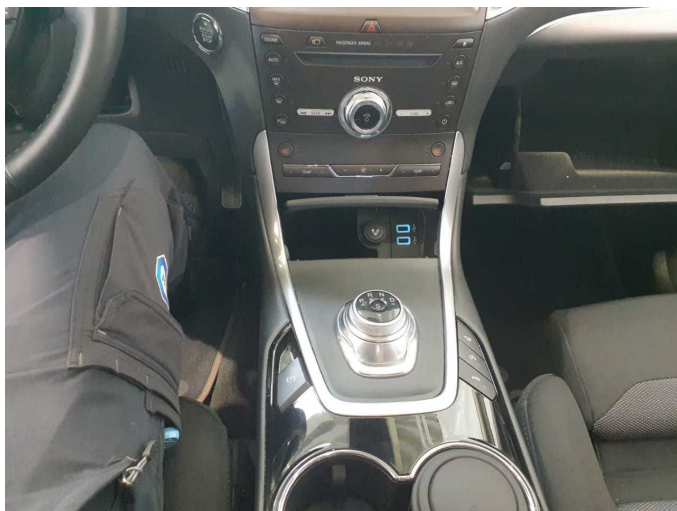


Figure 21: Misc.



Figure 22: Misc.

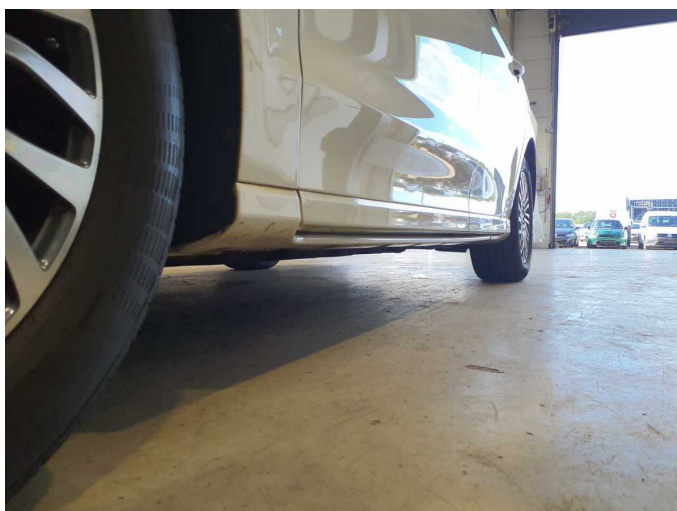


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Roof: Roof - Stone chips - Smart repair



Damage 2: Roof: Roof - Stone chips - Smart repair




Damage 3: Body: Body (Flugrost) - Paint defect - Conditioning



Damage 4: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace




Damage 4: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace

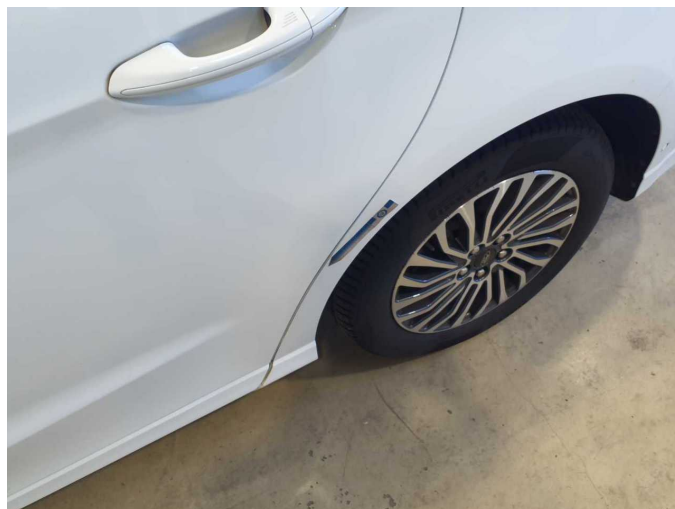

Damage 5: Side panel - rear left side: Side panel - Corrosion - Paint



Damage 5: Side panel - rear left side: Side panel - Corrosion - Paint

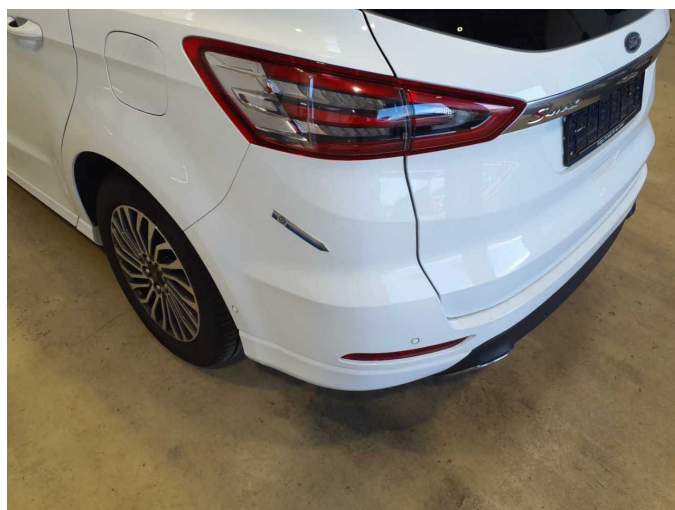

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: Bonnet: Bonnet - Scratch(es) - Paint



Damage 8: Bonnet: Bonnet - Scratch(es) - Paint



Damage 8: Bonnet: Bonnet - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0JXXWPCJNS12112
Hersteller / Modell: FORD FORD S-Max 2.0 EcoBlue Aut. TITANIUM

Datum	KM-Stand	Beschreibung
26.03.2026	150.792	Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
04.02.2026	145.110	Batterie ern
01.08.2025	124.061	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Wartung Sonstiges
24.06.2025	120.242	HU + AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
17.12.2024	90.798	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Keilriemen ern; Reparatur Sonstiges; Zahnriemen/ Steuerkett ern
31.10.2024	90.798	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
01.03.2024	59.967	Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.06.2023	31.372	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges