



Expertise

Protocol number: 46634900
Order No. / Reference: 26698667
Inspection date: 22 Jul 2026

Manufacturer: Audi

Model: A6 40 TDI S tronic sport

VIN: WAUZZZF28PN024082



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A6 40 TDI S tronic sport	
Vehicle Identification number	WAUZZZF28PN024082
Mileage (Read)	184,589 km
First registration	17 Nov 2022
Number of holders	1
Next periodical technical inspection	11/2027
(Report on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,968 ccm / 4
Power	150 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Brillantschwarz
Doors / Seats	4 / 5
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	17,500 km
Last service on / at	04/2026 at 172,654 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP811241
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BTN 03004		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,250 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	245/45 R19 102Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R17 99H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	225/60 R17 99H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Audi connect navigation & infotainment
- Audi drive select
- Audi pre sense front
- Exterior mirror housings in body color
- Fabric headliner
- Diesel particulate filter (DPF) with nitrogen oxide catalyst and AdBlue tank
- Electronic Stability Control (ESC)
- key fob
- Cruise control system including speed limiter
- Transmission: S tronic 7-speed
- Interior mirror dimming
- 2-zone automatic climate control
- Headrests (4)
- LED headlights
- Steering column, manually adjustable in height and axis
- front center armrest
- Package Gloss
- Progressive steering
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus with MMI touch response
- Seat covers in fabric
- Seats: Front sports seats
- Lane Departure Warning
- Glazing: Windscreen in heat-insulating glazing
- Electronic immobilizer
- Thermal insulation glazing on the sides and rear
- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Audi connect emergency call & service m.connect remote & control
- Electrically adjustable and heated exterior mirrors
- third brake light
- Decorative inlays aluminum fragment
- Tachometer
- Door sills with aluminum inlay front and rear
- Driver information system with color display
- Automatically opening luggage compartment lid/manually opening luggage compartment lid
- Interior lighting
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Paint finish: Solid
- Steering wheel: Leather steering wheel, 3-spoke, with multifunction and paddle shifters
- MMI navigation with MMI touch response
- Non-smoking package
- Wheel: Alloy wheels, 5-arm design
- Wheel: Tire repair kit
- Radio accessories: 8 speakers (passive) front and rear
- Seats: 4-way lumbar support
- Sun visor on driver and passenger side
- Start-stop system
- Glazing: Rear window, rear door and side windows in clear glass
- Central locking



Extra equipment

- Assistance Package Tour
- Business Package (Assistance Package Tour: Adaptive Driving Assistant supports the driver with acceleration, braking, maintaining speed and distance, and lane keeping. Adaptive Cruise Control, Speed Limiter. Efficiency Assistant supports the driver with predictive driving. Parking Aid Plus, 4-zone automatic climate control, heated front seats, Audi phone box, automatically dimming interior mirror, automatically dimming exterior mirrors, adaptive windscreen wipers with integrated washer nozzles, high-beam assistant)
- Decorative inlay in dark, matt brushed aluminum
- Front seat heating
- Fuel tank (73 liters) (fuel tank for 73 liters of gasoline/diesel fuel)
- Package: Ambient lighting package plus (contour lighting front/rear doors, color-matched - ambient fabric lighting front/rear doors, color-matched - ambient lighting front center console, color-matched - contour lighting front center console, color-matched - contour lighting with illuminated quattro lettering (for all-wheel drive) on the instrument panel on the passenger side, color-matched - ambient lighting of the instrument panel)
- Parking aid plus with surround view
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Seat covers in Valcona leather with S embossing for sports seats (seat center panels, seat side bolsters, headrests and front center armrest in black or rotor grey Valcona leather with contrasting stitching; door panel inserts in black Alcantara with S embossing in the backrests of the front seats)
- Seats: Split-folding rear seat backrest
- Towbar including trailer assist (Trailer assist supports the driver in steering the trailer while reversing; the trailer no longer needs to be constantly stabilized by the driver; when the system is active, collisions between the vehicle and trailer are avoided; Compatible with all trailers with a rigid drawbar; Feedback on the trailer and system status in the MMI display; Towbar with mechanically swiveling ball head; Trailer stabilization via ESC; Operation via button in the luggage compartment)
- Wheel: 5-arm dynamic alloy wheels (S-design)
- Audi virtual cockpit plus (3 individual display options: Dynamic, Sport and Classic - operation via the multifunction steering wheel - configuration of on-board computer values in the tachometer - display of the navigation map as a 3D terrain model on the high-resolution 12.3-inch full HD color display - permanent display of navigation information in the speedometer area when route guidance is active - break recommendation)
- Auxiliary heater/ventilation (The auxiliary heater warms the interior and defrosts the windows without starting the engine. The auxiliary ventilation system supplies fresh air and lowers the interior temperature. Both functions can be activated via a timer and separate remote control. An intelligent control system with timer and departure time programming calculates the heating duration efficiently in terms of time and energy. Separate remote control with illuminated display. 2 selectable heating modes: - defrost (defrost mode for the windows only) - warm)
- Comfort key with sensor-controlled luggage compartment unlocking (The vehicle can be opened by operating the door handle without actively using the key. To lock the vehicle from the outside, simply touch one of the sensor buttons on the door handles. The drive authorization is also activated without actively using the comfort key. The driver must be inside the vehicle and have the comfort key with them. The engine is started and stopped using the engine start/stop button in the center console.)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides
- Reversing camera (The reversing camera displays the area behind the vehicle on the upper display. Dynamic display elements such as a steering angle-dependent lane calculation assist with parking or maneuvering.)
- S line Sport package (5-arm alloy wheels (S design), 8.5J x 19 with 245/45 R19 tires, sport suspension, illuminated front and rear door sills, front door sills with S lettering, S line emblem on front fenders, 3-spoke sport leather steering wheel with multifunction controls and shift paddles, steering wheel grips and selector lever knob with S emblem in perforated leather, S line seat covers in fabric/leather combination with S embossing on the front seat backrests, brushed dark aluminum trim, interior, dashboard and headliner in black, stainless steel footrest and pedals, floor mats)
- Wheel: Winter alloy wheels, 10-spoke design (7.5 J x 17 with tires 225/60 R17)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Door trim - rear right side - Deformed - Loss in value
2	Sill - right side	Sill - Scratch(es) - Smart repair
3	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
4	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
5	Sill - right side	Trim - Scratched - Paint
6	Front bumper	Front bumper - Scratched - Paint
7	Rear bumper	Rear bumper - Scratch(es) - Paint
8	Door - rear right side	Door - Scratch(es) - Paint
9	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
10	Bonnet	Bonnet (Verätzung) - Soiled - Paint
11	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Door - front right side	Door edge - Scratch(es) - No deduction
2	Door - rear left side	Door - Scratch(es) - No deduction
3	Seat - rear	Upholstery (Druckstellen) - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Log book (Mappe)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 29 Jan 2024	2.521,93 €

Repainting

No. Repainting

1	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
---	---

Paint coat thickness measurement

Side panel - rear right side	183 µm
------------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

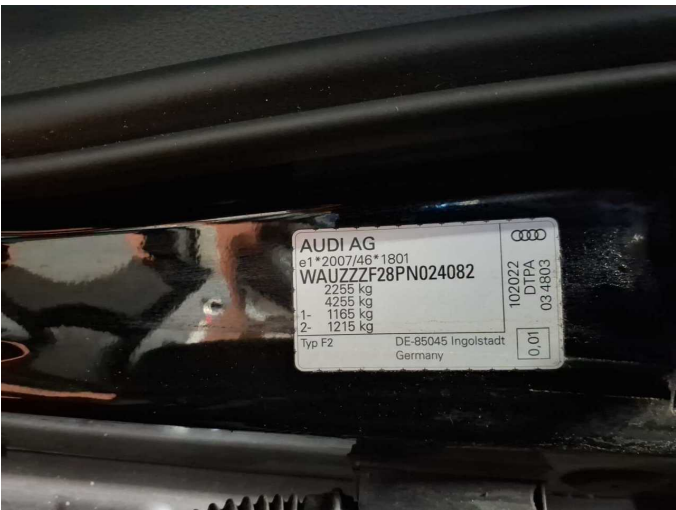


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

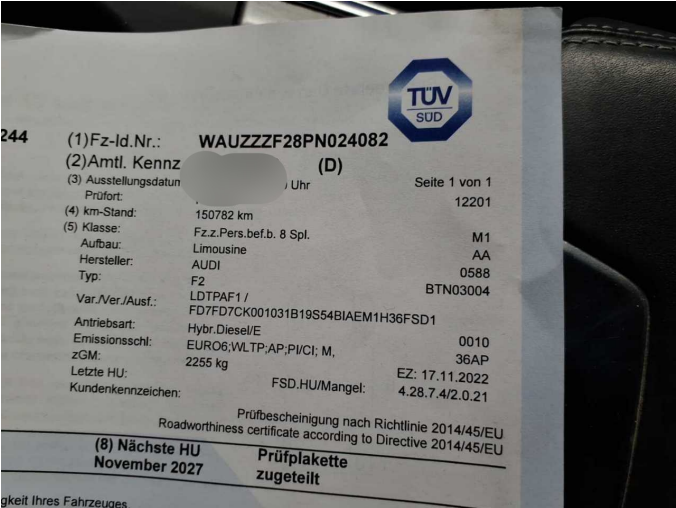


Figure 15: Documents



Figure 16: Additional tyres

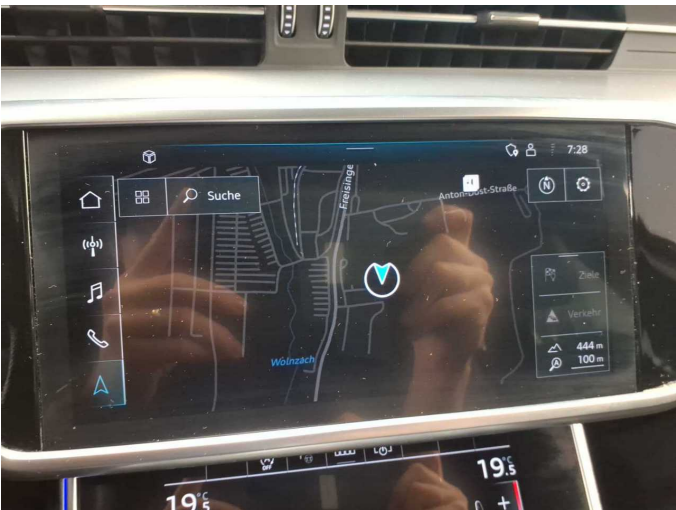


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

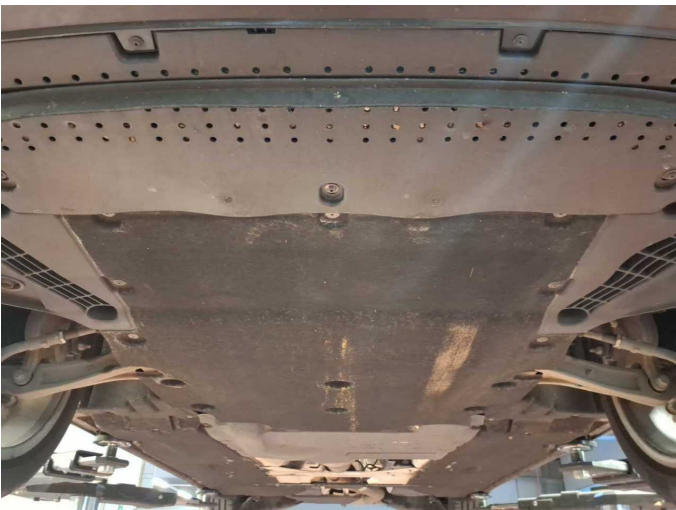


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

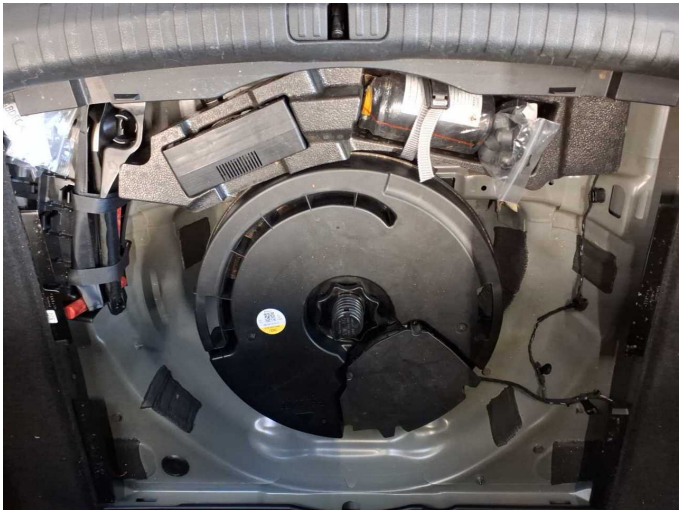


Figure 34: Misc.




Figure 35: Misc.



Damage 1: Trim / covers: Door trim - rear right side - Deformed - Loss in value



Damage 1: Trim / covers: Door trim - rear right side - Deformed - Loss in value

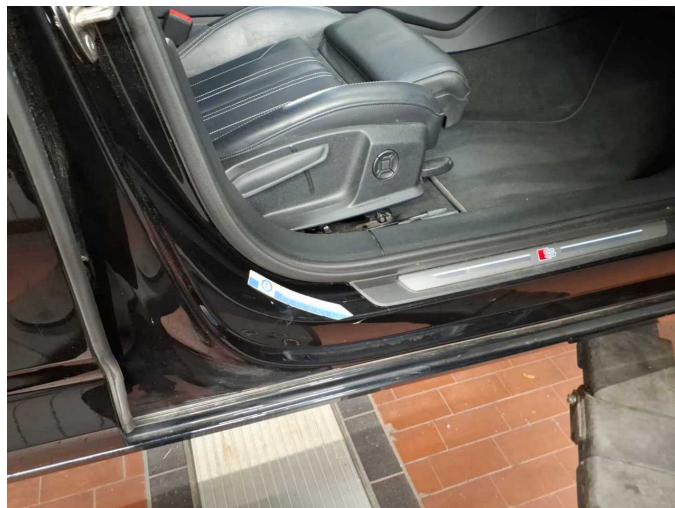

Damage 2: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 2: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 5: Sill - right side: Trim - Scratched - Paint



Damage 5: Sill - right side: Trim - Scratched - Paint



Damage 5: Sill - right side: Trim - Scratched - Paint



Damage 6: Front bumper: Front bumper - Scratched - Paint



Damage 6: Front bumper: Front bumper - Scratched - Paint




Damage 6: Front bumper: Front bumper - Scratched - Paint




Damage 6: Front bumper: Front bumper - Scratched - Paint



Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint

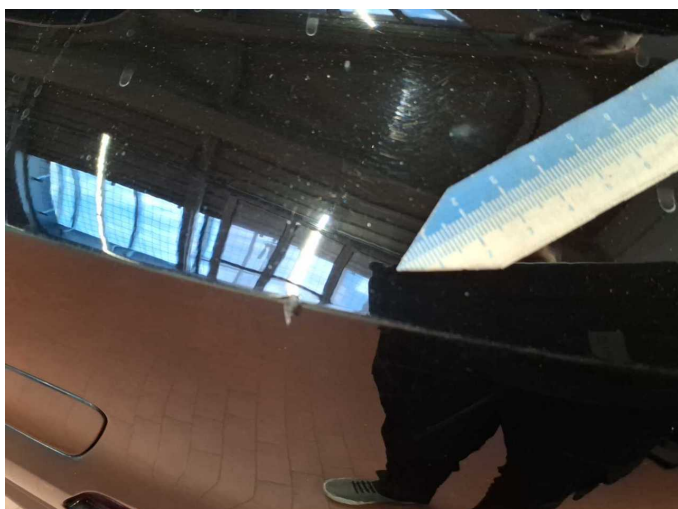

Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint

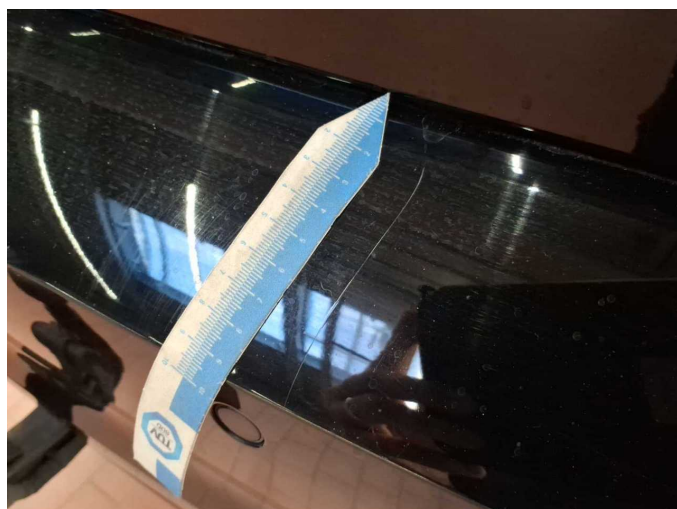


Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Door - rear right side: Door - Scratch(es) - Paint




Damage 8: Door - rear right side: Door - Scratch(es) - Paint

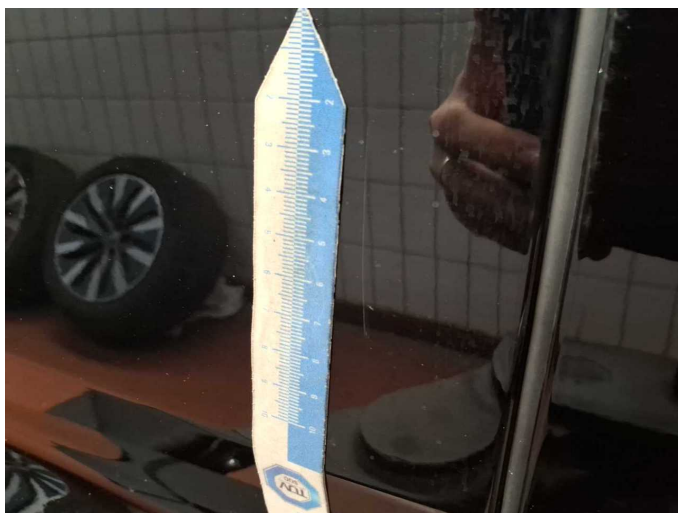

Damage 8: Door - rear right side: Door - Scratch(es) - Paint



Damage 9: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

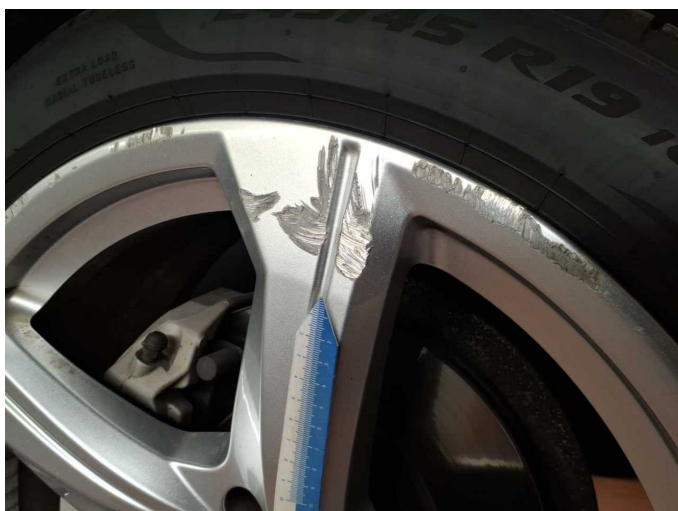

Damage 9: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 10: Bonnet: Bonnet (Verätzung) - Soiled - Paint




Damage 10: Bonnet: Bonnet (Verätzung) - Soiled - Paint



Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace

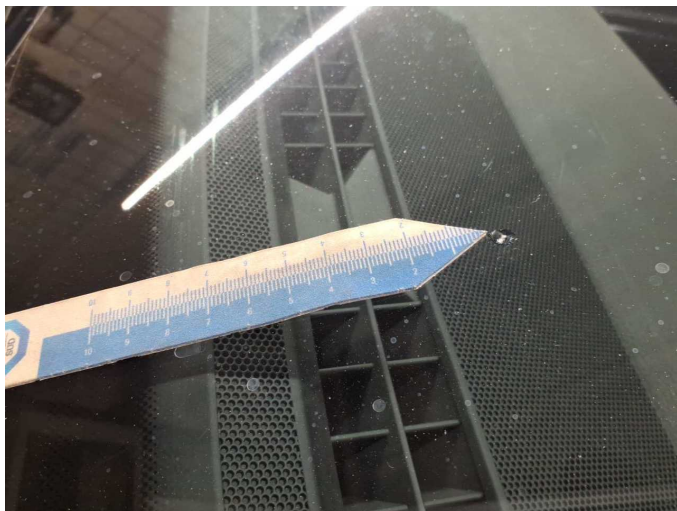

Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace

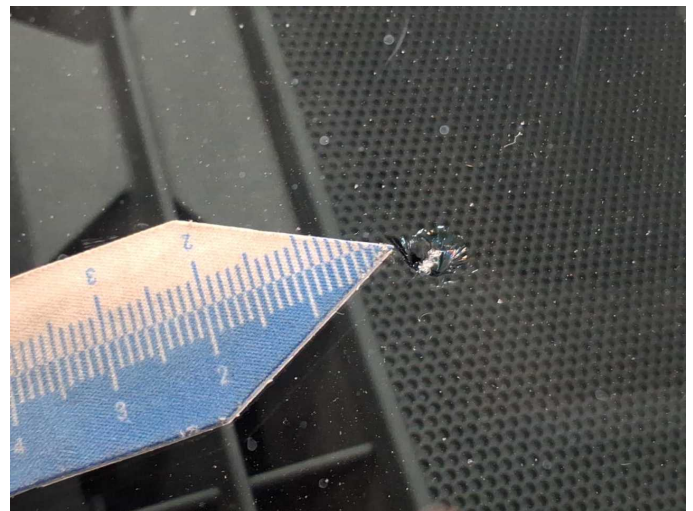

Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace



Repainting 1: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF28PN024082
Hersteller / Modell: AUDI AUDI A6 40 TDI S tronic sport

Datum	KM-Stand	Beschreibung
13.04.2026	172.654	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Getriebeöl ern/prüfen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
26.11.2025	152.841	Systemtest/Eigendiagnose; Systemtest/Eigendiagnose
24.11.2025	152.841	Systemtest/Eigendiagnose
07.11.2025	150.781	AU
26.09.2025	145.457	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
28.08.2025	140.483	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne
13.03.2025	117.225	Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
16.12.2024	104.326	Bremsflüssigkeit; Bremsflüssigkeit ern
19.09.2024	89.028	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
01.03.2024	58.887	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
24.07.2023	29.238	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges