



### RENAULT MEGANE GRANDTOUR:

Vinnnumber:	<b>VF1RFB00766885075</b>	Versionname:	<b>Blue dCi 115 EDC Intens</b>
First Registrationdate:	<b>18/02/2021</b>	Fiscalpower:	
Expertise Mileage:	<b>123556</b>	Power Kw:	<b>85</b>
Bodytype:		Body colour:	<b>White</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:		Parking lot:	<b>3815</b>
Fueltype:	<b>Diesel</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		
Registration Certificate Home (BE):	<b>No</b>		

### Options

Number of keys total:	<b>2</b>	Front parking sensors:	
Cruise Control:		Rear parking sensors:	
Steering wheel multifunctional:		Type of Tow bar:	<b>No Tow bar</b>
Radio multimedia:			
Type of headlighting:	<b>Headlighting LED</b>		
Type of GPS:	<b>GPS big screen color</b>		
Type of Lining:	<b>Lining semi-artificial leather</b>		
Type of climate control:	<b>Autom climate control</b>		

### Limited Technical Inspection

### Tyres

205/60/16/91 H				
Summer tyres:	Fr.L.	<b>Michelin: 4 mm</b>	Fr.R.	<b>Michelin: 4 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Michelin: 4 mm</b>
Tyre profile depth FL				<b>4.0</b>
Tyre profile depth FR				<b>4.0</b>
Tyre profile depth RL				<b>4.0</b>
Tyre profile depth RR				<b>4.0</b>
Tyre size FL				<b>205/60 R 16 91 H</b>
Tyre size FR				<b>205/60 R 16 91 H</b>
Tyre size RL				<b>205/60 R 16 91 H</b>
Tyre size RR				<b>205/60 R 16 91 H</b>
Tyre type FL				<b>Summer</b>
Tyre type FR				<b>Summer</b>
Tyre type RL				<b>Summer</b>
Tyre type RR				<b>Summer</b>
Tyre make FL				<b>261</b>
Tyre make FR				<b>261</b>
Tyre make RL				<b>261</b>
Tyre make RR				<b>261</b>

### Assistance equipment

Emergency spare wheel:	<b>Yes</b>	Jack:	<b>Yes</b>
Number of charging cables (normal):	<b>0</b>		
Number of charging cables (rapid charge):	<b>0</b>		

Total cost ex VAT:	<b>2022,92</b>
Interior, Not original part, Check:	<b>0,00</b>



Bumper F, Scratch(es), Repair and paint (complete) 296,58



Bumper moulding F, Scratch(es), Acceptable 0,00



Outside rear-view mirror housing L, Crack, Replace 66,45



Alloy rim FL polished, Scratch(es), Acceptable 0,00



Outer sill L, Dent(s) and scratch(es), Repair and paint (complete) 553,82



Boot carpet, Damaged, Replace 233,53




Luggage compartment cover, Missing, Replace 233,53



Bumper R, Scratch(es), Acceptable 0,00



Alloy rim FR polished, Scratch(es), Repair and paint (complete) 204,21

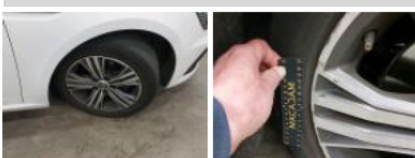

Outer sill R, Dent(s), Repair and paint (complete) 434,80



Bodywork, Not original part, Remove lettering

0,00

