



Expertise

Protocol number: 46417628
Order No. / Reference: 26383093
Inspection date: 9 Jul 2026

Manufacturer: Ford

Model: Mustang Mach-E AWD PREMIUM

VIN: WF0TK3SU5PMA13922



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Mustang Mach-E AWD PREMIUM	
Vehicle Identification number	WF0TK3SU5PMA13922
Mileage (Read)	118,669 km
First registration	18 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2026
(Report not on hand)	
Power / Engine displacement	124 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Absolute Black
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT878706
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BVF 00012		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,690 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R19 103H	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	225/55 R19 103H	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R18 104H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	225/50 R18 104H	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Acoustic Vehicle Alerting System (AVAS)
- Ambient lighting, multicolor LEDs
- Anti-lock braking system (ABS)
- Electrically folding exterior mirrors
- Exterior mirrors in contrasting black color
- Tires: Tire repair kit
- Brake calipers, painted red
- Anti-theft alarm system with interior monitoring
- Electronic Stability Program (ESP)
- Electric front and rear windows with all-around closing function
- Electric parking brake with auto hold function
- Ford EcoCoach
- Front trunk with Ford MegaBox
- Heated windshield
- Transmission: 1-speed direct drive
- Heated rear window
- Rear spoiler
- Intelligent Range
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Front headrests are height-adjustable
- Charging cables: 2 charging cables for charging the high-voltage battery (Mode 3 charging cable (length 6 m) and home charging cable for standard household socket (length 6.7 m))
- Media console with two USB ports at the front and two USB charging ports at the rear of the center console.
- MyKey key system
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Front and rear parking pilot system
- Pedal assembly with aluminum pads
- Upholstery: Premium Sensico upholstery in leather look, perforated, in black with red decorative stitching
- Wheel arch trim in glossy black
- Tire Pressure Monitoring System (TPMS)
- Reversing camera with reversing parking assistant
- Windscreen wipers with rain sensor
- Headlights: Matrix LED headlights with daytime running lights
- Keys: Two classic car keys (Keyless Entry - also possible via door code or smartphone via FordPass app, Keyless Start via smartphone via FordPass app, start button or code)
- Seat: Rear seat backrests, foldable, 60:40 split
- Seats: Front seats, individually and variably heated
- Power outlet: 12-volt connection in the luggage compartment
- Carpet floor mats front and rear, velour
- Traffic sign recognition system
- Immobiliser
- All-wheel drive
- Towbar preparation kit
- Dashboard with carbon-look inserts
- Electrically adjustable and heated exterior mirrors
- Tires: 7 J x 19 light alloy wheels (4) in 5-spoke Y-design
- third brake light
- Black woven fabric headliner
- Door sill trims with metal application
- Driver information system with digital instrument panel, 10.2" screen diagonal (25.9 cm)
- High Beam Assist, Glare-Free
- Ford Co-Pilot360 incl. Ford Intelligent Drive Assist
- FordPass Connect including eCall, live traffic information and Wi-Fi hotspot
- Flexible luggage compartment cover and luggage compartment lighting
- rear window wiper
- Interior mirror, automatically dimming
- Intelligent Protection System (IPS)
- Air conditioning with automatic temperature control
- Rear headrests (3) height adjustable
- Paint finish: Solid
- Steering wheel: Sensico steering wheel in leather look, heated
- Illuminated makeup mirrors in the driver's and passenger's sun visors
- Rear center armrest with two cup holders
- Mustang LED taillights
- Fatigue warning
- One Pedal Drive
- Package: Technology Package+ (B&O Sound System - electric, sensor-controlled tailgate)
- Pollen and dust filter
- Post-Collision Assist
- Radio: Ford SYNC 4A audio system with digital radio reception DAB/DAB+, touchscreen and navigation (Ford SYNC 4A communication and entertainment system - navigation system - FordPassConnect incl. eCall - Amazon Alexa Built-in voice assistant - radio player with DAB and 6 speakers - 15.5" touchscreen in center console - digital radio reception DAB/DAB+ (Digital Audio Broadcasting))
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Power steering
- Seats: Driver and passenger seats, 8-way electrically adjustable
- Seats: Comfort seats, front
- Pocket on the driver's and passenger's seat backrest
- Telephone: Inductive charging station for mobile devices
- Electric door child safety lock
- Lashing eyes in the luggage compartment
- Central locking system with overall locking function



Extra equipment

- Detachable towbar including installation
- Panoramic roof

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Wheel well extension - Scratch(es) - Smart repair

Missing parts

Description

Equipment - charging cable (Heimladekabel)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

Fahrzeug weist rundum hohe Lackwert auf

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

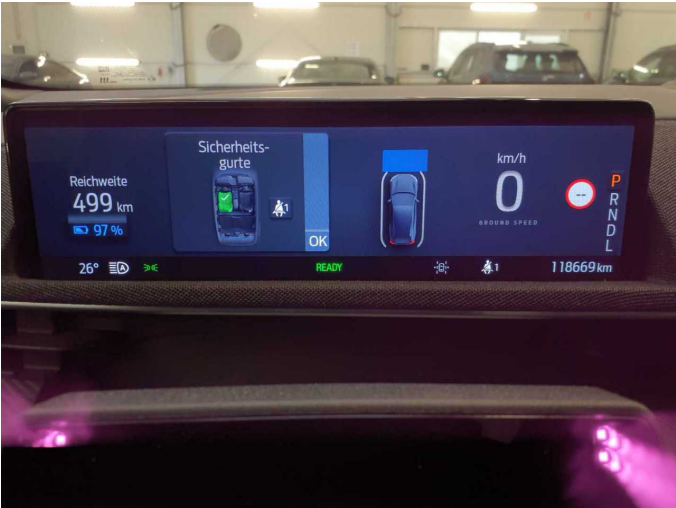


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

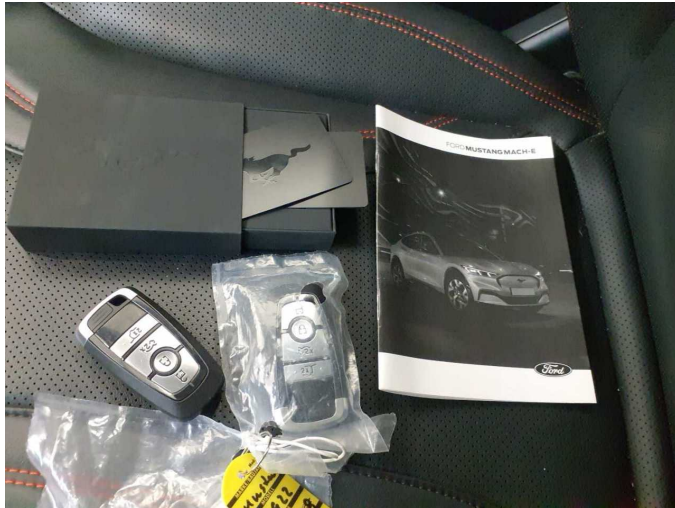


Figure 13: Documents



Figure 14: Additional tyres

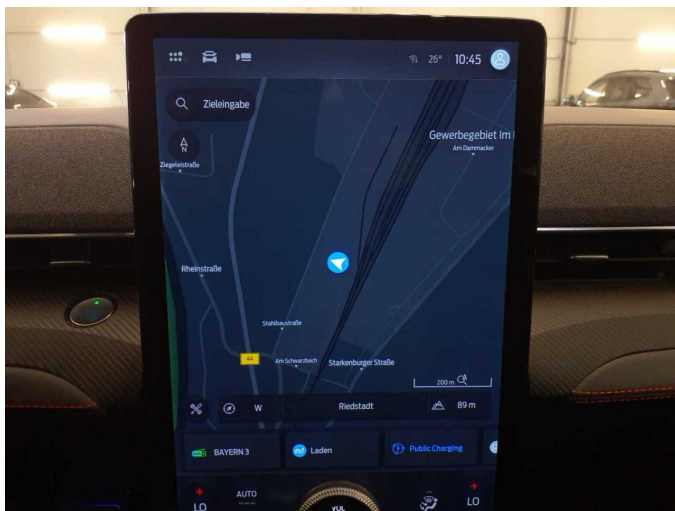


Figure 15: Navigation



Figure 16: Misc.

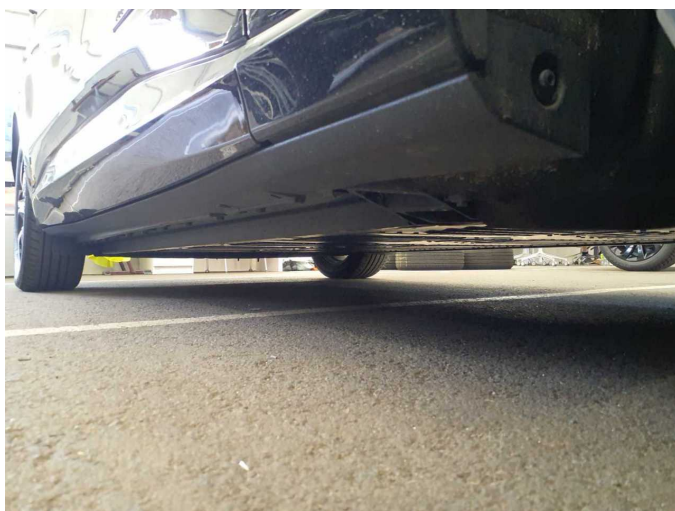


Figure 17: Misc.

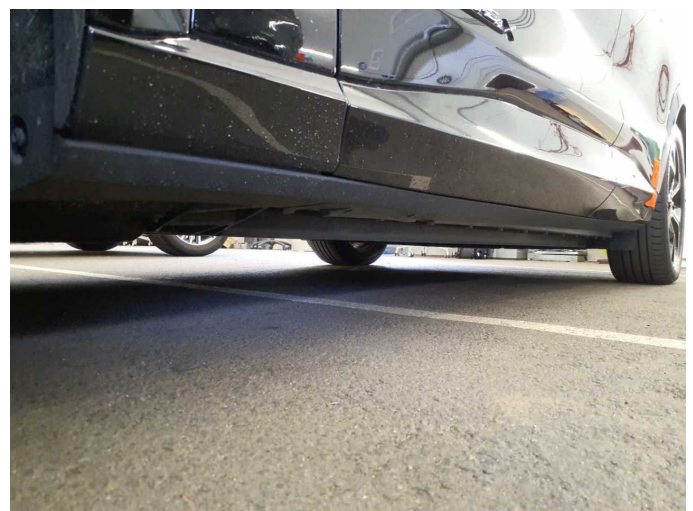


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

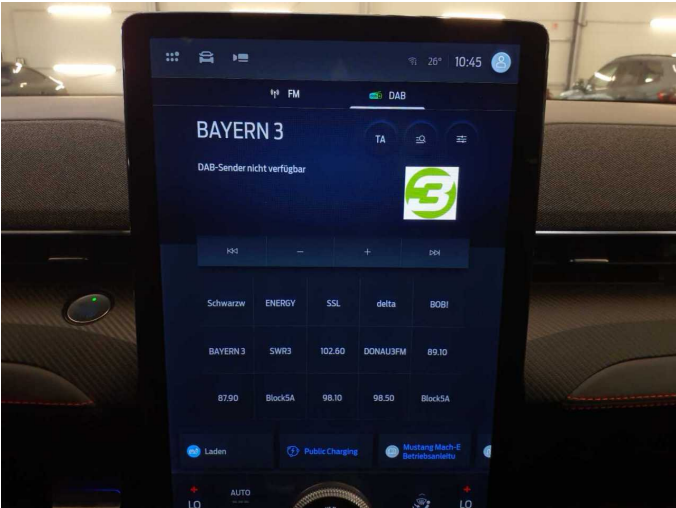


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Side panel - rear right side: Wheel well extension - Scratch(es) - Smart repair



Damage 1: Side panel - rear right side: Wheel well extension - Scratch(es) - Smart repair



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1TZNW011561

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touran 2.0 TDI SCR DSG
Highline

Datum	KM-Stand	Beschreibung
24.03.2026	137.355	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben hinten; Regelwartungsdienst; Wartung Sonstiges
02.12.2025	127.007	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
05.05.2025	105.741	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.01.2025	95.050	Systemtest/Eigendiagnose
28.06.2024	80.696	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
22.09.2023	54.967	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.01.2023	27.005	Motoröl b. Wartung; Regelwartungsdienst