



PEUGEOT 308: FQ-200-YK

Vinnumber:	VF3LPHNSKLS157178	Versionname:	PEUGEOT 308 Puretech 130 S&S EAT8 Allure Busin
First Registrationdate:	26/06/2020	Fiscalpower:	VP [5P] bva 8-130CH-6cv (bi-corps)
Expertise Mileage:	99445	Power Kw:	96
Bodytype:	Berline	Body colour:	Dark Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Interior colour:	Black
Fueltype:	Petrol	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Steering wheel leather		Rear view camera	
Type of climate control	Autom climate control	Seat cover lining	Lining Other
			Lining Semi-leather

Tyres

	205/55/16/91 H			
Summer tyres:	Fr.L.	Michelin: 70%	Fr.R.	Michelin: 75%
	Re.L.	Michelin: 90%	Re.R.	Michelin: 95%
Tyre profile depth FL				3.8
Tyre profile depth FR				3.4
Tyre profile depth RL				2.0
Tyre profile depth RR				1.8
Tyre size FL				205/55 R 16 91 H
Tyre size FR				205/55 R 16 91 H
Tyre size RL				205/55 R 16 91 H
Tyre size RR				205/55 R 16 91 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment


Spare wheel	Yes	Jack	Yes
Remote ignition key (no insert), Missing, Repair/replace (lump sum)			



Interior, Stain, Cleaning



Tyre FR, Out of tolerance, Replace

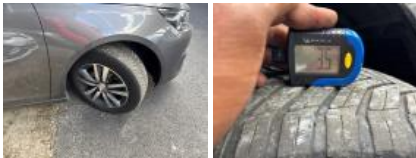

Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)




Tyre RR, Out of tolerance, Replace



Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)




Tyre RL, Out of tolerance, Replace

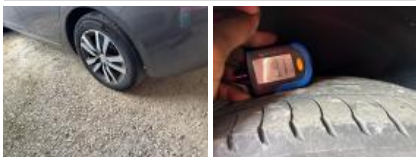

Tyre FL, Out of tolerance, Replace



Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)

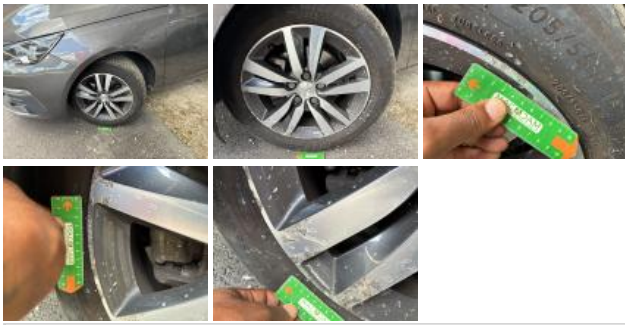

Bonnet, Dent(s), Repair and paint (complete)



Bumper F, Scratch(es), Paint



Wing RR, Dent(s), Repair and paint (complete)



Roof pillar R, Dent(s), Repair and paint (complete)



Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Dent(s) and scratch(es), Repair and paint (complete)



Door FR, Scratch(es), Paint



Outside rear-view mirror housing R, Scratch(es), Acceptable



Rubber seal for boot lid, Tear, Replace



Bumper R, Scratch(es), Paint



Roof, Hail damage, Repair and paint (complete)



Historique Maintenance

Immatriculation: FQ-200-YK Date de 1ère immatriculation: 26/06/2020

Modèle: Peugeot 308 Puretech 130 S&S EAT8 Allure Busin VP [5P] bva 8-130CH-6cv (bi-corps)

Date	Kilométrage	Fournisseur	Descriptif
13/11/2025	90.918	ABCIS POITOU BY AUTOSPHERE	DIVERS CLIM
	0		REVISION
	0		RECYCLAGE
	0		BALAI ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
13/12/2024	69.917	ABCIS POITOU BY AUTOSPHERE	BOITIER D ALLUMAGE RPLT
	0		FILTRE A AIR RPLT
	0		LIQUIDE DE FREIN
	0		RECYCLAGE
	0		REVISION
	0		BALAI ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
	0		DIVERS CLIM
	0		FILTRE CLIM RPLT
23/08/2024	64.039	ACO SECURITE	CONTRE VISITE CT
02/07/2024	63.971	ACO SECURITE	CONTROLE TECHNIQUE
15/09/2023	49.359	ABCIS POITOU BY AUTOSPHERE	RECYCLAGE
	0		REVISION
	0		BALAI ESSUIE GLACE AR
	0		BOITIER D ALLUMAGE RPLT
	0		FILTRE A AIR RPLT
	0		BALAI ESSUIE GLACE AV
28/09/2022	28.892	ABCIS POITOU BY AUTOSPHERE	LIQUIDE DE FREIN
	0		BALAI ESSUIE GLACE AV AR
	0		BALAI ESSUIE GLACE AV AR
	0		FILTRE CLIM RPLT
	0		REVISION
30/08/2021	11.939	ABCIS POITOU BY AUTOSPHERE	RECYCLAGE
	0		REVISION