



Expertise

Protocol number: 46523325
Order No. / Reference: 26469353
Inspection date: 7 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1N9N0CB3RJ087883

Model: EQA 250+ Progressive



ALPHABET



ALPHABET

Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz EQA 250+ Progressive	
Vehicle Identification number	W1N9N0CB3RJ087883
Mileage (Read)	74,595 km
First registration	1 Aug 2023
Number of holders	1
Power / Engine displacement	95 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Mountaingrau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	294 Tag(e)
Last service on / at	04/2026 at 74,491 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV728169
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BEE 00014		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,470 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Winter tyres on Light alloy	Uniroyal	5mm / 5mm
2)	225/55 R18 102V	Winter tyres on Light alloy	Uniroyal	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104T	Summer tyres on Light alloy	Bridgestone	2mm / 2mm
2)	235/55 R18 104T	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment in center console with roller blind
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Acoustic environmental protection
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- outdoor thermometer
- Color glass
- Third brake light in LED technology
- EASY-Pack tailgate with electric operation for opening and closing
- Velour floor mats in black
- Speed Limit Assistant
- Rear window heated
- Climate: THERMATIC automatic climate control
- Headrests (5)
- Charging cable for wallbox and public charging stations, 5m, smooth (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A).)
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Cargo space
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote and Charging Services Premium
- Windscreen wipers with rain sensor
- Seats: Comfort seats
- Power outlet: 12V socket in the luggage compartment
- TIREFIT with tire inflation compressor
- Immobiliser
- Decorative elements spiral look
- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- Ambient lighting
- Rear armrest
- Electrically adjustable exterior mirrors
- Basic services
- Double cup holder
- DYNAMIC SELECT
- Chassis: Comfort chassis with lowered suspension
- Electric windows, front and rear
- Luggage net on driver and passenger seatbacks
- Transmission: Direct drive
- rear window wiper
- Communication module (LTE) for the use of Mercedes me connect services
- Chrome-look loading sill protector
- Charging system: Direct current charging system (DC charging)
- Charging system: Alternating current charging system (AC charging) up to 11 kW (3-phase)
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black leather
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: Hard disk navigation
- Package: Light and Visibility Package
- Upholstery: ARTICO leatherette/fabric
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Rear view camera
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Rear seat backrests foldable
- Cruise control
- High-visibility vest for drivers
- Central locking with remote control



Extra equipment

- Active Speed Limit Assist (helps you to comply with the prescribed speed limit even in confusing situations. A camera detects speed limits, which the Active Distance Assist DISTRONIC automatically adopts and adjusts as the speed - for more safety and comfort while driving.)
- Decorative elements: aluminum with longitudinal brushing, light finish
- Exit warning function
- Package: Advanced (Fully digital instrument display, high resolution 10.25" - CENTRAL MEDIA DISPLAY 10.25" - Mirror package: interior and exterior mirrors automatically dimming, exterior mirrors electrically folding, ambient lighting of the exterior mirrors to illuminate the entry area - Parking package with reversing camera - Active Parking Assist with PARKTRONIC - Blind Spot Assist - visual and acoustic warning system)
- Package: Connectivity Package Navigation (Hard drive navigation - pre-installation for navigation services)
- Roof rails in polished aluminum
- Seats: Driver's seat electrically adjustable with memory (the memory programming includes all seat adjustment options such as seat height and fore/aft position, seat cushion tilt and backrest tilt - exterior mirrors and the optional head-up display are also integrated - dynamic seating while driving. Small movements of the seat cushion and backrest in three programs and two speeds)
- Towbar with ESP trailer stabilization
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Heated seats for driver and front passenger
- Interior headliner fabric crystal grey
- Package: Driving Assistance (Active Distance Assist DISTRONIC - Active Speed Limit Assist - Extended Automatic Restart on Highways - Route-Based Speed Adaptation with Traffic Jam Definition - Active Steering Assist - Active Emergency Stop Assist with SOS Function - Emergency Lane Radio - Active Brake Assist - Turning and Intersection Function - Traffic Jam Emergency Braking Function - Evasive Steering Assist - Active Blind Spot Assist - Exit Warning Function - PRE-SAFE)
- Paint finish: Metallic
- Traffic Sign Assist (driver assistance system for recognizing speed limits, entry and overtaking prohibitions, and their cancellation; detection of traffic signs via multifunction camera and display in the instrument cluster in real time and comparison with navigation data; helps the driver to comply with traffic regulations, increases driving safety; wrong-way driving warning function: with corresponding signage, visual and acoustic warning signal when entering a road against the prescribed direction of travel)
- Wheels: 45.7 cm (18") alloy wheels, 4-spoke design (aerodynamically optimized, painted black and polished with 235/55 R 18 tires on 7.5 J x 18 ET 53.5)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Sill - dent(s) - Smooth repair work
2	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
3	Front bumper	Front bumper - Scratched - Smart repair
4	2nd wheel set	1 tyre - Does not meet the leasing specifications - Replace
5	2nd wheel set	1 tyre - Does not meet the leasing specifications - Replace
6	Tail light	Tail light (Mitte) - Scratched - Replace
7	Front bumper	Spoiler - Scratched - Replace
8	Door - rear right side	Door - Scratch(es) - Paint
9	Door - front right side	Door - Scratch(es) - Paint
10	Boot lid / rear door	Boot lid (3 Dellen & verkratzt/verschürft) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Tail light	Tail lamp - right side (Oberflächlich, außerhalb des Leuchtbereichs) - Scratch(es) - No deduction
2	Door - rear left side	Door edge - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Der angegebene Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.
- Ein Nachweis über die Zulässigkeit des montierten Radsatzes wurde nicht erbracht.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

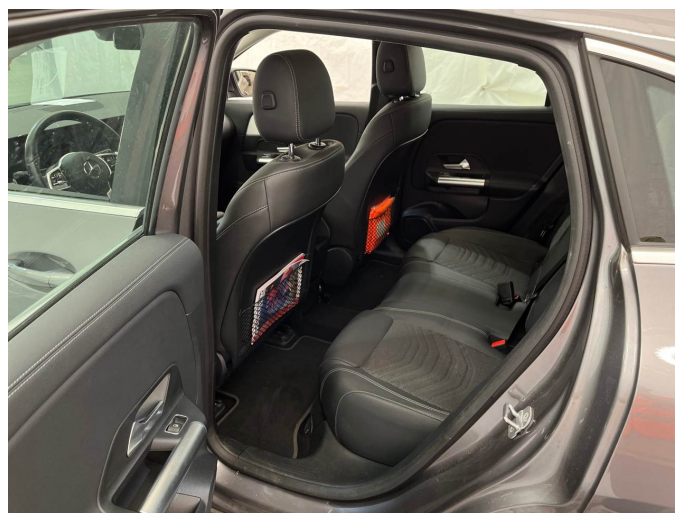


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

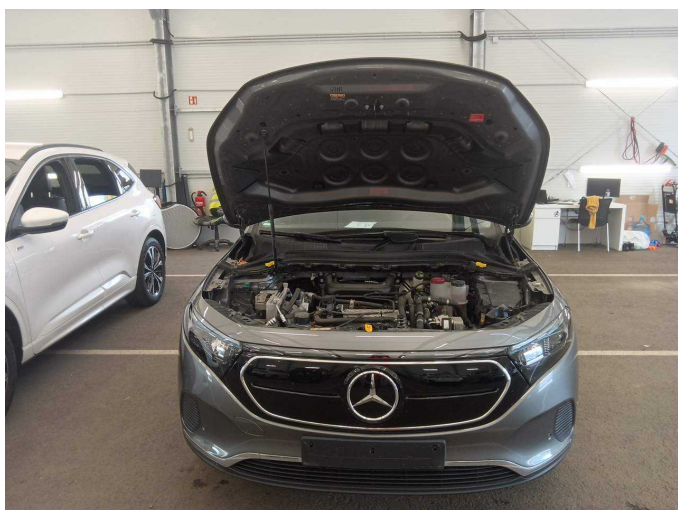


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

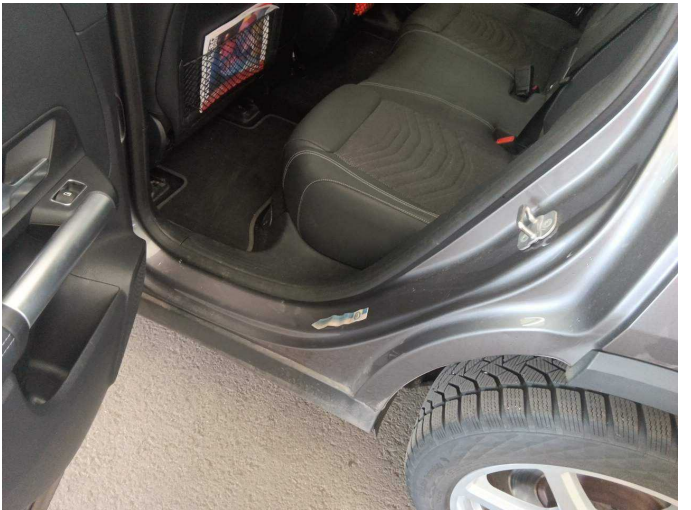

Damage 1: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 1: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 3: Front bumper: Front bumper - Scratched - Smart repair



Damage 3: Front bumper: Front bumper - Scratched - Smart repair



Damage 4: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 4: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 6: Tail light: Tail light (Mitte) - Scratched - Replace



Damage 6: Tail light: Tail light (Mitte) - Scratched - Replace



Damage 7: Front bumper: Spoiler - Scratched - Replace




Damage 7: Front bumper: Spoiler - Scratched - Replace



Damage 7: Front bumper: Spoiler - Scratched - Replace



Damage 8: Door - rear right side: Door - Scratch(es) - Paint

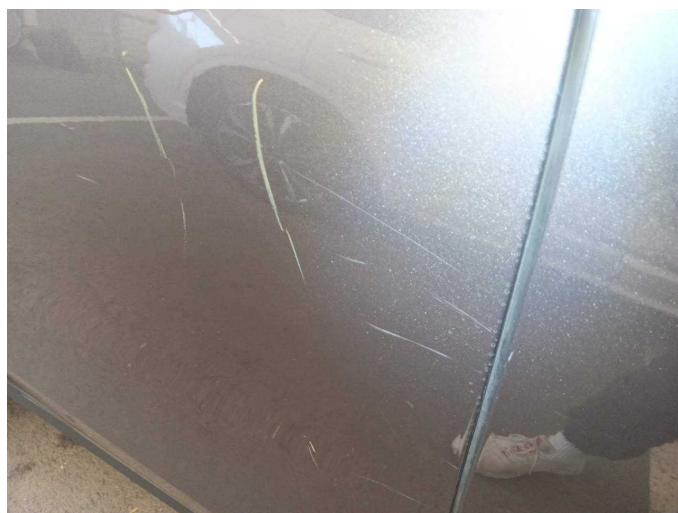

Damage 8: Door - rear right side: Door - Scratch(es) - Paint



Damage 8: Door - rear right side: Door - Scratch(es) - Paint



Damage 8: Door - rear right side: Door - Scratch(es) - Paint



Damage 9: Door - front right side: Door - Scratch(es) - Paint




Damage 9: Door - front right side: Door - Scratch(es) - Paint




Damage 9: Door - front right side: Door - Scratch(es) - Paint



Damage 10: Boot lid / rear door: Boot lid (3 Dellen & verkratzt/verschürft)
- Dent / paintcoat damage - Repair and paint

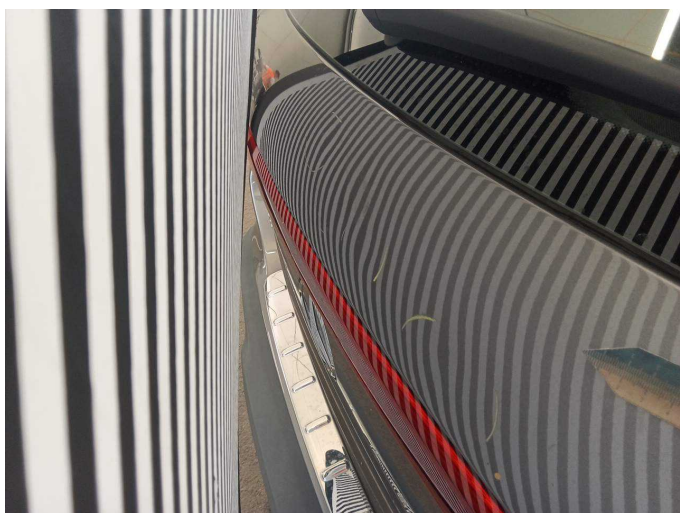

Damage 10: Boot lid / rear door: Boot lid (3 Dellen & verkratzt/verschürft)
- Dent / paintcoat damage - Repair and paint

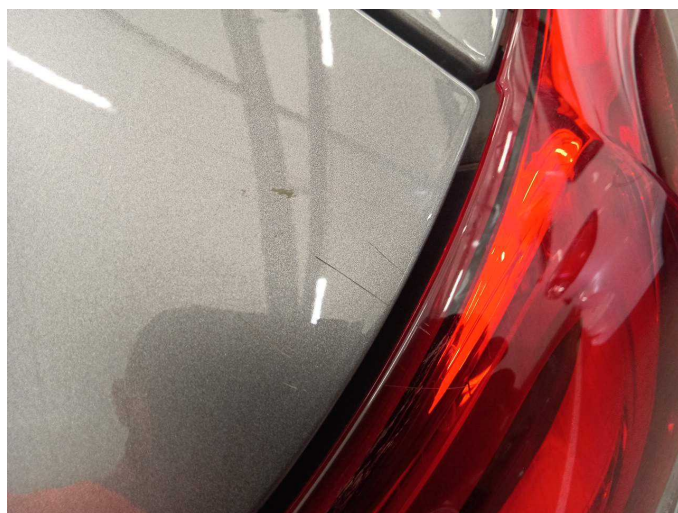

Wear and tear 1: Tail light: Tail lamp - right side (Oberflächlich, außerhalb des Leuchtbereichs) - Scratch(es) - No deduction



Wear and tear 2: Door - rear left side: Door edge - Scratch(es) - No deduction



Wear and tear 2: Door - rear left side: Door edge - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N9N0CB3RJ087883

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ EQA 250+ Progressive

Datum	KM-Stand	Beschreibung
27.04.2026	74.491	Regelwartungsdienst
26.05.2025	49.077	Regelwartungsdienst
15.07.2024	24.966	Regelwartungsdienst