



Expertise

Protocol number: 46284114
Order No. / Reference: 26622555
Inspection date: 1 Jul 2026

Manufacturer: Seat

Model: Tarraco 1.4 e-Hybrid DSG Xperience

VIN: VSSZZZKN9PW500853



Vehicle details	
Manufacturer / Type / Model / Equipment	
Seat Tarraco 1.4 e-Hybrid DSG Xperience	
Vehicle Identification number	VSSZZZKN9PW500853
Mileage (Read)	75,348 km
First registration	7 Nov 2022
Number of holders	1
Next periodical technical inspection	10/2027
(Report on hand)	
Power / Engine displacement	110 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Urano Grau
Doors / Seats	5 / 5
Upholstery type	Alcantara / cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	6,200 km
Last service on / at	11/2025 at 66,507 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GN383848
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	Conditional: Light/moisture/dirt	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	7593 / AQW 00086		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,390 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R20 100V	Summer tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm
2)	235/45 R20 100V	Summer tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12V socket at the front
- Storage pocket on the back of the front seats
- Ambient lighting (multicolored) in the door panels
- Automatic coming-home and leaving-home function
- Adaptive Cruise Control (ACC) up to 210 km/h
- Electrically adjustable, folding and heated exterior mirrors (with passenger-side mirror lowering function)
- Owner's manual holder under the driver's seat
- Chrome applications in the interior
- Black headliner
- Diesel particulate filter and SCR catalyst
- Tachometer
- Third brake light
- Electronic parking brake including auto-hold function
- Electric front and rear windows (with anti-pinch protection and one-touch function)
- Gear recommendation display
- Luggage compartment cover
- Illuminated glove compartment
- LED taillights (with dynamic turn signals and LED light strip - Infinite Light)
- Rear window wiper and rear window heater
- ISOFIX child seat restraint system (for the front passenger seat and the 2nd row of seats, left and right, including top tether anchor points)
- Headrests, 2 front, 3 rear
- Paint finish: Solid
- Steering wheel: Multifunction steering wheel in leather
- Light sensor with automatic headlight control
- Fatigue detection
- Navigation system with 9.2" color touchscreen (online infotainment function - prepared for the use of extended mobile online services - voice control - navigation data incl. MAPCARE - Full Link - Android Auto - Apple CarPlay incl. Full Link Wireless)
- Radio accessories: Full Link (Android Auto - Apple CarPlay incl. Full Link Wireless)
- Radio accessories: Wireless charger in the storage compartment of the center console
- Rain sensor
- Wheels: Tyre fit
- Paddle shifters on the steering wheel
- SEAT Drive Profile with "Driving Experience" button and progressive steering (driving profiles can be individually selected - selected driving profile influences steering assistance, throttle response and shift characteristics (with DSG))
- Seats: Front passenger seat backrest can be folded down completely
- Seats: Sport comfort seats in the front
- Seats: Front seats with height adjustment
- Lane departure warning system
- Power outlet: 230V socket in the luggage compartment
- Storage compartment for glasses
- Airbags (driver and front passenger airbag (passenger airbag deactivation) - side airbag for driver and front passenger - head airbag system, front and rear - driver's side knee airbag)
- Exterior mirror housings in body color
- Turn signals and welcome light integrated into the exterior mirrors
- Chrome trim on the side windows
- Silver roof rails
- Electronic differential lock (XDS)
- Three-point automatic seat belts, front and rear (warning tone for unfastened seat belts)
- Electronic Stability Control (ESC) (including Anti-lock Braking System (ABS) and Traction Control System (ASR))
- Footwell lighting
- Luggage compartment, illuminated
- Transmission: 6-speed DSG automatic transmission
- Electrically operated tailgate (opening & closing) (incl.: - Sensor-controlled opening & closing (Virtual Pedal) - Keyless locking and starting system "Kessy")
- Interior mirror automatically dimming
- Body covers on the wheel arches
- Climatronic air conditioning system with 3 climate zones and rear control unit
- Radiator grille in chrome design
- Mode 2 charging cable for household sockets
- Reading lights, 2 in the front and 2 in the rear
- Center console with integrated storage compartment, center armrest, cup holders
- LED fog lights with cornering light function
- Emergency call service
- Park Assist with front and rear parking aid
- Upholstery: Fabric/Dinamica
- Radio: Media-System Plus (Audio system with 8.25" color touchscreen - Digital radio reception DAB+ - 2 USB-C ports in the front - USB-C charging socket for the 2nd row of seats - Bluetooth interface with integrated hands-free system and audio streaming - 8 speakers)
- Tire pressure monitoring system
- Rear view camera
- SEAT CONNECT (prepared for activation of the service packages Security/Assistance and Remote Access)
- Side windows from the 2nd row of seats and rear window are dark tinted.
- Side trim in silver
- Electromechanical power steering
- Seats: Lumbar support for driver and front passenger
- Seats: Rear bench seat longitudinally adjustable and asymmetrically split and foldable (with center armrest)
- Sun visors with illuminated makeup mirror
- Start-stop technology



- Front door sill trims in aluminum look, illuminated
- Variable luggage compartment floor
- Lashing eyes in the luggage compartment
- Full LED headlights (low beam and high beam in LED technology - dynamic headlight range control)
- thermal insulation glazing

- LED daytime running lights
- Front Assist area monitoring system with City Emergency Braking function
- Virtual Cockpit (Fully digital instrument cluster with 10.25" TFT display)
- Electronic immobilizer
- Central locking, including tailgate, with remote control

Extra equipment

- Trailer maneuvering assistant (including parking assist with front and rear parking aid)
- Chassis: Adaptive chassis control DCC
- Mode 3 Type 2 charging cable, 16 A
- DYNAMIC package
- Package: Winter (XPERIENCE, FR) (Heated front seats - Heated outer seats of the 2nd row)
- Panoramic glass sliding roof, electric, including sunshade blind.
- Wheels: 4 "Supreme III" alloy wheels, diamond-cut finish (8J x 20", tires 235/45 R20)
- Swiveling towbar with electric release
- Deletion of the lettering on the tailgate
- Luggage partition net (including remote release for folding down the rear seat backrest)
- Package: XL Driving Assistance Package for Navigation System (High Beam Assist - Side Assist - Travel Assist - Emergency Assist - Pre-Crash Assist with Rollover Detection - Leather Multifunction Steering Wheel, Heated - Traffic Sign Recognition - Adaptive Cruise Control (ACC) up to 210 km/h with Predictive Speed Control)
- Seats: Driver's seat electrically adjustable with memory function (exterior mirrors with memory function - lumbar support electrically adjustable)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/dampness or dirt. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Interior trim - Scratch(es) - Loss in value
2	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
3	Boot lid / rear door	Seal - Broken / torn - Replace
4	Trim / covers	Door trim - rear left side (Druckstelle) - Deformed - Smart repair
5	Trim / covers	Door trim - rear right side (Druckstelle) - Deformed - Smart repair
6	Front bumper	Spoiler - Deformed - Replace
7	Rear bumper	Spoiler (inkl. Zierleiste & PDC-Sensor prüfen - Mehrkosten möglich) - Deformed - Replace
8	Rear bumper	Rear bumper - Scratched - Paint
9	Boot lid / rear door	Boot lid - Scratch(es) - Paint
10	Wheel / tyres	Alloy rim - rear left side - Scratched - Replace



Wear and tear

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Seat - rear	Back seat (Druckstelle) - No deduction
4	Trim / covers	Sill - front left side - Scratch(es) - No deduction
5	Mudguard - right side	Mudguard - right side - dent(s) - No deduction
6	Interior	Boot cover / roller cover - Scratch(es) - No deduction
7	Mudguard - left side	Mudguard - left side - Scratch(es) - No deduction
8	Sill - left side	Sill - Scratch(es) - No deduction
9	Sill - right side	Sill - Scratch(es) - No deduction
10	Side panel - rear left side	Sill - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

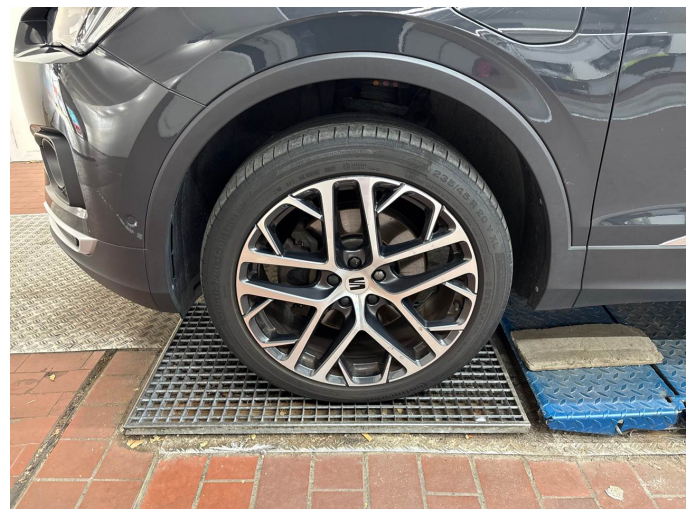


Figure 12: Mounted tyres



Figure 13: Documents

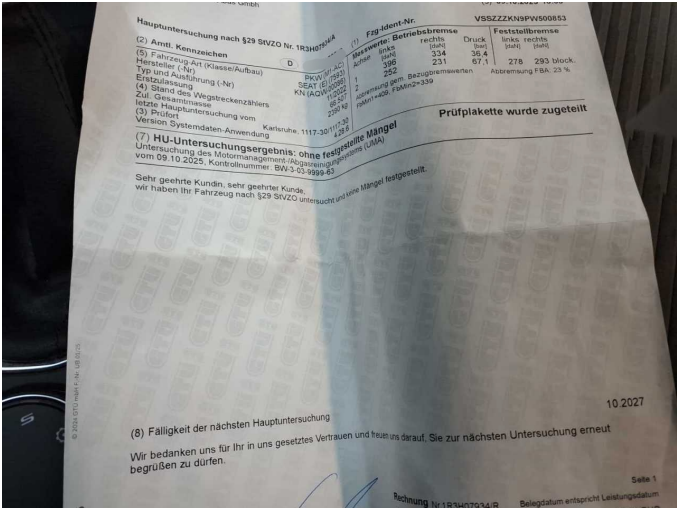


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres

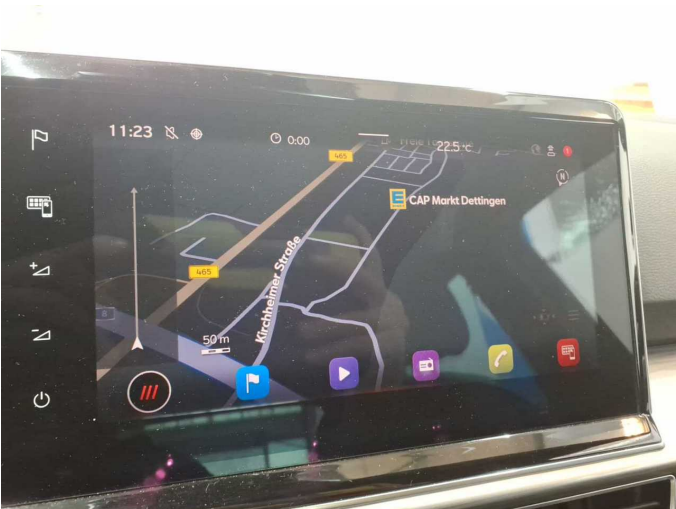


Figure 17: Navigation

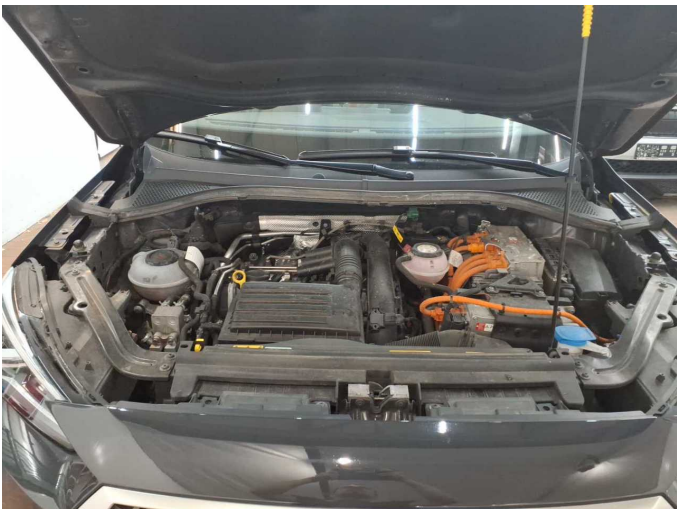


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

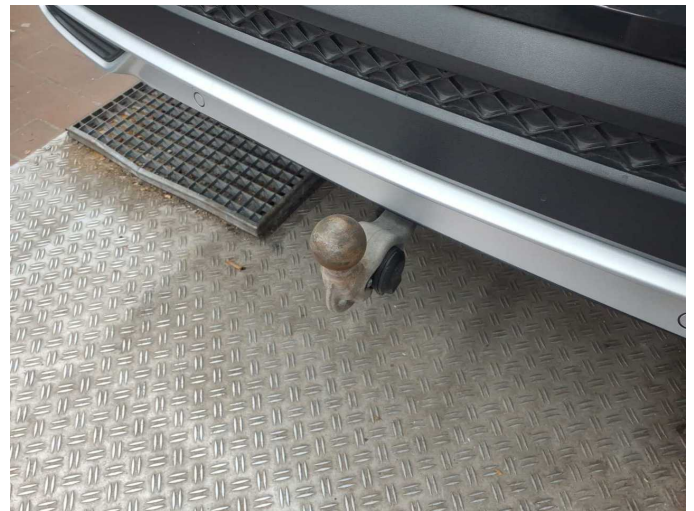


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

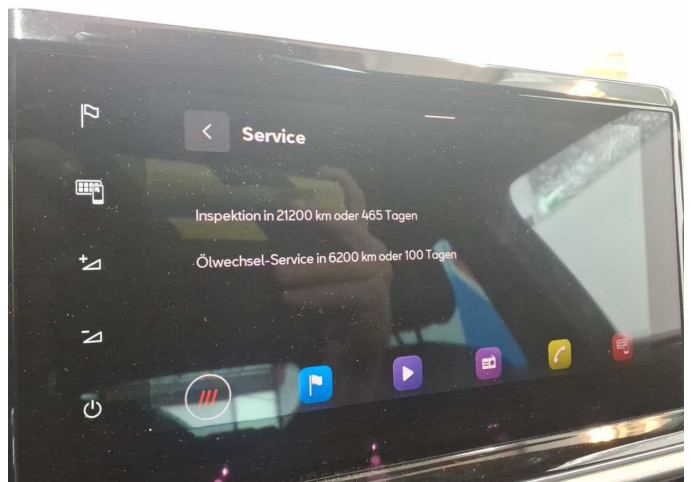


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Damage 1: Side panel - rear right side: Interior trim - Scratch(es) - Loss in value



Damage 1: Side panel - rear right side: Interior trim - Scratch(es) - Loss in value



Damage 1: Side panel - rear right side: Interior trim - Scratch(es) - Loss in value

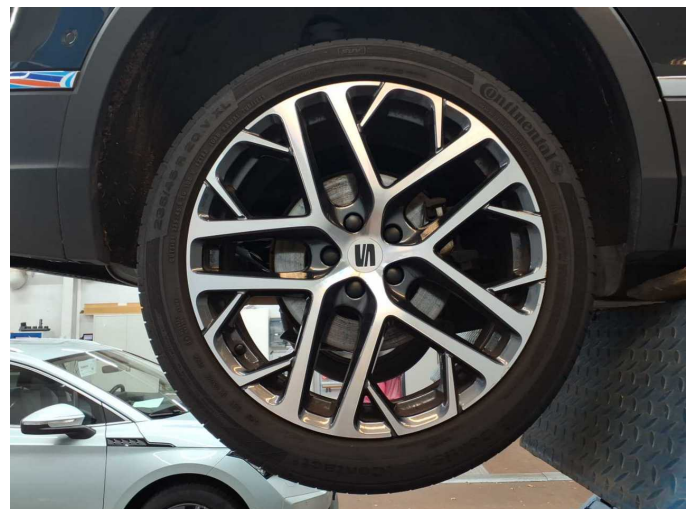


Damage 2: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 3: Boot lid / rear door: Seal - Broken / torn - Replace

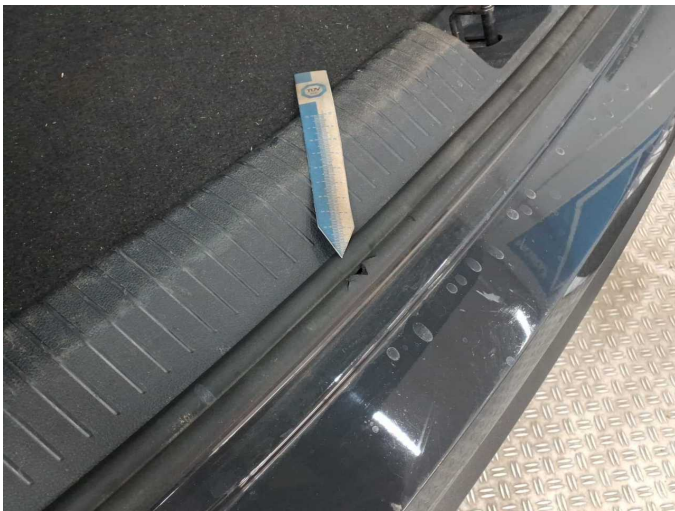

Damage 3: Boot lid / rear door: Seal - Broken / torn - Replace



Damage 4: Trim / covers: Door trim - rear left side (Druckstelle) - Deformed - Smart repair

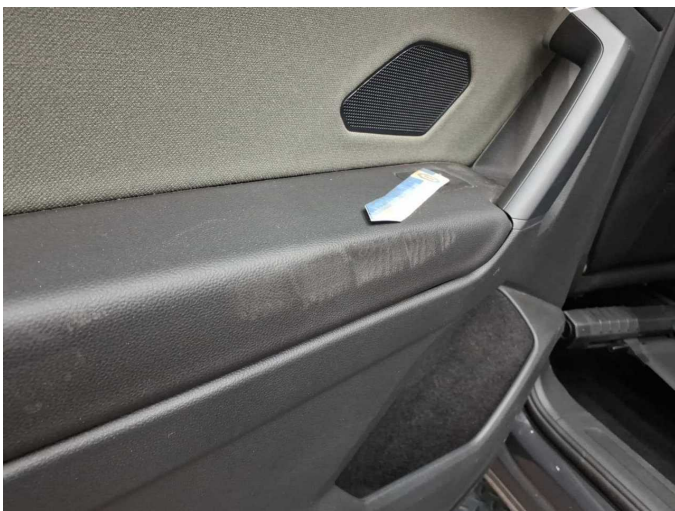

Damage 4: Trim / covers: Door trim - rear left side (Druckstelle) - Deformed - Smart repair



Damage 5: Trim / covers: Door trim - rear right side (Druckstelle) - Deformed - Smart repair



Damage 5: Trim / covers: Door trim - rear right side (Druckstelle) - Deformed - Smart repair



Damage 6: Front bumper: Spoiler - Deformed - Replace



Damage 6: Front bumper: Spoiler - Deformed - Replace



Damage 7: Rear bumper: Spoiler (inkl. Zierleiste & PDC-Sensor prüfen - Mehrkosten möglich) - Deformed - Replace



Damage 7: Rear bumper: Spoiler (inkl. Zierleiste & PDC-Sensor prüfen - Mehrkosten möglich) - Deformed - Replace



Damage 7: Rear bumper: Spoiler (inkl. Zierleiste & PDC-Sensor prüfen - Mehrkosten möglich) - Deformed - Replace



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint




Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 9: Boot lid / rear door: Boot lid - Scratch(es) - Paint

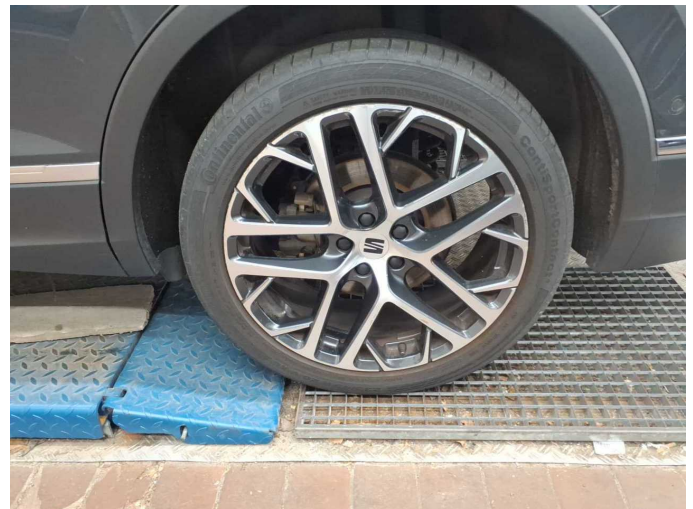

Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Wear and tear 6: Interior: Boot cover / roller cover - Scratch(es) - No deduction



Wear and tear 6: Interior: Boot cover / roller cover - Scratch(es) - No deduction



Wear and tear 6: Interior: Boot cover / roller cover - Scratch(es) - No deduction



Wear and tear 8: Sill - left side: Sill - Scratch(es) - No deduction



Wear and tear 8: Sill - left side: Sill - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VSSZZZKN9PW500853

Hersteller / Modell: SEAT SEAT Tarraco 1.4 e-Hybrid DSG Xcellence

Datum	KM-Stand	Beschreibung
12.11.2025	66.507	AU; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
04.12.2024	50.479	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
07.02.2024	33.480	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.07.2023	16.751	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges