



Expertise

Protocol number: 46056945
Order No. / Reference: 26512670
Inspection date: 17 Jun 2026

Manufacturer: Volkswagen

Model: ID.3 Pro S (4-Sitzer)

VIN: WVGZZZE1ZN8001267



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.3 Pro S (4-Sitzer)	
Vehicle Identification number	WVGZZZE1ZN8001267
Mileage (Read)	94,264 km
First registration	10 Nov 2021
Number of holders	1
Power / Engine displacement	70 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Stonewashed Blue Metallic / Dach Schwarz
Doors / Seats	5 / 4
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	360 Tag(e)
Last service on / at	06/2025 at 70,290 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF362155
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CKW 00021		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,280 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R19 93T	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	215/50 R19 93T	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R19 93T	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	215/50 R19 93T	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- 30-color ambient lighting
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Car2X
- Black surround for the infotainment display and central controls
- Driving profile selection
- Transmission: Direct drive, 1-speed
- rear window wiper
- "Climatronic" air conditioning system
- Mode 3 Type 2 charging cable, 16 A
- Charging: Maximum DC charging power depends on the traction battery.
- Steering wheel: Multifunction steering wheel in leather
- Front center console with 2 cup holders
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Package: Infotainment Package
- Upholstery in "Flow" fabric
- Radio accessories: 2 USB-C ports at the front
- Tire pressure monitoring system (passive)
- Keyless start system without safe locking
- electromechanical power steering
- Seats: 2 rear seats, rear seat backrest asymmetrically split and foldable
- Seats: Front seats are height-adjustable
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Airbags: Front and rear head airbags, front side airbags, center airbag
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- e-Sound
- Parking assistance
- Electronic Stability Program (ESP)
- Speed limiter
- Rear window heated
- ISOFIX mounting points
- Headrests (5) front and rear
- Charging: 11 kW AC charging capacity
- LED taillights
- LED headlights with automatic headlight control
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- eCall emergency call system
- Online update capability from ID.Software 2.1 onwards.
- Stainless steel pedals
- Radio: "Ready 2 Discover"
- Radio accessories: 4 + 1 speakers
- Wheels: 4 "Andoya" alloy wheels 7.5 J x 19 in black, polished finish
- Seat belts: Three-point automatic seat belts at the front with belt tensioners
- Seats: Armrests, front seats
- Lane keeping assistant "Lane Assist"
- Traffic sign recognition
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

Extra equipment

- Charging cable: Mains charging cable for household socket
- Chrome clothes hanger
- Heat pump for range optimization
- Two-tone paintwork with black roof, metallic
- Wheels: 4 winter alloy wheels "Andoya" 7.5 J x 19 in black, diamond-turned (additional) (Airstop winter tires 215/50 R 19 T - wheel locking with extended theft protection)
- Package: Interior Top-Sport "Plus" (4-seater) (2 rear seats, asymmetrically split folding rear seat backrest with center armrest - 30-color ambient lighting - ErgoActive front seats with electric adjustment and longitudinally adjustable thigh support - Pneumatically adjustable lumbar support for front seats with massage function - Leather-wrapped, heated multifunction steering wheel with touch controls - Stainless steel pedals in "Play/Pause" design - Front and rear seat center panels in "ArtVelours" microfleece - Heated front seats)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Misc. (Kleiderbügel) - Missing - Replace
2	Door - front right side	Door - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
4	2nd wheel set	2 alloy rims - Scratch(es) - Loss in value
5	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
6	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
7	Door - front left side	Door - Scratch(es) - Paint
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Front bumper	Front bumper - Scratched - Paint
10	Boot lid / rear door	Boot lid - Scratched - Paint
11	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Trim / covers - Floor mats

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

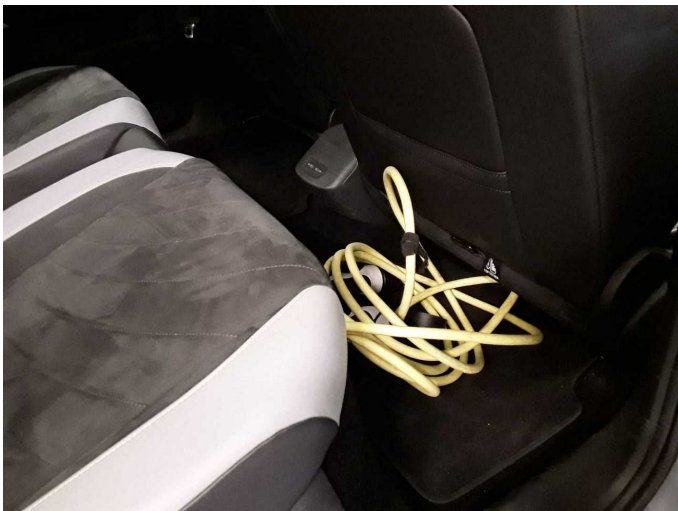


Figure 16: Misc.

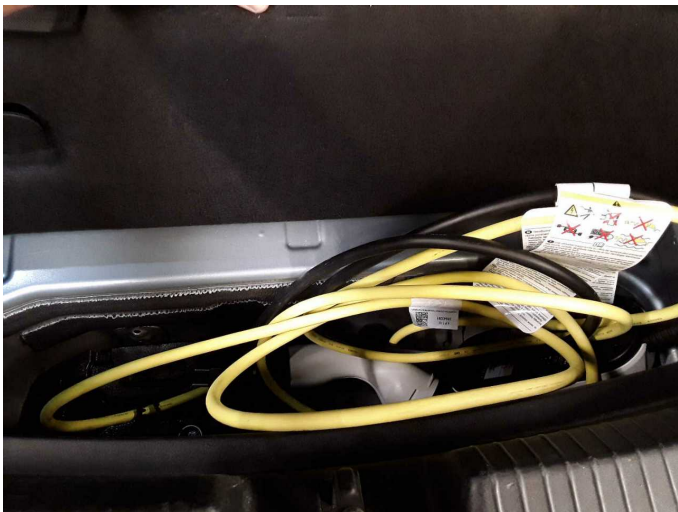


Figure 17: Misc.



Figure 18: Misc.

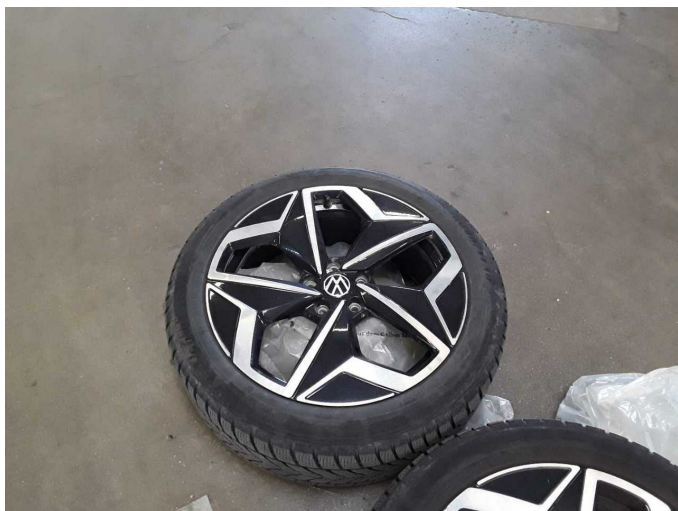


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

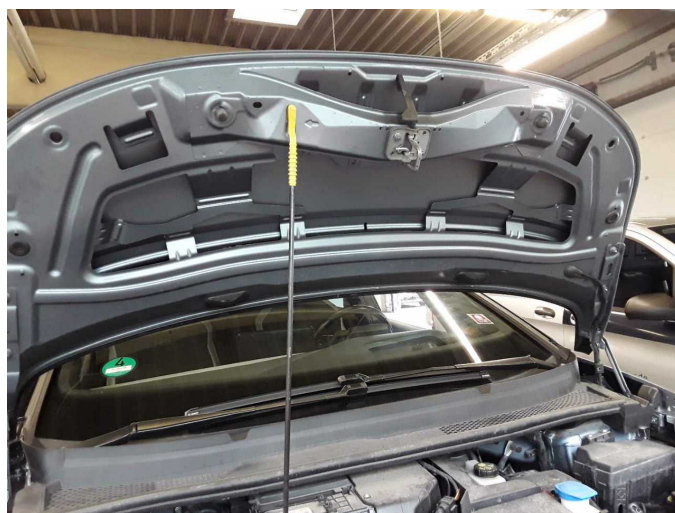


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

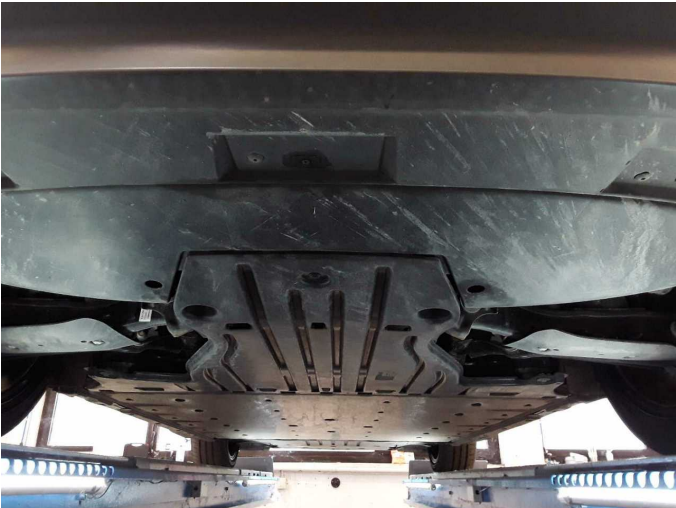


Figure 25: Misc.

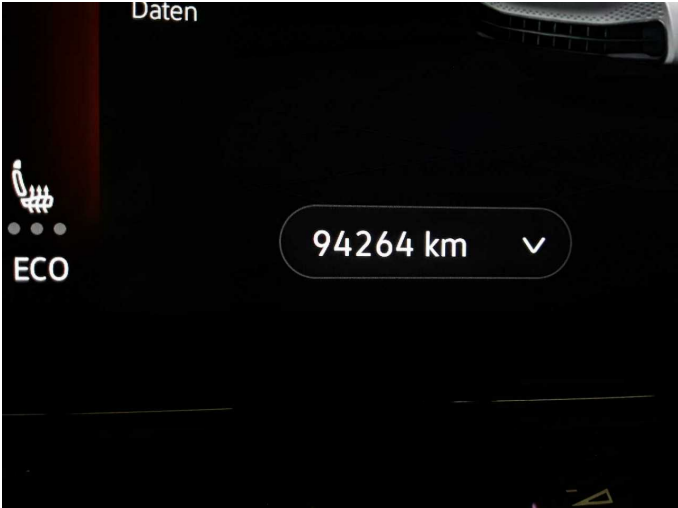


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 2: Door - front right side: Door - Scratch(es) - Smart repair



Damage 2: Door - front right side: Door - Scratch(es) - Smart repair



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 4: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 4: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value




Damage 4: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 4: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

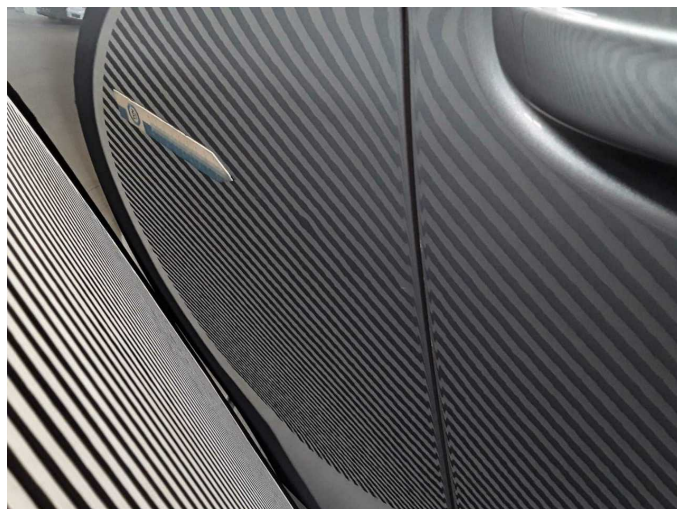


Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

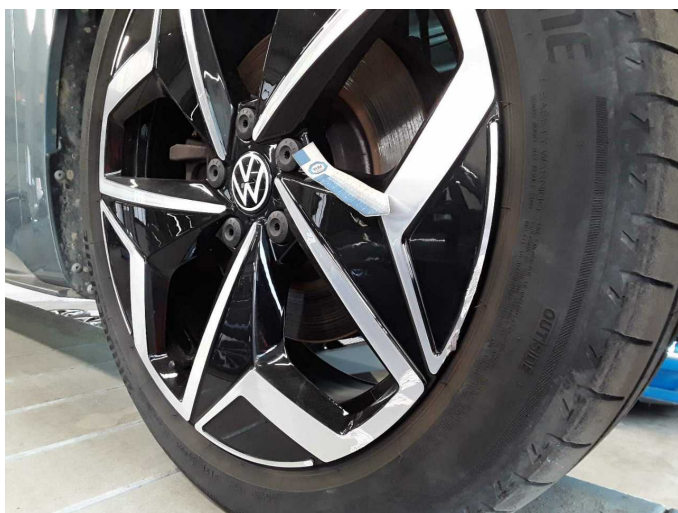

Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

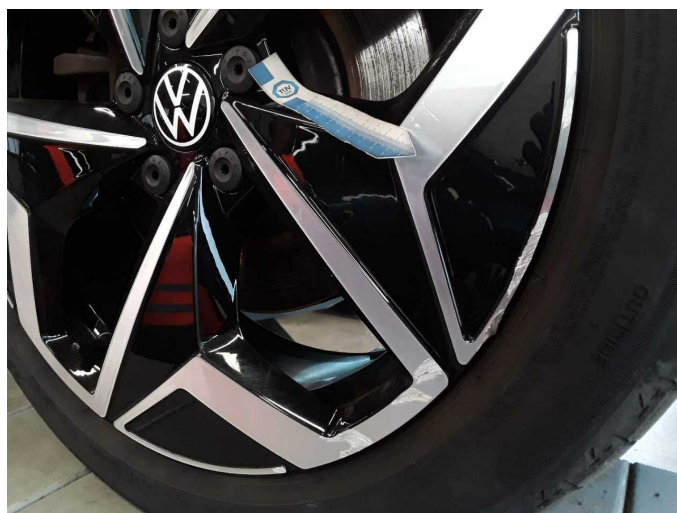

Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 7: Door - front left side: Door - Scratch(es) - Paint



Damage 7: Door - front left side: Door - Scratch(es) - Paint



Damage 7: Door - front left side: Door - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint




Damage 10: Boot lid / rear door: Boot lid - Scratched - Paint

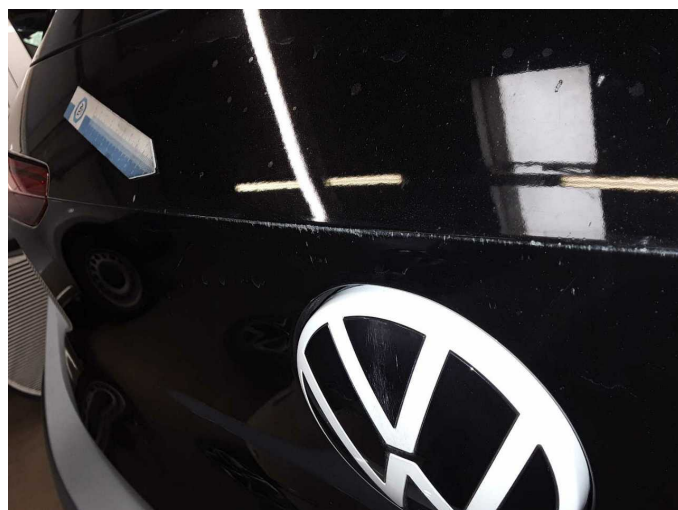


Damage 10: Boot lid / rear door: Boot lid - Scratched - Paint



Damage 11: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

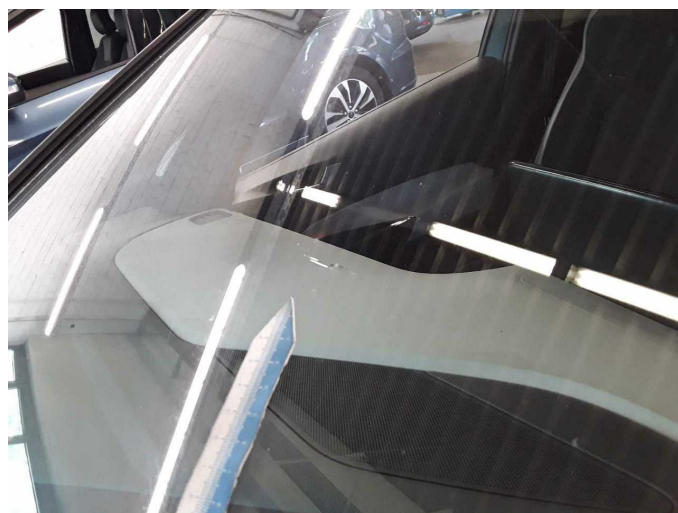


Damage 11: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

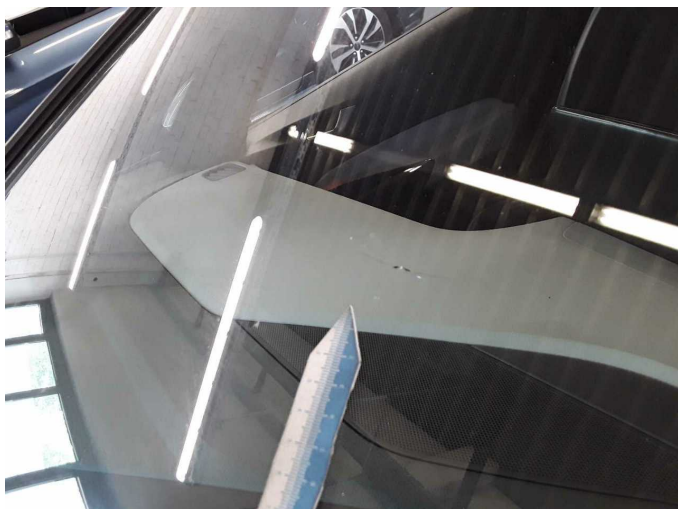

Damage 11: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace




Wear and tear 1: Interior: Interior - Scratch(es) - No deduction

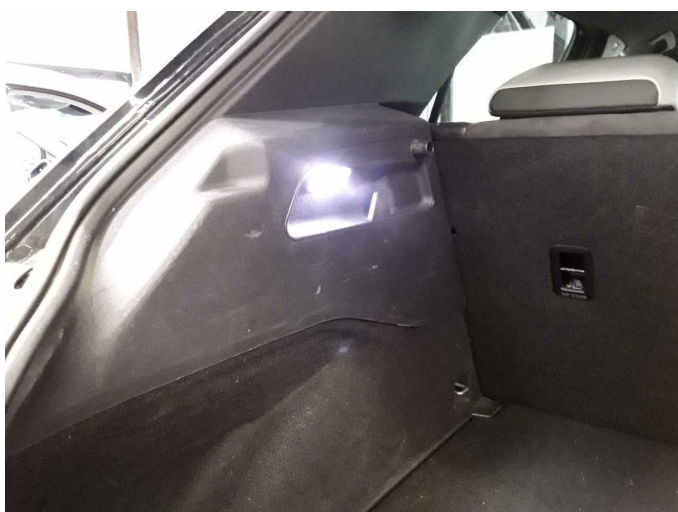


Wear and tear 1: Interior: Interior - Scratch(es) - No deduction



Wear and tear 1: Interior: Interior - Scratch(es) - No deduction

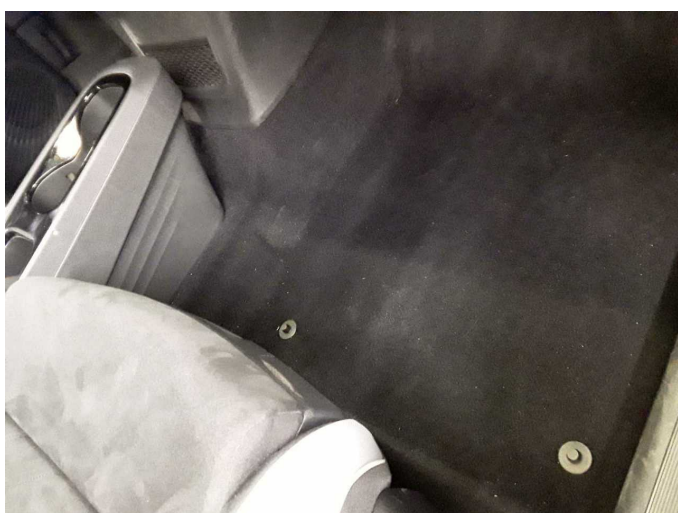

Missing part 1: Trim / covers: Floor mats - Missing - Replace

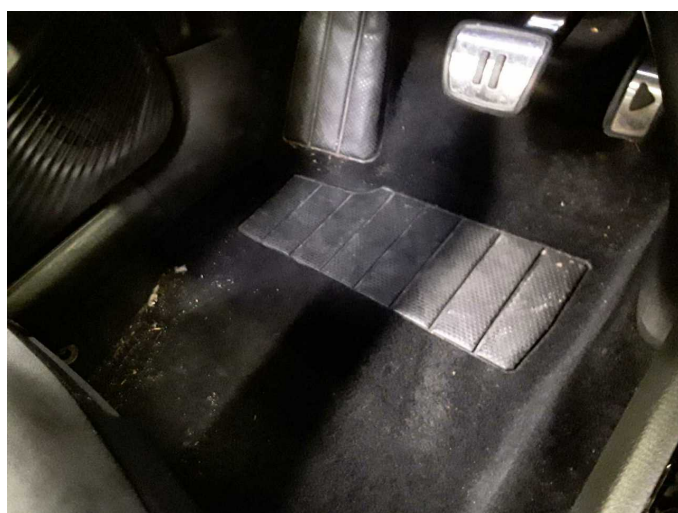

Missing part 1: Trim / covers: Floor mats - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVWZZZE1ZN8001267

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN ID.3 Pro S Tour

Datum	KM-Stand	Beschreibung
18.06.2025	70.290	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Systemtest/ Eigendiagnose
02.10.2023	39.000	Wartung Sonstiges
29.06.2023	29.023	Regelwartungsdienst; Wartung Sonstiges
21.12.2022	16.025	Wartung Sonstiges