



Expertise

Protocol number: 46466570
Order No. / Reference: 26716125
Inspection date: 9 Jul 2026

Manufacturer: Skoda
VIN: TMBJW9NPXN7014208

Model: Superb Combi 1.4 TSI iv DSG L&K



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 1.4 TSI iv DSG L&K	
Vehicle Identification number	TMBJW9NPXN7014208
Mileage (Read)	115,117 km
First registration	8 Nov 2021
Number of holders	1
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black-Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	2,300 km
Last service on / at	04/2026 at 105,645 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD090176
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / AUJ 00116		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,291 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R19 96W	Summer tyres on Light alloy	Bridgestone	3mm / 3mm
2)	235/40 R19 96W	Summer tyres on Light alloy	Bridgestone	4mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/55 R17 98H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver and switchable passenger airbag
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors
- Exterior mirrors and door handles in body color
- Electrically folding exterior mirrors (with boarding lights - interior and exterior mirrors with automatic dimming)
- Hydraulic brake assist (HBA)
- Decorative inlay Piano Black
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Driving profile selection including customizable key (Normal, Eco, Sport, Individual) (incl. additional key)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front radar assist including city emergency braking function (The front radar assist warns of impending collisions and initiates braking to reduce the force of an unavoidable impact. The front radar assist continuously monitors the distance to the vehicle ahead using a radar sensor integrated into the radiator grille.)
- Rear window wiper including windshield washer system
- Kessy, keyless entry and start-stop system
- Air Care Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter and air-conditioned glove compartment)
- LED ambient lighting (dashboard and decorative trim with selectable color climate, reading lamps, door handles and footwell as well as sun visors with LED lighting - projection of the SKODA lettering from the underside of the door onto the ground (front doors))
- Reading lights at the front and rear of the headliner
- Rear center armrest with cup holders and pass-through option
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- Amundsen navigation system
- Otto particulate filter
- Upholstery: Executive leather interior (combined with high-quality materials)
- Radio: CANTON sound system (11 speakers - 1 subwoofer - digital equalizer 610W)
- Radio accessories: SmartLink+ (Apple CarPlay - Android Auto - MirrorLink - SmartGate)
- Radio accessories: Wireless SmartLink (Apple CarPlay, Android Auto)
- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, holder for the warning vests in the front doors, glasses compartment in the headliner, storage compartments in the door panels (front and rear) with 1.5l bottle holders, cup holder in the front center console with easy-open bottle opening, storage pockets on the front seat backrests, storage compartments behind the wheel arches in the trunk including cargo elements, illuminated trunk)
- Illuminated glove compartment
- Hill start assist
- Roof rails, anodized
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electric tailgate opening
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (tunnel light, coming and leaving home function)
- Chassis: Adaptive chassis DCC (10 mm lowering, adjustable damper setting) (including driving profile selection (Normal, Comfort, Eco, Sport, Individual))
- Front footwell lighting
- Cruise control system (cruise control) including speed limiter
- Transmission: 6-speed direct-shift gearbox (DSG)
- Tinted windows
- Heated rear window
- ISOFIX preparation on the outer rear seats, including top tether
- Boot cover, roll-up and removable, semi-automatic
- Front and rear headrests are height-adjustable.
- Charging cable, Mode 2, Schuko, 10A
- Metal loading sill protector
- Remote release of the rear seat backrests in the trunk
- Steering wheel: 2-spoke leather steering wheel with multifunction buttons (including gearshift and handbrake levers in leather)
- Steering wheel: height and reach adjustable
- Matrix LED headlights (AFS - dynamic high beam assist - automatic headlight range control - headlight cleaning system - LED taillights in crystal glass look - incl. dynamic turn signals)
- Multi-collision brake
- LED fog lights with integrated cornering lights
- Front and rear parking sensors
- Radio: Bolero infotainment system (capacitive 8" touch display in glass design - Wireless Smartlink (Apple CarPlay, Android Auto))
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Voice control
- Radio accessories: USB ports at the front (Type-C) and USB charging port (Type-A) in the center armrest
- Tire pressure monitoring
- Heated windshield washer nozzles



- Tire mobility kit (tire repair spray incl. compressor)
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Adjustable lumbar support in the front seats
- Seats: Electrically adjustable front seats with memory function
- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Textile floor mats
- Lashing eyes in the trunk
- Immobiliser

Extra equipment

- Heated windshield
- Electric panoramic sunroof including sunshade (elimination of the glasses compartment in the headliner)
- Package: Assistance Plus (Lane Change Assist - Area View - Trailer Maneuvering Assist & Park Assist - Trailer Hitch - (Active Tire Pressure Monitoring System) - Driver Fatigue Detection)
- Package: Comfort Plus (Combi DSG) (3-zone Climatronic - heated front and rear seats - Lounge Step floor mats - KESSY - 3rd vehicle key - comfort opening for the tailgate - heated steering wheel (with shift paddles) - sunshade for the rear side windows)
- Package: Safety (Proactive occupant protection - rear side airbags - Isofix anchorage for passenger seat)
- Wheels: 19" Trinity alloy wheels, diamond-cut/anthracite (8J x 19" ET 44 with 235/40 R19 tires)

- Superb safety belts (Height-adjustable three-point front seat belts with belt tensioners - Three three-point rear seat belts - Belt fastening indicator for all seats)
- Seats: Height-adjustable front seats
- Seats: Rear seat backrest split 60:40, foldable
- Sun visor on driver and passenger side with illuminated make-up mirror
- Auxiliary heater with radio remote control
- Start/stop system including brake energy recuperation
- 12V socket in the trunk
- 12V socket in the center console, front and rear
- Sunset (rear window and rear side windows tinted dark)
- Telephone: Convenient hands-free phone system with Bluetooth (without connection to an external antenna)
- Chrome-plated elements (on air vents, light switches, music or navigation systems, air conditioning)
- Central locking with remote control

- black headliner
- Paint finish: Pearl effect
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A)
- Package: Business Columbus (DSG) (Columbus navigation system - voice control - Wi-Fi hotspot - Wireless Smartlink for Apple CarPlay - 9.2" capacitive touchscreen in glass design - Phonebox - Traveller assistance system (traffic sign recognition, predictive lane keeping assist pACC, adaptive lane keeping assist, emergency and traffic jam assist, capacitive steering wheel with hands-off detection) - 230V socket and 3 USB ports, tablet holder - Sunset - Infotainment Online (3-year subscription))
- Package: Transport (Combi iV) (Interior waste bin - boot net - luggage net partition)
- Seats: Ventilated front seats for leather interior (perforated leather)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Door - rear right side	Brightware - lower - Scratch(es) - Loss in value
2	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Smart repair
3	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
4	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
5	Wheel / tyres	Tyre - rear right side - Broken / torn - Replace
6	Tail light	Tail lamp - right side - Broken / torn - Replace
7	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Door - rear left side	Door - Scratch(es) - Paint
10	Door - rear right side	Door - Scratch(es) - Paint
11	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
12	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
13	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
14	Bonnet	Bonnet - Scratch(es) - Paint
15	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
3	Wing mirror - left side	Cap - Scratch(es) - No deduction
4	Roof	Roof - Scratch(es) - No deduction
5	Gearbox	Selector lever - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

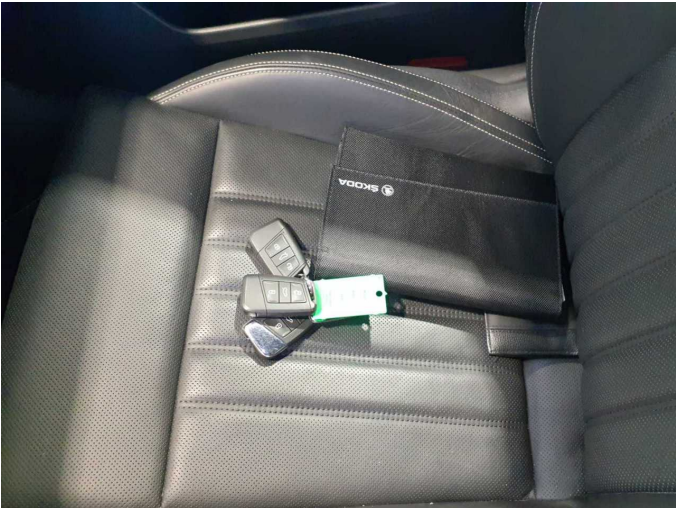


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

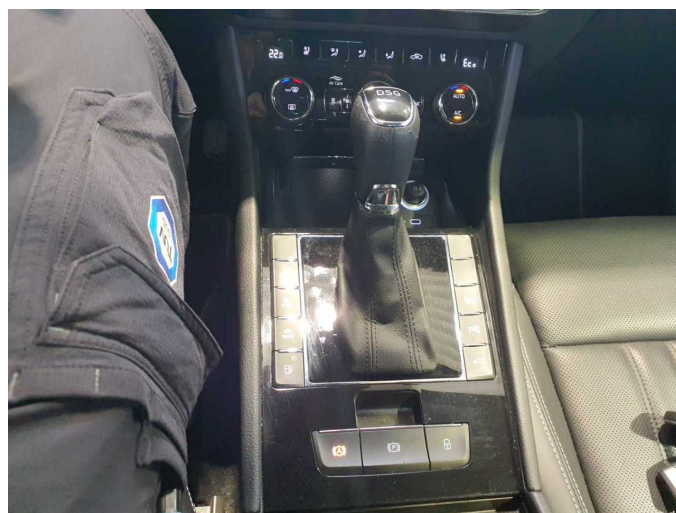


Figure 22: Misc.



Figure 23: Misc.

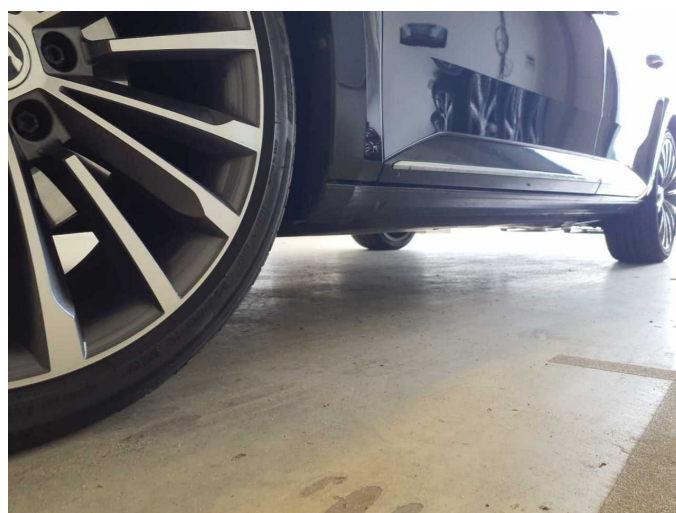


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

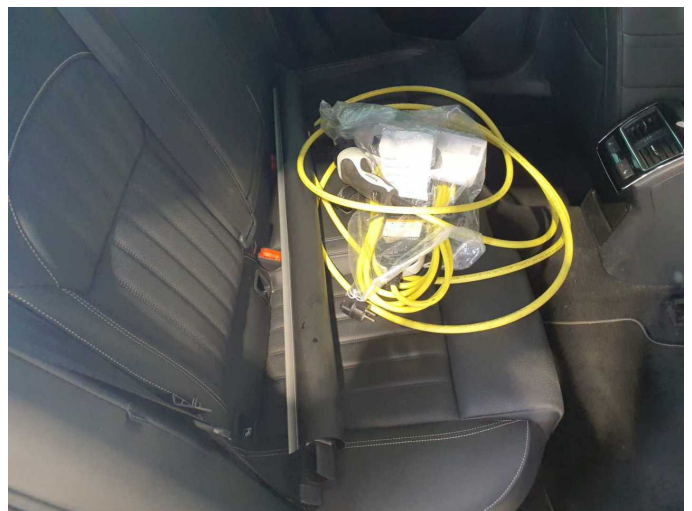


Figure 28: Misc.

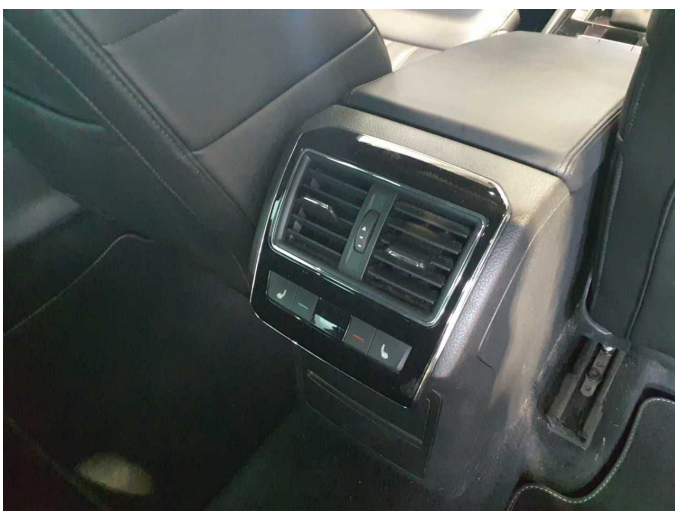


Figure 29: Misc.

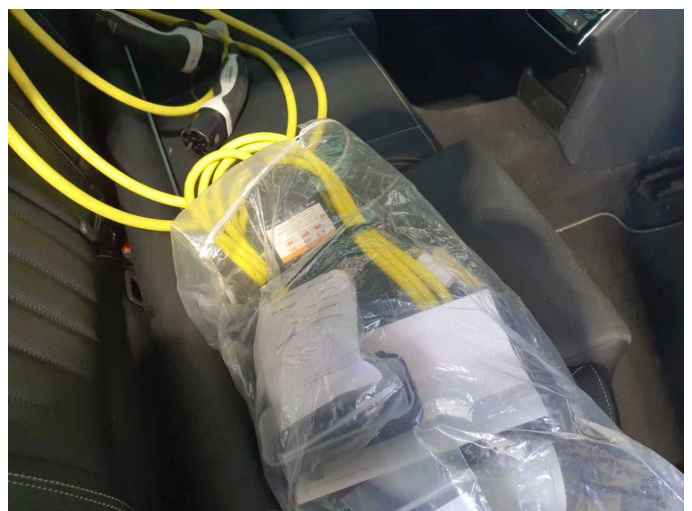


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.




Figure 34: Misc.




Figure 35: Misc.

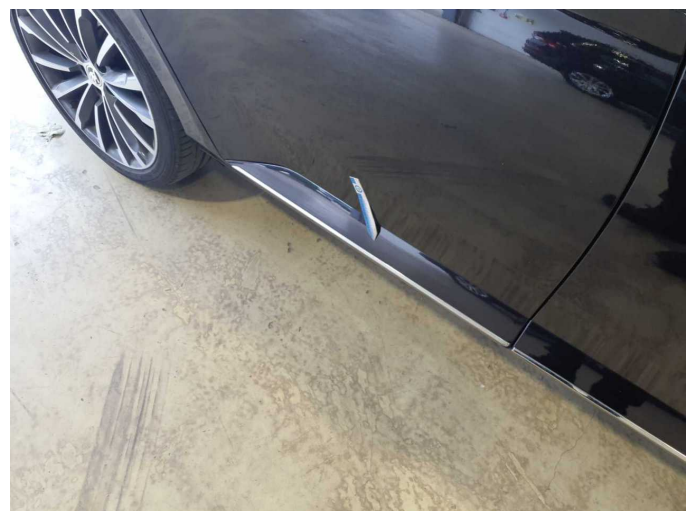

Damage 1: Door - rear right side: Brightware - lower - Scratch(es) - Loss in value

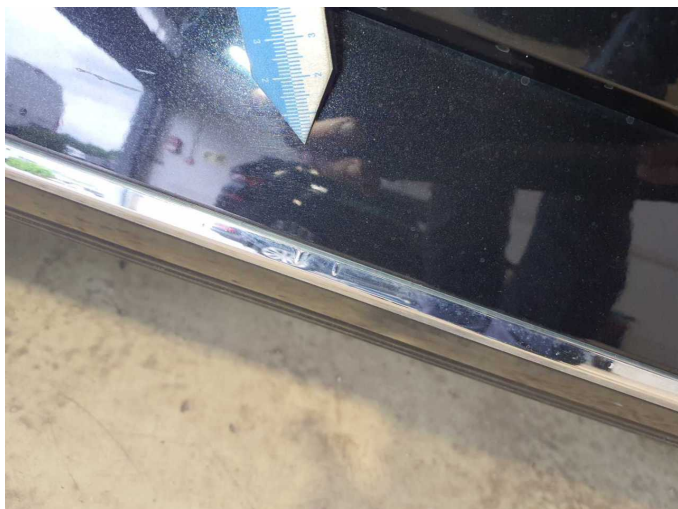

Damage 1: Door - rear right side: Brightware - lower - Scratch(es) - Loss in value

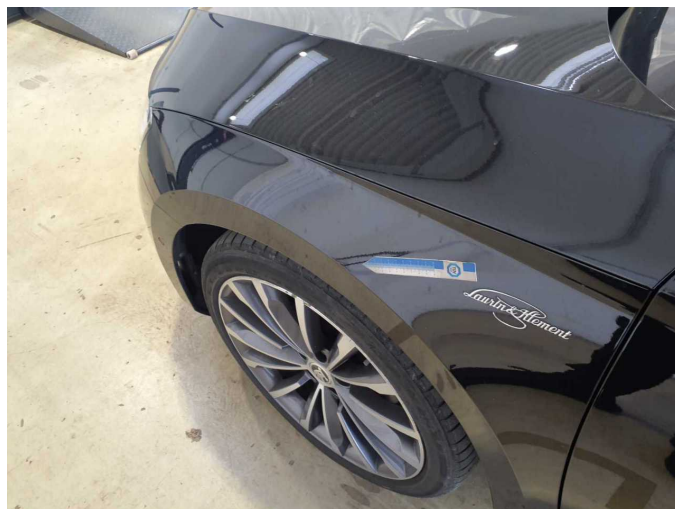

Damage 2: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair



Damage 2: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair



Damage 3: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value




Damage 5: Wheel / tyres: Tyre - rear right side - Broken / torn - Replace




Damage 5: Wheel / tyres: Tyre - rear right side - Broken / torn - Replace



Damage 6: Tail light: Tail lamp - right side - Broken / torn - Replace

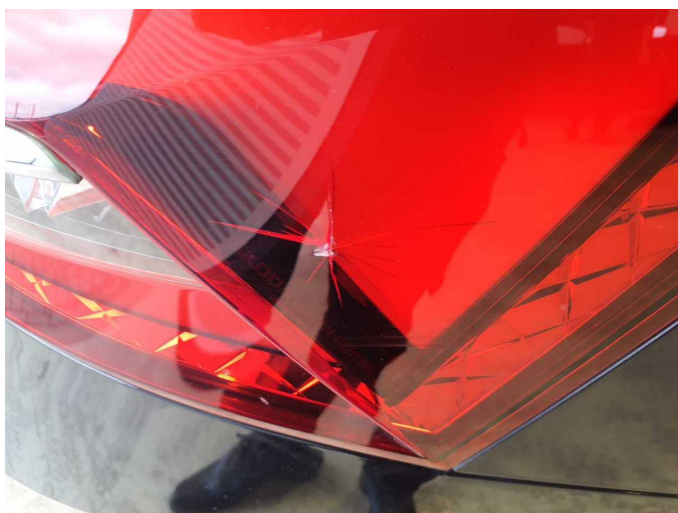

Damage 6: Tail light: Tail lamp - right side - Broken / torn - Replace

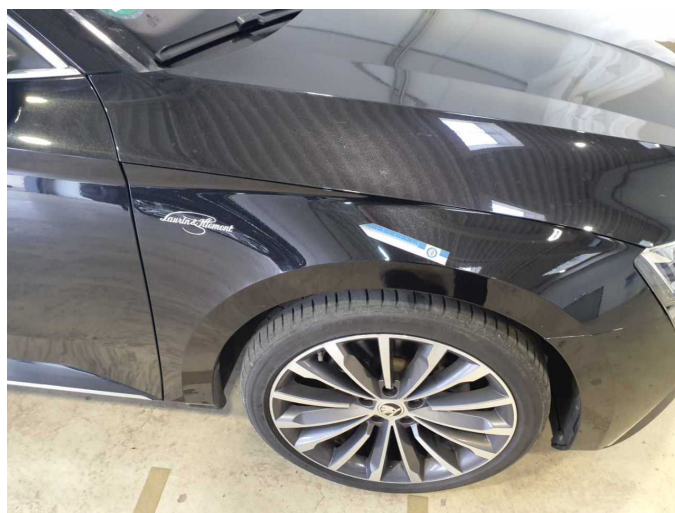


Damage 7: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 7: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint




Damage 7: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint

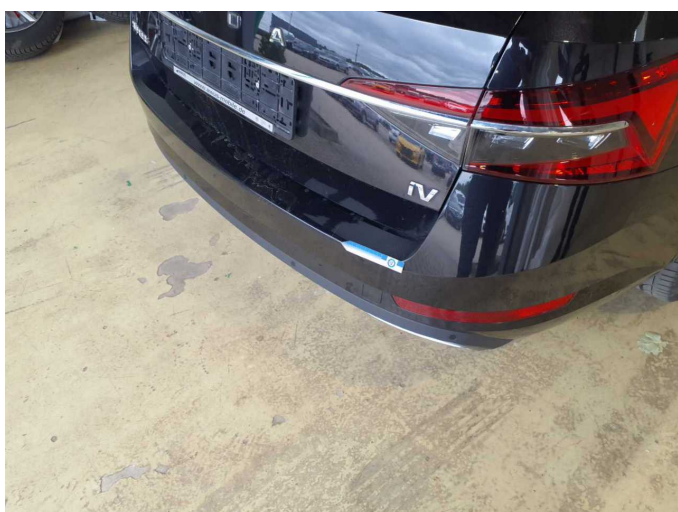

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

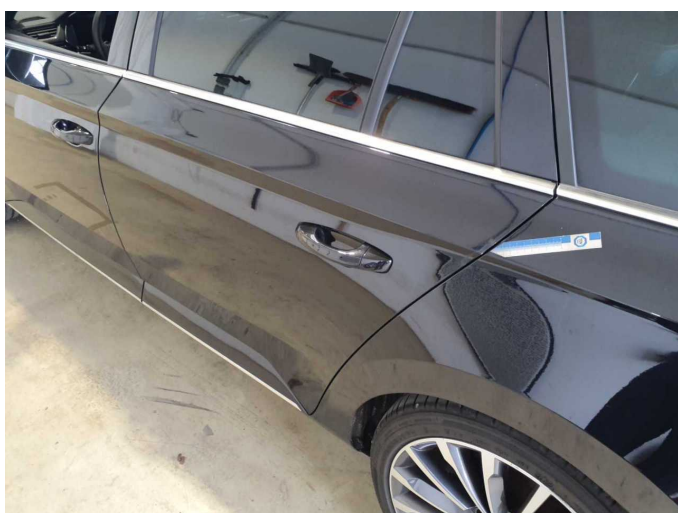

Damage 9: Door - rear left side: Door - Scratch(es) - Paint




Damage 9: Door - rear left side: Door - Scratch(es) - Paint



Damage 9: Door - rear left side: Door - Scratch(es) - Paint




Damage 9: Door - rear left side: Door - Scratch(es) - Paint

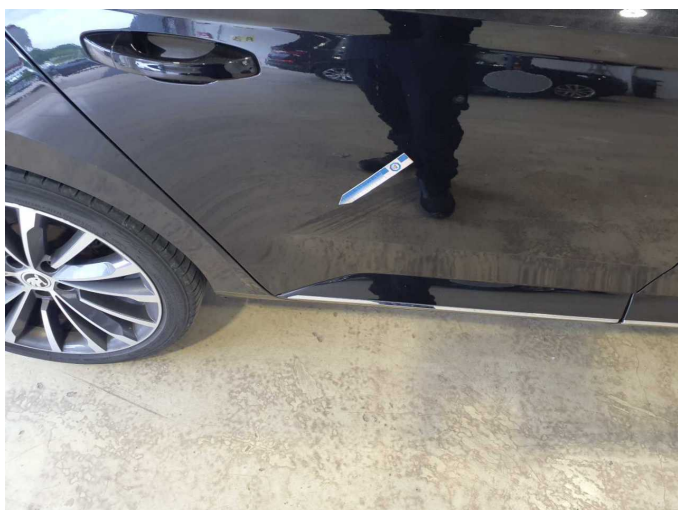


Damage 10: Door - rear right side: Door - Scratch(es) - Paint




Damage 10: Door - rear right side: Door - Scratch(es) - Paint

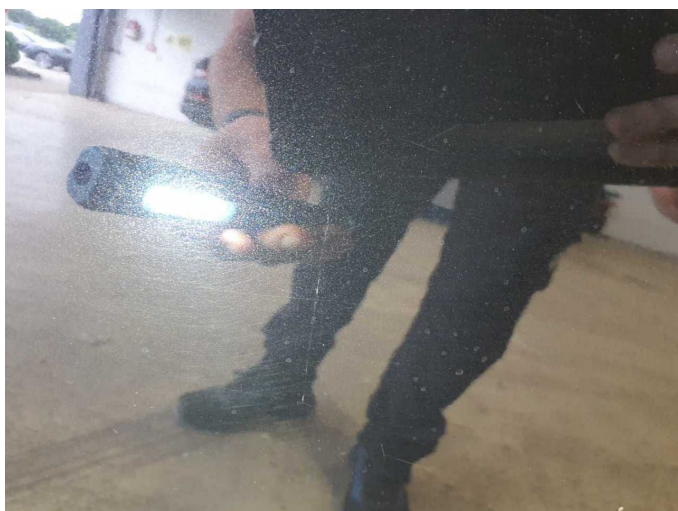


Damage 10: Door - rear right side: Door - Scratch(es) - Paint

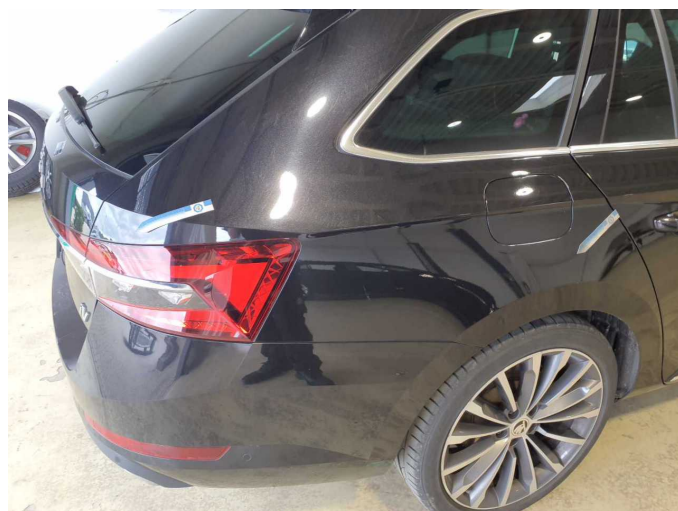

Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

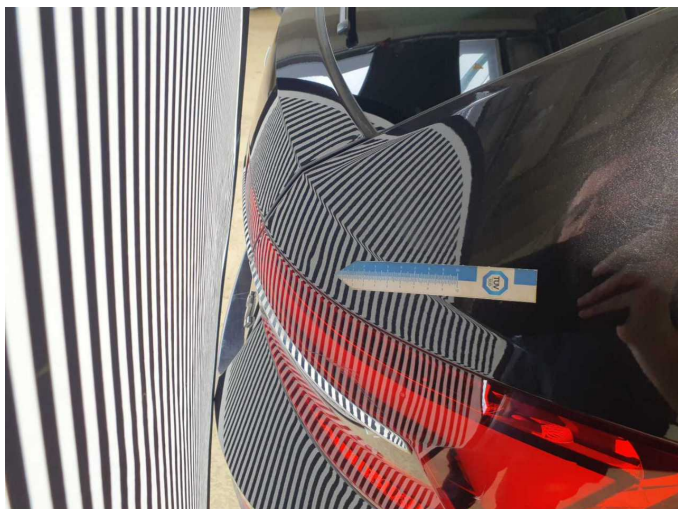

Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

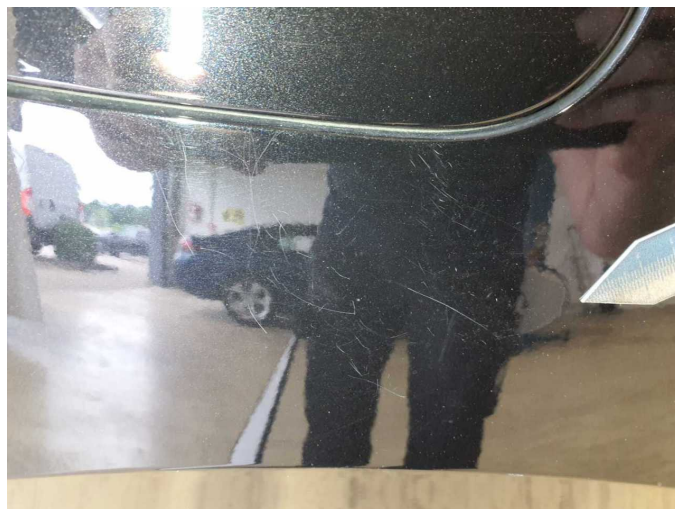

Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

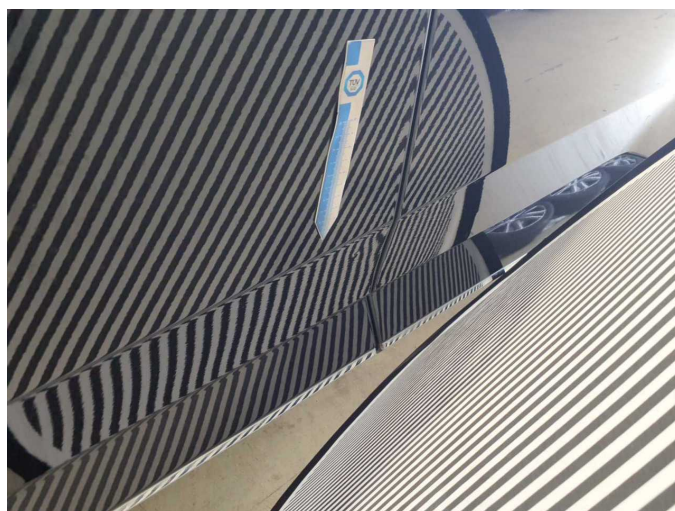

Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

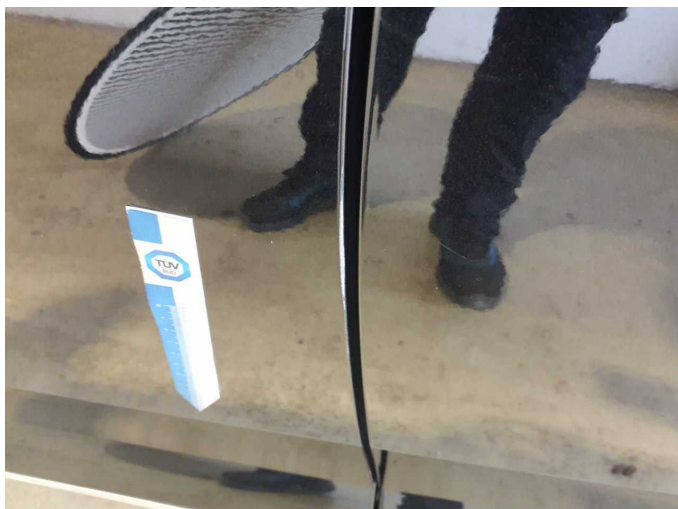

Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

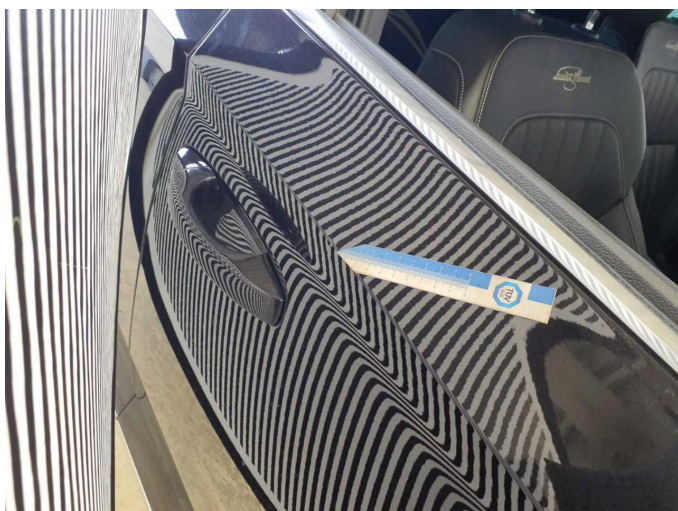


Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

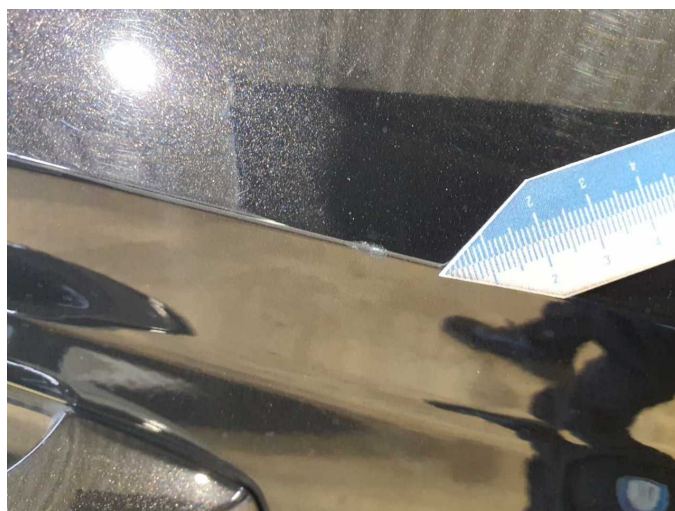


Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

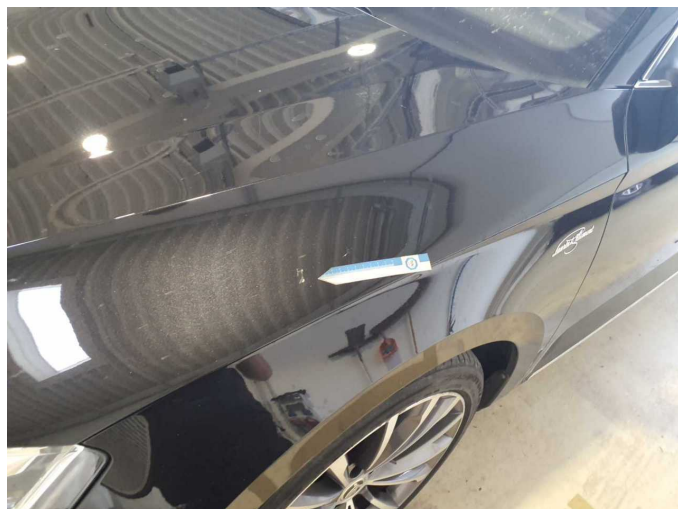

Damage 14: Bonnet: Bonnet - Scratch(es) - Paint

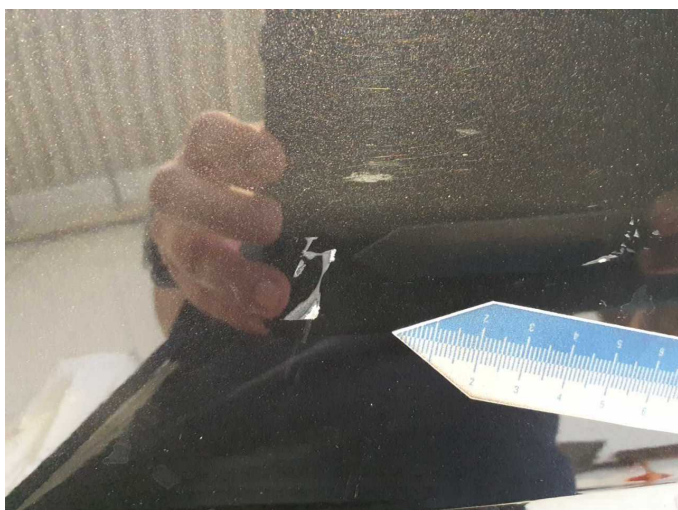

Damage 14: Bonnet: Bonnet - Scratch(es) - Paint



Damage 15: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 15: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 5: Gearbox: Selector lever - Scratch(es) - No deduction



Wear and tear 5: Gearbox: Selector lever - Scratch(es) - No deduction