



Expertise

Protocol number: 46316007  
Order No. / Reference: 26562342  
Inspection date: 29 Jun 2026

Manufacturer: Mercedes-Benz

Model: GLE 350 de 4Matic 9G-TRONIC Exclusive

VIN: W1N1671171A678406



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz GLE 350 de 4Matic 9G-TRONIC Exclusive

**Vehicle Identification number** W1N1671171A678406  
**Mileage (Read)** 171,982 km  
**First registration** 18 May 2022  
**Number of holders** 1  
**Next periodical technical inspection** 05/2027  
(Report on hand)

**Power / Engine displacement** 143 kw / 1,950 ccm  
**Fuel type / Cylinder** Hybr.D/E ext.aufl / 4  
**Gearbox / Number of gears** Automatic / 9  
**Type of drive** All-wheel drive  
**Type of vehicle** SUV

**Colour / colour code** Schwarz uni  
**Doors / Seats** 5 / 5  
**Upholstery type** Leather  
**Colour of upholstery** Black-Anthracite



## Vehicle details

|                                                  |                              |                                |                                                            |
|--------------------------------------------------|------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital proof / complete     | <b>Next maintenance in</b>     | 289 Tag(e)                                                 |
| <b>Last service on / at</b>                      | 04/2026 at 169,572 km        |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                        | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                              | <b>Letter No.</b>              | GJ441038                                                   |
| <b>Previous damage / Accident</b>                | Detectable                   | <b>Repainting</b>              | Detectable                                                 |
| <b>Inspection conditions</b>                     | sufficient                   | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                | Not performed                | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 2222 / AFH 00089             |                                |                                                            |
| <b>Emission standard</b>                         | EURO6;WLTP;AP;PI/CI; M, N1 I | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 3,260 kg                     | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 275/50 R20 113V | Summer tyres on Light alloy | Falken       | 5mm / 5mm   |
| 2) | 275/50 R20 113V | Summer tyres on Light alloy | Falken       | 5mm / 5mm   |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Exhaust system with 2 chrome-plated tailpipe trims
- Adaptive Highbeam Assist
- Airbag: Driver and passenger side
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- 4MATIC permanent all-wheel drive
- Anti-lock braking system
- Foldable armrest for driver and front passenger
- ATTENTION ASSIST
- Electrically adjustable and heated exterior mirrors
- Roof rails in aluminum look
- Downhill Speed Regulation (DSR)
- Third brake light
- EASY-Pack cargo cover (removable)
- ECO start/stop function
- Electronic Stability Program
- Electronic traction system for all-wheel drive (4ETS)
- Electric windows, front and rear
- Velour floor mats in black
- Transmission: 9G-TRONIC
- Rear window heated
- Rear window wiper with intermittent function
- Instrument panel and door sills in ARTICO man-made leather
- Climate: THERMATIC automatic climate control
- Rear headrests (3)
- Radiator grille with 2 chrome-plated louvers in SUV design
- Charging cable for household socket, 5m, smooth
- Charging system: AC on-board charger 7.4 kW
- LED High Performance Headlights
- Steering column mechanically adjustable lengthwise and heightwise.
- Navigation accessories: Extended MBUX functions
- Navigation: Hard disk navigation
- Package: Chrome
- Package: Parking package with reversing camera
- Package: Mirror Package
- PRE-SAFE system
- Radio accessories: Additional USB ports
- Remote Services Plus
- Windscreen wipers with rain sensor
- 3-point seat belts
- Seats: Comfort seats for driver and front passenger
- Seats: Rear seat backrests foldable
- Cruise control with variable speed limiter
- Immobiliser
- Heat-insulating glass, all around
- ADAPTIVE BRAKE
- Adaptive brake light
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- Acoustic environmental protection
- Ambient lighting
- Traction control (ASR)
- Rear armrest
- Automatic passenger airbag deactivation
- Brake Assist BAS
- Diesel particulate filter
- Tachometer
- EASY-Pack tailgate with electric operation for opening and closing
- Front door sills with "Mercedes-Benz" lettering illuminated in white
- Chassis with steel springs and lowered suspension
- electric parking brake
- Speed Limit Assistant
- Lockable, air-conditioned and illuminated glove compartment
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- Mechanical child safety lock in the rear doors
- Communication module (LTE) for the use of Mercedes me connect services
- Paint finish: Solid
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for navigation services
- Package: Chrome Interior Package
- Package: Public Charging
- Upholstery: Leather
- Radio accessories: Digital radio (DAB)
- Tire pressure monitoring system (TPMS)
- Rear view camera
- Power steering
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Heated seats for driver and front passenger seats
- Phone accessories: Smartphone integration
- High-visibility vest for drivers
- Widescreen Cockpit
- Central locking with interior switch



## Extra equipment

- Trailer maneuvering assistant (assistance system - articulation angle sensor in the ball head of the trailer hitch - rotating magnetic ring on the ball head)
- Black fabric headliner in combination with black upholstery
- Instrument panel and door sills in ARTICO man-made leather combined with Nappa leather (instrument panel in ARTICO man-made leather - door sills in ARTICO man-made leather)
- Cargo area cover (with additional partition net).
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC - Active Steering Assist - Active Brake Assist - Evasive Steering Assist - Active Lane Keeping Assist - Active Blind Spot Assist - PRE-SAFE PLUS - Active Traffic Jam Assist)
- Package: Warmth Comfort Package (Seat heating Plus for driver and front passenger: includes seat cushion and seat back - Armrest heating for driver and front passenger: includes armrests of the doors, the center console and the door center panels)
- Radio accessories: Burmester surround sound system (with 13 speakers and 590 watts system power. Experience enhanced performance and exclusivity with legendary Burmester sound. The high-performance speakers create a first-class surround sound experience. This can be specifically optimized for the front and rear seats, intensifying the listening experience. A quality that is also visible thanks to the high-quality Burmester logos.)
- Servo closing (This is what quality sounds and feels like: Servo closing ensures a smooth and virtually silent closing process. After the initial engagement, the front and rear doors are pulled into the lock by servo motors.)
- Electric sunshades in the rear doors, left and right (See and not be seen: The electrically operated sunshades in the two rear doors protect passengers from prying eyes and, in summer, from intense sunlight. Visibility to the outside remains possible.)
- Illuminated running boards in aluminum look with rubber studs
- Heat-insulating dark tinted glass
- Towbar with ESP trailer stabilization
- Head-up display (lens and mirror system projects a virtual image into the driver's field of vision - full-color display that is easily readable even on sunny days and at night - depending on the equipment, display of, for example, navigation instructions, speed, speed limits or settings of cruise control or active distance assist DISTRONIC)
- Chrome-look loading sill protector
- Steering wheel: Steering wheel heating
- Package: Parking Package with 360° camera (12 sensors: four front, four rear, two on the sides in the front/rear bumper; detects parking spaces up to 35 km/h; steering control; in conjunction with automatic transmission, assists with acceleration, braking, and gear changes; 360° camera; visual/audible warning of detected obstacles in front of/behind the vehicle up to approx. 10 km/h; Rear Cross Traffic Alert warns of detected cross traffic; Drive Away Assist (only in conjunction with automatic transmission); button on the center console or on the control panel for the assistance systems)
- Wheels: 50.8 cm (20") light alloy wheels in 5-spoke design (aerodynamically optimized, painted black and polished with front axle 275/50 R 20 on 8.5 J x 20 ET 55, rear axle 275/50 R 20 on 8.5 J x 20 ET 42)
- Heated windshield washer system (including washer fluid reservoir, washer nozzles and washer fluid hoses)
- Protection and preservation (The reversible mat helps in two ways: With its fine velour side, it effectively protects the cargo area from dirt, while its rubberized side prevents cargo from slipping. The foldable zigzag loading sill protector with Velcro fastening can prevent clothing from getting dirty or the paintwork from being scratched during loading and unloading.)
- Telephone: Multifunctional telephony (wireless connection of a compatible mobile phone to the external antenna - wireless charging for compatible mobile phones - Bluetooth and WLAN pairing wirelessly via NFC (Near Field Communication) technology)
- Decorative elements: Open-pore anthracite oak wood

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |



## Value reducing factors

| No. | Component group        | Description                                       |
|-----|------------------------|---------------------------------------------------|
| 1   | Interior               | Interior (Hundegeruch) - Odour - Ozone treatment  |
| 2   | Door - front left side | Door - Dent / paintcoat damage - Repair and paint |
| 3   | Boot lid / rear door   | Boot lid - Scratch(es) - Paint                    |
| 4   | Bonnet                 | Bonnet - Scratch(es) - Paint                      |

## Wear and tear

| No. | Component group | Description                                             |
|-----|-----------------|---------------------------------------------------------|
| 1   | Vehicle glazing | Windscreen - Stone chips - No deduction                 |
| 2   | Interior        | Interior - Scratch(es) - No deduction                   |
| 3   | Body            | Body (Waschanlagenkratzer) - Scratch(es) - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Missing parts

### Description

Equipment - charging cable (Haushaltssteckdose)

## Previous damages

| No. | Previous damage                      | Extent of damage (Net) |
|-----|--------------------------------------|------------------------|
| 1   | Side - left, Professionally repaired |                        |

## Accident damages

| No. | Accident                      |
|-----|-------------------------------|
| 1   | Front, Side - left, Underbody |

## Repainting

| No. | Repainting                                                                                   |
|-----|----------------------------------------------------------------------------------------------|
| 1   | Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

## Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

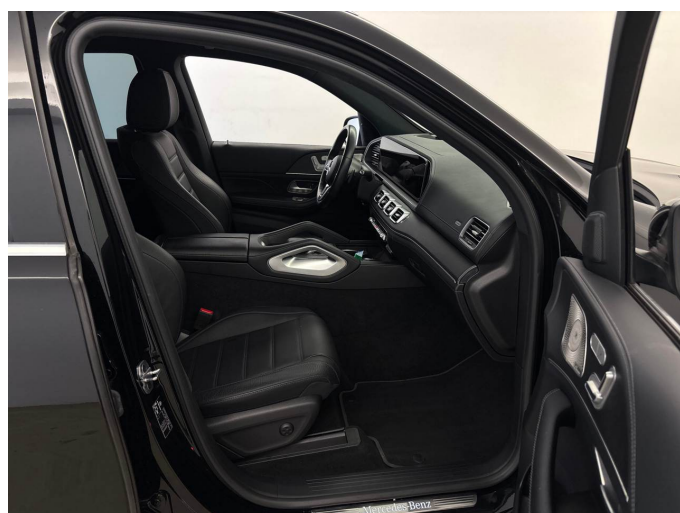


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area

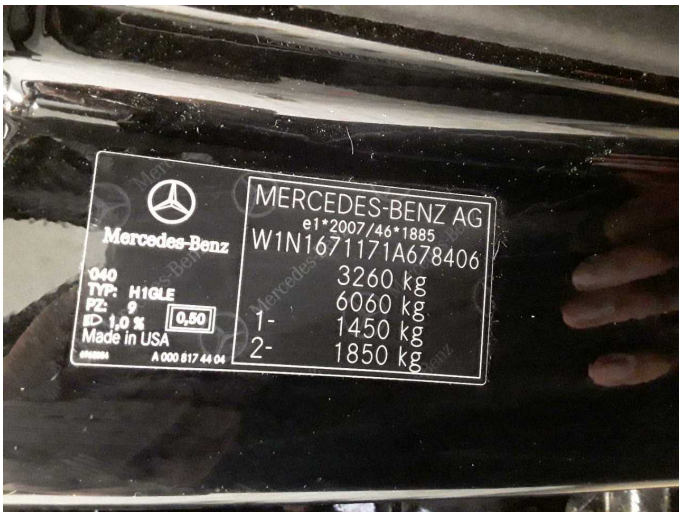


Figure 12: VIN



Figure 13: Mounted tyres



Figure 14: Documents

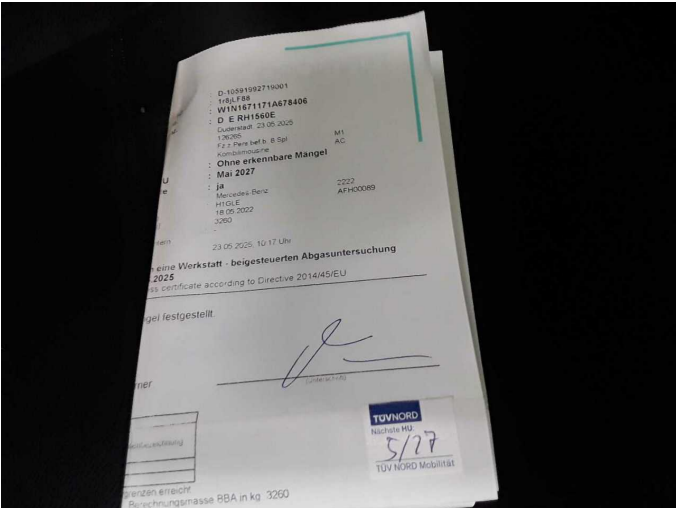


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

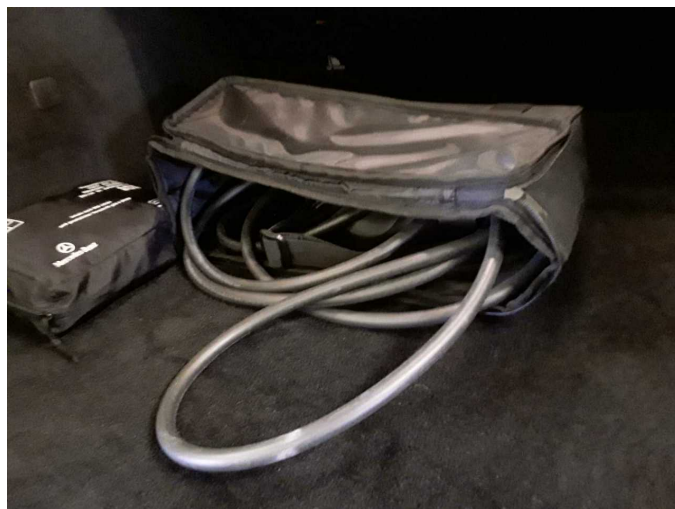


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

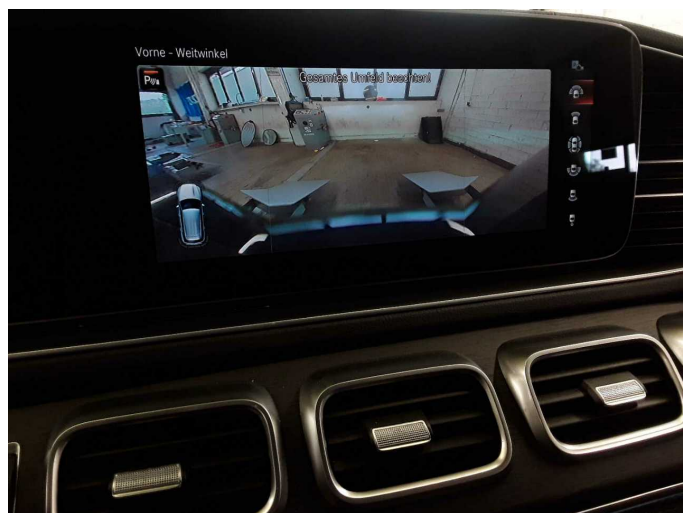


Figure 33: Misc.



Figure 34: Misc.

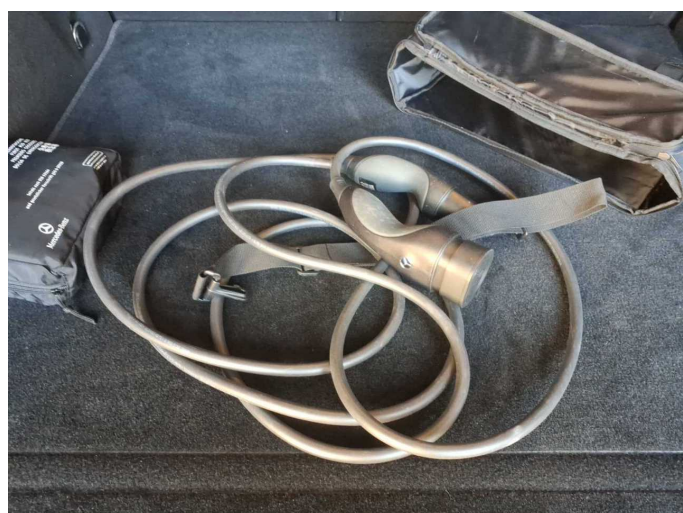


Figure 35: Misc.



**Damage 2:** Door - front left side: Door - Dent / paintcoat damage - Repair and paint



**Damage 2:** Door - front left side: Door - Dent / paintcoat damage - Repair and paint




**Damage 2:** Door - front left side: Door - Dent / paintcoat damage - Repair and paint




**Damage 3:** Boot lid / rear door: Boot lid - Scratch(es) - Paint



**Damage 3:** Boot lid / rear door: Boot lid - Scratch(es) - Paint

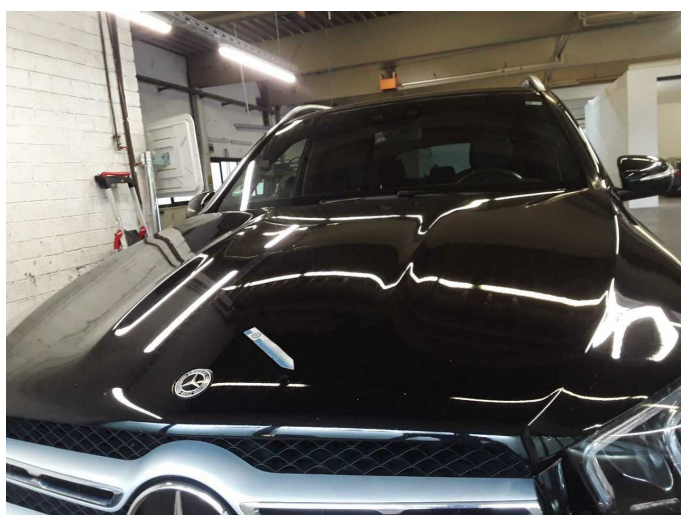

**Damage 4:** Bonnet: Bonnet - Scratch(es) - Paint

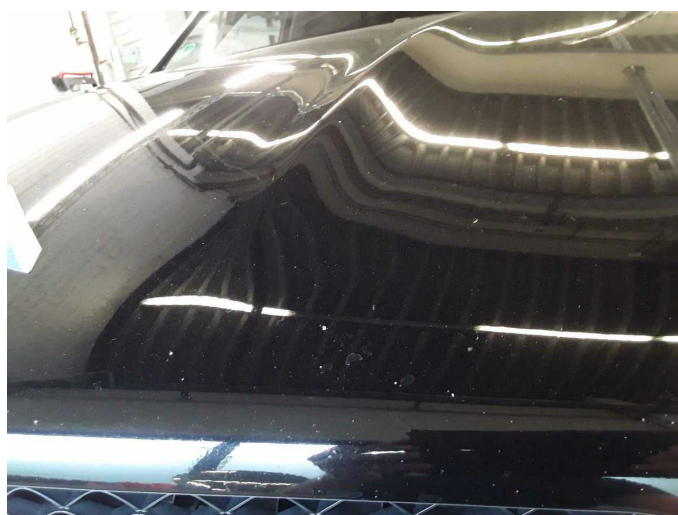

**Damage 4:** Bonnet: Bonnet - Scratch(es) - Paint



**Damage 4:** Bonnet: Bonnet - Scratch(es) - Paint



**Wear and tear 1:** Vehicle glazing: Windscreen - Stone chips - No deduction



**Wear and tear 1:** Vehicle glazing: Windscreen - Stone chips - No deduction



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody



**Accident 1:** Front, Side - left, Underbody




**Repainting 1:** Side panel - rear left side



**Repainting 1:** Side panel - rear left side



**Repainting 1:** Side panel - rear left side

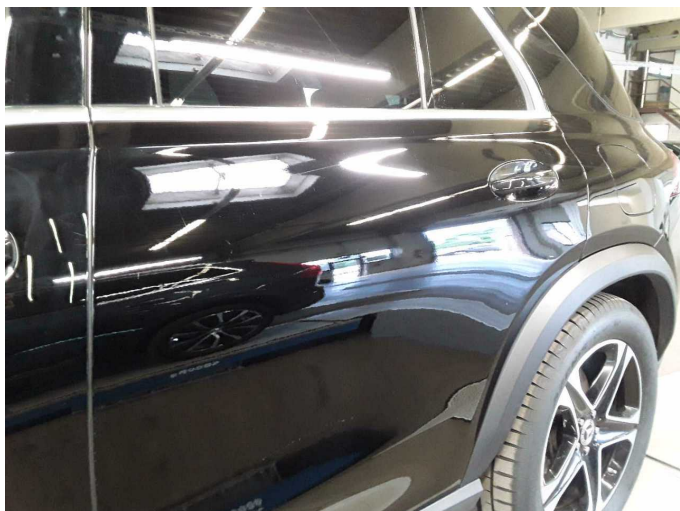

**Repainting 1:** Side panel - rear left side



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N1671171A678406

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLE 350 de 4Matic 9G-TRONIC Exclusive

| Datum      | KM-Stand | Beschreibung             |
|------------|----------|--------------------------|
| 13.04.2026 | 169.572  | Regelwartungsdienst      |
| 09.10.2025 | 145.243  | Regelwartungsdienst      |
| 10.04.2025 | 120.484  | Regelwartungsdienst      |
| 16.12.2024 | 111.869  | Bremsscheiben+Beläge v+h |
| 02.07.2024 | 95.434   | Regelwartungsdienst      |
| 30.11.2023 | 71.434   | Regelwartungsdienst      |
| 22.05.2023 | 48.713   | Regelwartungsdienst      |
| 12.12.2022 | 25.712   | Regelwartungsdienst      |