



Expertise

Protocol number: 46466390
Order No. / Reference: 26573144
Inspection date: 10 Jul 2026

Manufacturer: Mercedes-Benz

Model: EQA 250+

VIN: W1N9N0CB1SJ167429



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz EQA 250+	
Vehicle Identification number	W1N9N0CB1SJ167429
Mileage (Read)	22,033 km
First registration	1 Apr 2025
Number of holders	1
Next periodical technical inspection	04/2028
(Report not on hand)	
Power / Engine displacement	95 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Mountaingrau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	313 Tag(e)
Last service on / at	05/2025 at 19,409 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HM211869
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BEE 00020		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,475 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104T	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	235/55 R18 104T	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R18 102T	Winter tyres on Light alloy	Continental	3mm / 3mm
2)	215/60 R18 102T	Winter tyres on Light alloy	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment in center console with roller blind
- Airbag: Driver and passenger side
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Acoustic environmental protection
- Rear armrest
- Double cup holder
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis: Comfort chassis with lowered suspension
- Pedestrian protection with active hood
- Luggage net on driver and passenger seatbacks
- Transmission: Direct drive
- Rear window wiper/washer system
- Climate: THERMATIC automatic climate control
- Adjustable headrests (5)
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Charging system: Alternating current charging system (AC charging) up to 11 kW
- LED light strip (function: tail light and rear fog light) between the LED tail lights
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: MBUX Navigation Premium
- Package: Light and Visibility Package
- Package: Progressive Line
- Upholstery: ARTICO leatherette/fabric
- Radio accessories: Digital radio
- Radio accessories: Additional USB ports
- Remote and Charging Services Premium
- Rear view camera
- Seats: 4-way lumbar support for driver
- Seats: Comfort seats
- Heated seats for driver and front passenger
- 12V power outlet in center console
- Cruise control
- High-visibility vest for drivers
- heat pump
- Decorative elements Star Pattern
- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- Ambient lighting
- Automatic passenger airbag deactivation
- Third brake light in LED technology
- EASY-PACK tailgate
- Elimination of roof rails
- Electric windows (4-way)
- Velour floor mats
- Speed Limit Assistant
- Rear window heated
- Black fabric headliner
- Communication module (LTE) for the use of Mercedes me connect services
- Chrome-look loading sill protector
- Charging system: Direct current charging system (DC charging)
- LED High Performance Headlights
- Steering wheel: Multifunction sports steering wheel in leather
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Cargo space
- Package: Progressive
- Package: Seating comfort
- Radio accessories: CENTRAL MEDIA DISPLAY
- Radio accessories: GPS antenna
- Tire pressure monitoring system
- Wheels: 45.7 cm (18") alloy wheels, 4-spoke design
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment in the rear
- Seats: Rear seat backrests foldable
- Sun visor with illuminated makeup mirror
- Power outlet: 12V socket in the luggage compartment
- TIREFIT
- Immobiliser
- Central locking with remote control



Extra equipment

- Active Distance Assist DISTRONIC (radar sensor in the radiator grille - automatically acting assistance system - active up to a speed of 160 km/h - visual and acoustic warning if you as the driver need to intervene - depending on the driving program, the vehicle accelerates faster or slower to the desired speed - detected speed limits can be conveniently adopted by pressing a button on the steering wheel (only in conjunction with Traffic Sign Assist or Speed Limit Assist))
- Package: Progressive Advanced (Charging cable for household socket, 5m, smooth; Advanced package - Fully digital instrument display with 10.25" screen diagonal - Parking package with reversing camera - Blind spot assist - Individualization package - Mirror package - Illuminated door sill trims with model-specific lettering and interchangeable cover)
- Package: Winter Package (heated seats for driver and front passenger, selectable in three stages and with automatic shut-off - heated steering wheel - heated windscreen washer system)
- Wheels: Complete winter wheel sets fitted at the factory
- Siemens volume model
- Blind Spot Assist (The Blind Spot Assist system keeps a very close eye on your surroundings, especially as soon as you activate the turn signal. The system can therefore warn you visually and audibly of potential side collisions with other road users in your blind spot. Even after driving, the system remains vigilant and will warn you if you open the door at the wrong moment.)
- Fully digital instrument display (The large, high-resolution 10.25" display can be configured to your specific needs. For example, with the power meter in the right-hand tube. Depending on your mood, you can choose the display style: Classic, Sporty, or Discreet.)
- Towbar with ESP trailer stabilization (Foldable towbar - operating button with LED light in the boot or tailgate - ESP trailer stabilization)
- Roof rails in polished aluminum
- Paint finish: Metallic
- Package: Parking package with reversing camera (12 ultrasonic sensors: 6 each in the front and rear bumpers - reversing camera: integrated into the trunk lid, display in the central display, trailer mode - Active Parking Assist PARKTRONIC: detects parking spaces, assisted parking, visual and acoustic warning of detected obstacles, display of camera and ultrasonic data in the central display, button for Active Parking Assist with PARKTRONIC - cross traffic warning - maneuvering braking - drive-away assist)
- Package: Mirror package (electrically folding exterior mirrors via a button in the driver's door control panel - the menu allows you to set the exterior mirrors to fold in automatically when locking the vehicle and unfold again when unlocking - interior mirror automatically dimming, steplessly, depending on the incident glare and ambient light)
- Phone accessories: Smartphone integration (Smartphone integration connects your mobile phone wirelessly to the multimedia system via Apple CarPlay and Android Auto. This gives you convenient access to your smartphone's most important applications. You can also use third-party apps such as Spotify quickly and easily.)
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Removal of emblem on the front fenders
- Dark tinted heat-insulating glass (rear side windows and rear window)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Door trim - rear right side - Scratch(es) - Smart repair
2	Side panel - rear left side	Sill - Scratch(es) - Smart repair
3	Door - rear left side	Handle - Scratch(es) - Smart repair
4	Trim / covers	Door trim - rear left side - Scratch(es) - Smart repair
5	Mudguard - right side	Wheel well extension - Scratch(es) - Replace
6	2nd wheel set	2 tyres - Worn - Replace



Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Trim / covers	Boot lid - interior trim - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

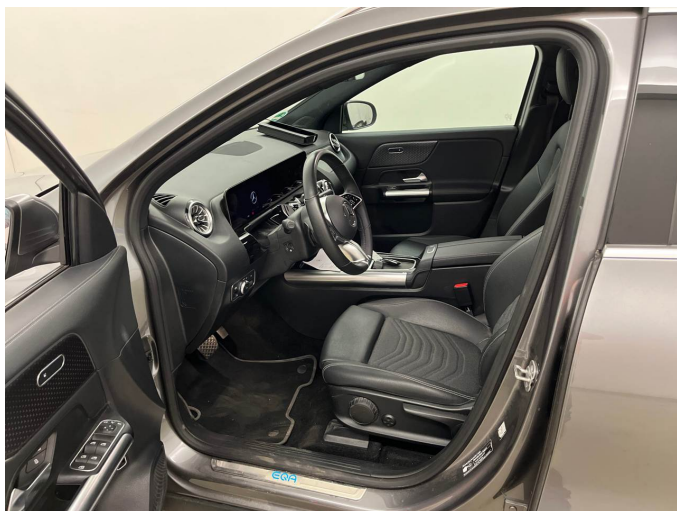


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

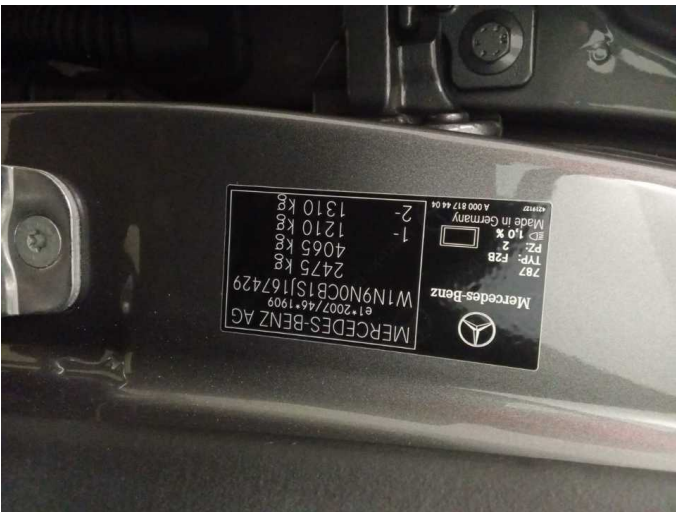


Figure 11: VIN



Figure 12: Mounted tyres

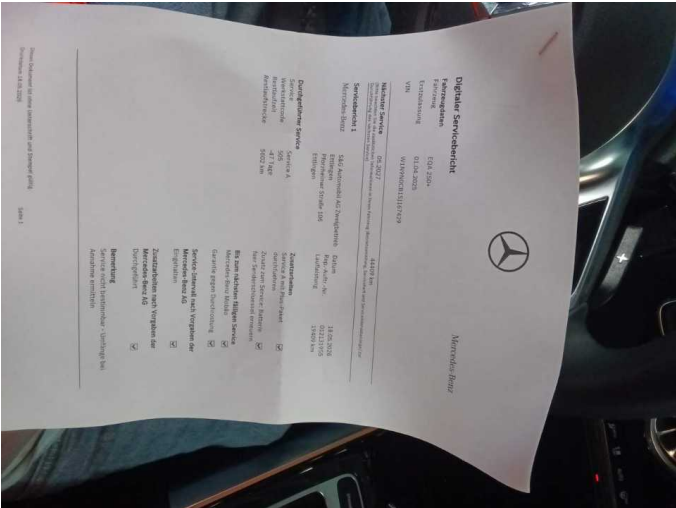


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.

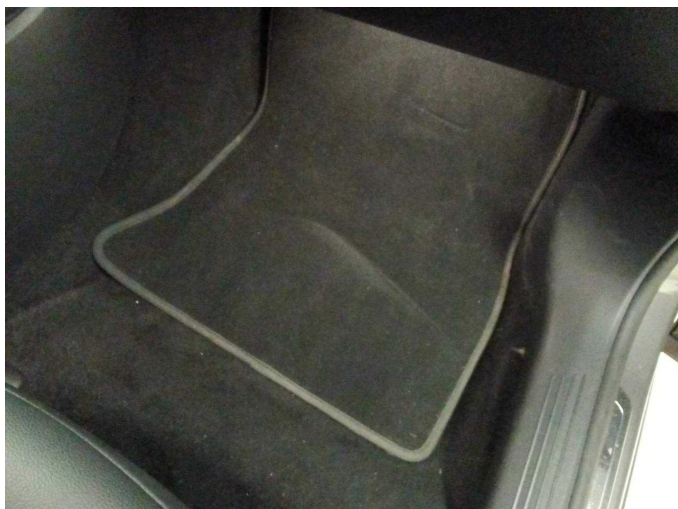


Figure 19: Misc.

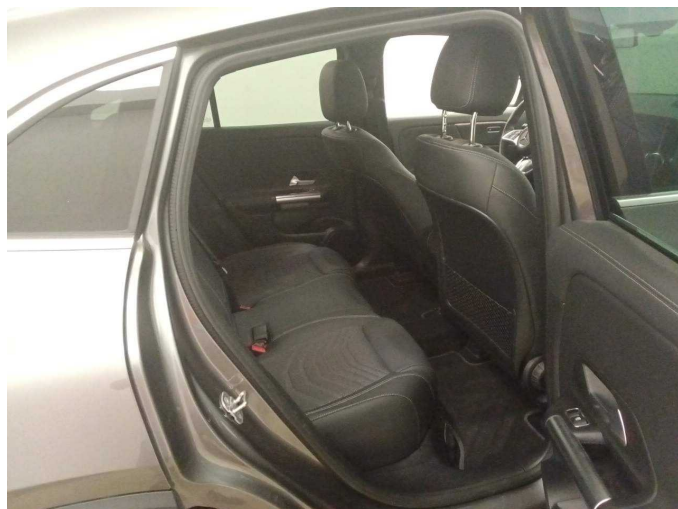


Figure 20: Misc.

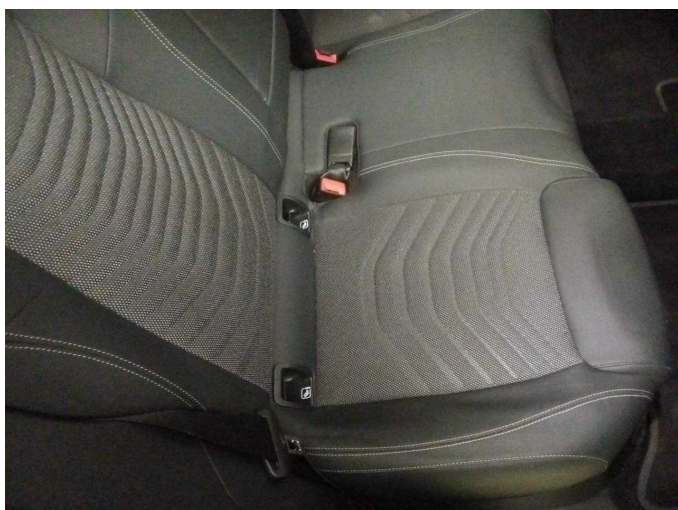


Figure 21: Misc.

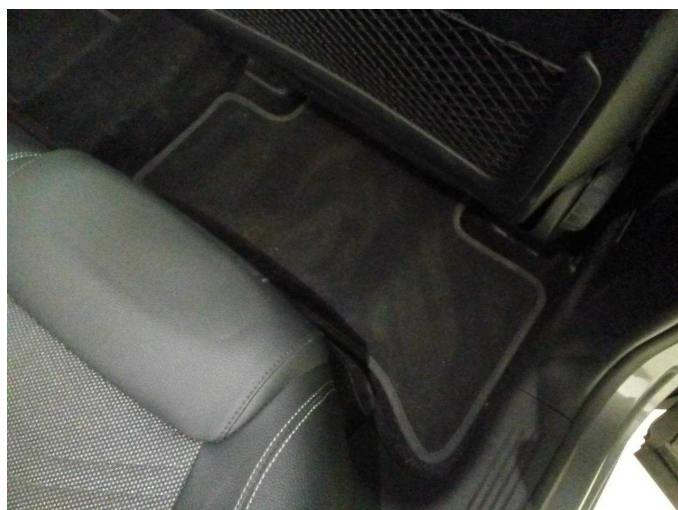


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

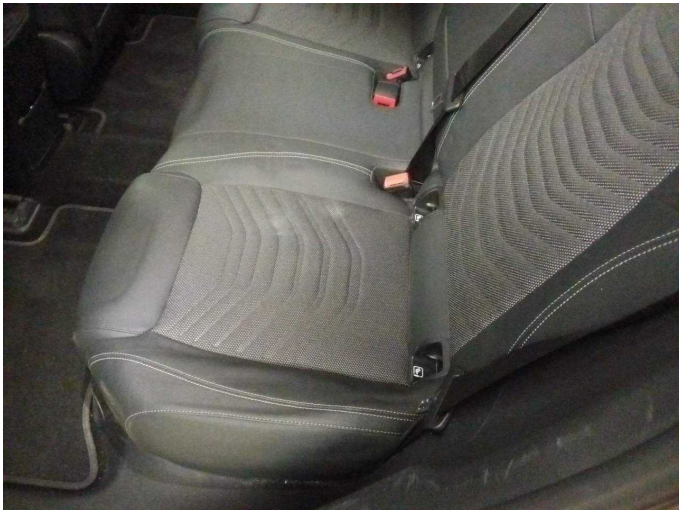


Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



Figure 40: Misc.



Figure 41: Misc.



Figure 42: Misc.



Figure 43: Misc.



Figure 44: Misc.



Figure 45: Misc.



Figure 46: Misc.



Figure 47: Misc.



Figure 48: Misc.



Figure 49: Misc.



Figure 50: Misc.

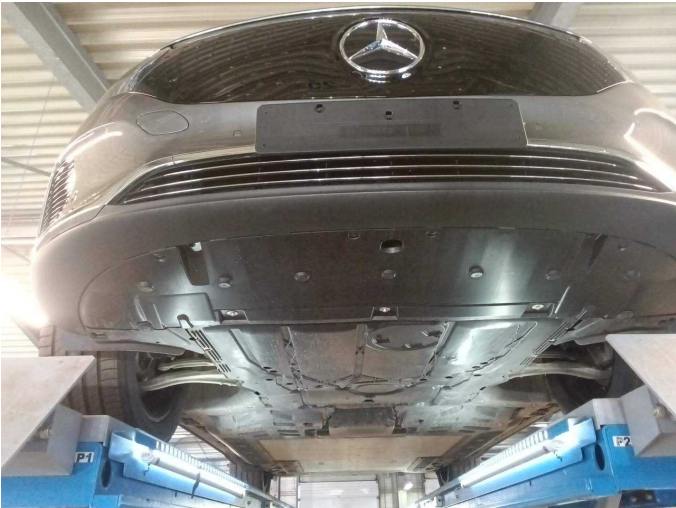


Figure 51: Misc.



Figure 52: Misc.




Figure 53: Misc.




Damage 1: Trim / covers: Door trim - rear right side - Scratch(es) - Smart repair




Damage 1: Trim / covers: Door trim - rear right side - Scratch(es) - Smart repair

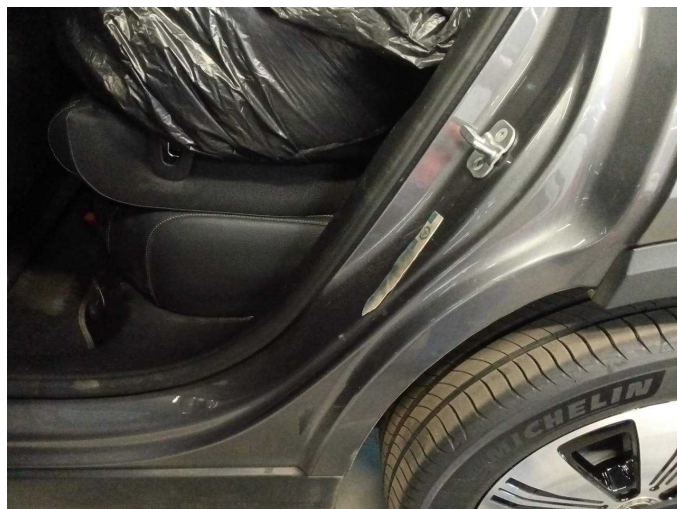

Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair

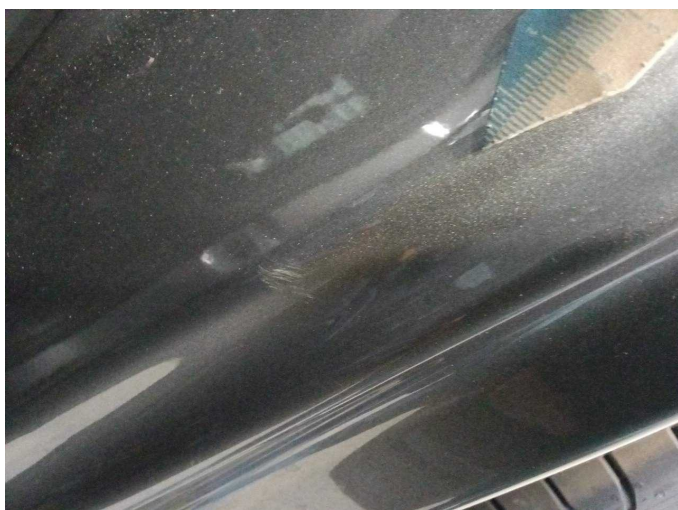

Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair

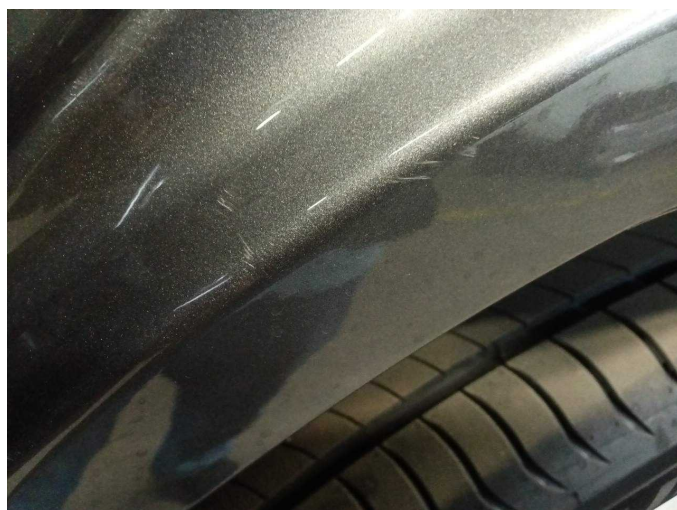

Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Handle - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Handle - Scratch(es) - Smart repair



Damage 4: Trim / covers: Door trim - rear left side - Scratch(es) - Smart repair



Damage 4: Trim / covers: Door trim - rear left side - Scratch(es) - Smart repair




Damage 5: Mudguard - right side: Wheel well extension - Scratch(es) - Replace



Damage 5: Mudguard - right side: Wheel well extension - Scratch(es) - Replace




Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction

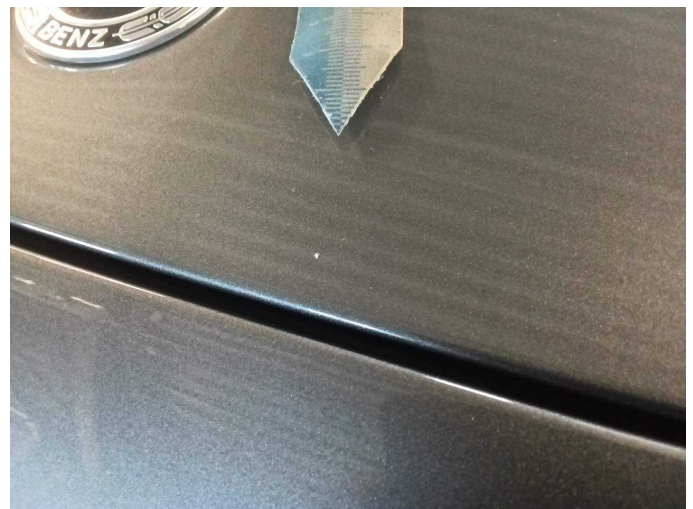

Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Trim / covers: Boot lid - interior trim - Scratched - No deduction

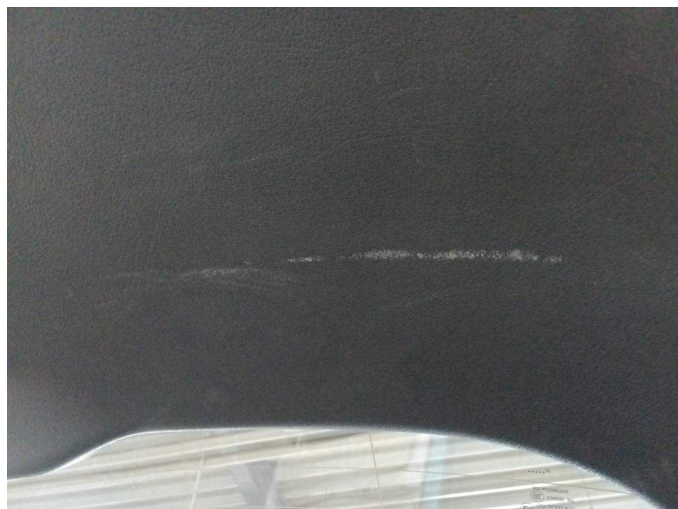

Wear and tear 2: Trim / covers: Boot lid - interior trim - Scratched - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N9N0CB1SJ167429

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ EQA 250+

Datum	KM-Stand	Beschreibung
18.05.2026	19.409	Regelwartungsdienst