



Expertise

Protocol number: 46445981
Order No. / Reference: 26571161
Inspection date: 10 Jul 2026

Manufacturer: Skoda
VIN: TMBJR9NP7R7017810

Model: Superb Combi 2.0 TDI DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI DSG Style	
Vehicle Identification number	TMBJR9NP7R7017810
Mileage (Read)	155,892 km
First registration	16 Oct 2023
Number of holders	1
Power / Engine displacement	147 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Brillant-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Beige



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	22,200 km
Last service on / at	04/2026 at 148,014 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT135758
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWB 00682		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,220 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 98Y	Summer tyres on Light alloy	Dunlop	4mm / 4mm
2)	235/45 R18 98Y	Summer tyres on Light alloy	Dunlop	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Dunlop	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors
- Exterior mirrors and door handles in body color
- Illuminated glove compartment
- Hydraulic brake assist (HBA)
- Roof rails, anodized
- Diesel particulate filter and SCR catalyst
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electric tailgate opening
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (Easy Light Assist)
- Front radar assistant including city emergency braking function
- Cruise control system including speed limiter
- Tinted windows
- Rear window wiper including windshield washer system
- ISOFIX preparation on the outer rear seats, including top tether
- Boot cover, roll-up and removable, semi-automatic
- Radiator grille slats, frame and window surround chrome-plated
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Steering wheel with multifunction buttons including paddle shifters
- Rear center armrest with cup holders and pass-through option
- Multifunctional storage compartment under the boot cover
- LED fog lights with integrated cornering lights
- Radio: Bolero infotainment system
- Radio accessories: Voice control
- Radio accessories: Wireless SmartLink
- Umbrella compartments in the front side doors
- Tire mobility kit
- Heated windshield washer nozzles
- Superb seat belts
- Seats: Adjustable lumbar support in the front seats
- Seats: Electric operation of the front passenger seat from the rear
- SKODA Care Connect
- Start/stop system including brake energy recuperation
- 12V socket in the trunk
- Sunset (rear window and rear side windows tinted dark)
- Door sill plates
- Glazing: Acoustic glazing in the front side windows
- Immobiliser
- Storage compartments
- Airbag, driver and switchable passenger airbag
- Airbag, head airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black, headliner in grey
- Electrically folding exterior mirrors
- Hill start assist
- Grey headliner
- Decorative inlay Dark Brushed
- Digital Cockpit Plus 10.2"
- Third brake light
- Easy Start (start-stop button instead of ignition lock)
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front and rear footwell lighting
- Transmission: 7-speed dual-clutch transmission (DSG)
- Heated rear window
- Interior mirror automatically dimming
- Child safety lock for rear doors & windows, electric
- Air Care Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- Metal loading sill protector
- LED reading lights at the front and rear of the headliner
- Steering wheel: Height and reach adjustable leather steering wheel
- Matrix LED headlights
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- Rear parking sensors
- Radio accessories: Digital radio reception DAB+
- Radio accessories: USB ports at the front (Type-C) and USB charging port (Type-A) in the center armrest
- Tire pressure monitoring
- Gearshift and handbrake levers in leather
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Electrically adjustable front seats
- Seats: Height-adjustable front seats
- Seats: Rear seat backrest split 60:40, foldable
- Sun visor on driver and passenger side with illuminated make-up mirror
- 12V socket in the center console, front and rear
- Telephone: Bluetooth hands-free system
- Chrome-plated elements
- Lashing eyes in the trunk
- Central locking with remote control



Extra equipment

- Heated windshield, wireless
- Electric panoramic sunroof including sunshade (elimination of the glasses compartment in the headliner)
- Paint finish: Metallic
- Package: Assistance Plus (Lane Change Assist - Area View - Trailer Maneuvering Assist & Park Assist - Trailer Hitch - (Active Tire Pressure Monitoring System) - Driver Fatigue Detection)
- Package: Comfort Plus (Combi, Style) (3-zone Climatronic - heated front and rear seats - KESSY - 3rd vehicle key - comfort opening for the tailgate - heated steering wheel (with shift paddles) - sunshade for the rear side windows - Argenzo-Zebrano trim strip - ambient lighting)
- Package: Safety (Proactive occupant protection - rear side airbags - Isofix anchorage for passenger seat)
- Progressive steering (adjustment of the steering angle depending on the speed)
- Seats: Leather upholstery & ventilated front seats (perforated leather)
- ACCESSORIES - Clothes hangers
- ACCESSORIES - Cooler box 15 liters
- ACCESSORIES - Roof rack
- ACCESSORIES - Front mud flap set
- ACCESSORIES - Combi partition grille
- ACCESSORIES - Universal holder for multimedia devices
- Anti-theft alarm system with SAFE system, interior monitoring and tilt sensor
- Chassis: Adaptive chassis DCC (10 mm lowering, adjustable damper setting) (including driving profile selection (Normal, Comfort, Eco, Sport, Individual))
- Package: Business Columbus (Columbus navigation system - voice control - Wi-Fi hotspot - Wireless Smartlink for Apple CarPlay - 9.2" capacitive touchscreen in glass design - Phonebox - Traveller assistance system (traffic sign recognition, predictive lane keeping assist ACC, adaptive lane keeping assist, emergency and traffic jam assist) - 230 V socket and 3 USB ports, tablet holder - Infotainment Online (3-year subscription))
- Package: Transport (Combi) (Boot net - Variable loading floor - Luggage net partition)
- Wheels: 18" Antares alloy wheels (8J x 18" ET 44 with 235/45 R18 tires)
- Auxiliary heater with radio remote control
- ACCESSORIES - Waste bin for interior door, black
- ACCESSORIES - Plastic boot mat
- ACCESSORIES - Umbrella
- ACCESSORIES - Rear mud flap set
- ACCESSORIES - Sunshade set for rear window and trunk
- ACCESSORIES - Universal headrest mount, black

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Front bumper	Front bumper (in Unfallschaden berücksichtigt) - Scratched - Paint
2	Interior	Clothes hanger - Missing - Replace
3	Seat - front	Backrest cover - left side - Scratch(es) - Smart repair
4	Interior	Interior (Hundegeuruch) - Odour - Ozone treatment
5	Electrical system	Cool box - Missing - Replace
6	Interior	Interior (Hundehaare) - Soiled - Conditioning
7	Body	Body - Glued / labelled - De-glue / neutralise
8	Wheel / tyres	Alloy rim - front left side - Scratched - Replace
9	Wheel / tyres	Alloy rim - rear left side - Scratched - Replace
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Bonnet	Bonnet (Vermehrte steinschläge) - Stone chips - Paint
12	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
13	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 alloy rims - Scratch(es) - No deduction
2	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Separation net

Accident damages

No. Accident

1 Front, Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

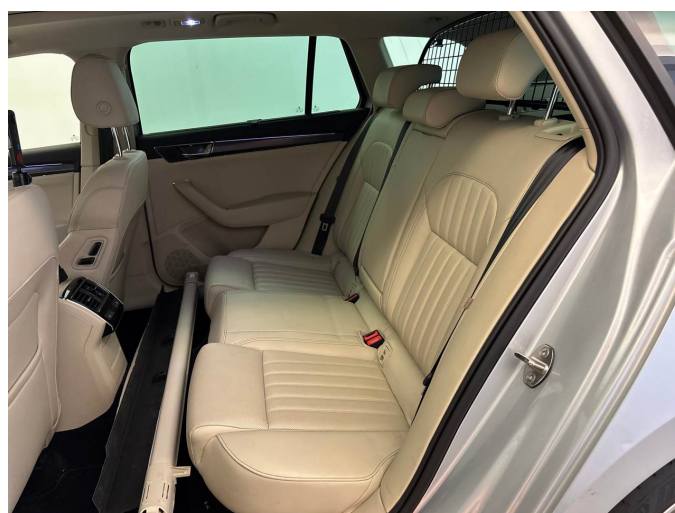


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

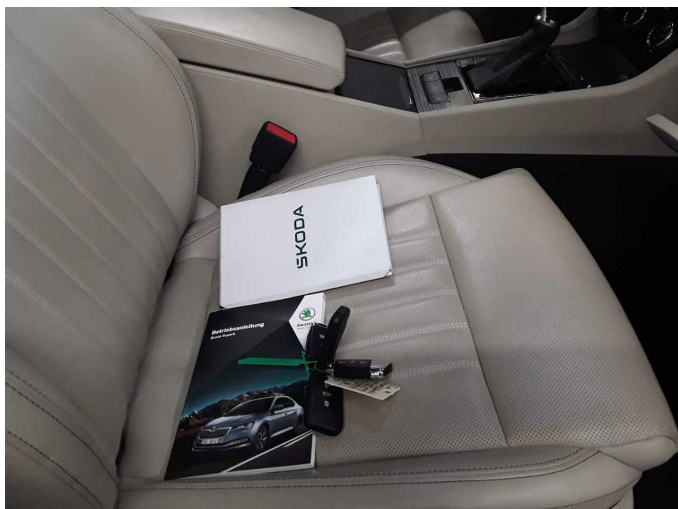


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

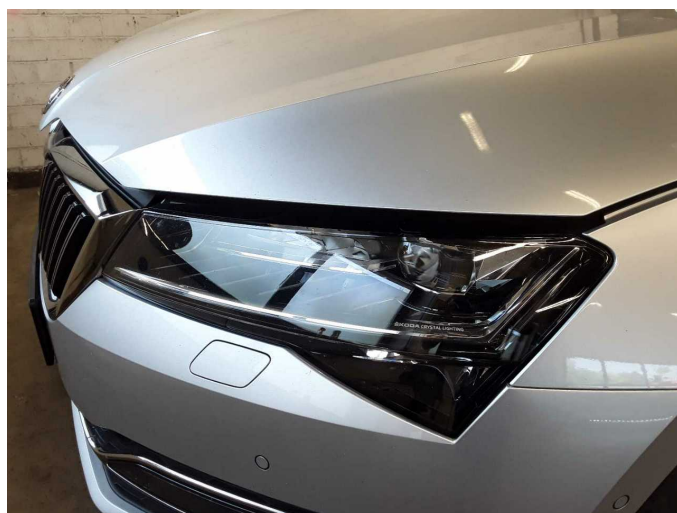


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

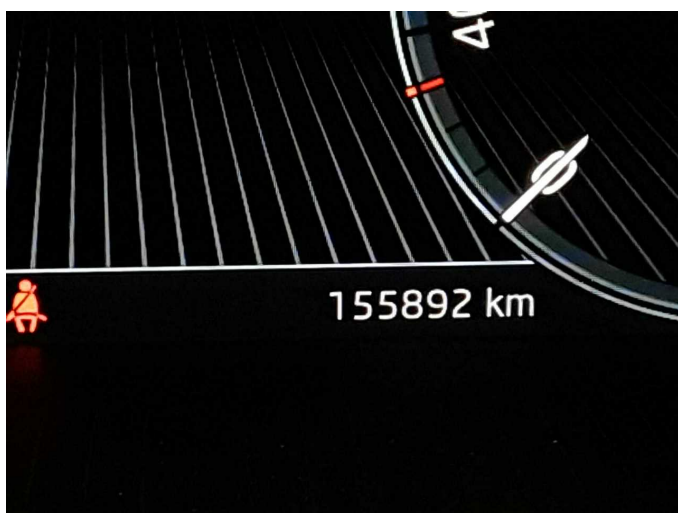


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Front bumper: Front bumper (in Unfallschaden berücksichtigt)
- Scratched - Paint




Damage 1: Front bumper: Front bumper (in Unfallschaden berücksichtigt)
- Scratched - Paint




Damage 1: Front bumper: Front bumper (in Unfallschaden berücksichtigt)
- Scratched - Paint



Damage 1: Front bumper: Front bumper (in Unfallschaden berücksichtigt)
- Scratched - Paint

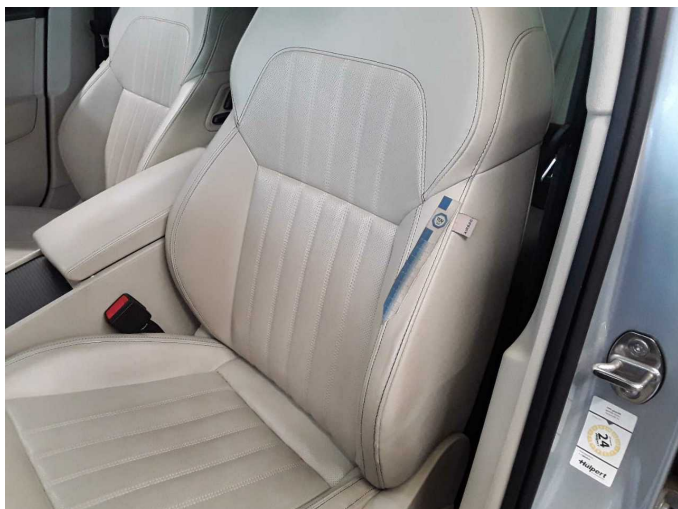

Damage 3: Seat - front: Backrest cover - left side - Scratch(es) - Smart repair

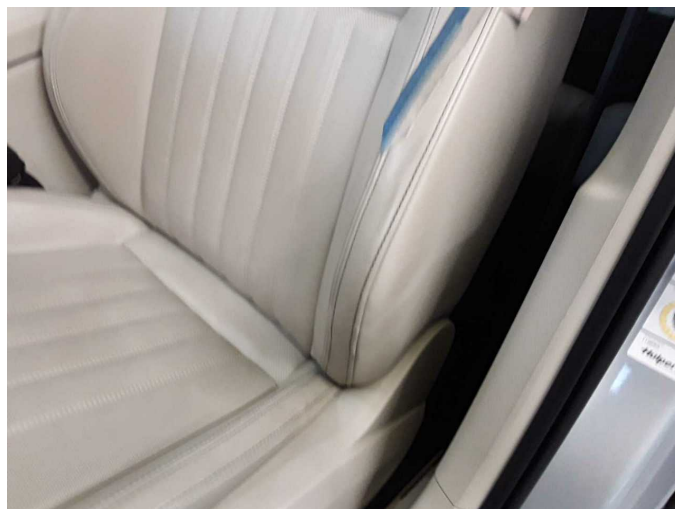

Damage 3: Seat - front: Backrest cover - left side - Scratch(es) - Smart repair



Damage 6: Interior: Interior (Hundehaare) - Soiled - Conditioning



Damage 6: Interior: Interior (Hundehaare) - Soiled - Conditioning



Damage 6: Interior: Interior (Hundehaare) - Soiled - Conditioning




Damage 6: Interior: Interior (Hundehaare) - Soiled - Conditioning



Damage 7: Body: Body - Glued / labelled - De-glue / neutralise



Damage 7: Body: Body - Glued / labelled - De-glue / neutralise

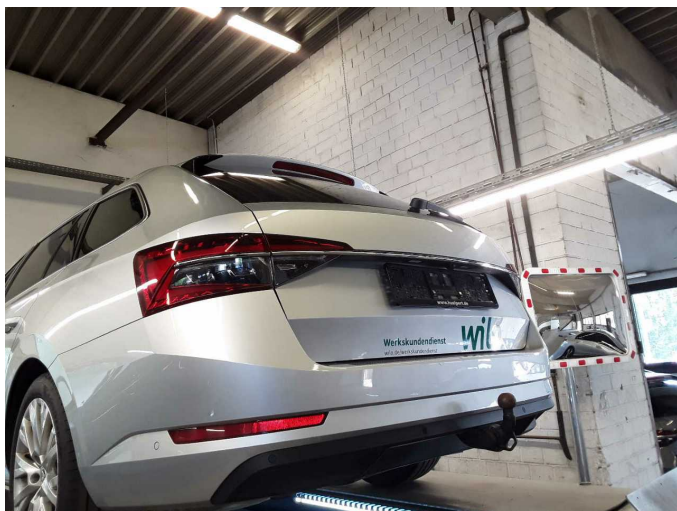

Damage 7: Body: Body - Glued / labelled - De-glue / neutralise



Damage 8: Wheel / tyres: Alloy rim - front left side - Scratched - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side - Scratched - Replace



Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace




Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint

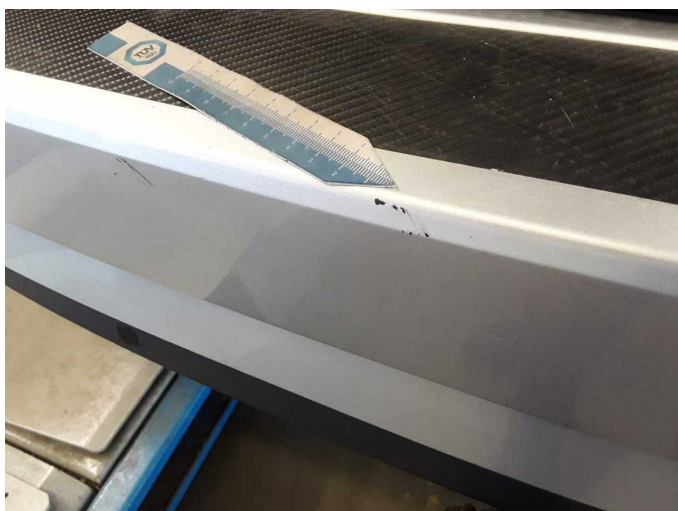

Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 11: Bonnet: Bonnet (Vermehrte steinschläge) - Stone chips - Paint

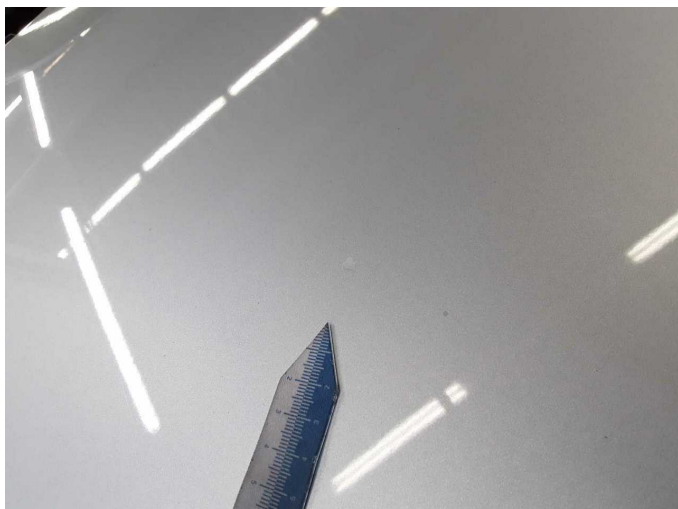

Damage 11: Bonnet: Bonnet (Vermehrte steinschläge) - Stone chips - Paint



Damage 11: Bonnet: Bonnet (Vermehrte steinschläge) - Stone chips - Paint

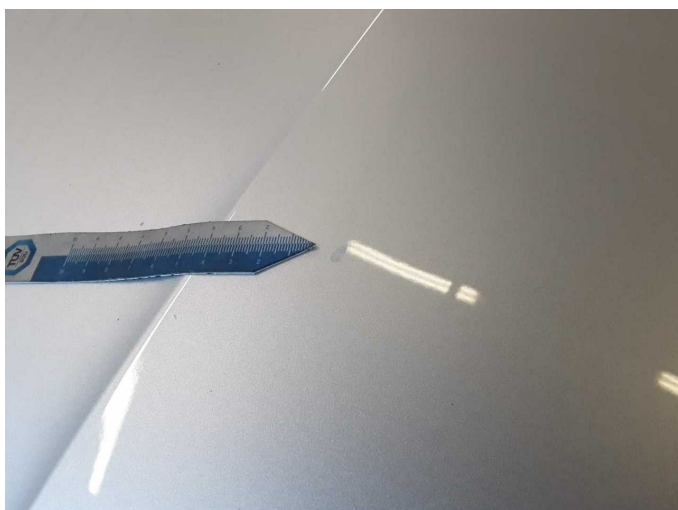

Damage 11: Bonnet: Bonnet (Vermehrte steinschläge) - Stone chips - Paint



Damage 11: Bonnet: Bonnet (Vermehrte steinschläge) - Stone chips - Paint



Damage 12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 13: Vehicle glazing: Windscreen - Broken / torn - Replace




Damage 13: Vehicle glazing: Windscreen - Broken / torn - Replace




Damage 13: Vehicle glazing: Windscreen - Broken / torn - Replace



Accident 1: Front, Side right

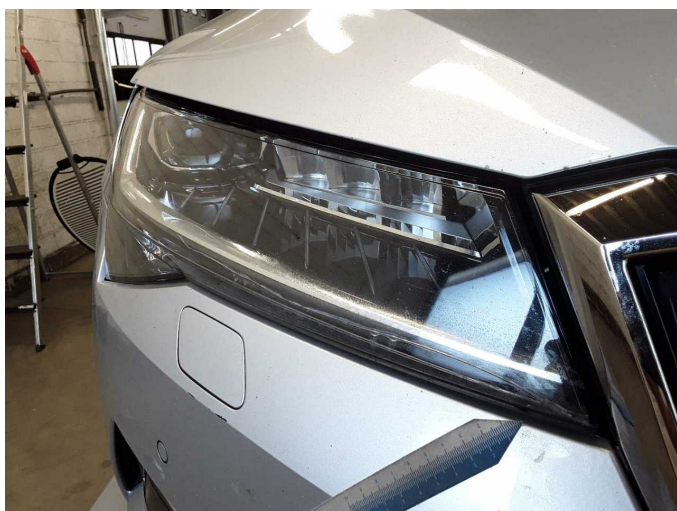

Accident 1: Front, Side right

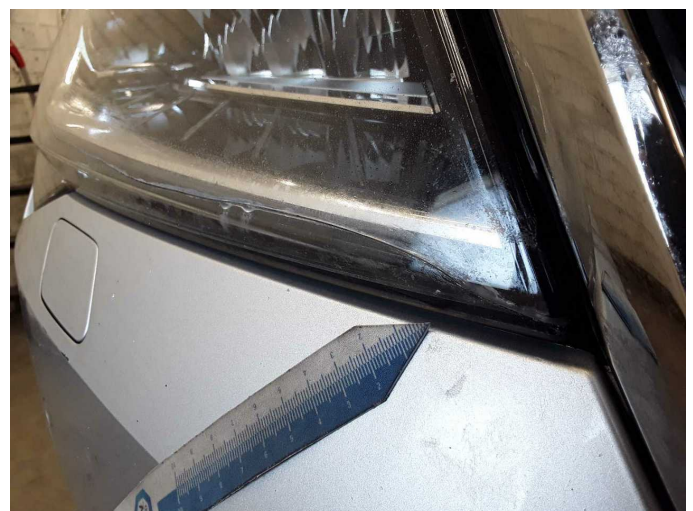

Accident 1: Front, Side right



Accident 1: Front, Side right




Accident 1: Front, Side right



Accident 1: Front, Side right




Accident 1: Front, Side right

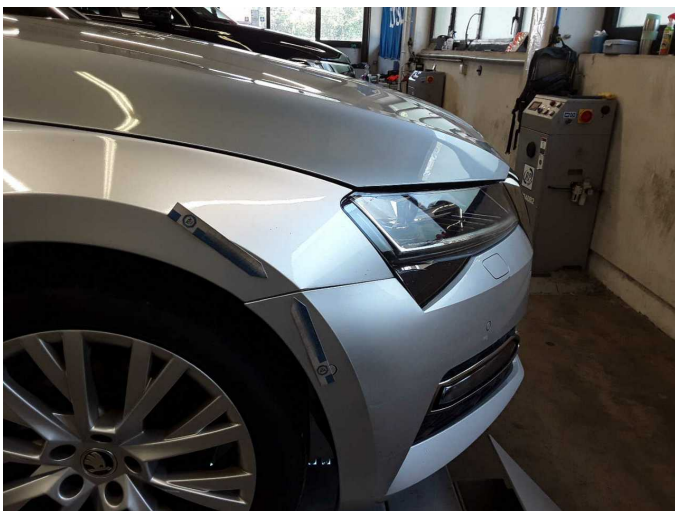

Accident 1: Front, Side right



Accident 1: Front, Side right

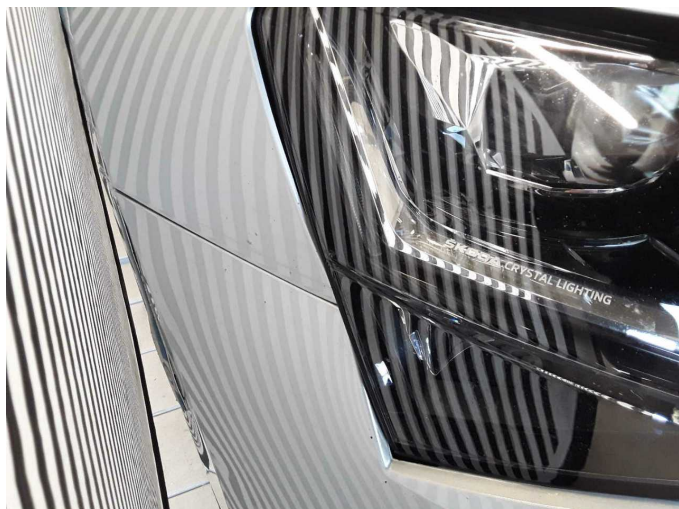

Accident 1: Front, Side right



Accident 1: Front, Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJR9NP7R7017810

Hersteller / Modell: SKODA SKODA Superb Combi 2.0 TDI DSG Style

Datum	KM-Stand	Beschreibung
21.04.2026	148.014	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.12.2025	127.710	Dieselpartikelfilter ern; Systemtest/Eigendiagnose
23.09.2025	118.167	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.03.2025	87.311	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.09.2024	57.158	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.04.2024	28.320	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges