

Expertise

Protocol number: 45529147
Order No. / Reference: 26359695
Inspection date: 20 May 2026

Manufacturer: Skoda

Model: Superb Combi 2.0 TDI DSG L&K

VIN: TMBJH8NZXSC049002



Vehicle details

Manufacturer / Type / Model / Equipment

Skoda Superb Combi 2.0 TDI DSG L&K

Vehicle Identification number TMBJH8NZXSC049002

Mileage (Read) 24,935 km

First registration 21 May 2025

Number of holders 1

Next periodical technical inspection 05/2028
(Report not on hand)

Power / Engine displacement 110 kw / 1,968 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 7

Type of drive Front drive

Type of vehicle Station wagon

Colour / colour code Cobalt Blue/Reef blue
(B5K)

Doors / Seats 5 / 5

Upholstery type Leather

Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	5,100 km
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HM643150
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AXZ 00070		
Emission standard	EURO6;WLTP;EA;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	2,241 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	215/55 R17 94H	Winter tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 94W	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/45 R18 94W	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18	Summer tyres on Steel		3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Mosolf SE & Co.KG
August-Horch-Straße 1
04519 Rackwitz



Equipment



Standard equipment

- Storage compartments in the front door panels with 1.5l bottle holders
- Airbag, driver and passenger
- Airbag: Side airbags, front center airbag and front and rear head airbags
- Anti-lock braking system (ABS)
- Attention and fatigue assistant
- Exterior mirrors and door handles in body color
- Cup holders in the front center console
- Hydraulic brake assist (HBA)
- Cargo elements in the trunk
- Grey headliner
- Digital Cockpit Plus
- Ice scraper in the fuel filler flap
- Electronic transverse differential lock (XDS+)
- Electric windows front and rear, including anti-pinch protection and electric child safety lock
- Transmission: 7-speed dual-clutch transmission (DSG)
- Heated rear window
- Interior LED lights at the front with 2 reading lights, 2 reading lights at the rear
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Front headrests, height and length adjustable
- LED footwell lighting front and rear
- electric auxiliary air heater
- Engine drag torque control (MSR)
- Multifunctional camera (for driver assistance systems)
- eCall+ emergency call function
- Package: Drive Plus
- Package: Infotainment
- Package: Transport (Combi)
- Front and rear parking sensors with maneuvering brake function
- Radio accessories: 2 USB charging ports in the center console
- Radio accessories: Digital radio reception DAB+
- Radio accessories: USB charging port in the rearview mirror (15W)
- Umbrella and broom compartments in the front doors
- Tire pressure monitoring
- Rear view camera
- Superb seat belts
- Seats: Heated front seats
- Seats: Rear seat backrest split 60:40, foldable with center armrest
- Sun visors with illuminated make-up mirror on driver and passenger side
- Daytime running lights with cornering lights and coming home function
- Glazing: Acoustic glazing in the front side windows and Sunset
- Electronic immobilizer
- Storage pockets on the backs of the front seats including smartphone pockets
- Airbag, driver's knee airbag
- Ambient lighting
- Trailer hitch preparation including trailer stabilization
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors, with boarding lights
- Hill start assist
- third brake light
- roof grab handles four
- Diesel particulate filter
- Digital rotary controls (Smart Dials)
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Luggage compartment lighting with 2 lamps
- Cruise control system including speed limiter (speed limiter)
- Rear window wiper including windshield washer system
- Interior mirror automatically dimming
- Interior Design Selection Suite L&K Black
- Climatronic air conditioning (3-zone)
- Rear headrests (3), height adjustable
- Stainless steel loading edge
- Remote release of the rear seat backrests in the trunk
- Center armrest with storage compartment and 12-volt socket
- Multi-collision brake
- Package: Chrome (Combi)
- Package: EU-NCAP
- Package: Light & Visibility
- Package: Winter
- Phone box with charging function 15 W
- Proactive occupant protection with rear impact detection
- Radio accessories: Bluetooth hands-free system
- Radio accessories: CANTON sound system with 14 speakers
- Radio accessories: Wireless & Wired SmartLink
- Umbrella
- Rain sensor and driving light assistant
- Wheels: 18" Belatrix alloy wheels, diamond-turned anthracite (8Jx18 tires 235/45 R18 94)
- LED safety lights in the front and rear doors
- Seats: Ergo Comfort front seats
- SKODA Care Connect
- SKODA Infotainment Online
- 12V power outlet in the luggage compartment
- Sunset (rear window and rear side windows tinted dark)
- Textile floor mats
- Front door sill trims
- Lashing eyes in the luggage compartment
- Preparation for alcohol immobilizer
- Central locking accessories: 3rd vehicle key



Extra equipment

- Swiveling trailer hitch including trailer stabilization
- Paint finish: Metallic
- Package: Infotainment Plus (Navigation system - 13" infotainment display - Display cleaner - Head-up display - Infotainment Online (3-year subscription))
- Auxiliary heater with radio remote control
- Variable double floor including anchoring eyelet for loading floor, organizer
- Luggage net partition
- Package: Driving Assistance Plus (Travel Assist Plus: - Adaptive Cruise Control ACC (control range up to 210 km/h, cruise control system omitted) - Adaptive Lane Keeping Assist (Lane Assist +) - Traffic Jam and Emergency Assist - Intelligent Park Assist, front and rear parking sensors - Trained Park Assist - Remote Park Assist - 360° Area View cameras)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Roof rail - left side - Scratch(es) - Smart repair
2	2nd wheel set	1 alloy rim - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front right side - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

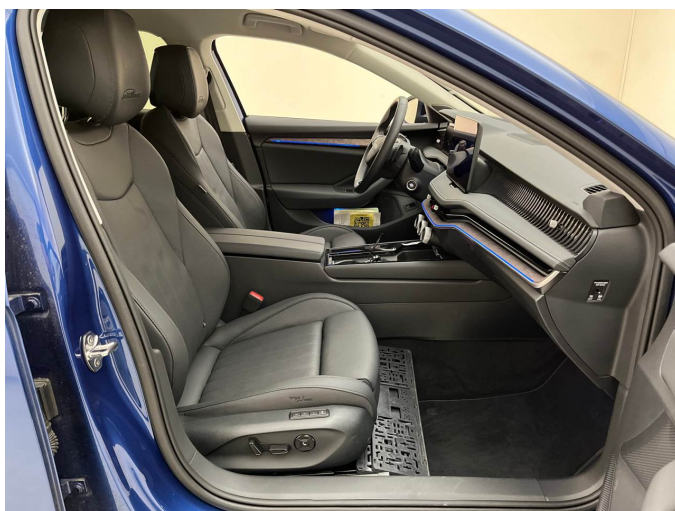


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

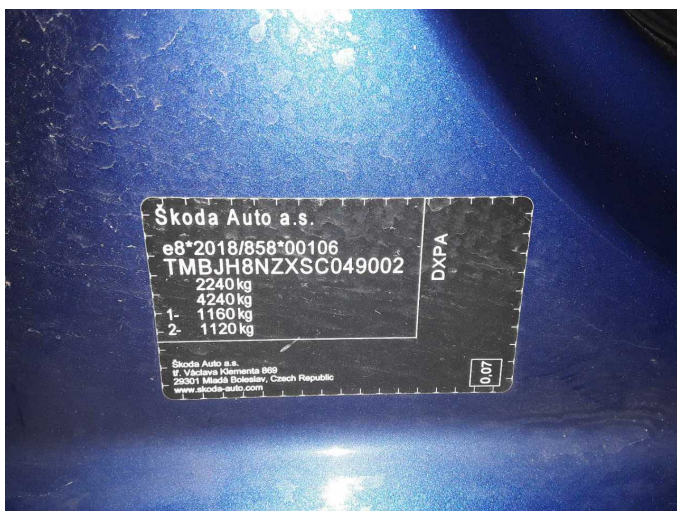


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

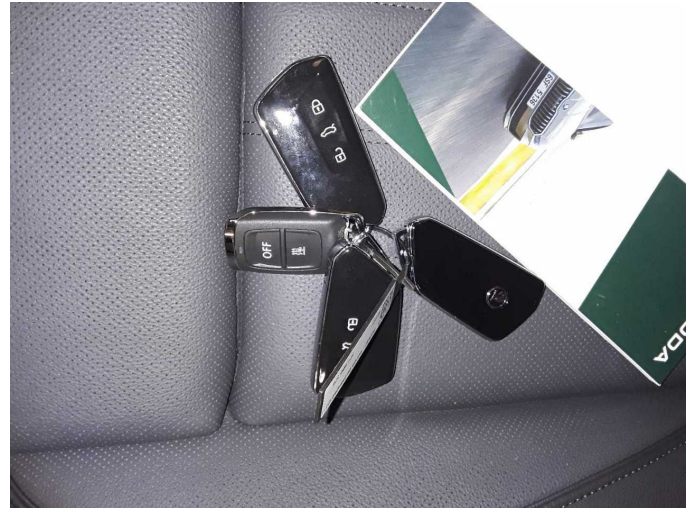


Figure 14: Documents

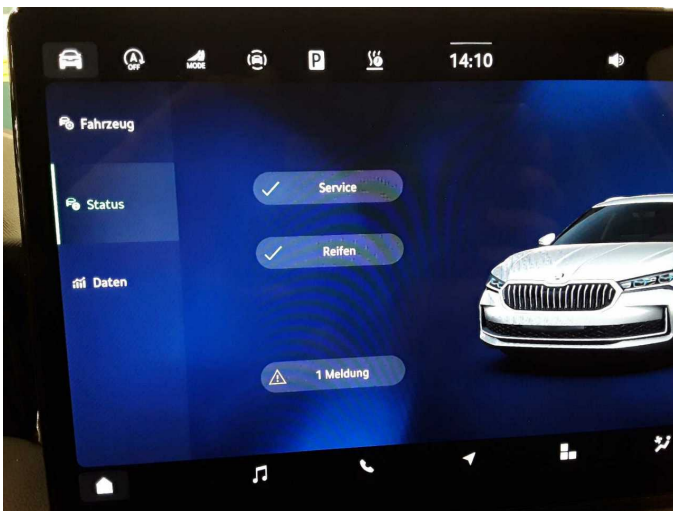


Figure 15: Documents

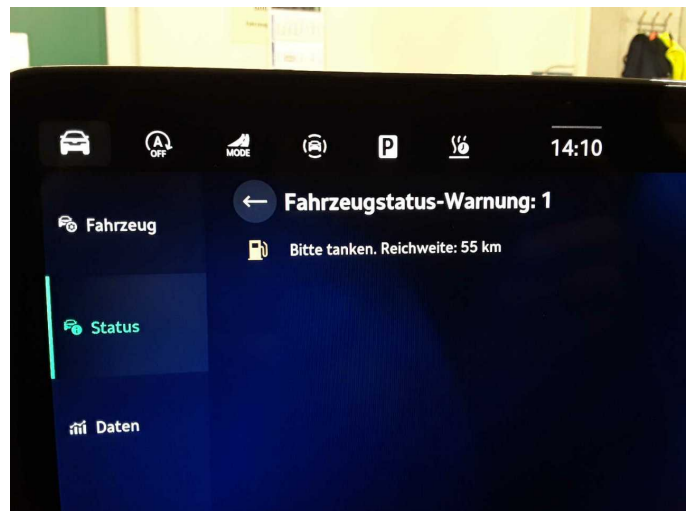


Figure 16: Documents

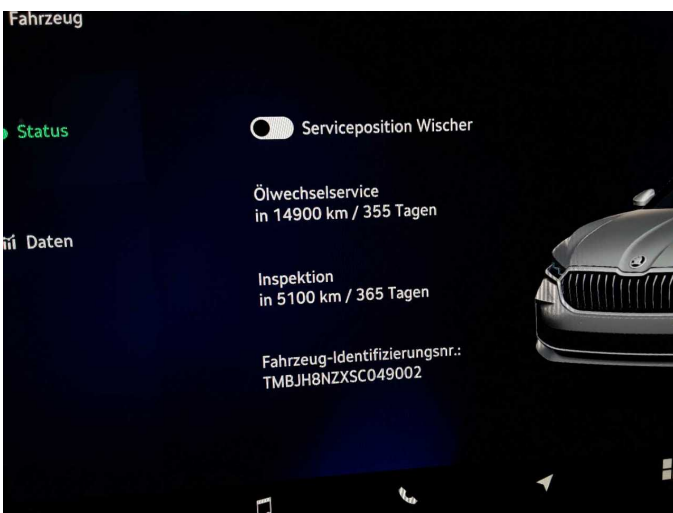


Figure 17: Documents

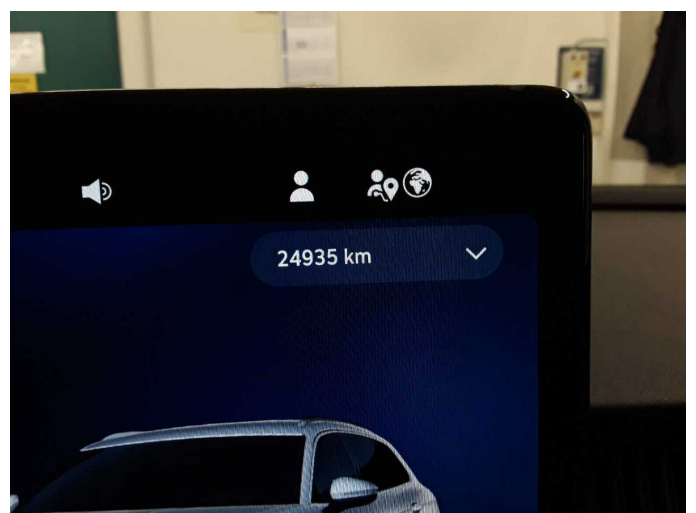


Figure 18: Documents

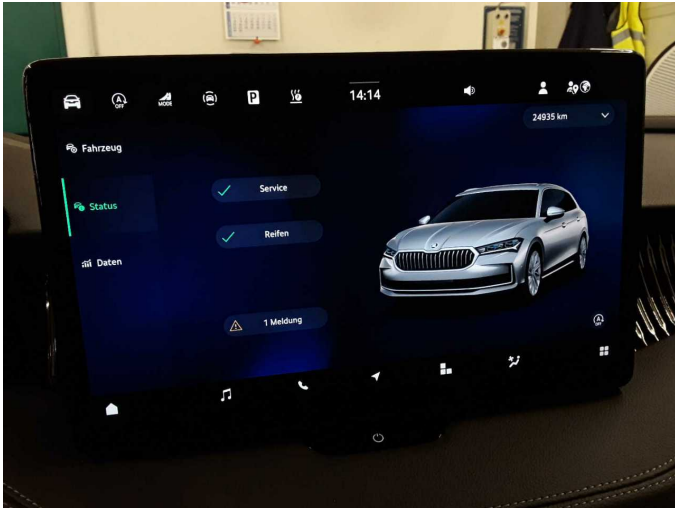


Figure 19: Documents



Figure 20: Documents



Figure 21: Additional tyres

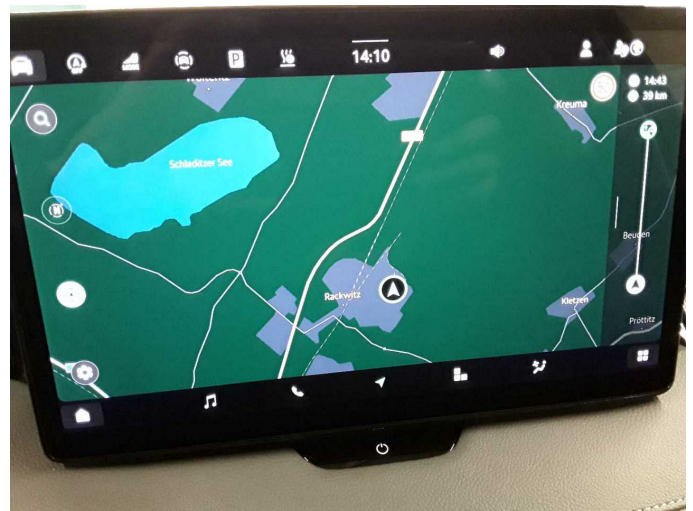


Figure 22: Navigation



Figure 23: Misc.

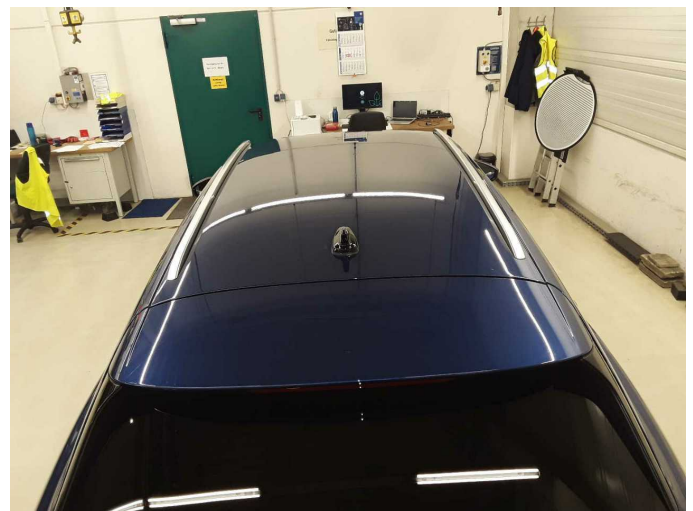


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

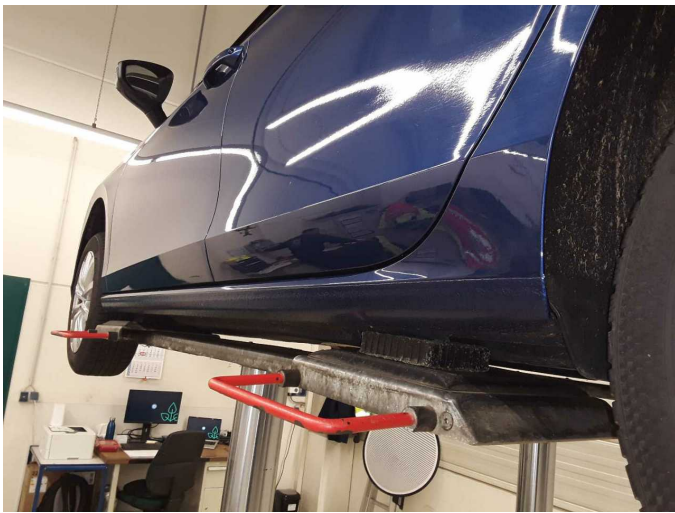


Figure 27: Misc.



Figure 28: Misc.

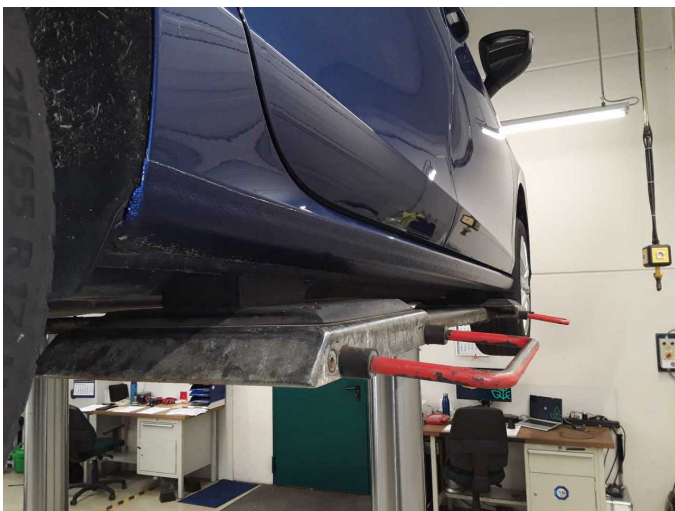


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Damage 1: Roof: Roof rail - left side - Scratch(es) - Smart repair



Damage 1: Roof: Roof rail - left side - Scratch(es) - Smart repair



Damage 1: Roof: Roof rail - left side - Scratch(es) - Smart repair



Damage 2: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 2: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 2: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 2: 2nd wheel set: 1 alloy rim - Scratched - Replace



Wear and tear 1: Wheel / tyres: Alloy rim - front right side - Scratched - No deduction



Wear and tear 1: Wheel / tyres: Alloy rim - front right side - Scratched - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJH8NZXSC049002

Hersteller / Modell: SKODA SKODA Superb Combi 2.0 TDI DSG L&K

Datum	KM-Stand	Beschreibung
11.03.2026	22.326	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges