



RENAULT Clio: 6000-KRH

Vinnumber:	VF1R9800961563027	Versionname:	Sport Tou. Limited En. TCe 66kW (90CV) familiar
First Registrationdate:	31/10/2018	Fiscalpower:	66kW 5P manual
Expertise Mileage:	96417	Power Kw:	
Bodytype:	Berline	Body colour	White
Gearbox:	MAN 5 VIT	Type of rims (mounted)	Aluminium
Transmission:			
Fueltype:	Petrol		
Engine functioning	Yes		
Battery functioning	Yes		
Vehicle running	Yes		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	1	Luggage cover
Number keys remote	1	Roof bar alu
GPS big screen color		
Windows electric F		
Steering wheel multifunctional		
Steering wheel leather		
Type of climate control	Manual climate control	

Tyres

	195/55/16/87 V			
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm
Tyre profile depth FL	4.0			
Tyre profile depth FR	4.0			
Tyre profile depth RL	4.0			
Tyre profile depth RR	4.0			
Tyre size FL	195/55 R 16 87 V			
Tyre size FR	195/55 R 16 87 V			
Tyre size RL	195/55 R 16 87 V			
Tyre size RR	195/55 R 16 87 V			
Tyre type FL	Summer			
Tyre type FR	Summer			
Tyre type RL	Summer			
Tyre type RR	Summer			
Tyre make FL	259			
Tyre make FR	259			
Tyre make RL	259			
Tyre make RR	259			

Assistance equipment

Repair kit	Yes
------------	------------

Ignition key, Missing, Repair/replace (lump sum)



Malfunction indicator, Blinking, Check



Boot lid covering R, Scratch(es), Replace




Boot lid covering R, Scratch(es), Replace



Boot lid covering R, Scratch(es), Replace



Roof liner, Hole, Replace

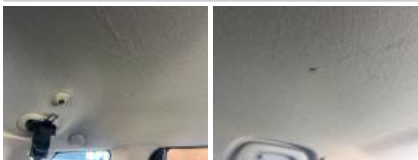


Door panel RR, Scratch(es), Replace



Door panel FR, Scratch(es), Replace




Boot lid covering R, Scratch(es), Replace

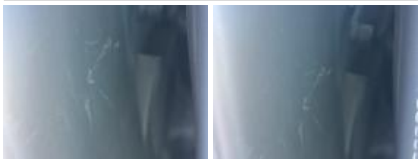

Centre console, Scratch(es), Replace



Wing RL, Scratch(es), Repair and paint (complete)

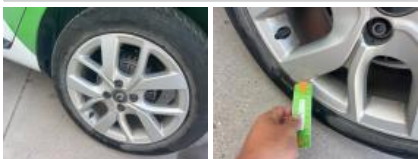

Door FL, Scratch(es), Repair and paint (complete)



Alloy rim FL, Scratch(es), Repair/replace (lump sum)



Wing FL, Scratch(es), Repair and paint (complete)




Bumper F, Scratch(es), Repair and paint (complete)




Door FR, Scratch(es), Repair and paint (complete)



Rear light R, Broken, Replace

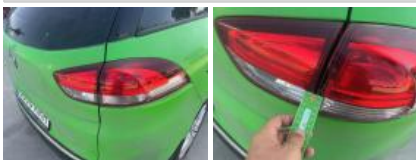

Bumper R, Scratch(es), Repair and paint (complete)

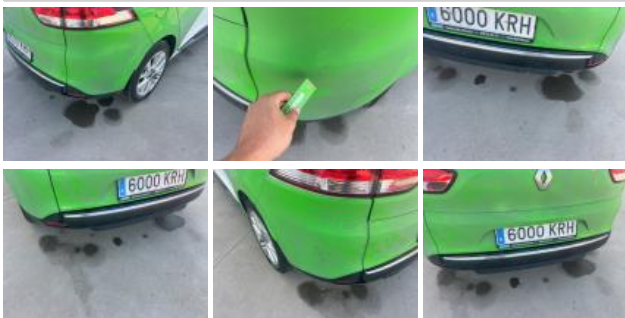


Tailgate / Boot, Scratch(es), Repair and paint (complete)



Tyres, No damage, Check



Bodywork, Glue residues, Remove lettering

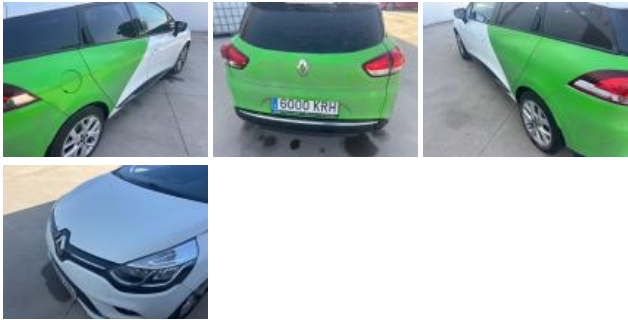

Datos del vehículo

Marca

Modelo

Versión

Matrícula

VIN

Histórico

Fecha	Descripción	Kilómetros	Taller

Datos del vehículo

Marca

Modelo

Versión

Matrícula

VIN

Histórico

Fecha	Descripción	Kilómetros	Taller