



Expertise

Protocol number: 45919539
Order No. / Reference: 26570777
Inspection date: 11 Jun 2026

Manufacturer: Mercedes-Benz

Model: GLB 200 7G-DCT Progressive Advanced

VIN: W1N4M8HB2RW349450



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 200 7G-DCT Progressive Advanced	
Vehicle Identification number	W1N4M8HB2RW349450
Mileage (Read)	44,310 km
First registration	8 Feb 2024
Number of holders	1
Power / Engine displacement	120 kw / 1,332 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	POLARWEISS - UNILACK
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	288 Tag(e)
Last service on / at	03/2026 at 43,971 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY582860
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BPA 00017		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,140 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100W	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/55 R18 100W	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

Standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Storage compartment in center console with roller blind • Airbag for driver and front passenger • Airbag: Side airbag for driver and front passenger • Active Brake Assist • Anti-lock braking system (ABS) • ATTENTION ASSIST • Heated exterior mirrors (left and right), electrically adjustable from inside • Chrome trim strip • Double cup holder • Third brake light in LED technology • EASY-PACK tailgate • Door sills with "Mercedes-Benz" lettering • Chassis: Comfort chassis • Velour floor mats • Speed Limit Assistant • Rear window heated • rear window wiper • Climate: THERMATIC automatic climate control • Headrests (2) • Rear headrests (3) • Cargo area cover (roller blind) • Steering wheel: Multifunction sports steering wheel in leather • Mercedes-Benz emergency call system • Navigation accessories: Extended MBUX functions • Package: Light and Visibility Package • Package: Seating comfort • Package: USB Package Plus • Radio accessories: Digital radio • Wheels: 45.7 cm (18") light alloy wheels in a 5-twin-spoke design • Side panels in black grained finish with chrome insert • Seats: 4-way lumbar support for driver and front passenger • Seats: Comfort seats • 12V power outlet in center console • Front and rear underride protection • High-visibility vest for drivers • Decorative elements Star Pattern | <ul style="list-style-type: none"> • Adaptive Highbeam Assist • Airbag: Kneebag for driver • Airbag: Windowbags • Active Lane Keeping Assist • Rear armrest • Automatic passenger airbag deactivation • Basic services • On-board computer • Roof rails in polished aluminum • Tachometer • DYNAMIC SELECT • ECO start/stop function • Electronic Stability Program (ESP) • Electric window regulators (4) • Luggage net on driver and passenger seatbacks • Transmission: 7G-DCT dual-clutch automatic transmission, 7-speed • Black fabric headliner • Communication module (LTE) for the use of Mercedes me connect services • Paint finish: Solid • LED High Performance Headlights • Steering column mechanically adjustable lengthwise and heightwise. • Hood with power domes • Otto particulate filter • Package: Progressive Line Advanced • Package: Mirror Package • Upholstery: ARTICO leatherette/fabric • Tire pressure monitoring system (TPMS) • Rear view camera • Windscreen wipers with rain sensor • Power steering • Seats: Rear seat backrests foldable • Seats: Rear seat backrests foldable • Cruise control • Pre-installation for digital key handover • Immobiliser |
|---|---|



Extra equipment

- Active Distance Assist DISTRONIC (radar sensor in the radiator grille
 - automatically acting assistance system - active up to a speed of 160 km/h - visual and acoustic warning if you as the driver need to intervene - depending on the driving program, the vehicle accelerates faster or slower to the desired speed - detected speed limits can be conveniently adopted by pressing a button on the steering wheel (only in conjunction with Traffic Sign Assist or Speed Limit Assist))
- Active Parking Assist
- Towbar with ESP trailer stabilization
- Paint finish: Special paint finish, solid color
- Wheels: 45.7 cm (18") light alloy wheels in a 5-twin-spoke design, painted tremolite grey
- Wheels: Complete summer wheel sets fitted at the factory
- Wheels: Winter complete set LM 5-DpSp.Des. 17" 4R9
- Type designation removed from luggage compartment lid
- Heat-insulating dark tinted glass

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - rear right side	Door - Scratch(es) - Cover / polish
2	Door - rear left side	Door - dent(s) - Smooth repair work
3	2nd wheel set	1 alloy rim - Scratched - Loss in value
4	Rear bumper	Rear bumper - Scratch(es) - Smart repair

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres

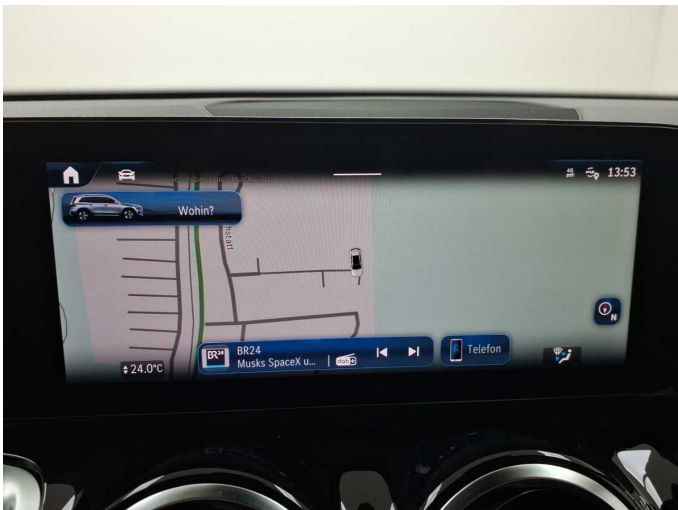


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

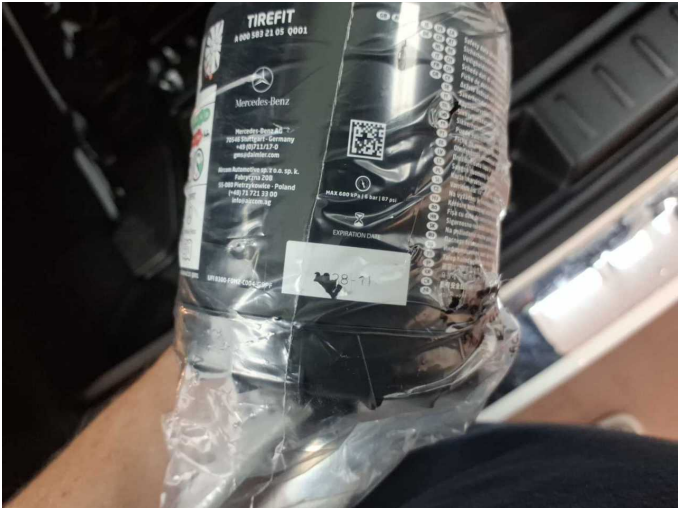


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.



Damage 1: Door - rear right side: Door - Scratch(es) - Cover / polish



Damage 1: Door - rear right side: Door - Scratch(es) - Cover / polish

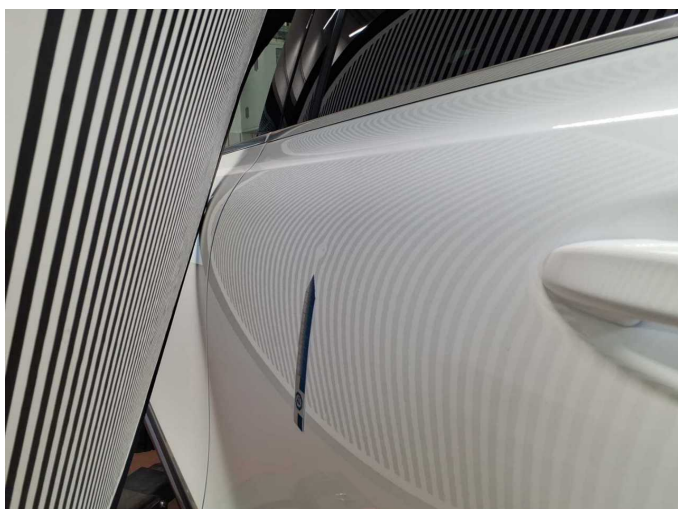

Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work




Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value

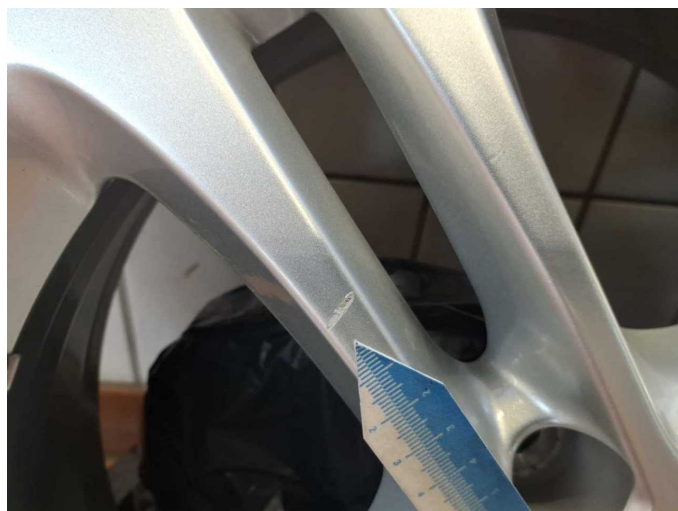

Damage 3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N4M8HB2RW349450

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLB 200 7G-DCT
Progressive Advanced

Datum	KM-Stand	Beschreibung
25.03.2026	43.971	Regelwartungsdienst
27.03.2025	23.534	Regelwartungsdienst