



Expertise

Protocol number: 46465947
Order No. / Reference: 26638452
Inspection date: 10 Jul 2026

Manufacturer: Skoda
VIN: TMBLJ7NU8P5067702

Model: Karoq 2.0 TDI SCR 4x4 DSG Tour



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Karoq 2.0 TDI SCR 4x4 DSG Tour	
Vehicle Identification number	TMBLJ7NU8P5067702
Mileage (Read)	140,684 km
First registration	17 Jan 2024
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Brilliant Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	Yes (not ozone-treated)



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,400 km
Last service on / at	03/2026 at 130,451 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT119671
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ASQ 04531		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,180 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	225/55 R17 101Y	Summer tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, high-visibility vest compartment in the front doors, glasses compartment in the headliner, storage compartments in the front door panels with 1.5l bottle holders, cup holders in the front center console)
- Allergen filter
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Illuminated trunk
- Hydraulic brake assist (HBA)
- Grey headliner
- Roof rails, black
- Anti-theft alarm system (with SAFE system, interior monitoring and tilt sensor)
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor ((tunnel light, coming and leaving home function))
- Front radar assistant including city emergency braking function with pedestrian detection
- Cruise control
- Tinted windows
- Heated rear window
- Rear window wiper/washer system
- ISOFIX preparation on the outer rear seats (including top tether)
- Paint finish: Solid
- LED brake light in the rear spoiler
- LED headlights with daytime running lights
- LED taillights in crystal glass look (and animated turn signals)
- LED headlights with daytime running lights
- Steering wheel: Heated sports leather steering wheel (DSG) with multifunction buttons (including paddle shifters)
- Rear center armrest with cup holders and pass-through option
- Multi-collision brake
- Package: Infotainment package Bolero (Bolero music system - Capacitive 8" color display - Digital Cockpit Plus - Wireless SmartLink - Voice control)
- Package: Winter PLUS (Heated front and outer rear seats - Heated windshield washer nozzles - Headlight cleaning system - Heated windshield)
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink (Android Auto and Apple CarPlay)
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- front aero windshield wipers
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Permanent all-wheel drive
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Exterior mirrors and door handles painted in body color
- Hill start assist
- Care Connect: Proactive services (10-year term) (Remote Access (1-year term))
- Decorative inlay TOUR
- Diesel particulate filter
- Digital Cockpit Plus (10")
- eCall (automatic emergency call function in case of an accident with airbag deployment)
- ESC Electronic Stability Control
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Floor mats
- Closed storage compartment on the dashboard
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (start/stop system and brake energy recuperation)
- Automatic interior mirror dimming
- Trunk cover, fixed
- Front and rear headrests are height-adjustable.
- LED ambient lighting (decorative strips in the door panels with selectable color climate, LED reading lights in the front, LED lighting for the make-up mirrors in the sun visors)
- LED fog lights
- Steering wheel: Heated steering wheel (leather steering wheel with multifunction buttons including paddle shifters)
- Reading lights at the front of the headliner
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Fatigue detection
- Package: Comfort PLUS (Adjustable lumbar support in the front seats - Climatronic air conditioning (2-zone) - Sunset - Kessy)
- Rear parking sensors
- Upholstery: Cloth
- Wheel arch cover (front and rear, made of plastic, black textured)
- Radio accessories: USB port in the center console (Type-C)
- Tire mobility kit (tire repair spray incl. compressor)
- Wheels: 17" Scutus alloy wheels in grey metallic with matte black aerodynamic trim (4x4) (wheels 7J x 17, ET 45 - tires 225/55 R17 97V)



- Gear shift indicator
- Electromechanical power steering
- Seats: Adjustable lumbar support in the front seats
- Seats: Height-adjustable front seats
- Skoda Care Connect (SOS emergency call function (eCall, including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection for rapid assistance in case of breakdown) - Information service (connection to the hotline for all questions regarding vehicle functions) - Free remote vehicle access for one year with access to vehicle data/functions via smartphone, e.g., parking position, activating hazard warning lights, current fuel level, etc.)

- Seat belts (Height-adjustable three-point seat belts in the front - Three three-point seat belts in the rear - Seat belt reminder indicators on the front and rear seats)
- Sun visor on driver and passenger side with illuminated vanity mirror
- Speed limiter
- 12V socket - in the trunk
- 12V socket - in the center console
- Bumpers partially painted in body color
- Lashing eyes in the trunk
- Immobiliser
- Central locking with remote control

Extra equipment

- Paint finish: Metallic
- Package: Parking BASIC (front and rear parking sensors - reversing camera)
- Auxiliary heating
- Preparation for a trailer hitch (including trailer stabilization)

- Package: Amundsen Infotainment Package (Amundsen Dynamic Radio Navigation System - 8" Capacitive Color Display - Digital Cockpit Plus - Wireless SmartLink - Voice Control - Phonebox with inductive charging function (connection via external antenna) - Infotainment Online (3-year term) - Mapcare navigation data update)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door edge - Scratch(es) - Smart repair
2	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
3	Interior	Interior (Zigaretten) - Odour - Ozone treatment
4	Body	Underbody panelling - Broken / torn - Replace
5	Rear bumper	Rear bumper - Scratch(es) - Paint
6	Front bumper	Front bumper - Stone chips - Paint
7	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
8	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
2	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
3	Roof	Roof rail - right side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der montierte Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

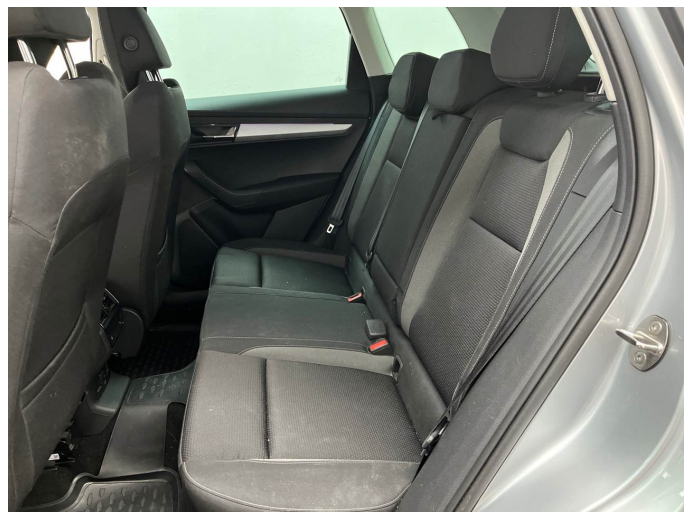


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

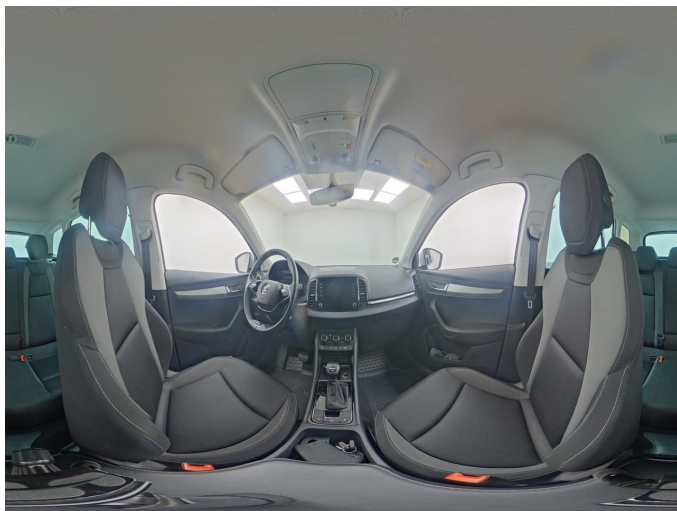


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

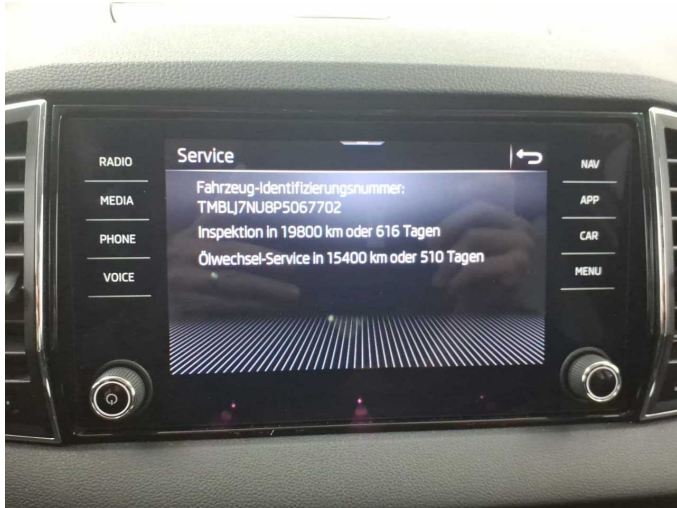


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

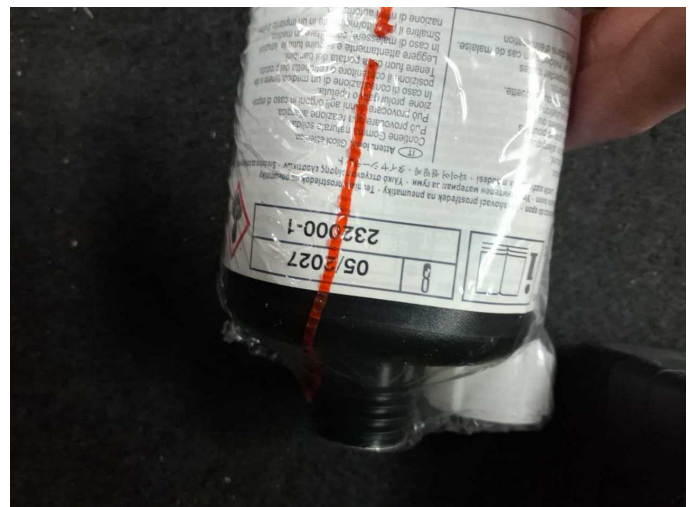


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Damage 1: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front right side: Door edge - Scratch(es) - Smart repair

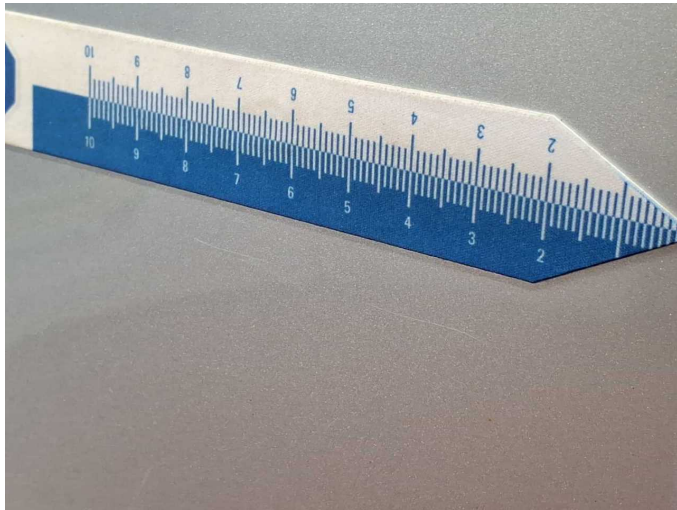

Damage 2: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 2: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 4: Body: Underbody panelling - Broken / torn - Replace



Damage 4: Body: Underbody panelling - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper - Stone chips - Paint



Damage 6: Front bumper: Front bumper - Stone chips - Paint



Damage 6: Front bumper: Front bumper - Stone chips - Paint



Damage 6: Front bumper: Front bumper - Stone chips - Paint



Damage 6: Front bumper: Front bumper - Stone chips - Paint



Damage 6: Front bumper: Front bumper - Stone chips - Paint



Damage 6: Front bumper: Front bumper - Stone chips - Paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 8: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 8: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 8: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

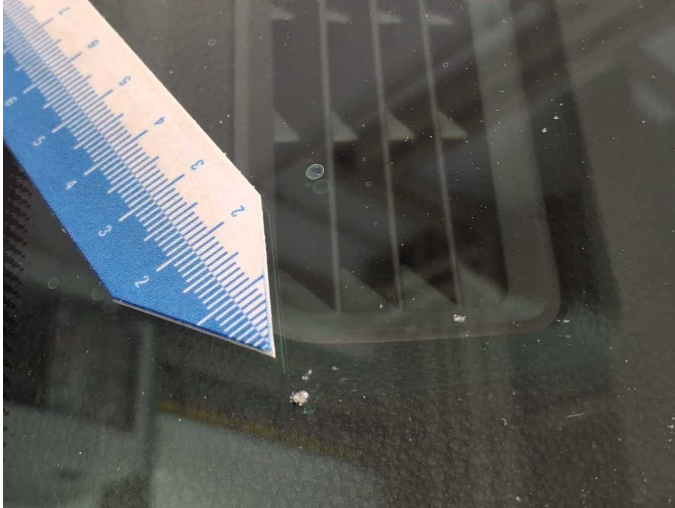

Damage 8: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 8: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 8: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Wear and tear 2: Boot lid / rear door: Boot lid - Scratch(es) - No deduction



Wear and tear 2: Boot lid / rear door: Boot lid - Scratch(es) - No deduction



Wear and tear 3: Roof: Roof rail - right side - Stone chips - No deduction



Wear and tear 3: Roof: Roof rail - right side - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLJ7NU8P5067702
Hersteller / Modell: SKODA SKODA Karoq 2.0 TDI SCR 4x4 DSG Tour

Datum	KM-Stand	Beschreibung
18.03.2026	130.451	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/ prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
10.06.2025	87.337	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
17.01.2025	58.566	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Motoröl b. Wartung; Regelwartungsdienst; Wartung Sonstiges
15.07.2024	30.999	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges