



Expertise

Protocol number: 46838146
Order No. / Reference: 26830504
Inspection date: 31 Jul 2026

Manufacturer: Opel	Model: Insignia Sports Tourer 2.0 Diesel Aut. Business
VIN: W0VZT8GP4N1046759	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Aut. Business	
Vehicle Identification number	W0VZT8GP4N1046759
Mileage (Read)	102,983 km
First registration	10 Feb 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	128 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Diamant Schwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	24 %
Last service on / at	10/2025 at 84,453 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ354995
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMC 00298		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,215 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97Y	Summer tyres on Light alloy	Continental	7mm / 7mm
2)	225/55 R17 97Y	Summer tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Automatic climate control, two zones
- Decorative strip hexagon
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Glasses compartment in the headliner
- Illuminated makeup mirrors in both sun visors
- LED fog lights
- Luggage compartment cover (extendable with comfort operation)
- Package: Winter 1 (Heated seats, multi-stage, driver and front passenger - Heated leather steering wheel - Heated ThermoTec windshield)
- Power steering (speed-dependent)
- Quickheat rapid heating system
- Radio: Multimedia Navi Pro with 8" color touchscreen display (voice control for audio, telephone and navigation, USB port, Bluetooth audio streaming, navigation system with SD card storage, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, steering wheel controls, Apple CarPlay and Android Auto)
- Rear headrests (3 pieces) (height adjustable)
- rear window wiper
- Safety net (for installation behind the 1st or 2nd row of seats)
- Seats: Ergonomic active seat (AGR) driver (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - headrest, height and tilt adjustable)
- Start/Stop system (reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function)
- Steering column adjustable for height and reach
- Storage compartments (storage compartment in the center console, pockets in the front doors suitable for 1.5-liter beverage bottles, pockets in the rear doors suitable for 1-liter beverage bottles, cup holder in the center console, illuminated glove compartment)
- Tachometer
- Traffic sign assistant (recognition of speed limits, no-overtaking zones and their cancellation, additional information signs (e.g., for wet conditions, slippery surfaces, left/right directions) on standard traffic signs, beginning and end of motorways, expressways and traffic-calmed areas, display of the recognized sign in the driver information display (depending on traffic sign quality, visibility and weather conditions).)
- Transmission: 8-speed automatic transmission
- Visibility equipment (rain sensor, front)
- Adaptive brake light
- Airbag: Front and rear outer head airbags
- Airbag: Front and side airbags, driver and front passenger (front and side airbag, passenger, deactivatable)
- Ambient lighting (dashboard and doors (front))
- Back window, heater
- Bumpers painted in body color
- Center armrest, front
- Central locking with remote control (and interior switches)
- Child safety lock in the rear doors, manual
- Diesel particulate filter
- Electric parking brake (including 12-volt socket)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable)
- Electronic brake force distribution (EBD)
- Front headrests (height adjustable)
- Hill Start Assist
- Immobiliser
- Lane Keeping Assist (warning in case of unintentional lane departure (between 60 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- LED daytime running lights including LED indicators, front and LED taillights
- LED headlights (automatic headlight range control)
- Noise-reducing, laminated front side windows
- Parkpilot, front and rear parking aid
- Pedestrian protection including active hood
- Pre-installation for child seat mounting system "ISOFIX" (rear)
- Radio: Digital radio reception DAB+
- Rear seat backrest folds forward in a 60:40 split
- Roof rails, silver anodized
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Speed controller
- Thermal insulation glazing, green tinted
- third brake light
- Tire pressure display (with tire pressure warning - direct system with automatic calibration after wheel change)
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Upholstery: Billy fabric, black
- Wheels: Alloy wheels 7.5 J x 17 in 5 twin-spoke design (tires 225/55 R 17)



Extra equipment

- Package: Business Premium (Easy Access Package: Keyless locking and starting system, sensor-controlled tailgate, electric loading sill protection, stainless steel - Charging Package: Wireless charging, 2 USB ports, rear center console - Park & Go: Digital reversing camera, reversing assistant, lane change assistant, blind spot warning in both exterior mirrors - Innovation Package 1: IntelliLux LED Pixel headlights, traffic sign assistant - Solar Protect heat-insulating glass, heavily tinted, in the rear)
- Paint finish: Metallic
- Swiveling trailer hitch (including trailer stability program)
- Wheels: Additional set of 17" alloy winter wheels SFP
- Package: Innovations 2 (automatic transmission) (Head-up display - Adaptive cruise control (Generation 3), Stop & Go function - Forward collision warning with pedestrian detection and automatic emergency braking, active from 4 km/h, range 150 m. In case of risk of collision, the braking system is prepared and, if necessary, emergency braking / automatic emergency braking is initiated - Traffic sign recognition)
- Upholstery: Alcantara trim, black including Winter Package 3 (Active Seat (AGR), front (length, height, backrest angle manual, seat angle electrically adjustable, lumbar support electro-pneumatic), Alcantara/ leatherette, side airbags, rear center armrest, rear cup holders and pass-through, rear seat with FlexFold, 40:20:40 split-folding, heated front/rear seats, heated leather steering wheel, heated ThermoTec windscreen, Seat Comfort Package 1 (driver's seat 8-way electrically adjustable, memory function for driver's seat and exterior mirrors, massage function for driver, exterior mirrors with ambient lighting, electrically adjustable, heated and folding), Charging Package (wireless charging, USB)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Rear spoiler - Scratch(es) - Smart repair
2	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
3	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
4	Roof	Roof rail - right side - Scratch(es) - Smart repair
5	Interior	Sun visor - left side - Broken / torn - Replace
6	Interior	Sun visor - right side - Broken / torn - Replace
7	Front bumper	Front bumper - Dent / paintcoat damage - Repair and paint
8	Vehicle glazing	Windscreen - Stone chips - Replace



Wear and tear

No.	Component group	Description
1	Roof	Roof - dent(s) - No deduction
2	Side panel - rear left side	Sill - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	2nd wheel set	1 alloy rim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

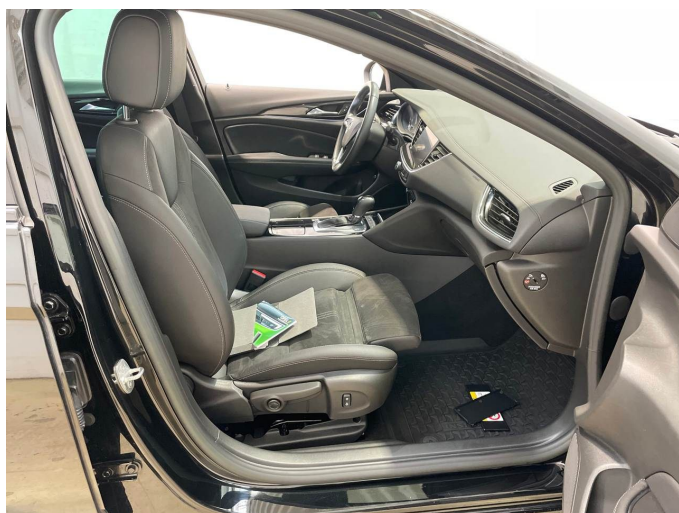


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

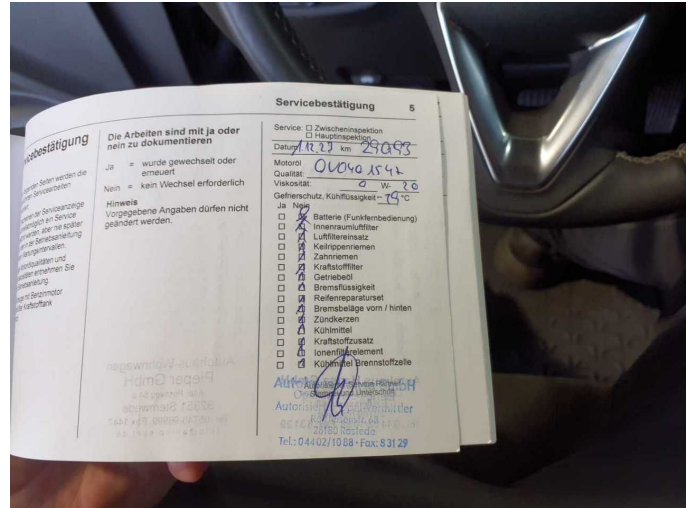


Figure 14: Documents

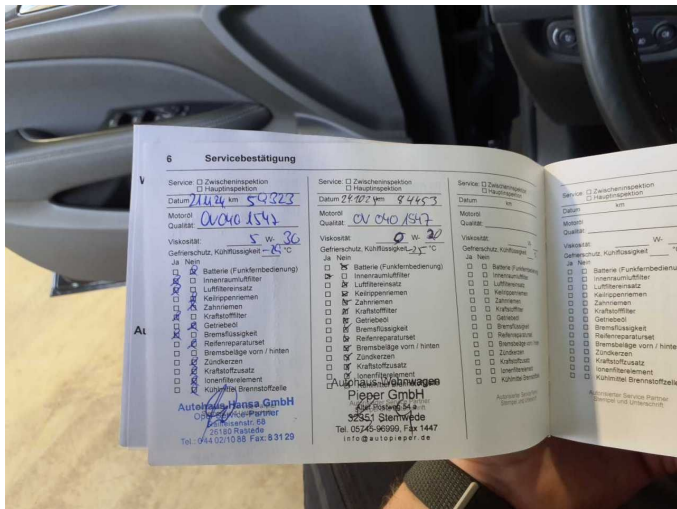


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

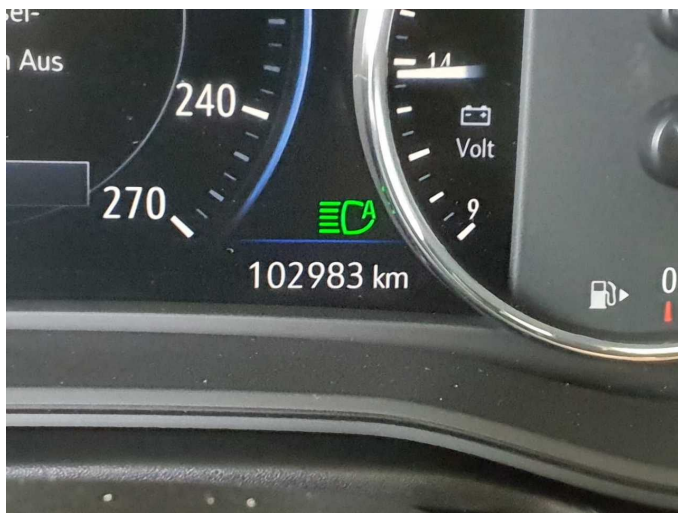


Figure 21: Misc.

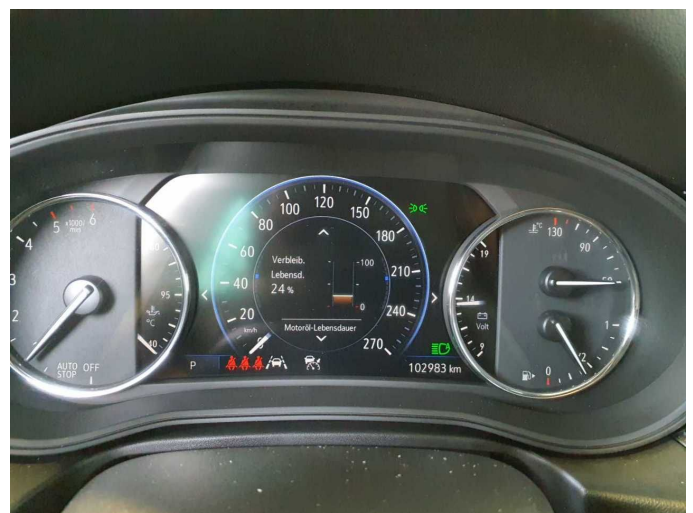


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.


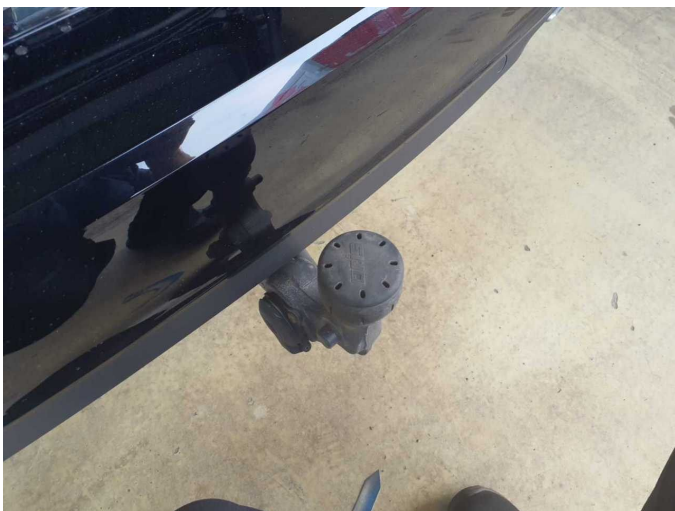


Figure 29: Misc.



Damage 1: Boot lid / rear door: Rear spoiler - Scratch(es) - Smart repair

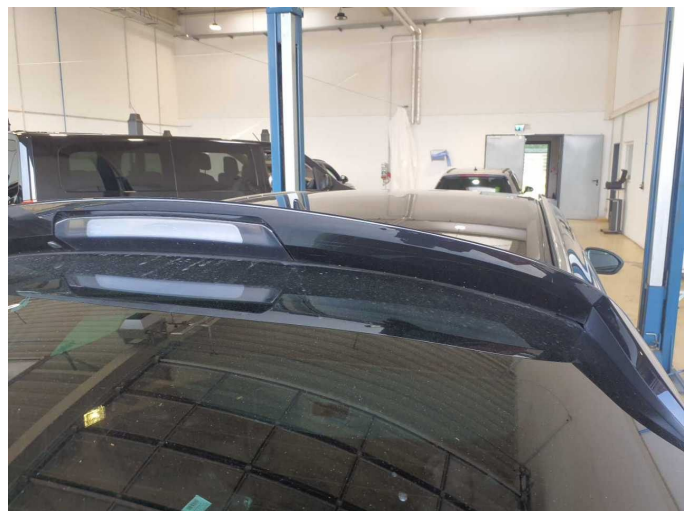

Damage 1: Boot lid / rear door: Rear spoiler - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 3: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 3: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 4: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 4: Roof: Roof rail - right side - Scratch(es) - Smart repair




Damage 5: Interior: Sun visor - left side - Broken / torn - Replace




Damage 6: Interior: Sun visor - right side - Broken / torn - Replace



Damage 6: Interior: Sun visor - right side - Broken / torn - Replace

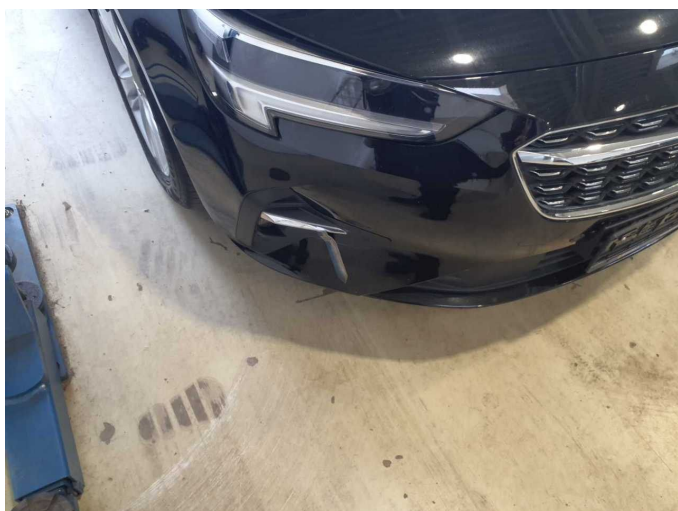

Damage 7: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

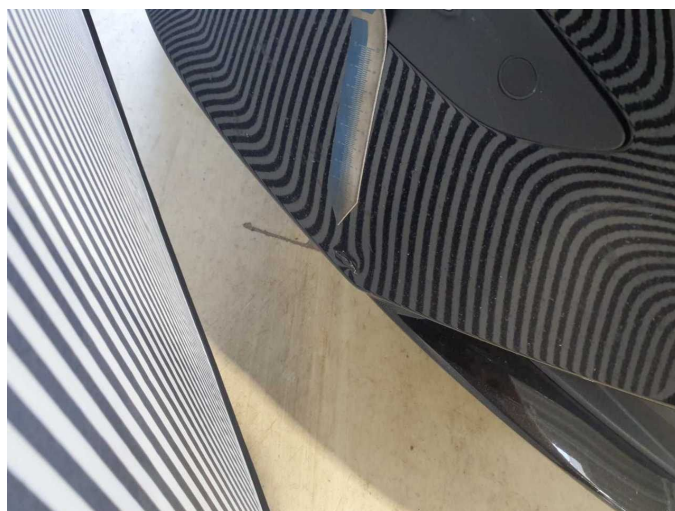

Damage 7: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 7: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 7: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 8: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 8: Vehicle glazing: Windscreen - Stone chips - Replace