



Expertise

Protocol number: 46378258
Order No. / Reference: 26588126
Inspection date: 7 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1N4M8EB6PW296107

Model: GLB 180 7G-DCT Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 180 7G-DCT Style	
Vehicle Identification number	W1N4M8EB6PW296107
Mileage (Read)	74,650 km
First registration	12 May 2023
Number of holders	1
Power / Engine displacement	100 kw / 1,332 ccm
Fuel type / Cylinder	Petrol / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	NACHTSCHWARZ UNILACK
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	159 Tag(e)
Last service on / at	12/2025 at 66,184 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS708553
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ATI 00154		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,080 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Michelin	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Michelin	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	215/65 R17 99V	Summer tyres on Light alloy	Continental	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- Rear armrest
- Automatic passenger airbag deactivation
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated turn signal light)
- Brake assist
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Door sills with "Mercedes-Benz" lettering
- Electronic Stability Program (ESP)
- Chassis: Comfort chassis
- Electric window regulators (4)
- Velour floor mats
- Luggage net on driver and passenger seatbacks
- Speed Limit Assist (The Speed Limit Assist makes it easy for you to comply with the regulations and avoid unnecessary speeding tickets. The system shows what is permitted: It can detect the current speed limit via the camera and display it in the instrument cluster. Additional restrictive signs for special weather conditions such as wet conditions are also detected.)
- KEYLESS-GO start function
- Communication module (LTE) for the use of Mercedes me connect services (communication module with permanently installed SIM card of the mobile communications standard LTE - two mobile communications antennas)
- Paint finish: Solid
- Cargo area cover (roller blind) (stores under the cargo floor)
- Steering column mechanically adjustable lengthwise and heightwise.
- Mercedes-Benz Emergency Call System (The Mercedes-Benz Emergency Call System can provide a crucial time advantage in an emergency. A communication module with its own SIM card automatically triggers an emergency call upon detection of an accident, which can shorten the time until emergency services arrive. The emergency call can also be triggered manually to organize assistance.)
- Otto particulate filter
- Package: Light and Sight Package (Overhead control unit with 4 light elements (including glasses compartment) - Interior light/reading light rear in mounting plate (rear/left/right) - Touchpad lighting (front) - Reading lights (front/left/right), console ambient light - Make-up lights (front/left/right) - Signal and ambient light - Exit signal light (front/left/right) - Footwell lighting (front/left/right) - Cupholder/storage compartment lighting - Occasional storage compartment lighting)
- Radio accessories: Digital radio
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- Anti-lock braking system (ABS)
- ATTENTION ASSIST (can detect typical signs of fatigue via steering behavior and can warn the driver of impending microsleep)
- On-board computer
- Border trim strip in silver chrome
- Roof rails in polished aluminum
- Tachometer
- DYNAMIC SELECT (Simply drive the way you want. At the touch of a button, DYNAMIC SELECT offers various driving programs that predefine, for example, the engine, transmission, suspension, or steering. Sport mode provides a decidedly dynamic driving experience, while the basic Comfort program offers a very balanced ride. ECO mode, on the other hand, prioritizes maximum efficiency, saving fuel and money.)
- Transmission: 7G-DCT dual-clutch automatic transmission, 7-speed
- Halogen headlights including integrated LED daytime running lights
- Rear window heated
- rear window wiper
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control (1-zone climate control - automatically controlled air distribution - recirculation function - tunnel mode in conjunction with navigation system - fine dust filter)
- Headrests (2)
- Rear headrests (3)
- Loading floor height-adjustable and removable
- Steering wheel: Multifunction sports steering wheel in leather (The elegant leather covering makes the multifunction sports steering wheel even more premium, turning it into a highlight of the interior. As a driver, you benefit in two ways: What looks good must also feel good. Among other things, the touch control buttons on the left and right operate a variety of functions, from navigation and telephony to entertainment. Last but not least, you can set the speed and distance control: Everything under control without taking your hands off the steering wheel.)
- Navigation accessories: Extended MBUX functions (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via "Hey Mercedes" - Wi-Fi hotspot - internet radio)
- Package: Seating comfort (height adjustment for passenger seat - seat cushion tilt adjustment for driver and passenger seats - seat cushion depth adjustment for improved seating comfort through a 60 mm wider thigh support area - specific seat design)
- Upholstery: ARTICO leatherette/fabric



- Radio accessories: Touchpad (integrated into the center console, including a hand rest - single and multi-finger gestures, swiping movements and zoom gestures by spreading and pinching the fingers - recognizes handwritten characters: letters, special characters and numbers - clear haptic feedback)
- Rain and light sensor
- Tire pressure monitoring system (TPMS)
- Remote Services Plus (The Remote Services Plus package transforms mobility into a new experience, offering greater comfort and safety. Status queries provide information about the remaining range. You can remotely control certain functions and locate your vehicle. Services such as maintenance management coordinate service appointments, saving you valuable time.)
- Seats: Comfort seats (the comfort seat offers you good long-distance comfort and comprehensive adjustments in length and height. You can also adjust the seat cushion angle and even extend it.)
- High-visibility vest for drivers
- Immobiliser
- Decorative elements in elliptical design

- Radio: MBUX multimedia system (instrument display with 17.78 cm (7") diagonal - media display with 17.78 cm (7") diagonal and touch function - touch control buttons on the steering wheel - radio (FM/AM) - USB interface in the center console under the armrest - Bluetooth telephony with contact transfer and audio streaming of music data - display of vehicle functions (driver assistance system, driving programs and vehicle settings) - favorites memory - smartphone-related voice control - activated by long press on the voice button on the steering wheel)
- Wheels: 43.2 cm (17") light alloy wheels in 5-twin-spoke design (vanadium silver painted and polished with 225/55 R 17 tires on 7.5 J x 17 ET 40)
- Windscreen wipers with rain sensor
- Power steering
- Seats: Rear seat backrests foldable (in a 40/20/40 ratio and adjustable to 7 tilt positions)
- 12V power outlet in center console
- Cruise control (Drive relaxed and fuel-efficiently, especially on longer journeys. Simply select your desired speed and your vehicle will regulate it. In addition to the cruising speed, the speed limiter helps you maintain a maximum speed. This increases road safety and protects you from expensive speeding tickets.)

Extra equipment

- Black fabric headliner
- Fog light
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Parking assistant with PARKTRONIC - Preparation for live traffic information)
- Package: Parking package with reversing camera (Active parking assistant with visual and acoustic warning of detected obstacles, notification of detected parking spaces in the instrument cluster via arrow display, assists with parking in and out of parallel and perpendicular parking spaces - reversing camera in the tailgate: display in the multimedia system screen with schematic representation and guidelines - ultrasonic sensors: located in the front and rear bumpers)
- Type designation removed from luggage compartment lid

- LED High Performance Headlights (LED High Performance headlights offer you greater safety at night and a distinctive, striking look. Thanks to LED technology, they illuminate the road better than conventional headlights - with lower energy consumption.)
- Package: MBUX High-End Package (Hard drive navigation - Smartphone integration - Wireless charging system for mobile devices - Preparation for digital key handover - Connectivity package navigation - Central Media Display 10.25" - Fully digital instrument display with high-resolution 10.25" display - MBUX Augmented Reality for navigation - Traffic sign assistant - Preparation for live traffic information)
- Panoramic sunroof
- Seats: 4-way lumbar support for driver and front passenger
- Phone accessories: Wireless charging system for mobile devices

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Engine	Engine cover - Damage caused by marten / rodent - Replace
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair
3	Side panel - rear right side	Side panel (Vogelkot eingebrannt) - Paint defect - Paint
4	Bonnet	Bonnet - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Side panel - rear left side	Side panel - dent(s) - No deduction
4	Door - rear left side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Professionally repaired, Invoice of repair done Non-existent	

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Bonnet	237 µm
--------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

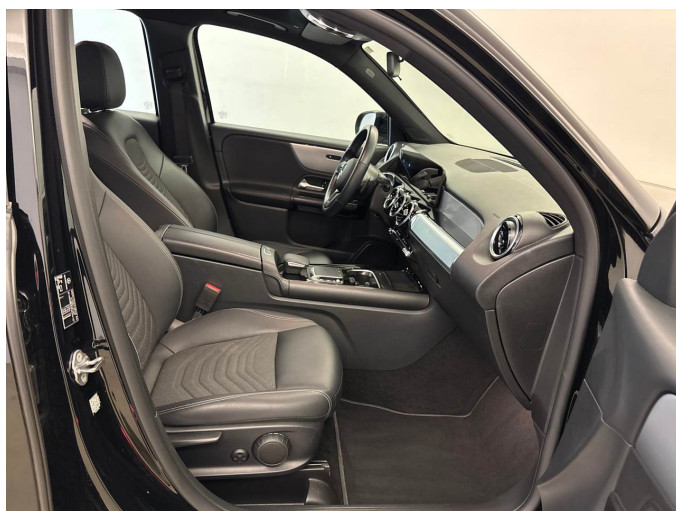


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

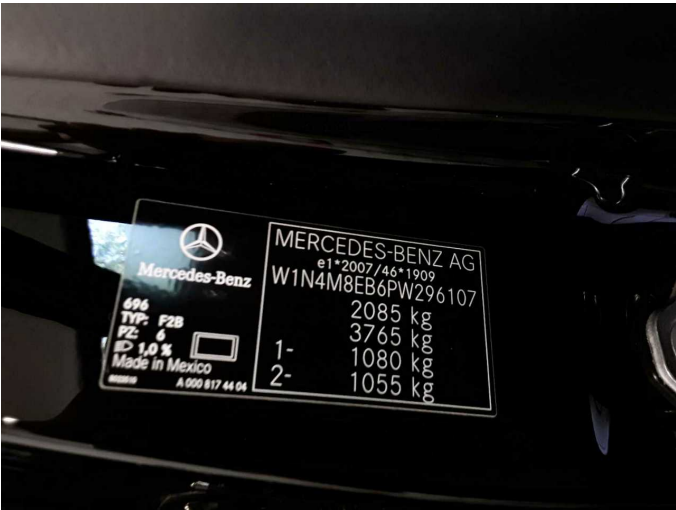


Figure 11: VIN



Figure 12: Mounted tyres

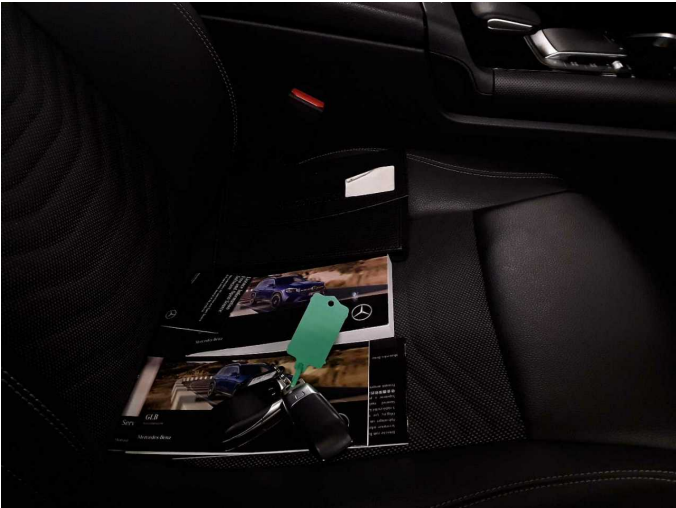


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

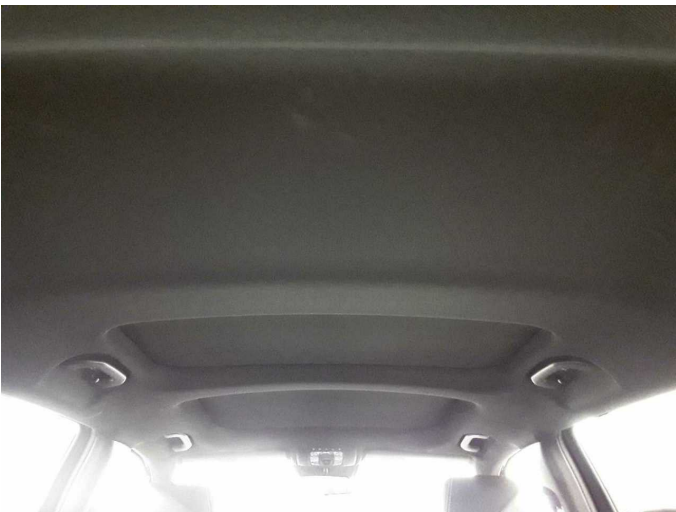


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

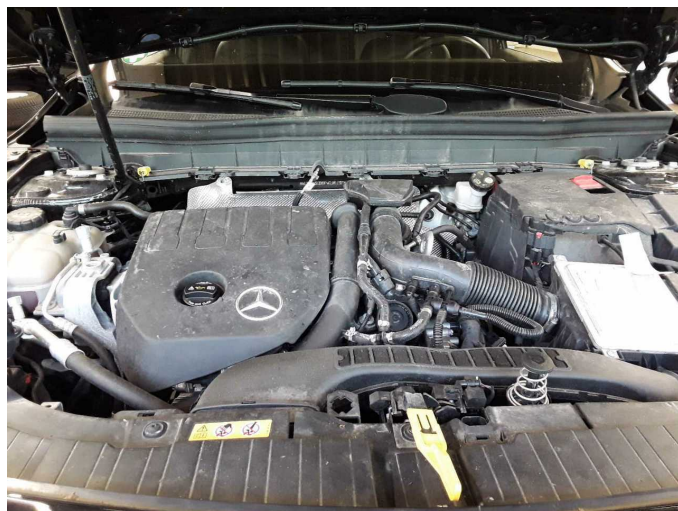


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: Engine: Engine cover - Damage caused by marten / rodent - Replace



Damage 1: Engine: Engine cover - Damage caused by marten / rodent - Replace




Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair

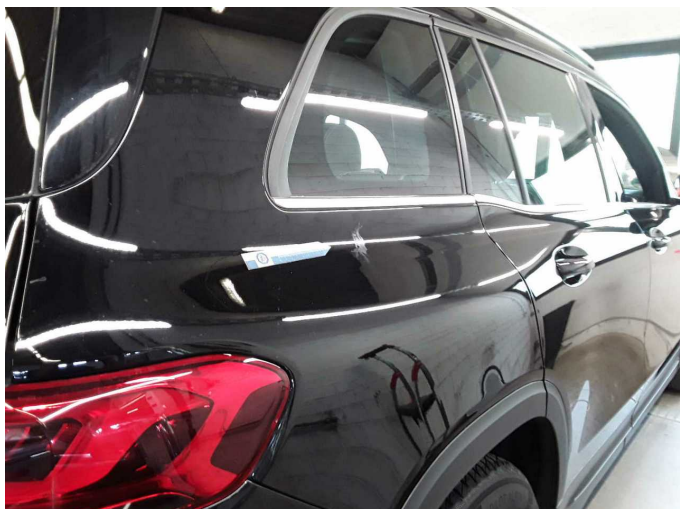


Damage 3: Side panel - rear right side: Side panel (Vogelkot eingebrannt) - Paint defect - Paint



Damage 3: Side panel - rear right side: Side panel (Vogelkot eingebrannt) - Paint defect - Paint



Damage 3: Side panel - rear right side: Side panel (Vogelkot eingebrannt) - Paint defect - Paint

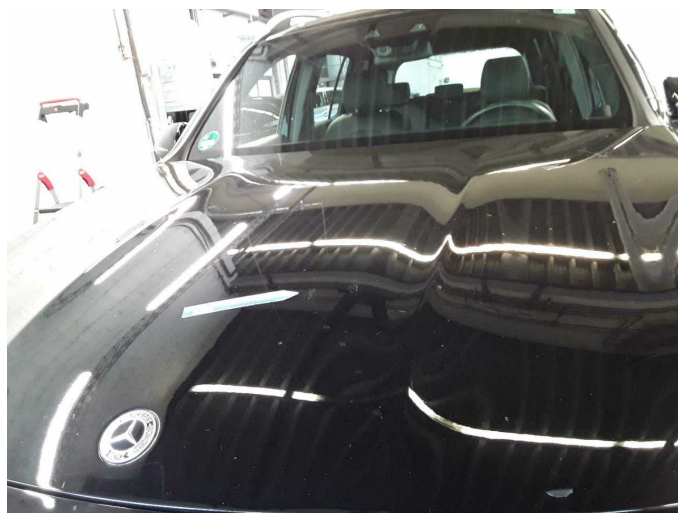

Damage 4: Bonnet: Bonnet - Scratched - Paint



Damage 4: Bonnet: Bonnet - Scratched - Paint




Damage 4: Bonnet: Bonnet - Scratched - Paint




Damage 4: Bonnet: Bonnet - Scratched - Paint




Wear and tear 3: Side panel - rear left side: Side panel - dent(s) - No deduction

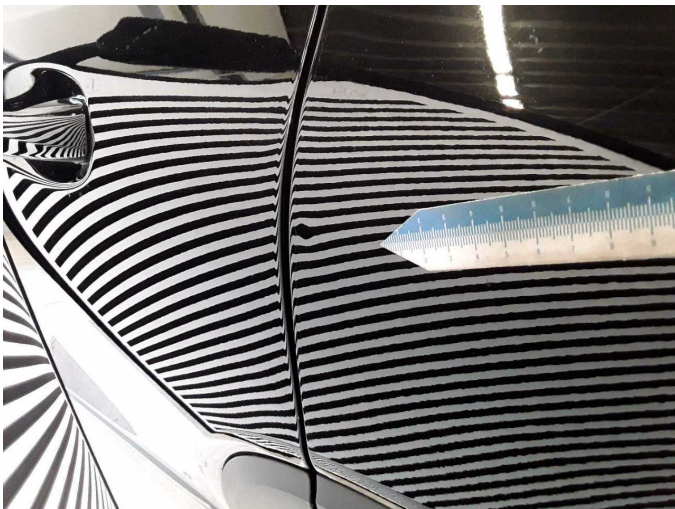

Wear and tear 3: Side panel - rear left side: Side panel - dent(s) - No deduction

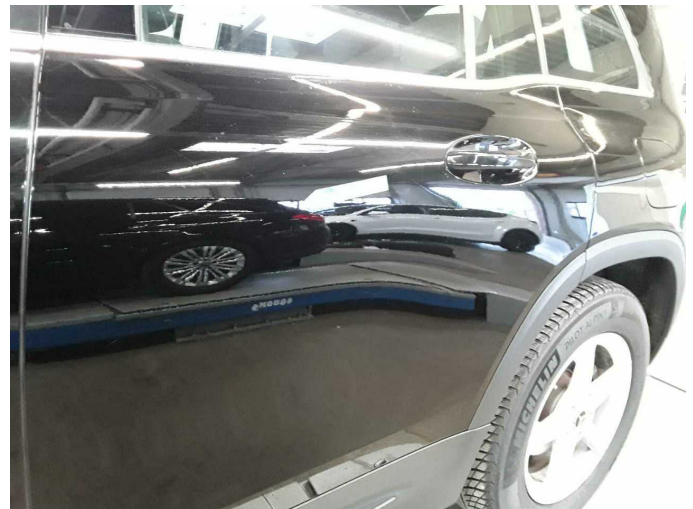

Wear and tear 4: Door - rear left side: Door - dent(s) - No deduction

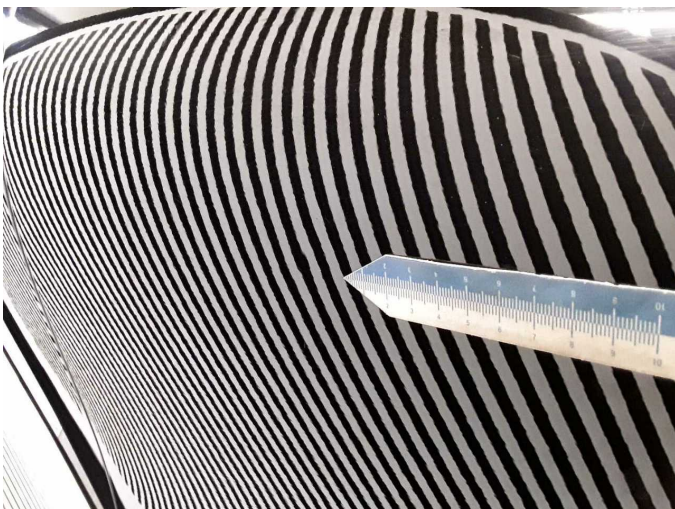

Wear and tear 4: Door - rear left side: Door - dent(s) - No deduction



Repainting 1: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N4M8EB6PW296107

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLB 180 7G-DCT Style

Datum	KM-Stand	Beschreibung
11.12.2025	66.184	Regelwartungsdienst
07.11.2024	49.264	Regelwartungsdienst
31.01.2024	23.382	Regelwartungsdienst