



PEUGEOT 500

Vinnnumber:	VF3MICYHZUMS062191	Versionname:	1.5 BlueHdi 96kW S&S EAT8 Allure Pack
First Registrationdate:	17/03/2021	Fiscalpower:	
Expertise Mileage:	92481	Power Kw:	96
Bodytype:		Body colour:	Brown
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:		Parking lot:	3201
Fueltype:	Diesel		
Maintenance:	NOT OK		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Registration Certificate Home (BE):	No		

Options

Number of keys total:	2	Luggage cover:	
Cruise Control:		Front parking sensors:	
Steering wheel multifunctional:		Rear parking sensors:	
Radio multimedia:		Type of Tow bar:	No Tow bar
Type of headlighting:	Headlighting LED		
Type of GPS:	GPS big screen color		
Type of Lining:	Lining semi-leather		
Type of climate control:	Autom climate control		
Type of GPS storage:	HD		

Limited Technical Inspection

Tyres

225/55/18/102 V				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 3 mm	Re.R.	Michelin: 3 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				3.0
Tyre profile depth RR				3.0
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261


Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Total cost ex VAT:	1232,52
Service, Maintenance, Check:	0,00



Seat cover FL, Worn, Acceptable 0,00

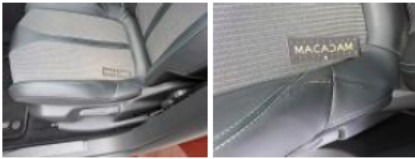

Engine insulation, Damaged, Replace 0,00



Alloy rim FL polished, Scratch(es), Repair and paint (complete) 204,21



Door RL, Scratch(es), Acceptable 0,00



Door RL, Scratch(es), Acceptable 0,00



Alloy rim RL polished, Chemical polution, Repair and paint (complete) 204,21



Door trim FL, Scratch(es), Acceptable 0,00



Wheel aperture RL, Dent(s) and scratch(es), Spot repair 207,84



Wheel aperture RR, Dent(s) and scratch(es), Spot repair 207,84



Door RR, Scratch(es), Acceptable

0,00



Alloy rim RR polished, Scratch(es), Repair and paint (complete)

204,21



Alloy rim FR polished, Scratch(es), Repair and paint (complete)

204,21



Wing FR, Scratch(es), Acceptable

0,00

