



Expertise

Protocol number: 46606655
Order No. / Reference: 26453225
Inspection date: 20 Jul 2026

Manufacturer: Ford

Model: Focus Turnier 1.5 EcoBlue Start-Stopp-System
COOL&CONNECT

VIN: WF0PXXGCHPLS81213



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System
COOL&CONNECT

Vehicle Identification number WF0PXXGCHPLS81213
Mileage (Read) 161,240 km
First registration 1 Jun 2021
Number of holders 1
Next periodical technical inspection 06/2026
(Report on hand)

Fuel type Diesel
Engine displacement / Cylinder 1,499 ccm / 4
Power 88 kW
Gearbox / Number of gears Manual / 6
Type of drive Front drive
Type of vehicle Station wagon

Colour / colour code Frost-Weiß
Doors / Seats 5 / 5
Upholstery type Cloth
Colour of upholstery Anthracite-Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	67 %
Last service on / at	12/2025 at 151,362 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FY060246
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BPV 00369		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,955 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	205/60 R16 92H	Summer tyres on Light alloy	Continental	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R 16 tires
- Fabric headliner
- Roof spoiler painted in car color
- Tachometer
- Driver information system
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto-hold function
- Ford ECO-Coach
- Luggage compartment lighting
- Luggage compartment floor, adjustable in two ways
- Cruise control
- Illuminated glove compartment
- rear window wiper
- Instrument lighting, adjustable
- Isofix bracket
- LED daytime running lights
- Steering wheel: 3-spoke design
- Make-up mirrors in driver and passenger sun visors
- MyKey key system (individually programmable second key)
- Fog light
- Emergency brake light
- Pollen filter and dust filter
- Post-Collision Assist
- Tire repair kit
- Rear view camera
- Electromechanical power steering
- Seats: Driver's seat height adjustable
- Seats: Rear seat backrest
- Seats: Front sports seats with enhanced lateral support
- 12-volt power outlet in the luggage compartment
- Child safety lock on the rear doors, manual
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Heat-insulating glazing, tinted
- Additional heating
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Mounting points behind the second row of seats
- Chrome decor
- Roof rails, aluminum
- Diesel particulate filter (DPF)
- Electronic Safety and Stability Program (ESP)
- Driving mode switch, selective
- Electric windows front and rear
- Ford Easy Fuel
- FordPass Connect including eCall, live traffic information (only with navigation) and Wi-Fi hotspot
- Speed limiter
- Transmission: 6-speed manual transmission
- Back window, heater
- Interior lighting with LED technology
- Intelligent security system
- Headrests: 2 front and 3 rear, height adjustable
- Leather gear knob
- Adjustable steering column
- Center console "Premium" front
- Navigation: Ford Navigation, Ford SYNC 3 with AppLink, 8" touchscreen (20.3 cm) with DAB/DAB+
- Front and rear parking pilot system
- Upholstery: Cloth
- Pre-Collision Assist
- Tire Pressure Monitoring System (TPMS)
- Headlight assistant with day/night sensor
- Seats: Passenger seat, 2-way adjustable
- Seats: Map grid on the driver's and front passenger's seat backrests
- Start-stop system
- Carpet floor mats in the front
- Black trim around the side windows
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Central/Double Locking



Extra equipment

- Detachable towbar (including ESP trailer stabilization)
- Package: Easy Parking Package (Active Parking Assist with parking and exiting function - Blind Spot Assist and Cross Traffic Alert with emergency braking function (when reversing out of a parking space) - Door edge protection - Rearview camera additionally with split view technology)
- Package: Technology (Cool&Connect) (Intelligent Adaptive Cruise Control (iACC) with traffic sign recognition - Wrong-way driver warning - Evasive Steering Assist (ESA) - High Beam Assist (in conjunction with intelligent LED headlights with glare-free high beam assist) - Driver alert system - Rain-sensing wipers with variable sensitivity - Auto-dimming rearview mirror - Headlights with delayed shut-off - Distance indicator and distance warning)
- Paint finish: Frost White
- Package: Comfort (2-zone automatic climate control for driver and front passenger side, separately adjustable - Ford Key Free system (keyless locking/unlocking) including Ford Power Start function (keyless starting) - Windscreen wipers with rain sensor, variable sensitivity adjustment - Interior mirror, automatically dimming - Headlights with delayed shut-off)
- Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Safety partition net for luggage compartment

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Side panel - rear right side	Side panel - Stone chips - Smart repair
3	Misc.	Main inspection - Due - Replace
4	Front bumper	Front bumper - Stone chips - Paint
5	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Rear bumper	Rear bumper (Verladebereich) - Scratched - No deduction
3	Boot lid / rear door	Boot lid - dent(s) - No deduction
4	Body	B-pillar - right side - Scratched - Smart repair

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Towing eye



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 23 Mar 2022	1.040,61 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Das Fahrzeug verfügt über eine allgemeine hohe Lackstärke.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

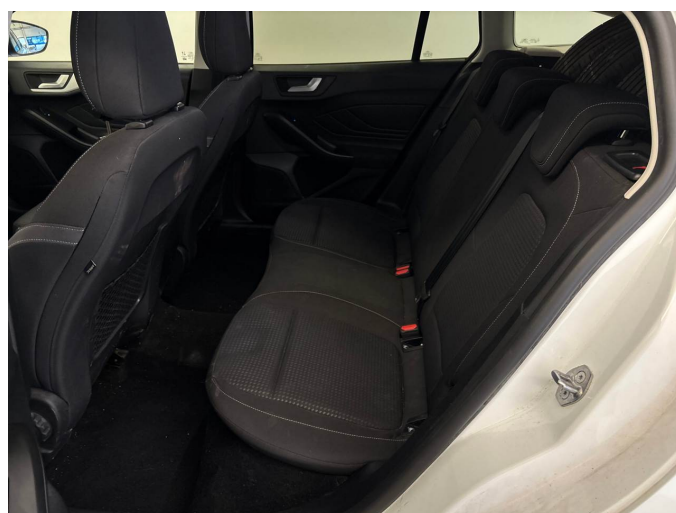


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

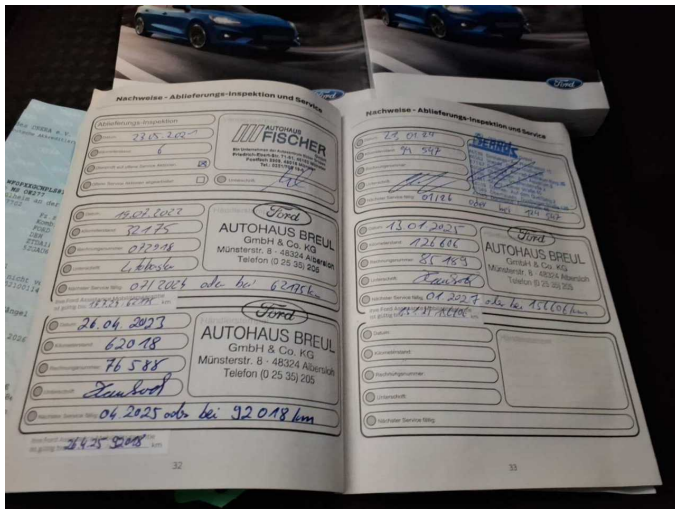


Figure 15: Documents

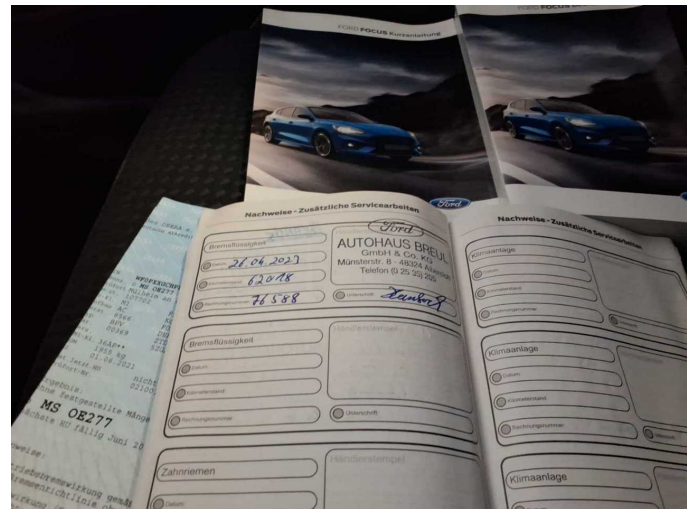


Figure 16: Documents

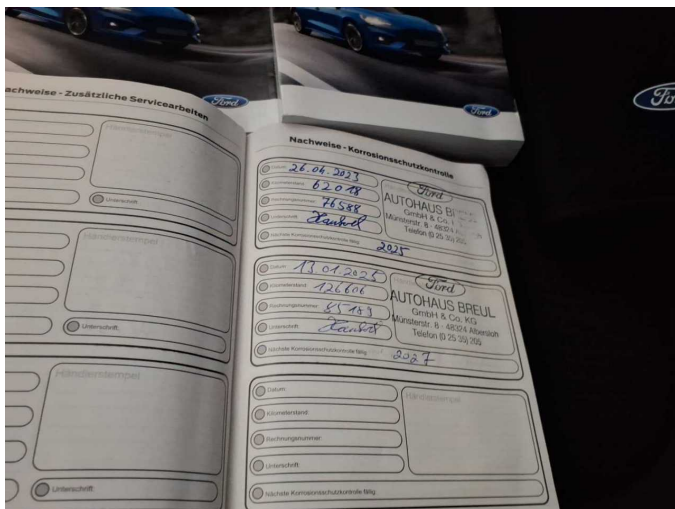


Figure 17: Documents



Figure 18: Documents

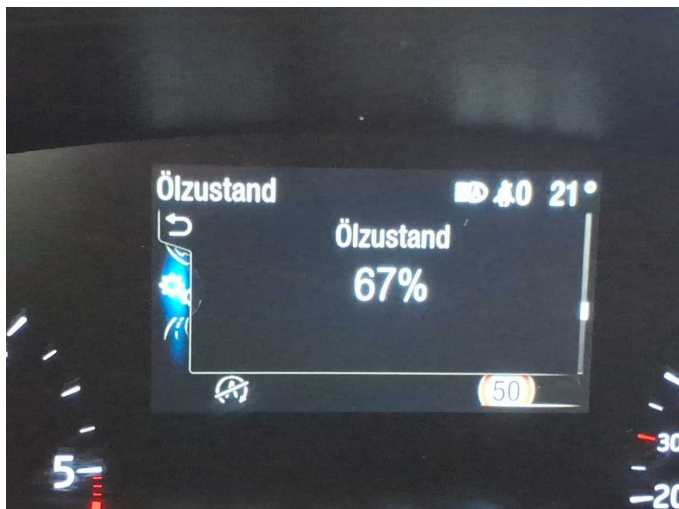


Figure 19: Documents



Figure 20: Additional tyres



Figure 21: Navigation

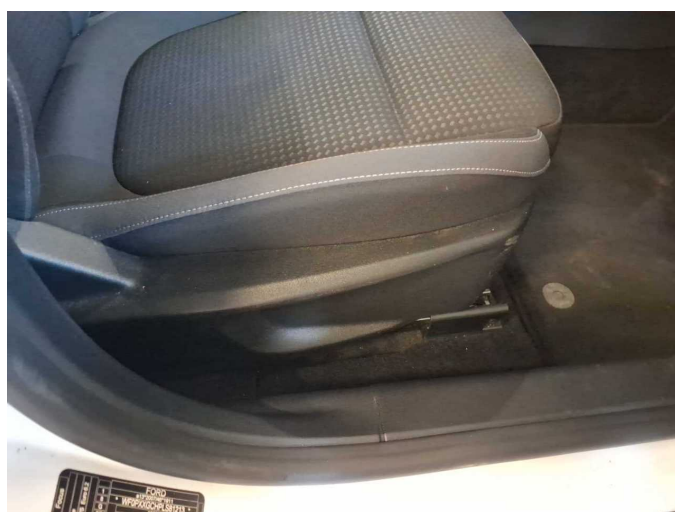


Figure 22: Misc.

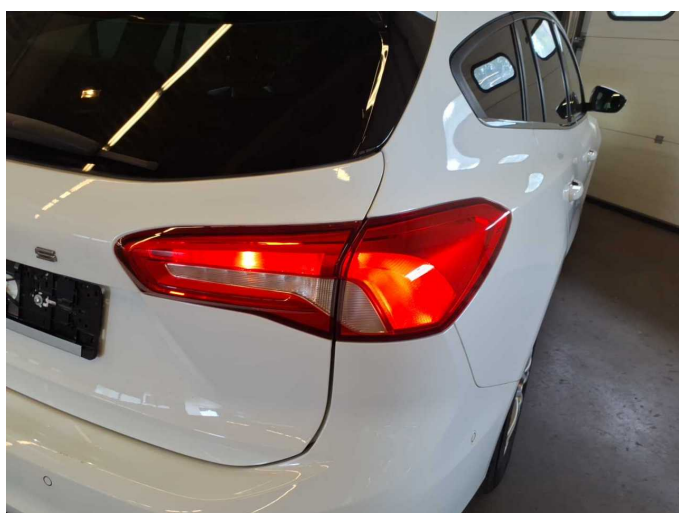


Figure 23: Misc.

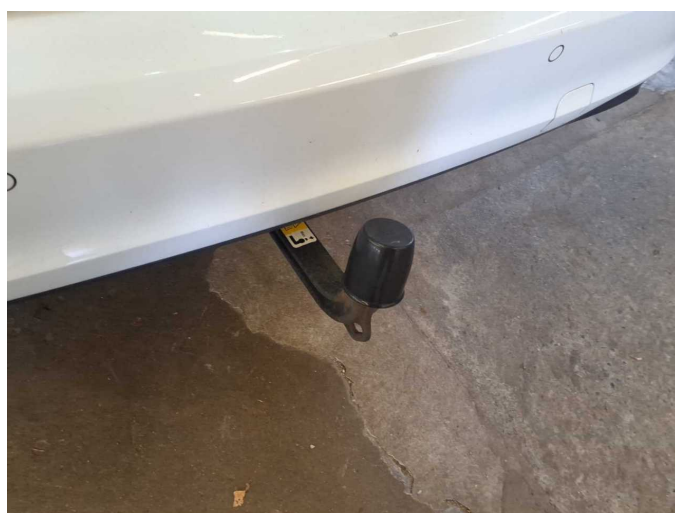


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

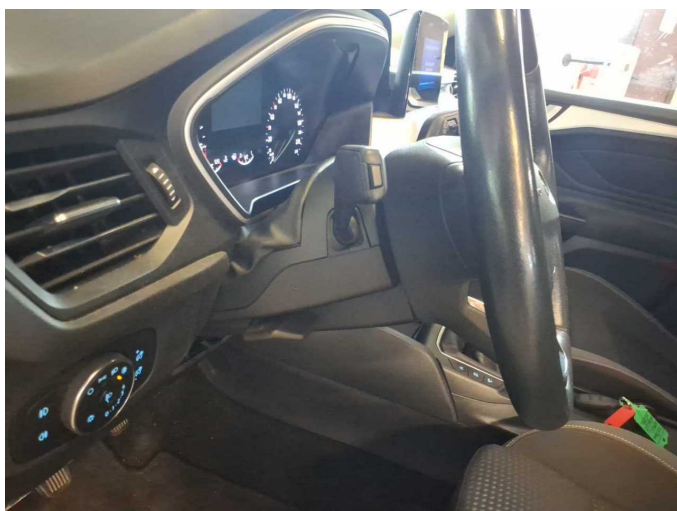


Figure 35: Misc.



Figure 36: Misc.




Figure 37: Misc.




Figure 38: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace

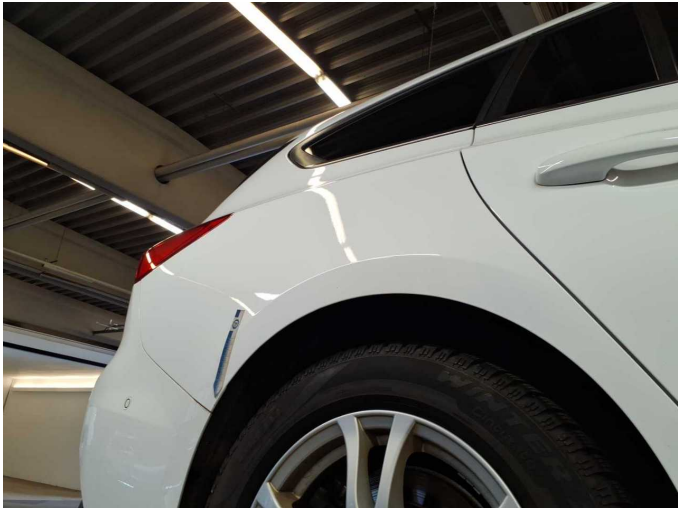

Damage 2: Side panel - rear right side: Side panel - Stone chips - Smart repair

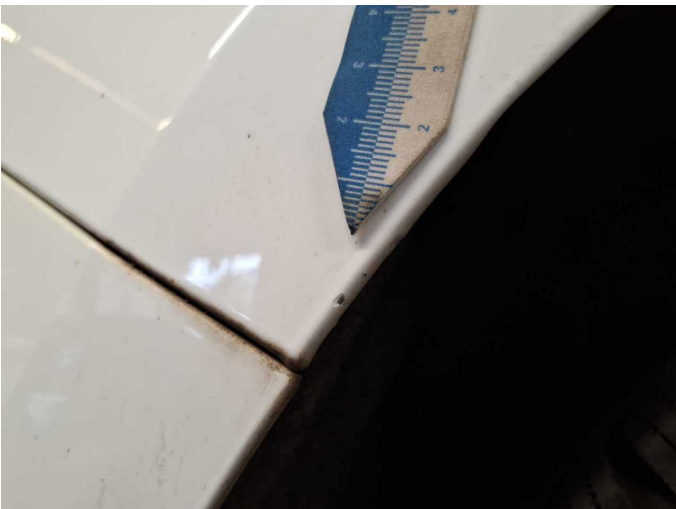

Damage 2: Side panel - rear right side: Side panel - Stone chips - Smart repair

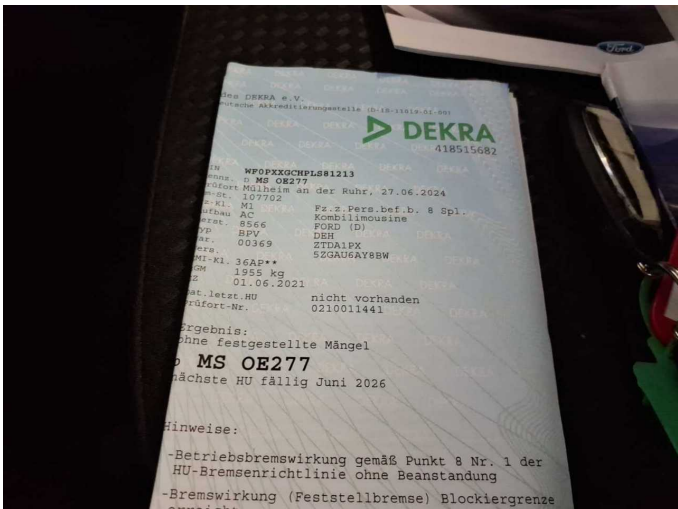

Damage 3: Misc.: Main inspection - Due - Replace



Damage 4: Front bumper: Front bumper - Stone chips - Paint




Damage 4: Front bumper: Front bumper - Stone chips - Paint



Damage 4: Front bumper: Front bumper - Stone chips - Paint



Damage 4: Front bumper: Front bumper - Stone chips - Paint

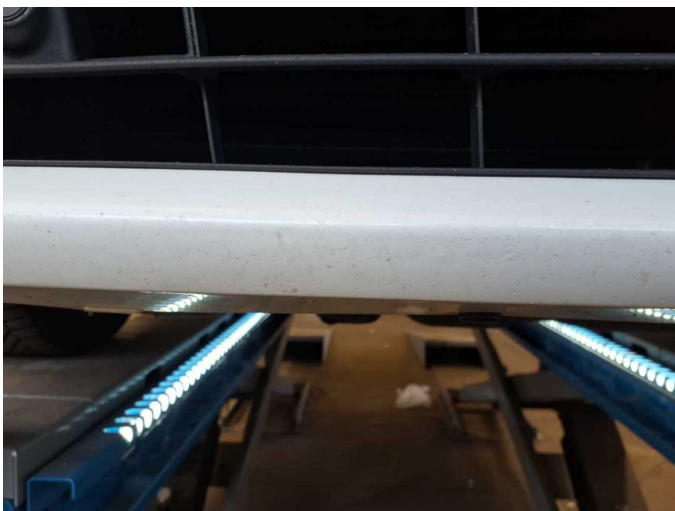

Damage 4: Front bumper: Front bumper - Stone chips - Paint



Damage 4: Front bumper: Front bumper - Stone chips - Paint



Damage 4: Front bumper: Front bumper - Stone chips - Paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 2: Rear bumper: Rear bumper (Verladebereich) - Scratched - No deduction



Wear and tear 2: Rear bumper: Rear bumper (Verladebereich) - Scratched - No deduction



Wear and tear 2: Rear bumper: Rear bumper (Verladebereich) - Scratched - No deduction

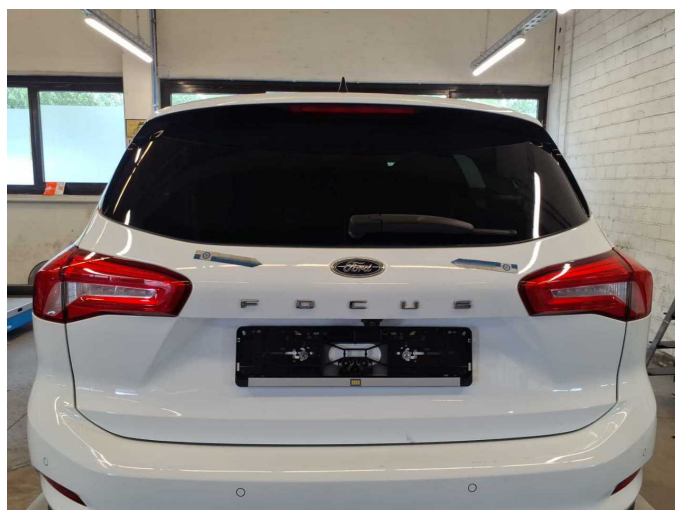

Wear and tear 3: Boot lid / rear door: Boot lid - dent(s) - No deduction



Wear and tear 3: Boot lid / rear door: Boot lid - dent(s) - No deduction



Wear and tear 3: Boot lid / rear door: Boot lid - dent(s) - No deduction



Wear and tear 4: Body: B-pillar - right side - Scratched - Smart repair



Wear and tear 4: Body: B-pillar - right side - Scratched - Smart repair



Missing part 1: Equipment: Towing eye - Missing - Replace



Missing part 1: Equipment: Towing eye - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0PXXGCHPLS81213

Hersteller / Modell: FORD FORD Focus Turnier 1.5 EcoBlue Start-Stopp-System
COOL&CONNECT

Datum	KM-Stand	Beschreibung
01.12.2025	151.362	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
27.02.2025	131.940	Reparatur Sonstiges
23.01.2025	126.606	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.11.2024	120.074	Bremsklötze vorne
15.08.2024	110.904	Systemtest/Eigendiagnose
27.06.2024	107.702	Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; HU + AU
23.01.2024	94.547	Motoröl b. Wartung; Regelwartungsdienst
27.07.2023	74.755	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
17.05.2023	62.018	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges