



Expertise

Protocol number: 46407937
Order No. / Reference: 26553279
Inspection date: 7 Jul 2026

Manufacturer: Peugeot

Model: 5008 BlueHDi 130 EAT8 GT

VIN: VF3MCYHZUNS200369



Vehicle details

Manufacturer / Type / Model / Equipment

Peugeot 5008 BlueHDi 130 EAT8 GT

Vehicle Identification number VF3MCYHZUNS200369

Mileage (Read) 118,599 km

First registration 25 Apr 2023

Number of holders 1

Power / Engine displacement 96 kw / 1,499 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 8

Type of drive Front drive

Type of vehicle SUV

Colour / colour code Celebes Blau Metallic

Doors / Seats 5 / 7

Upholstery type Cloth / leather combination

Colour of upholstery Black-Grey

Re-import no

Vehicle with smoke odor no

readiness to drive Not roadworthy / not moveable



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-99,900 km
Last service on / at	05/2026 at 118,599 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG061459
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Not possible
readiness to drive	Not roadworthy / not moveable		
Manufacturer key number/ type code number	3003 / AZJ 00275		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	
Dimensions	4641 x 1844 x -		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102H	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	225/55 R18 102H	Winter tyres on Light alloy	Dunlop	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tyre is listed first, for the right tyre it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS (Anti-lock Braking System)
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Active Blind Spot Assist
- Electrically folding exterior mirrors with LED approach lighting
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- On-board computer (outside temperature and maintenance display - average and current fuel consumption - remaining range - distance traveled - average speed)
- Black Diamond roof (roof in Perla Nera black) (exterior mirror caps in Perla Nera black - rear spoiler in glossy black)
- Alcantara "Grevat" decorative inserts for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Misfueling protection
- Electric front and rear windows (with comfort operation and anti-pinch protection)
- High beam assist
- Follow-me-home function (automatic)
- Front bumper in chrome look
- Floor mats (front and rear)
- Cruise control system with speed limiter
- Cup holder in the center console
- Illuminated glove compartment
- Heated rear window
- rear window wiper
- Interior mirror automatically dimming
- Frameless interior mirror
- Keyless system (keyless access and start system)
- Child safety locks on the rear doors
- Automatic climate control (2-zone), with activated carbon filter (separately adjustable for driver and front passenger)
- Rear headrests (3) (height adjustable and lowerable)
- Chrome-plated loading sill protector
- Blue LED lighting on the door panel
- Steering wheel: Multifunction leather steering wheel
- Steering wheel: small multifunction steering wheel, flattened at the top and bottom
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- Emergency brake assist (with automatic activation of the hazard warning lights)
- Package: Children's package (folding tables on the front seatbacks - map pockets on the front seatbacks - sunshades in row 2)
- Particulate filter: FAP diesel particulate filter
- Aluminum pedals and stainless steel door sills
- Active Safety Brake Plus (for nighttime use and cyclists)
- Airbag: Front and rear side airbags
- Airbag: Curtain airbags front and rear
- Adaptive Cruise Control (ACC) with Stop & Go function including lane positioning assistant (and Active Safety Brake Plus (for night driving and cyclists))
- Exterior mirrors in Perla Nera Black
- Hill start assist
- third brake light
- Chrome trim strips on the lower part of the doors
- Chrome trim strips above the side windows
- Chrome trim strips below the side windows
- Black headliner
- Aluminum roof rails
- Ceiling light - LED at the front, in row 2 and in row 3, 2 LED reading lights at the front, in row 2 and in row 3
- Decorative trim on the dashboard and door panels in satin chrome
- EBV (Electronic Brakeforce Distribution)
- Front parking aid, acoustic and visual
- Driving mode switch (Sport - Normal - Eco) (Sport mode to activate the following functions: - Display of driving dynamics parameters on the instrument cluster - More responsive accelerator pedal response - More responsive power steering - Increased engine noise)
- electric parking brake
- Front collision warning
- Full LED headlights with automatic headlight range control (with static cornering lights and (Foggy Mode) function)
- Transmission: 8-speed automatic transmission EAT8
- Seat belts: 3-point seat belts (Front seats: - Height-adjustable three-point seat belts with belt locks - Pyrotechnic belt tensioners and electronically controlled belt force limiters - Warning light and warning signal when the seat belt is not fastened or is released for driver and front passenger Rear seats: - 3 three-point seat belts - 3 three-point Isofix child seat anchors in the 2nd row - Belt force limiters on the side seats - Warning light and warning signal when the seat belt is released)
- Front headrests (2) (Safety optimized)
- Paint finish: Copper Brown
- White LED ambient lighting in the front footwell
- LED daytime running lights and LED turn signals at the front
- light sensor
- Makeup mirror (illuminated for driver and front passenger)
- Fatigue warning system with fatigue detection
- Navigation system: 3D navigation system NAC (3D navigation including 3D display of buildings and monuments - voice recognition for navigation, telephone and media - operation via touchscreen with 10" HD color screen - map transfer to the digital instrument cluster - multifunctional touchscreen - capacitive screen - piano key toggle switches)



- Upholstery: Fabric/faux leather "Belomka" in black with decorative stitching in copper
- Radio: RCC audio system (Bi-tuner - 6 speakers - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - USB port - operation via steering wheel and touchscreen)
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire pressure monitoring system
- Wheels: 18" "Detroit" alloy wheels, two-tone with black (with 225/55 R 18 tires)
- Wheels: Tire repair kit (compressor + tire sealant spray)
- Reversing camera with 180° surround view
- Keyless start system
- Electric power steering
- Seats: 2 additional seats for the 3rd row (removable and fully retractable)
- Seats: Passenger seat height adjustable
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Power outlet: Dual USB port (Type A) in row 2
- Traffic sign recognition (with display of the speed recommendation in the instrument cluster)
- Central locking system, activatable from inside via remote control (doors lock automatically when driving off)
- Peugeot Connect Box (with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - Integrated European SIM card - Speaker and microphone - Emergency battery)
- Radio: Mirror Screen (Mirror Screen (Transfer of multimedia content and apps from a smartphone to the touchscreen in the vehicle, via which the compatible functions and apps can be operated directly - Mirror Link: Mirroring of the smartphone screen on the touchscreen (for compatible smartphone models with Android operating system) - CarPlay (for compatible iPhone models from Apple) - Android Auto and Mirror Link (for compatible smartphone models with Android operating system))
- paddle shifters on the steering wheel
- Side windows in the second row and rear window are more heavily tinted.
- Seats: 3 separate individual seats in row 2 (foldable, with longitudinal adjustment and backrest tilt adjustment)
- Seats: Passenger seat foldable
- Seats: Manual lumbar support for driver's seat (2-way)
- 12 Volt power outlet (3) (in the trunk, rows 1 and 2)
- Stop&Start system (automatic)
- Tie-down points in the trunk (4 pieces)
- Immobiliser

Extra equipment

- Alarm system (including all-round, interior, towing protection and safe locking)
- Night Vision (night vision system with display of the road situation at night in the instrument cluster)
- Paint finish: Special metallic paint
- Radio: FOCAL sound system (total output 515 watts - 10 speakers including center speaker and subwoofer - HiFi woofer and midrange speaker as well as TNF tweeter - 12-channel amplifier - speaker grilles of the center speaker and tweeter in Belem Bronze color)
- tailgate sensor-controlled
- Detachable towbar (with removable ball head without tools)
- Panoramic tilt/slide sunroof with electric blind (blue LED lighting - exterior mirrors with projection of the PEUGEOT lion onto the ground)
- Seats: Ergonomic comfort seats with AGR seal of approval (electrically adjustable driver's seat with memory function - heated front seats - massage function for driver and front passenger seats - extendable thigh support on driver and front passenger sides - electric lumbar support on driver and front passenger sides - electric seat tilt adjustment on the front passenger side - exterior mirrors with projection of the PEUGEOT lion onto the ground)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run could not be performed. This is due to the following reason.: Motor springt nicht an
readiness to drive	The vehicle was not roadworthy at the time of inspection, but only capable of being towed.



Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Electrical system	Battery (Mehrkosten möglich) - Empty - Perform diagnosis
3	Gearbox	Gearbox - Non-operational - Perform diagnosis
4	Side panel - rear left side	Sill - Dent / paintcoat damage - Repair and paint
5	Side panel - rear right side	Sill - Dent / paintcoat damage - Repair and paint
6	Braking system	Brake discs and pads - rear - Corrosion - Replace
7	Misc.	Inspection / maintenance - Expired - Replace
8	Braking system	Brake discs and brake pads - front - Corrosion - Replace
9	Door - rear left side	Door - Dent / paintcoat damage - Paint
10	Engine	Engine (Motor springt nicht an, siehe KVA) - Non-operational - repair according to calculation

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front right side - Scratched - No deduction
2	Wheel / tyres	Alloy rim - rear right side - Scratched - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 18 Dec 2023	5.761,98 €

Repainting

No.	Repainting
1	Bonnet, Professionally carried out

Paint coat thickness measurement

Bonnet 80 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferumfangs.
- Motorschaden, siehe KVA.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

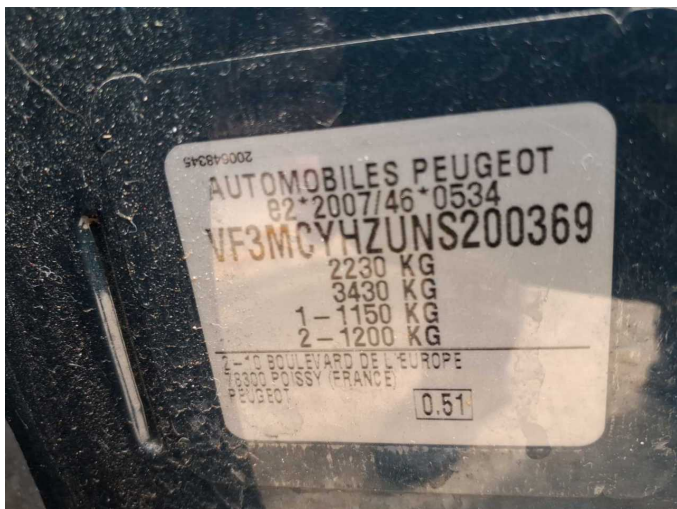


Figure 11: VIN



Figure 12: Mounted tyres

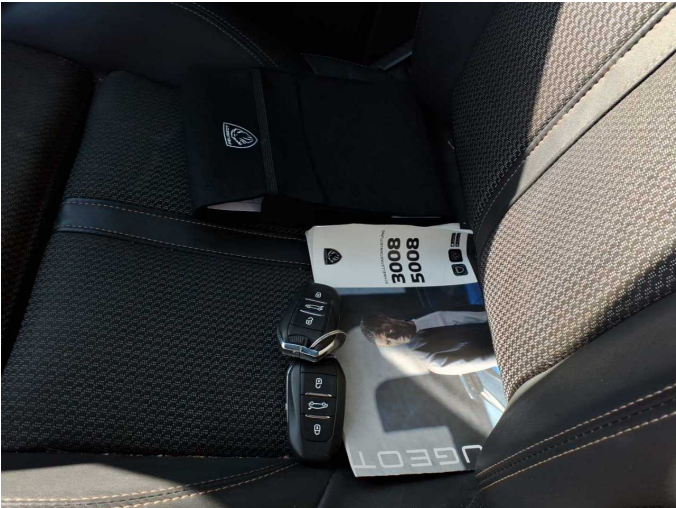


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

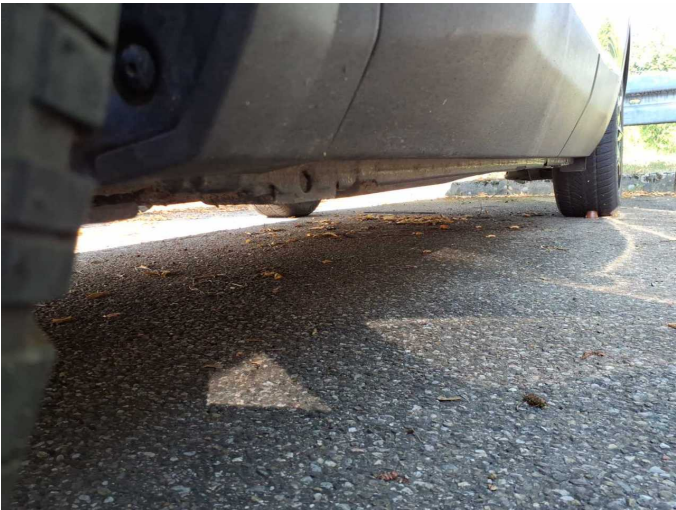


Figure 17: Misc.

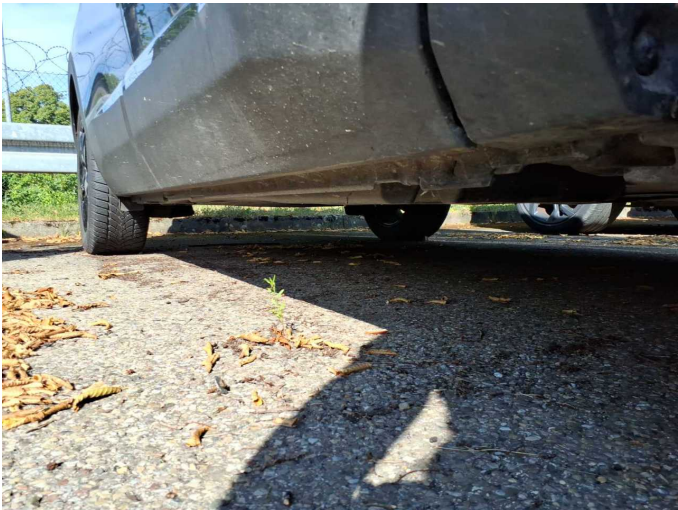


Figure 18: Misc.



Figure 19: Misc.

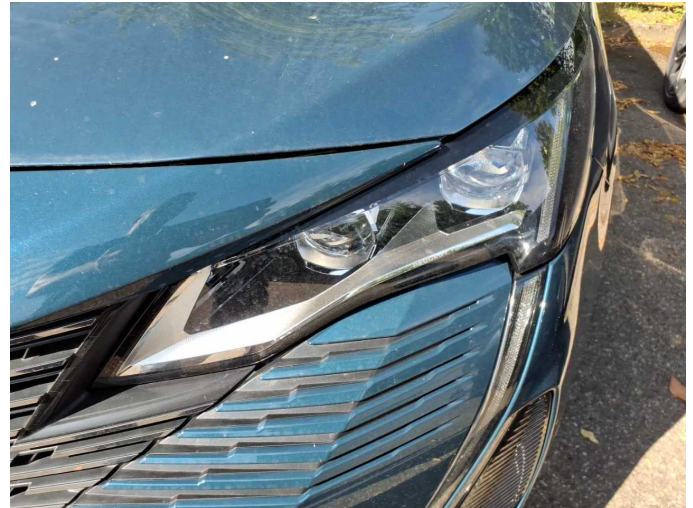


Figure 20: Misc.

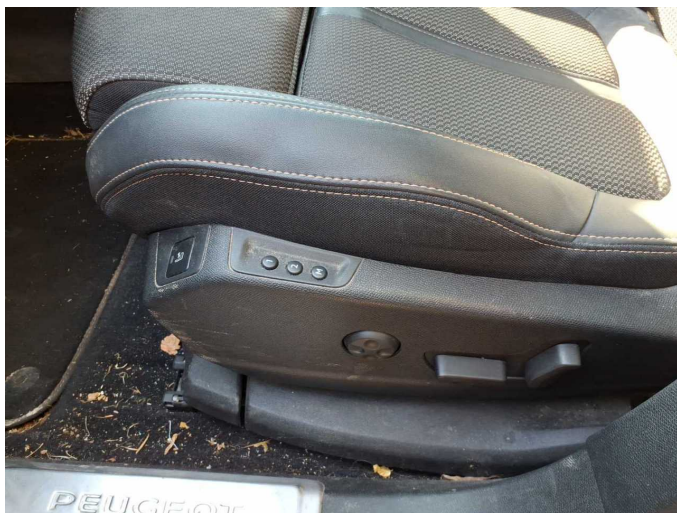


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

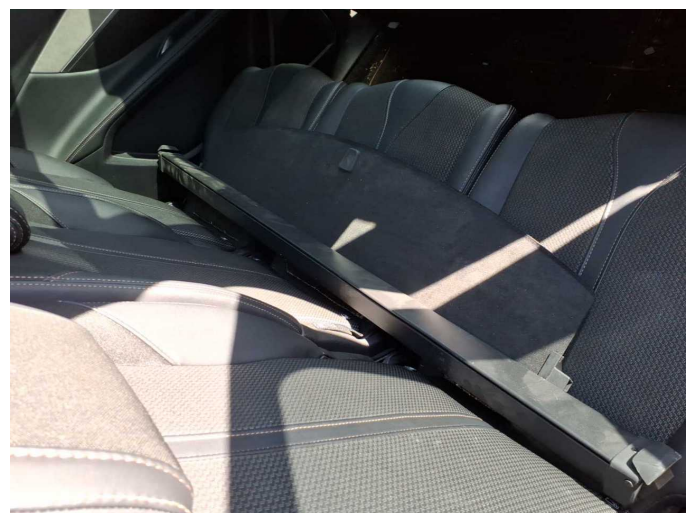


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

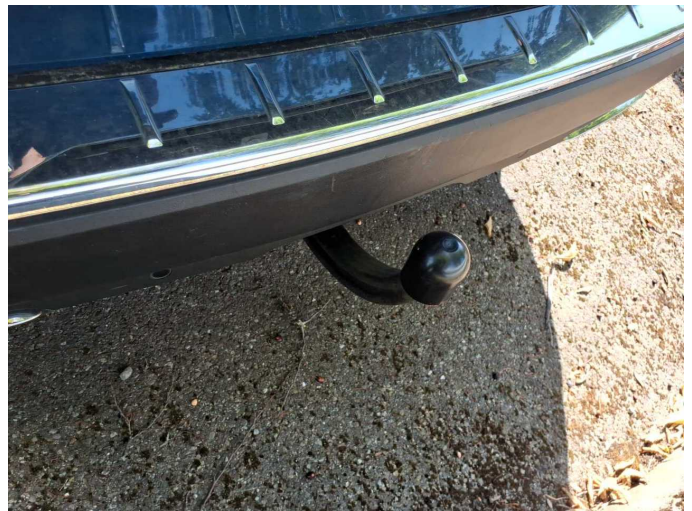


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.


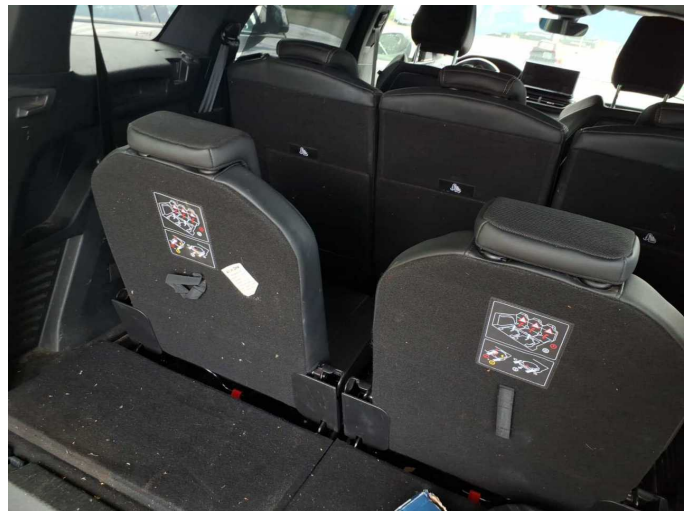


Figure 34: Misc.



Damage 3: Gearbox: Gearbox - Non-operational - Perform diagnosis

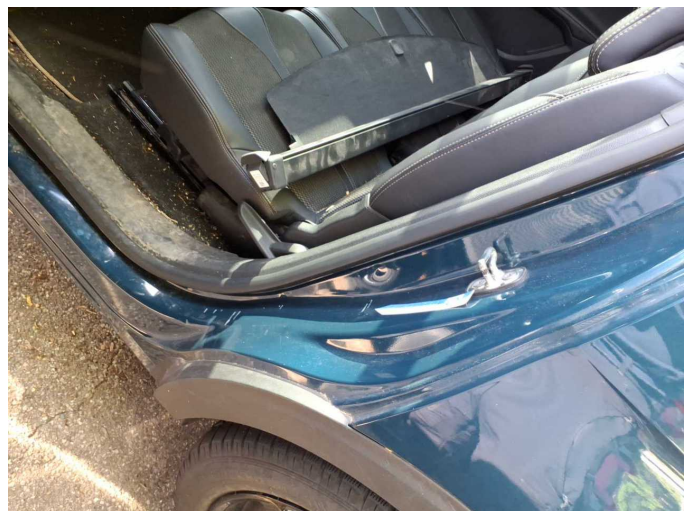


Damage 4: Side panel - rear left side: Sill - Dent / paintcoat damage - Repair and paint



Damage 4: Side panel - rear left side: Sill - Dent / paintcoat damage - Repair and paint



Damage 4: Side panel - rear left side: Sill - Dent / paintcoat damage - Repair and paint

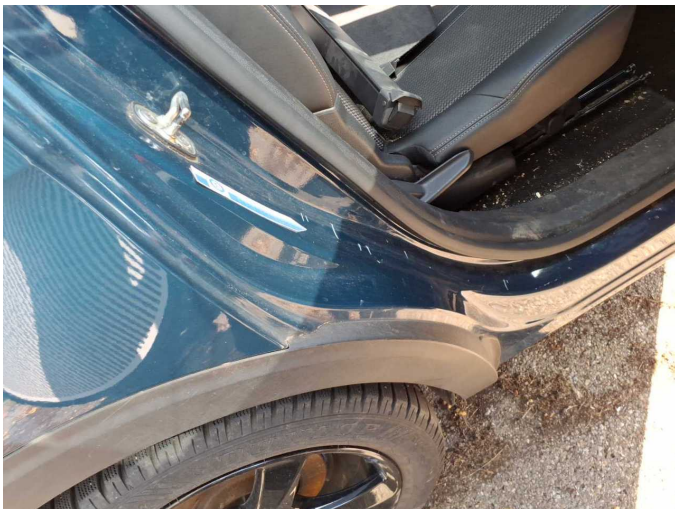

Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Repair and paint




Damage 6: Braking system: Brake discs and pads - rear - Corrosion - Replace



Damage 6: Braking system: Brake discs and pads - rear - Corrosion - Replace



Damage 6: Braking system: Brake discs and pads - rear - Corrosion - Replace

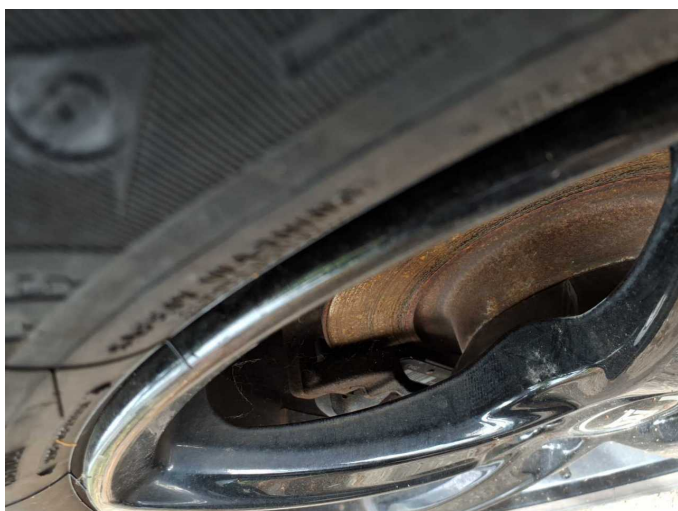

Damage 6: Braking system: Brake discs and pads - rear - Corrosion - Replace



Damage 7: Misc.: Inspection / maintenance - Expired - Replace



Damage 8: Braking system: Brake discs and brake pads - front - Corrosion - Replace




Damage 8: Braking system: Brake discs and brake pads - front - Corrosion - Replace



Damage 8: Braking system: Brake discs and brake pads - front - Corrosion - Replace



Damage 8: Braking system: Brake discs and brake pads - front - Corrosion - Replace

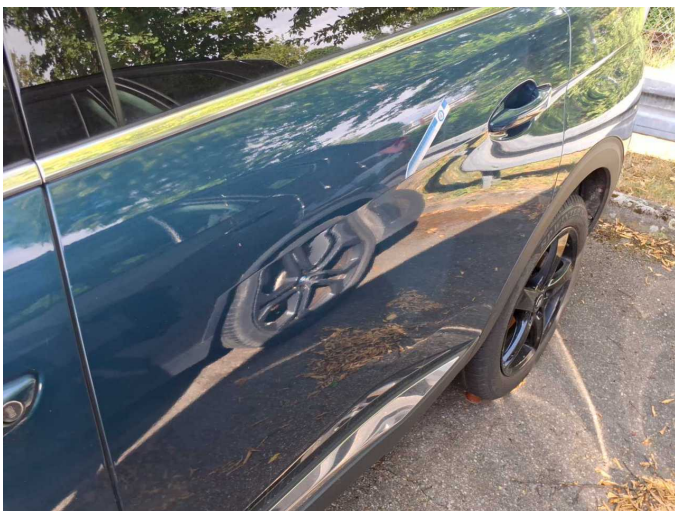

Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Paint



Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Paint



Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Paint



Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Paint



Repainting 1: Bonnet



Repainting 1: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF3MCYHZUNS200369

Hersteller / Modell: PEUGEOT PEUGEOT 5008 BlueHDi 130 EAT8 GT

Datum	KM-Stand	Beschreibung
29.05.2026	118.599	Reparatur Sonstiges; Systemtest/Eigendiagnose
13.10.2025	107.509	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Wartung Sonstiges
12.08.2025	98.661	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges; Wartung Sonstiges
29.01.2025	78.113	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges; Wartung Sonstiges
26.09.2024	64.859	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben+Beläge v+h; Bremsscheiben hinten; Bremsscheiben vorne
22.04.2024	46.078	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.09.2023	23.187	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges