



Expertise

Protocol number: 46364842
Order No. / Reference: 26661501
Inspection date: 3 Jul 2026

Manufacturer: Skoda
VIN: TMBJW7NX3MY152962

Model: Octavia Combi 1.4 TSI iV DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 1.4 TSI iV DSG Style	
Vehicle Identification number	TMBJW7NX3MY152962
Mileage (Read)	153,452 km
First registration	25 May 2021
Number of holders	1
Power / Engine displacement	110 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Metal Grey Metallic (F7Y)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7,700 km
Last service on / at	02/2026 at 146,119 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA543288
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / AVE 00054		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,090 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95W	Summer tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm
2)	225/45 R18 91Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	Winter tyres on Light alloy	Fulda	6mm / 6mm
2)	205/55 R17 95V	Winter tyres on Light alloy	Bridgestone	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Acoustic Vehicle Alerting System (AVAS) (E-Noise sound generator that produces artificial driving sounds in electric driving mode)
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Center section of the dashboard with fabric covering
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Hydraulic brake assist (HBA)
- Grey headliner
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant (Coming Home / Leaving Home function)
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Transmission: 6-speed direct-shift gearbox (DSG)
- Green tec: Start/stop system including brake energy recuperation
- Heated rear window
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Electronic child safety lock
- Removable boot cover
- Headrests (5) front and rear height adjustable
- LED fog lights
- LED taillights
- LED headlights with LED daytime running lights
- Steering wheel: height and reach adjustable
- Manual headlight range adjustment
- Rear center armrest with pass-through option
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Front and rear parking sensors
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: 8 speakers
- Radio accessories: Voice control
- Tire pressure monitoring
- Wheels: 18" Perseus alloy wheels, silver polished (7.5J x 18, ET 48 with 225/45 R18 tires)
- Safety lights in the front side doors
- Seats: Electrically adjustable front seats with memory function
- Seats: Rear seat backrest split 60:40, foldable
- Speed limiter
- Storage compartments (Four roof grab handles, rear with coat hooks; holder for the warning vest under the driver's seat; storage compartments in the front door panels with 1.5l bottle holders; storage compartments in the rear door panels with 0.5l bottle holders; ticket holder on the windshield; coat hooks on the B-pillars; storage compartments in the doors with felt lining)
- Airbag, head airbags
- Ambient lighting (dashboard, front trim strips and footwell with selectable color climate) in the interior as well as logo projector on the outside)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors with memory function (boarding spots in the exterior mirrors as well as memory function and mirror lowering)
- Hill start assist including auto-hold function
- Glasses compartment in the headliner
- Roof rails, anodized
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Driving profile selection
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Tinted windows
- Rear lights with crystal glass look and animated turn signals
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger and anti-allergen filter & activated carbon filter - air-conditioned and illuminated glove compartment)
- LED license plate lights
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Leather steering wheel with multifunction buttons and paddle shifters (leather steering wheel and gearshift lever with leather elements - infotainment and driver assistance system operation)
- Emergency charging cable (Mode 2 charging cable, Schuko, 10A)
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire mobility kit (tire repair spray incl. compressor)
- Electromechanical power steering
- Seat belts (Three three-point seat belts in the rear)
- Seats: Heated front seats
- Seats: Height-adjustable driver and passenger seats (including lumbar support)



- Lane keeping assistant (Lane Assist)
- Lane change and parking assist
- 12V socket in the trunk
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Phone: SmartLink (MirrorLink, Apple CarPlay, Android Auto)
- Phone: Wireless SmartLink for Apple CarPlay
- Bluetooth hands-free phone system
- Immobiliser

- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start

Extra equipment

- Comfort opening with electric tailgate operation (incl. semi-automatic luggage compartment cover)
- Package: Infotainment Columbus Plus (Combi) (Columbus navigation system - Infotainment Online (3-year term) - Head-Up Display - Luggage net partition)
- Package: Parking & Visibility (cornering lights in the fog lights - headlight cleaning system - LED ambient lighting - LED matrix headlights and dynamic high beam assist (AFS) - crystal glass look taillights and animated turn signals - reversing camera - parking assist)
- Package: Travel (DSG) (Traveller assistance system: - Traffic sign recognition - Predictive and adaptive cruise control (pACC) - Adaptive lane keeping assist - Emergency and traffic jam assist - Capacitive steering wheel with hands-off detection - Adaptive cruise control (ACC) (control range 210 km/h) - Driver fatigue detection - Driving profile selection - Automatically dimming exterior mirror (driver's side))
- Smart Holder Bag Holder
- Auxiliary heating
- Winter complete wheels
- Paint finish: Metallic
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A)
- Package: Comfort & Relax (Combi) (3-zone Climatronic - Sunset (dark tinted rear window and rear side windows) - acoustic glazing in the front side windows - heated front and outer rear seats - heated steering wheel - 230 V socket and 3 x USB charging ports - sunshades in the rear doors - multi-function storage compartment in the boot - sleeping headrests in the rear - semi-automatic luggage compartment cover)
- Package: Simply Clever (Double-sided boot mat - Media holder - Tablet holder - Waste bin - 3rd car key)
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Seats: Electrically adjustable ergonomic comfort seats in the front (AGR seal of approval) (Massage function - Extendable leg rest - Seat ventilation - Leather interior (combined with high-quality materials))
- Heated windscreen

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Broken / torn - Replace
2	Door - front left side	Door handle - outside - Scratch(es) - Smart repair
3	Wing mirror - left side	Cap - Scratch(es) - Smart repair
4	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
5	Door - rear left side	Door - Scratch(es) - Smart repair
6	Trim / covers	Roof lining - Burn hole (cigarettes) - Smart repair
7	Boot lid / rear door	Rear spoiler - Scratch(es) - Smart repair
8	Rear bumper	Rear bumper - Scratch(es) - Smart repair
9	Roof	Roof rail - left side - Scratch(es) - Smart repair
10	Front bumper	Front bumper - Scratch(es) - Smart repair
11	Boot lid / rear door	Reflectors - Broken / torn - Replace
12	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
13	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
14	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
15	Bonnet	Bonnet - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Seat - front	Seat cover - left side - Scratch(es) - No deduction
2	Interior	Roller blind rear window - Malposition - No deduction
3	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction
5	Door - front right side	Door - Dent / paintcoat damage - No deduction
6	Headlight	Headlight - right side - Scratch(es) - No deduction
7	Headlight	Headlight - left side (außerhalb Blendbereich) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - charging cable (Mode 2 Kabel (Serienausstattung))

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 3 Nov 2023	1.257,86 €
2	Front, Provided by user / customer, from 17 Mar 2022	1.639,92 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

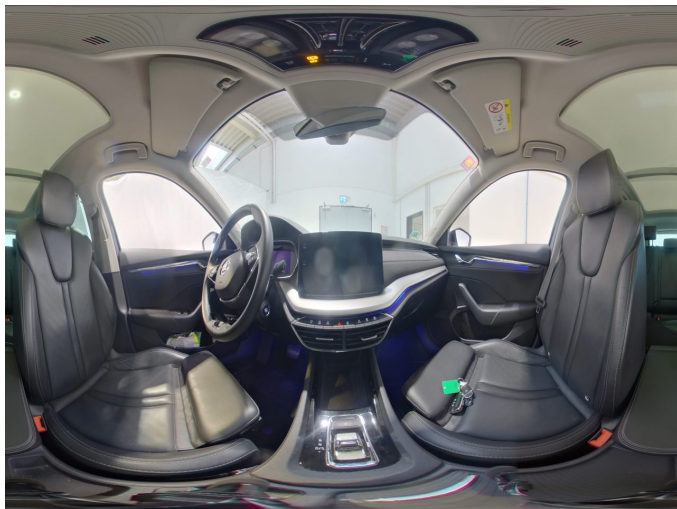


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area

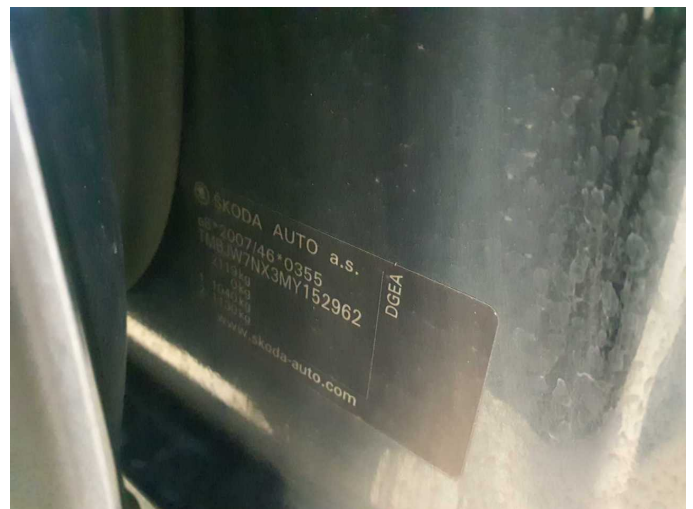


Figure 12: VIN



Figure 13: Mounted tyres

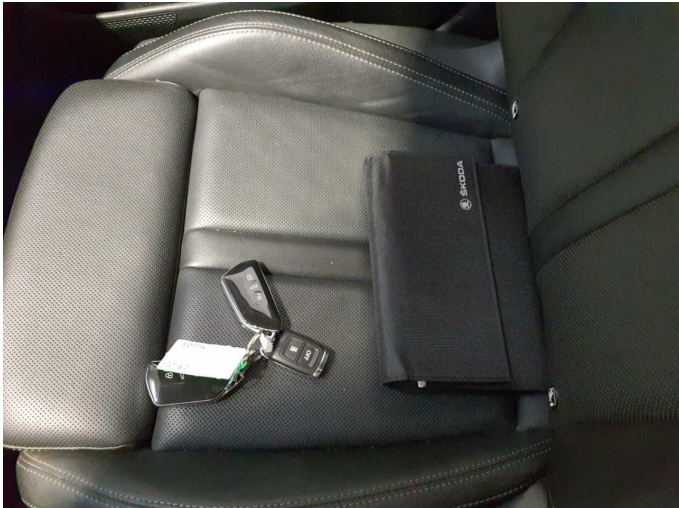


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres

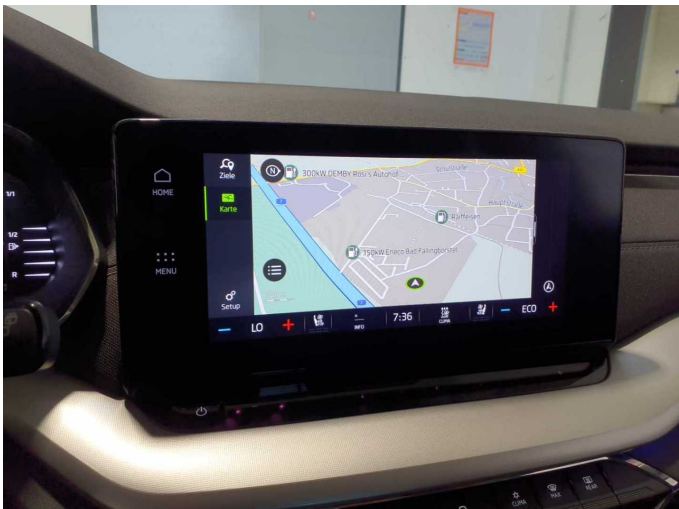


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

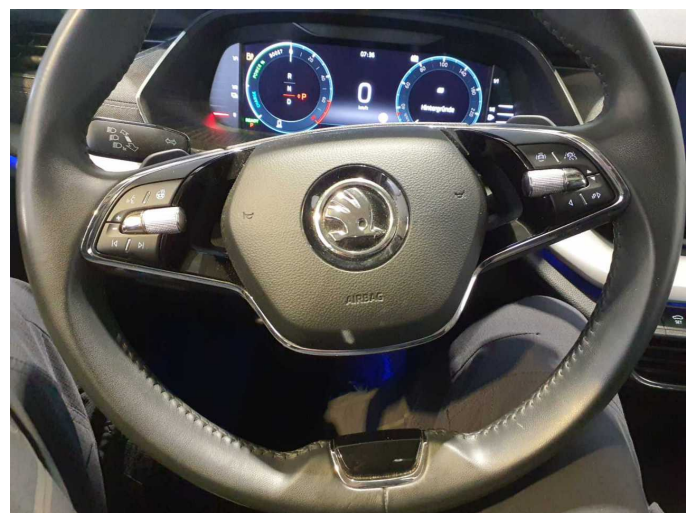


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

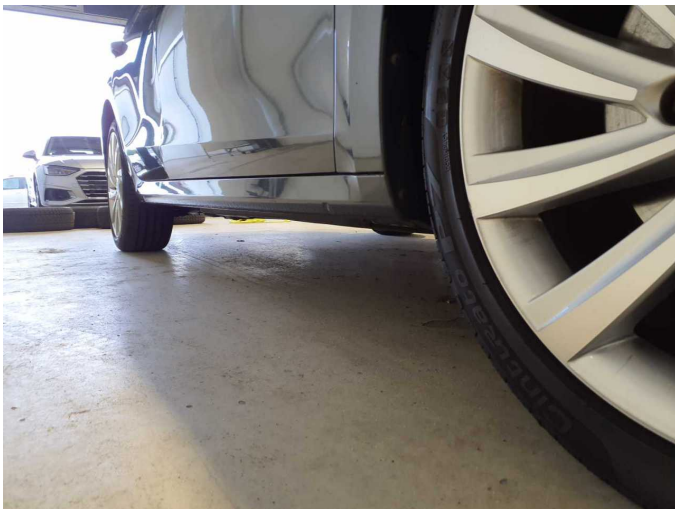


Figure 27: Misc.

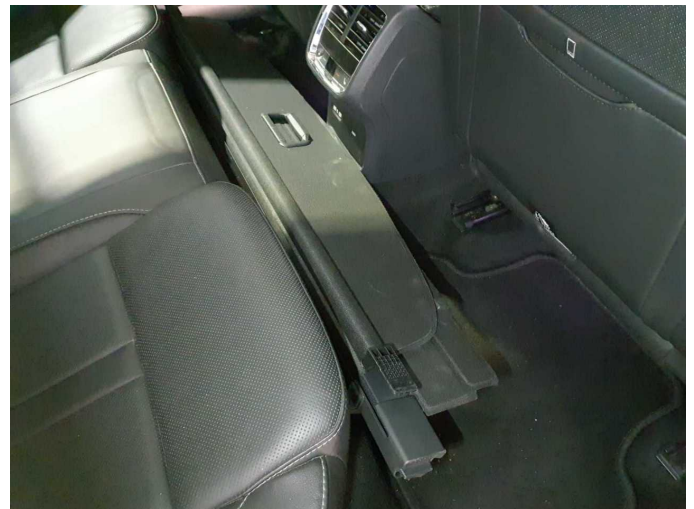


Figure 28: Misc.

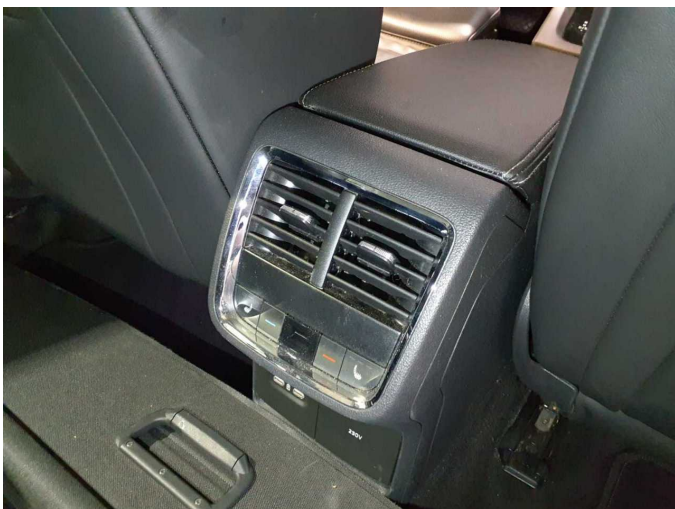


Figure 29: Misc.

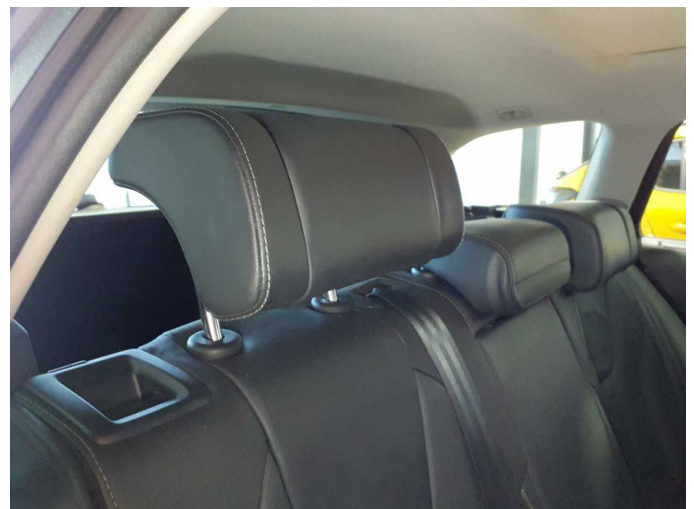


Figure 30: Misc.



Figure 31: Misc.

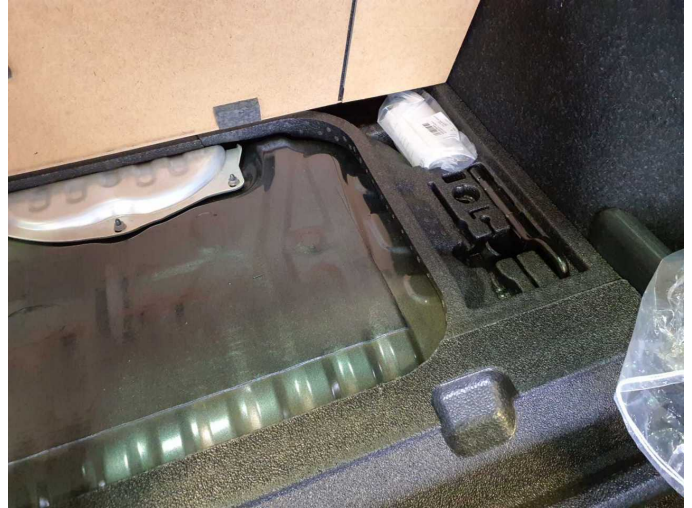


Figure 32: Misc.


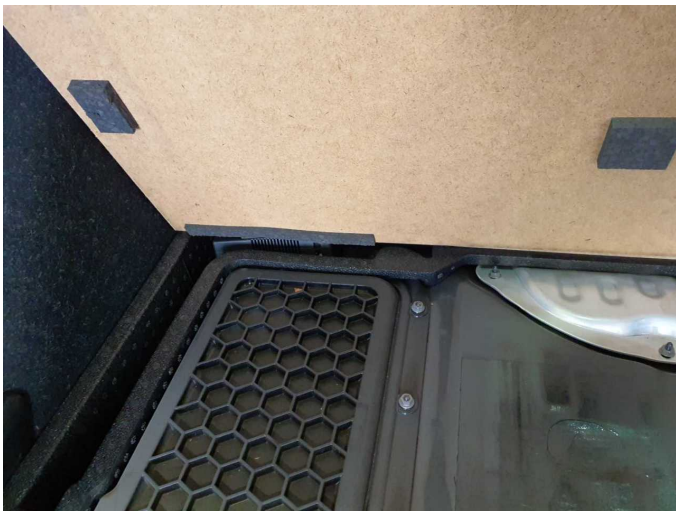



Figure 33: Misc.



Figure 34: Misc.

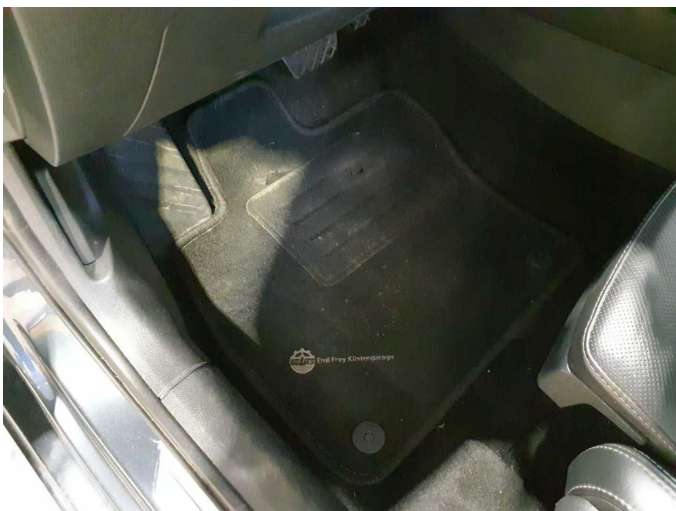


Damage 1: Trim / covers: Floor mats - Broken / torn - Replace

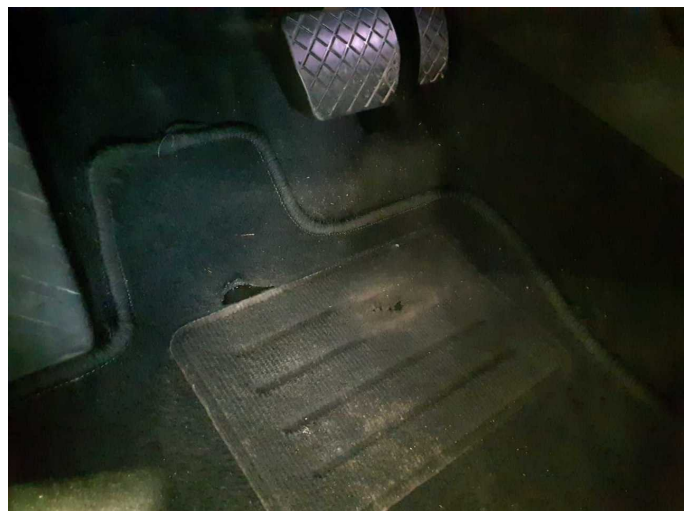

Damage 1: Trim / covers: Floor mats - Broken / torn - Replace




Damage 2: Door - front left side: Door handle - outside - Scratch(es) - Smart repair

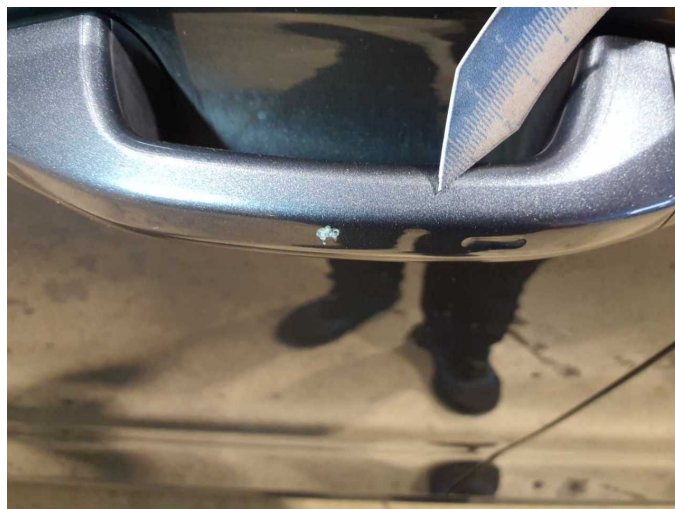


Damage 2: Door - front left side: Door handle - outside - Scratch(es) - Smart repair



Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair

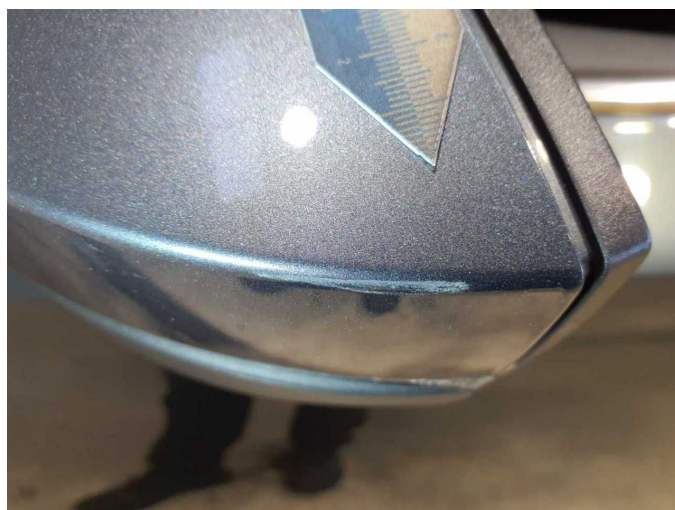


Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair

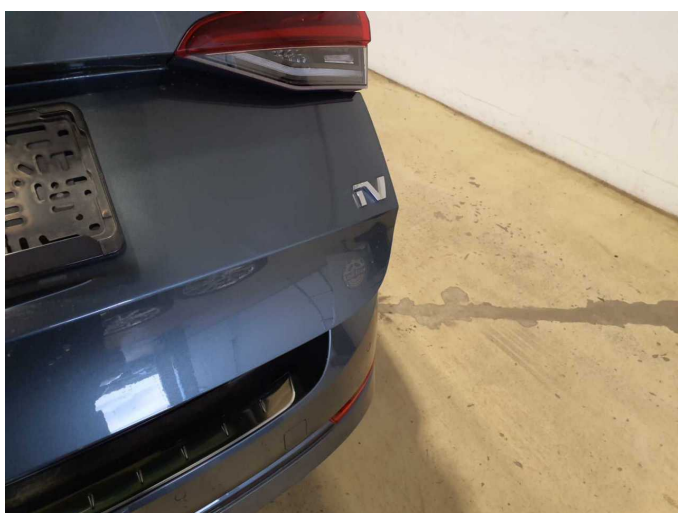

Damage 4: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 4: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

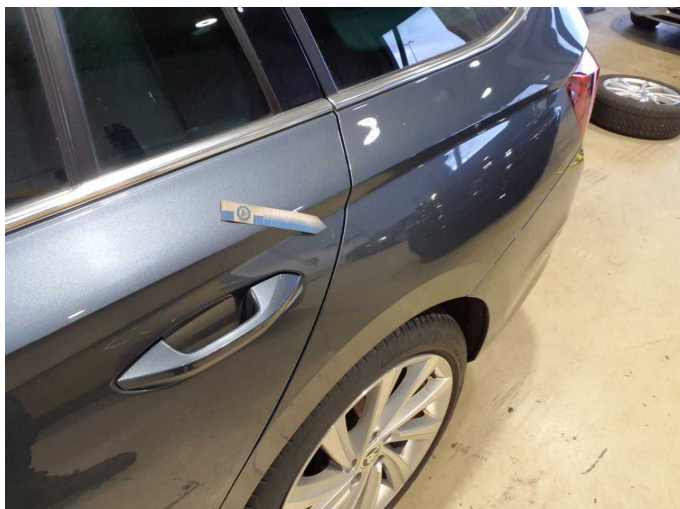


Damage 5: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 5: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 6: Trim / covers: Roof lining - Burn hole (cigarettes) - Smart repair

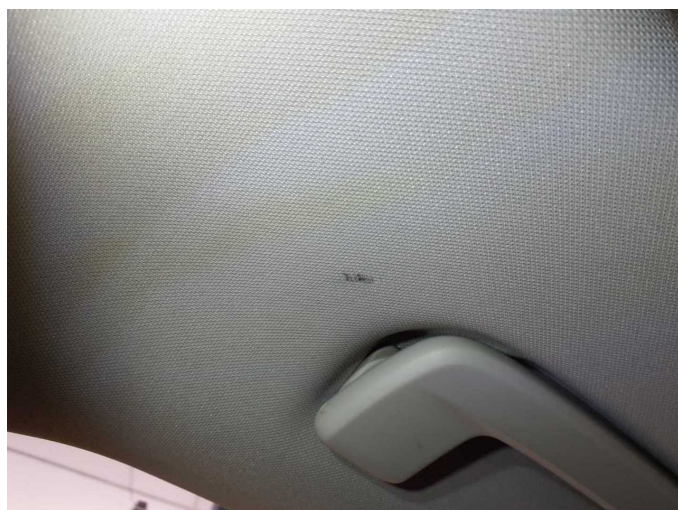

Damage 6: Trim / covers: Roof lining - Burn hole (cigarettes) - Smart repair



Damage 7: Boot lid / rear door: Rear spoiler - Scratch(es) - Smart repair




Damage 7: Boot lid / rear door: Rear spoiler - Scratch(es) - Smart repair



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Smart repair

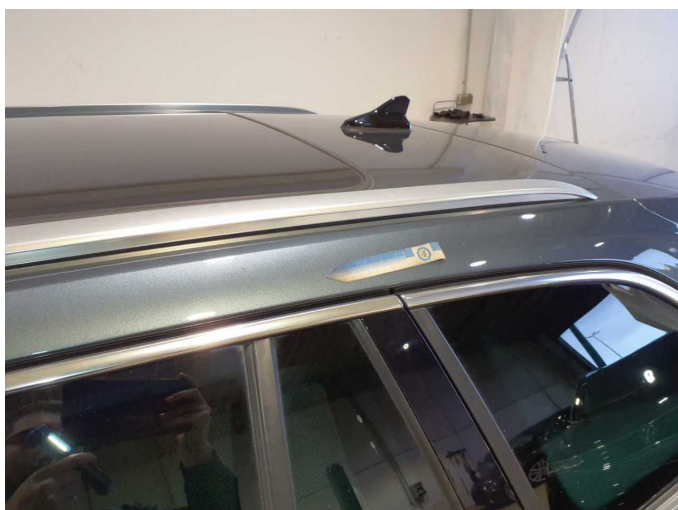

Damage 9: Roof: Roof rail - left side - Scratch(es) - Smart repair




Damage 9: Roof: Roof rail - left side - Scratch(es) - Smart repair

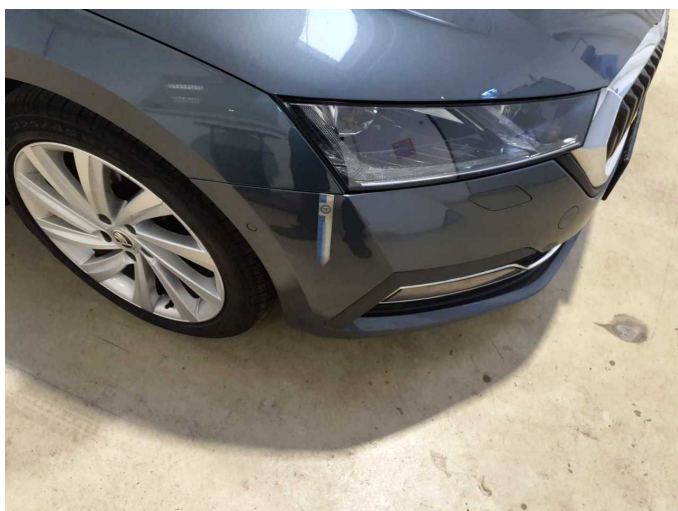

Damage 10: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 10: Front bumper: Front bumper - Scratch(es) - Smart repair

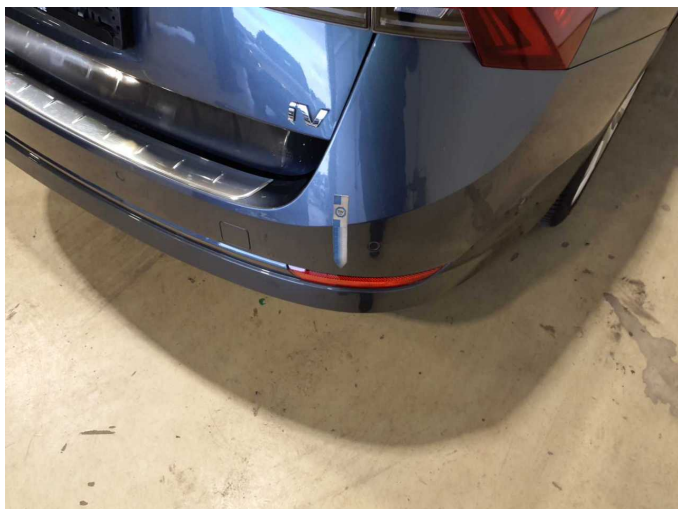

Damage 11: Boot lid / rear door: Reflectors - Broken / torn - Replace




Damage 11: Boot lid / rear door: Reflectors - Broken / torn - Replace




Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

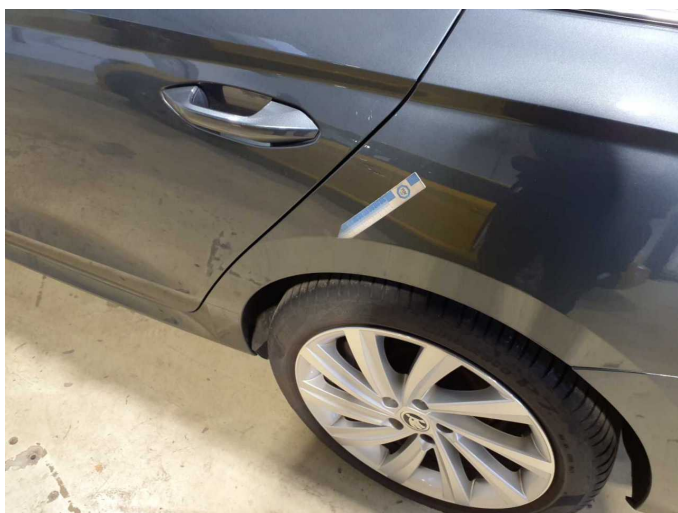

Damage 13: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

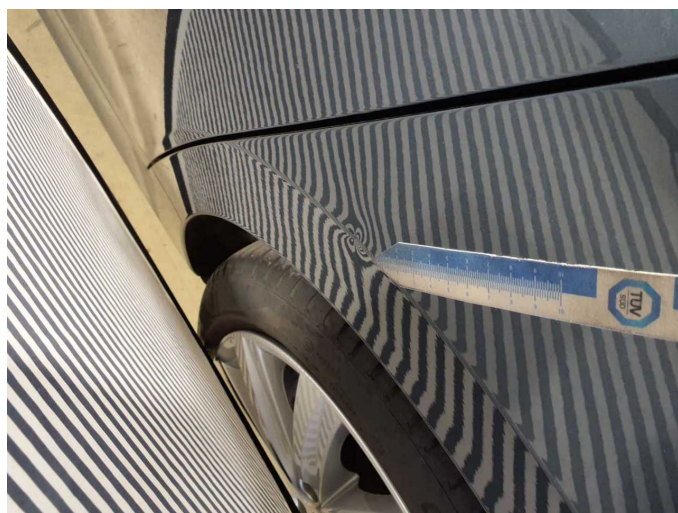


Damage 13: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 13: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 13: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

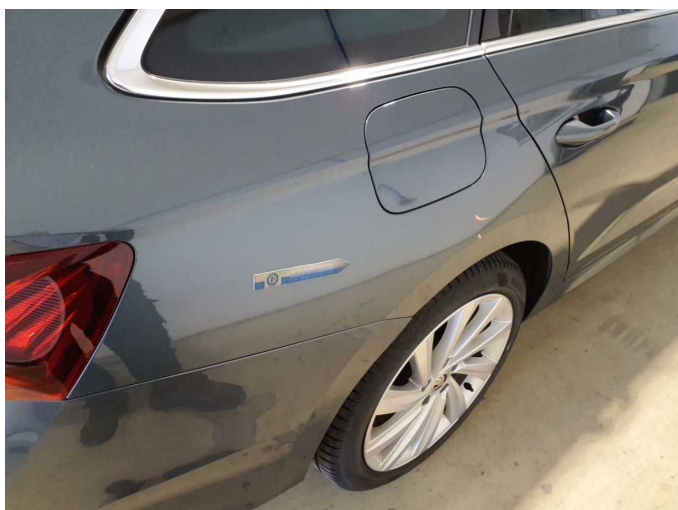


Damage 14: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

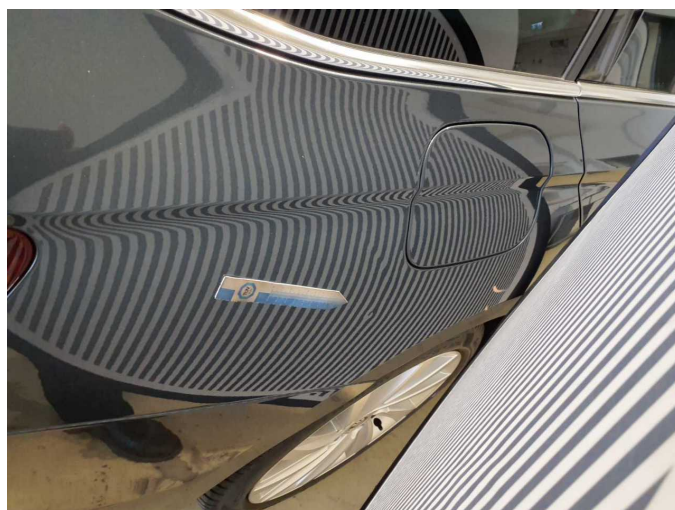

Damage 14: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

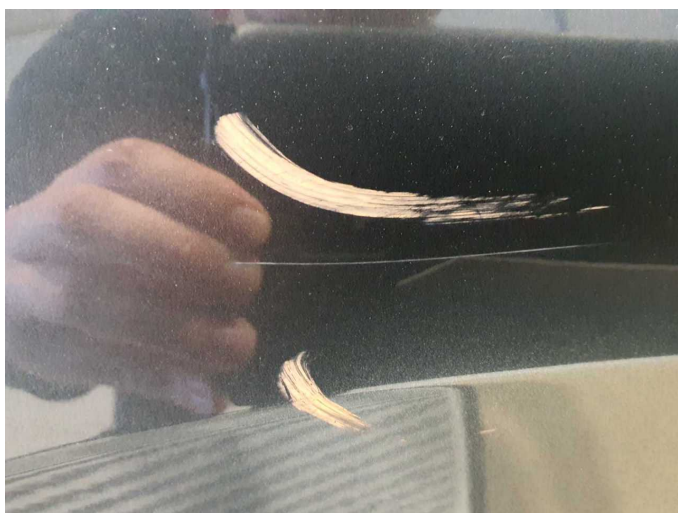

Damage 14: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

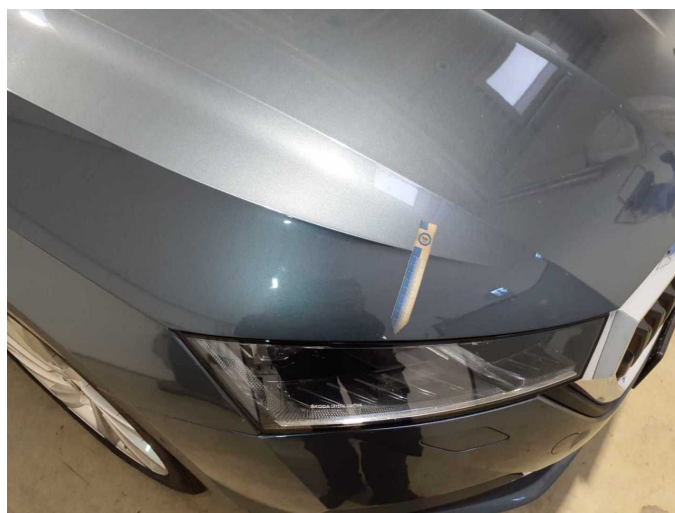

Damage 15: Bonnet: Bonnet - Scratch(es) - Paint




Damage 15: Bonnet: Bonnet - Scratch(es) - Paint




Damage 15: Bonnet: Bonnet - Scratch(es) - Paint




Wear and tear 5: Door - front right side: Door - Dent / paintcoat damage - No deduction

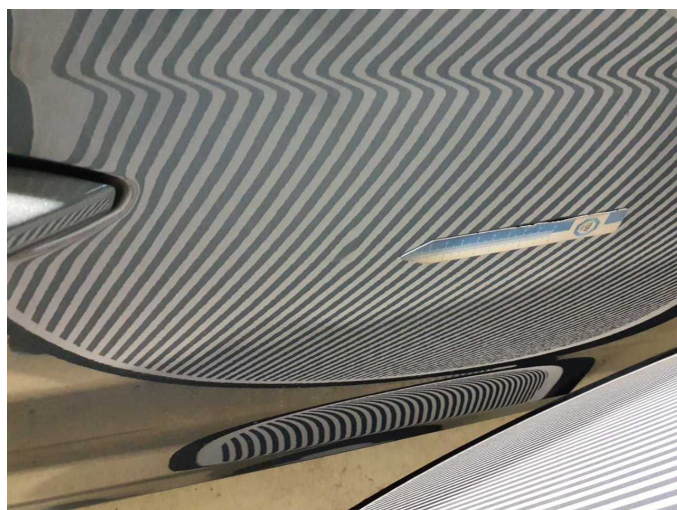


Wear and tear 5: Door - front right side: Door - Dent / paintcoat damage - No deduction

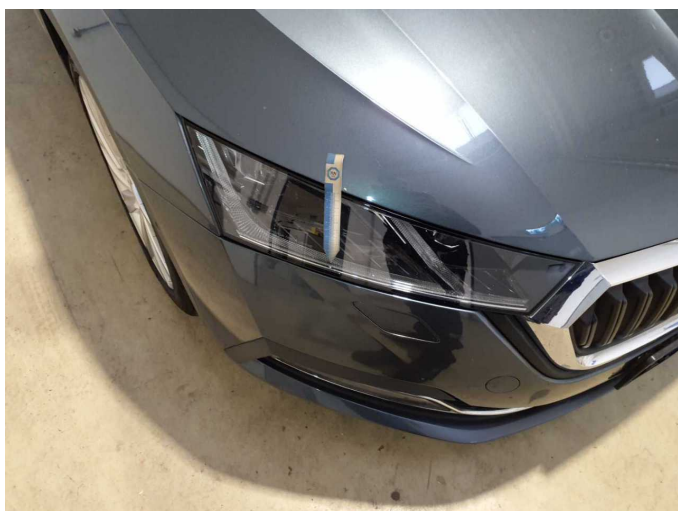


Wear and tear 6: Headlight: Headlight - right side - Scratch(es) - No deduction

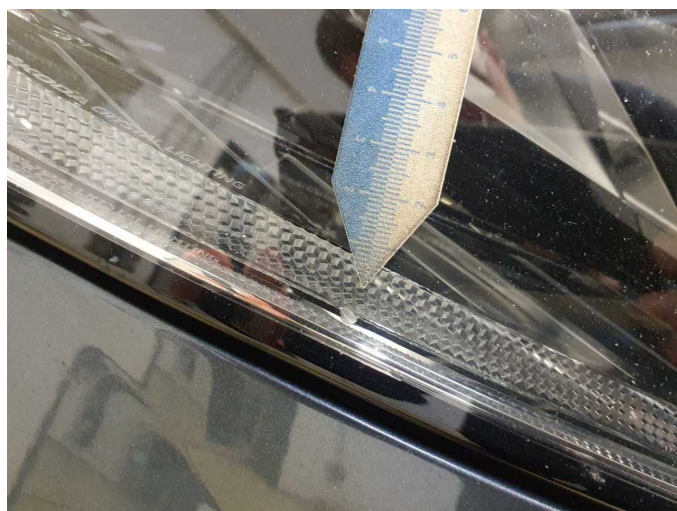

Wear and tear 6: Headlight: Headlight - right side - Scratch(es) - No deduction

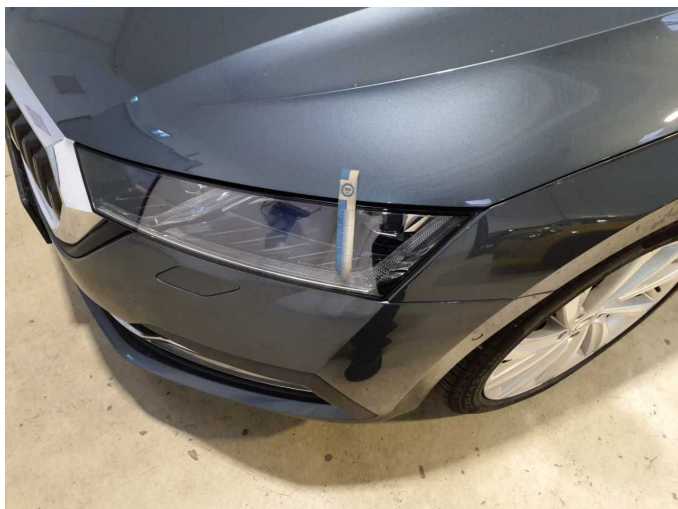

Wear and tear 7: Headlight: Headlight - left side (außerhalb Blendbereich) - Scratch(es) - No deduction

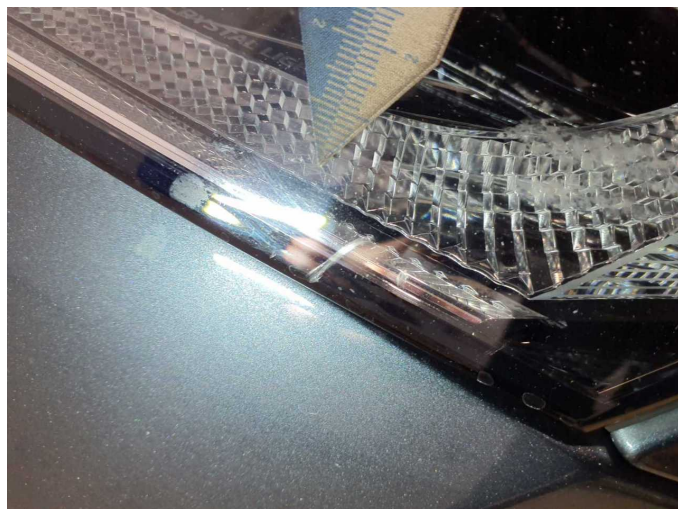

Wear and tear 7: Headlight: Headlight - left side (außerhalb Blendbereich) - Scratch(es) - No deduction