



Expertise

Protocol number: 46053799
Order No. / Reference: 26512689
Inspection date: 19 Jun 2026

Manufacturer: Audi
VIN: WAUZZZF31N1104496

Model: Q3 40 TDI Sportback quattro S tronic



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q3 40 TDI Sportback quattro S tronic	
Vehicle Identification number	WAUZZZF31N1104496
Mileage (Read)	151,188 km
First registration	30 Jun 2022
Number of holders	1
Power / Engine displacement	147 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Mythossschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,900 km
Last service on / at	09/2025 at 126,063 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ089408
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BVT 00994		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,220 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	2mm / 2mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	3mm / 3mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100V	Summer tyres on Light alloy	Hankook	4mm / 4mm
2)	235/55 R18 100V	Summer tyres on Light alloy	Hankook	4mm / 4mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- All-wheel drive "quattro"
- Audi connect Emergency Call & Service
- Audi pre sense basic
- Electrically adjustable and heated exterior mirrors
- third brake light
- Diesel particulate filter (DPF)
- Tachometer
- Door sills with plastic inserts
- Electronic Stability Control (ESC)
- Electric windows front and rear
- Adjustable speed limiter
- Transmission: S tronic 7-speed
- rear window wiper
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Progressive steering
- Wheel: Tire repair kit
- Radio accessories: 4 front speakers
- rear seat plus
- Seats: Standard front seats
- Lane change warning
- Front/rear bumpers and underride protection
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi drive select
- Audi pre sense front
- Hill start assist
- Decorative inlays Micrometallic silver
- Digital instrument cluster - fully digital instrument cluster in 10.25 inches
- Electromechanical parking brake
- Chassis: Sport chassis
- front and rear floor mats
- Legal emergency number
- Heated rear window
- Electrically operated child safety lock
- Headrests (5) front and rear
- LED headlights
- Light/rain sensor
- Package Gloss
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio
- Radio accessories: Digital radio reception (DAB)
- Fabric seat covers Argument
- Lane Departure Warning
- Start-stop system with recuperation
- Phone: Bluetooth interface
- Electronic immobilizer
- Central locking



Extra equipment

- Airbag: Rear side airbags
- Parking aid plus (supports the driver with acoustic signals and a display in the MMI when parking and maneuvering. The parking aid is activated by engaging reverse gear or via a button in the center console, or automatically when the distance to a detected object is less than 90 cm. Automatic activation can be switched on and off.)
- High-beam assist (within the system's limitations, it automatically detects oncoming headlights, taillights of other road users, and light sources in built-up areas. Depending on the traffic situation, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Paint finish: Mythos Black Metallic
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (The steering wheel impresses with its high-quality look and aluminum trim and feels good in the hand. Height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons.)
- Business package (MMI Navigation plus - 3-spoke leather steering wheel with multifunction plus - Audi virtual cockpit plus - Audi phone box - Audi connect Navigation & Infotainment plus - Cruise control)
- Wheel: Light alloy wheels in 5-double-arm design (7 J x 18 with tires 235/55 R 18)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)
- Audi connect Remote & Control (for MMI Navigation) (The Audi connect Remote & Control services connect the vehicle to your smartphone. The myAudi app allows you to remotely access the vehicle, view its last parking position and current vehicle status. - Parking position - Vehicle status and driving data - Remote locking and unlocking - Remote charging - Remote climate control (45 TFSI e) and auxiliary heating - Push notifications for the anti-theft alarm system)
- 2-zone automatic climate control (electronically regulates air temperature, volume and distribution - separate temperature distribution for driver and front passenger side - sun position-dependent control - automatic recirculation control via air quality sensor - dust and odor separating allergen filter - air vents in the rear center console - separate defroster button for faster defrosting of the front and side windows)
- Front center armrest (adjustable in tilt, movable in length)
- Assistance package in conjunction with Business (Adaptive Cruise Control (combines adaptive cruise control with lane keeping assist) - Emergency Assist (Lane Departure Warning. If the driver does not react, the system takes over control of the vehicle and automatically brings it to a stop in its lane; the hazard warning lights are activated.) - High Beam Assist - Parking Assist Plus)
- Package: Child safety (ISOFIX child seat attachment for the front passenger seat with deactivation switch for the passenger airbag)
- Front seat heating (heats seat and backrest center section for standard seats, otherwise seat and backrest center section as well as seat side bolsters - individually adjustable in 3 stages for driver and front passenger via direct selection button on the climate control unit)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Interior	Interior - Soiled - Conditioning
3	Door - front left side	Door - Dent / paintcoat damage - Smart repair
4	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
5	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
6	Rear bumper	Rear bumper - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front left side - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 11 Mar 2025	1.513,54 €

Repainting

No.	Repainting
1	Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	156 µm
----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

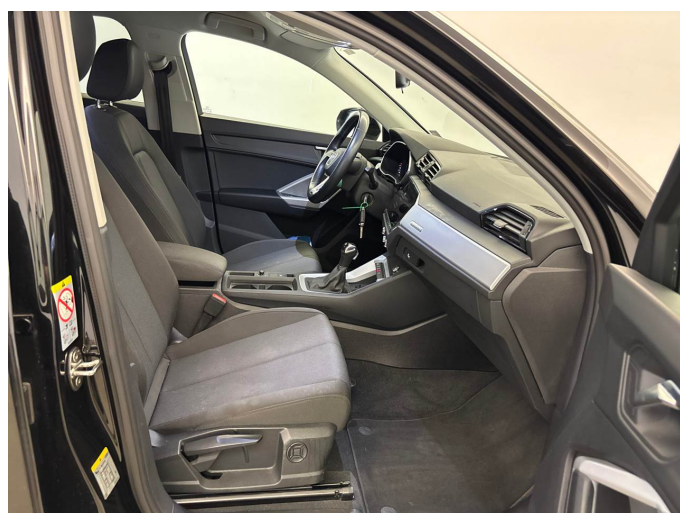


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

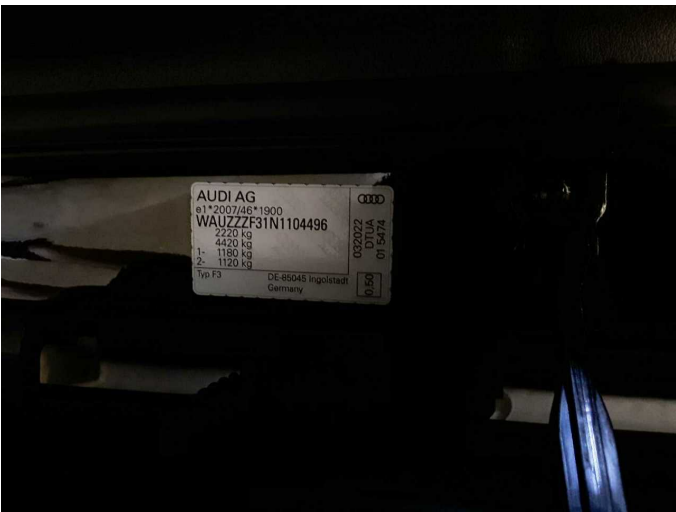


Figure 11: VIN



Figure 12: Mounted tyres

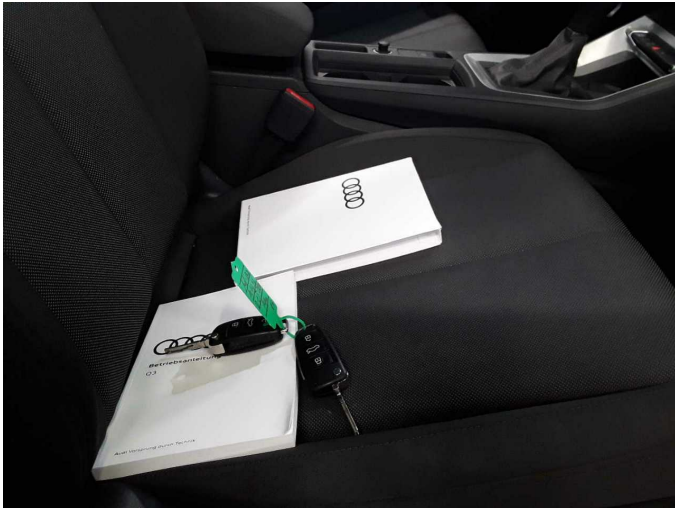


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

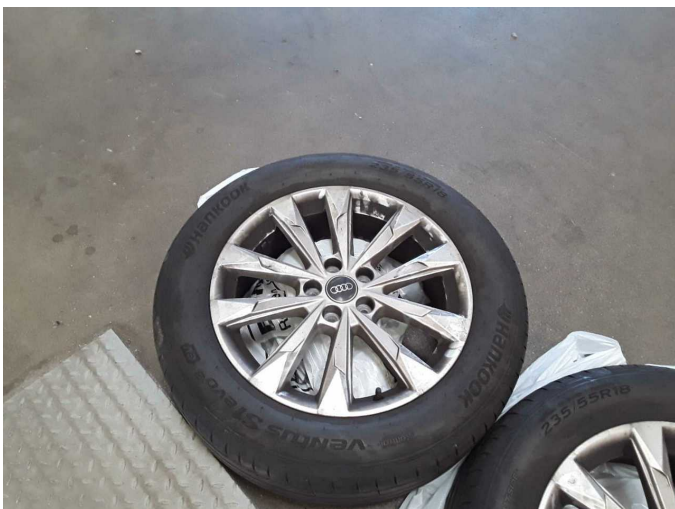


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Interior: Interior - Soiled - Conditioning



Damage 2: Interior: Interior - Soiled - Conditioning

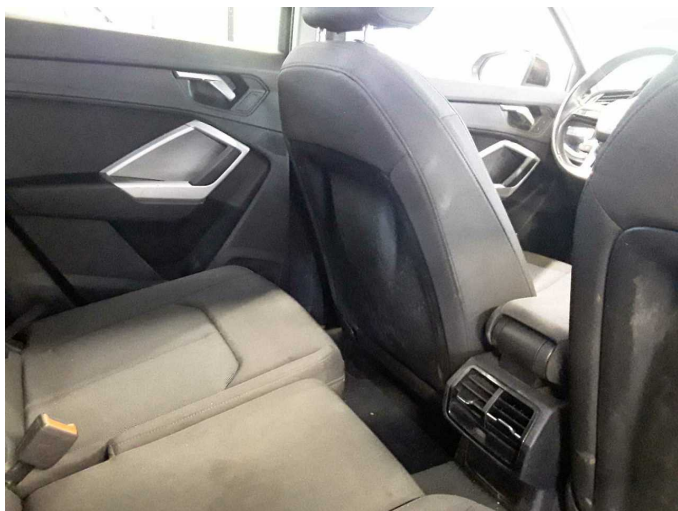

Damage 2: Interior: Interior - Soiled - Conditioning



Damage 2: Interior: Interior - Soiled - Conditioning



Damage 2: Interior: Interior - Soiled - Conditioning



Damage 2: Interior: Interior - Soiled - Conditioning




Damage 2: Interior: Interior - Soiled - Conditioning



Damage 2: Interior: Interior - Soiled - Conditioning




Damage 3: Door - front left side: Door - Dent / paintcoat damage - Smart repair

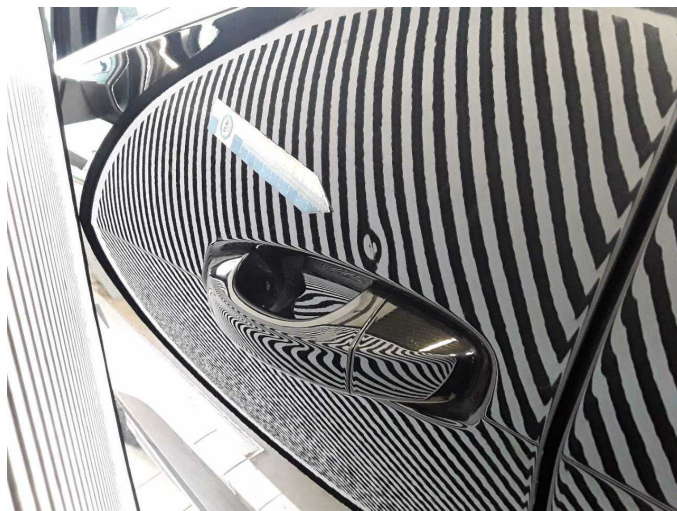


Damage 3: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

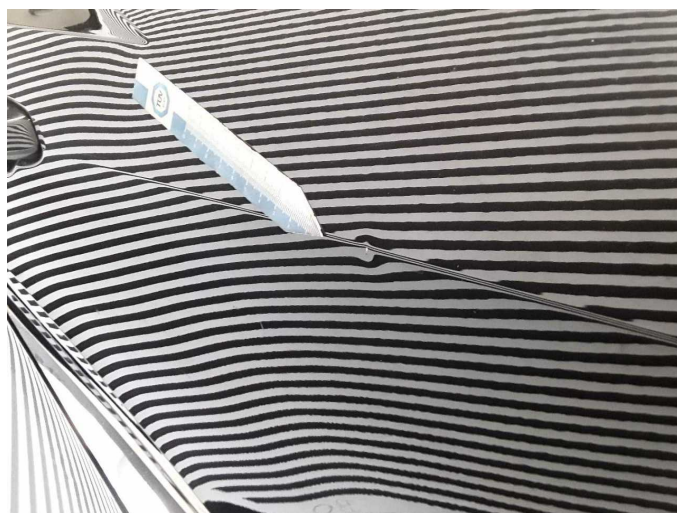

Damage 4: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

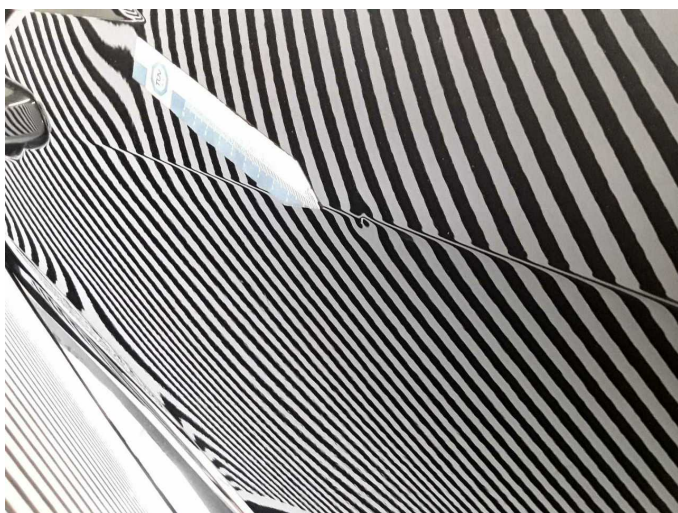


Damage 4: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

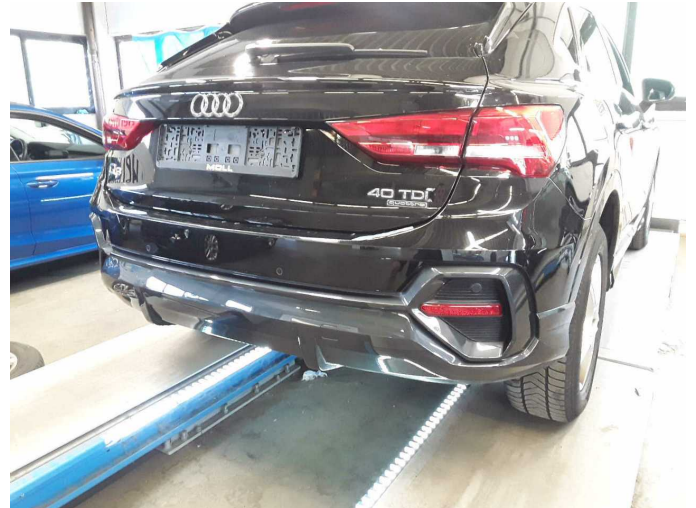

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction



Repainting 1: Mudguard - left side



Repainting 1: Mudguard - left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF31N1104496

Hersteller / Modell: AUDI AUDI Q3 40 TDI Sportback quattro S tronic

Datum	KM-Stand	Beschreibung
17.09.2025	126.063	AU; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
18.10.2024	89.352	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
23.02.2024	61.426	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
17.07.2023	34.635	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges