


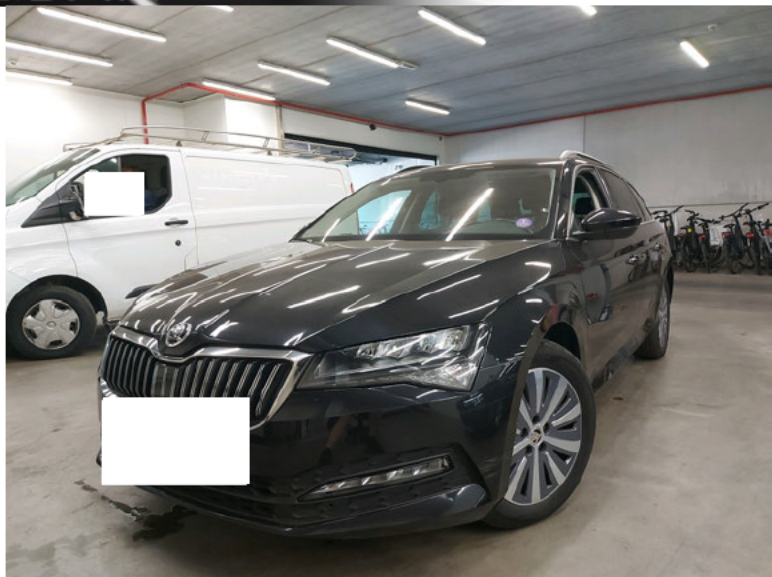

Skoda Superb

Vinnumber:	TMBJN9NP8M7064199	Versionname:	
First Registrationdate:	30/06/2021	Fiscalpower:	
Expertise Mileage:	118003	Power Kw:	
Bodytype:		Body colour	Black
Gearbox:	MAN 6 VIT	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	2325
Fueltype:	Petrol		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Seats electric F L	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Seats F heated		Rear parking sensors	
Radio multimedia		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Tyres

215/55/17/92 H				
Summer tyres:	Fr.L.	Hankook: 5 mm	Fr.R.	Hankook: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				215/55 R 17 92 H
Tyre size FR				215/55 R 17 92 H
Tyre size RL				215/55 R 17 92 H
Tyre size RR				215/55 R 17 92 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				260
Tyre make FR				260
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1626,05
Floor covering FL, Damaged, Smart repair	116,69



Bumper F, Scratch(es), Repair and paint (complete)	355,89
--	--------



Bonnet, Chemical polution, Repair and paint (complete)	487,44
--	--------



Windscreen, Scratch(es), Polish	0,00
---------------------------------	------



Step L, Scratch(es), Repair and paint (complete)	161,81
--	--------



Door FL, Scratch(es), Spot repair	148,33
-----------------------------------	--------



Bumper R, Scratch(es), Repair and paint (complete)	355,89
--	--------



Tailgate / Boot, Dent(s), Acceptable	0,00
--------------------------------------	------



Rear window, Scratch(es), Polish	0,00
----------------------------------	------



Wing FR, Scratch(es), Acceptable	0,00
----------------------------------	------



Door FR, Scratch(es), Acceptable	0,00
----------------------------------	------



Door RR, Scratch(es), Acceptable	0,00
----------------------------------	------



Wing RR, Dent(s) and scratch(es), Acceptable	0,00
--	------



Alloy rim RR polished, Scratch(es), Acceptable	0,00
--	------



Roof, Hail damage, Paintless dent repair (hail)	0,00
---	------

