



Mercedes GLA-Klasse (UKL): 2CDJ320

Vinnumber:	W1N2477841J374076	Versionname:	GLA180 Business Solution 1.3i 136pk/cv 5p 7G-DCT
First Registrationdate:	13/06/2022	Fiscalpower:	
Expertise Mileage:	83674	Power Kw:	100
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:	Petrol		
Maintenance	NOT OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	215/65/17/99 V			
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				215/65 R 17 99 V
Tyre size FR				215/65 R 17 99 V
Tyre size RL				215/65 R 17 99 V
Tyre size RR				215/65 R 17 99 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Service, Maintenance, Check




Armrest, Tear, Replace



Bumper spoiler F, Scratch(es), Replace



Bumper F, Scratch(es), Smart repair

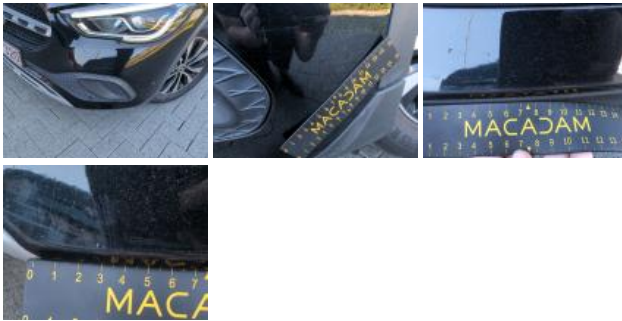

Bonnet, Scratch(es), Acceptable



Alloy rim FL polished, Scratch(es), Repair and paint (complete)



Alloy rim RL polished, Scratch(es), Acceptable



Wing RL, Dent(s), Paintless dent repair



Wing trim FL, Scratch(es), Replace



Charging cable (normal), Missing, Check



Charging cable (fast), Missing, Check



Boot cover, Broken, Replace



Rubber seal for boot lid, Broken, Replace



Rear light R, Broken, Replace



Tailgate / Boot, Dent(s), Paintless dent repair



Alloy rim RR polished, Chemical polution, Repair and paint (complete)



Kenteken	2CDJ320
Merk Model	Mercedes GLA180 Business Solution 1.3i 136pk/cv 5p 7G-DCT
Brandstofsoort	Benzine
Datum deel1	6/13/22

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
5/28/25	61,759	bougie	Vervangen
5/28/25	61,759	klein materiaal	
5/28/25	61,759	luchtfilter	Vervangen
5/28/25	61,759	mercedes assyst a	Uitvoeren
1/21/25	50,443	batterij	Vervangen
1/21/25	50,443	remschijven en blokken vooraan	Vervangen
8/2/24	37,062	klein materiaal	Uitvoeren
8/2/24	37,062	mercedes assyst b	Uitvoeren
8/2/24	37,062	remvloeistof	Vervangen
8/2/24	37,062	ruitenswisserrubber achter	Vervangen
8/2/24	37,062	ruitenswisserrubber vooraan	Vervangen
7/25/23	19,982	klein materiaal	Uitvoeren
7/25/23	19,982	mercedes assyst a	Uitvoeren